Upsampling (5B)

-
-

Please send corrections (or suggestions) to youngwlim@hotmail.com.

This document was produced by using OpenOffice and Octave.

Band-limited Signal

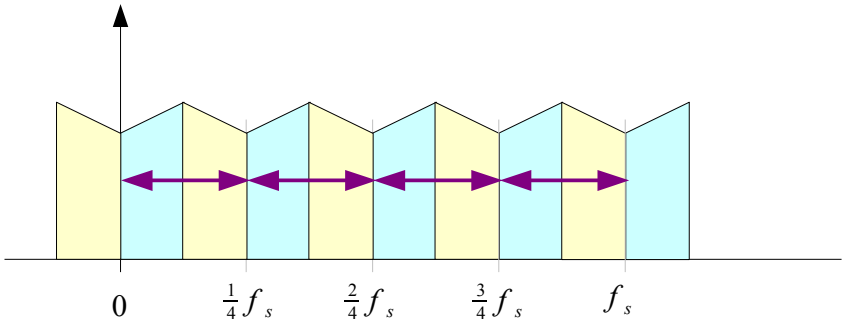

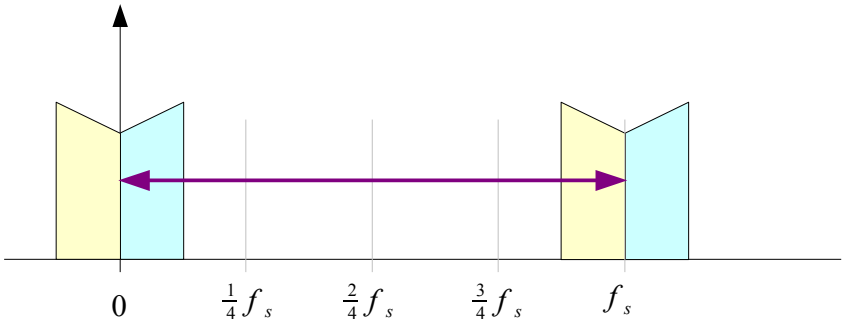

Sampling Frequency $\frac{1}{4}f_s$

Sampling Time $T = \frac{4}{f_s}$

Sampling Frequency $f'_s = f_s$

Sampling Time $T' = \frac{1}{f_s}$

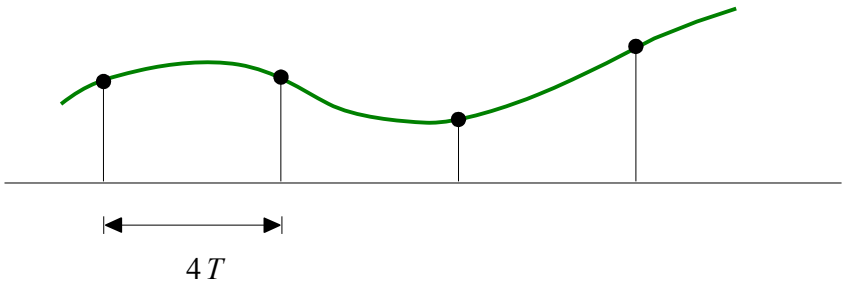

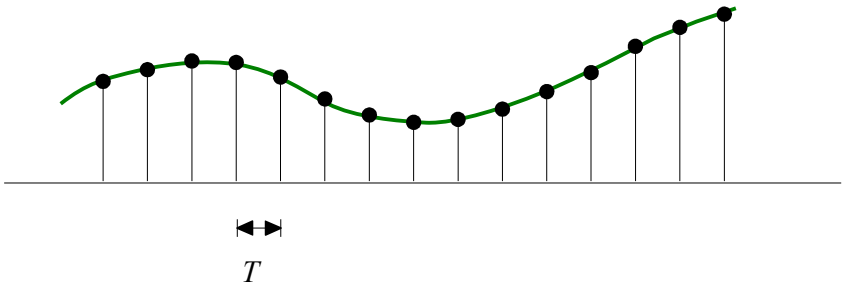

Time Sequence

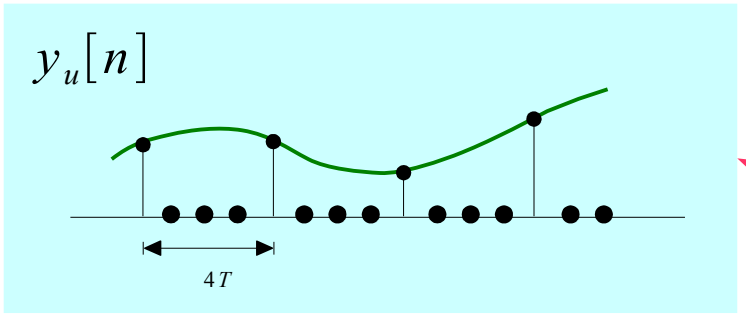

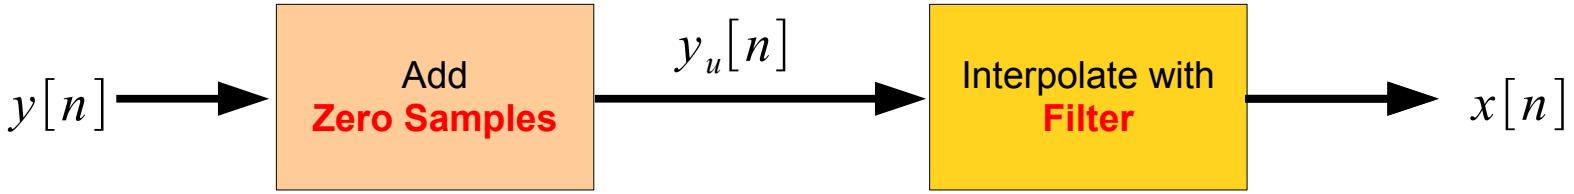

Ideal
Sampling

T **Sampling Period**

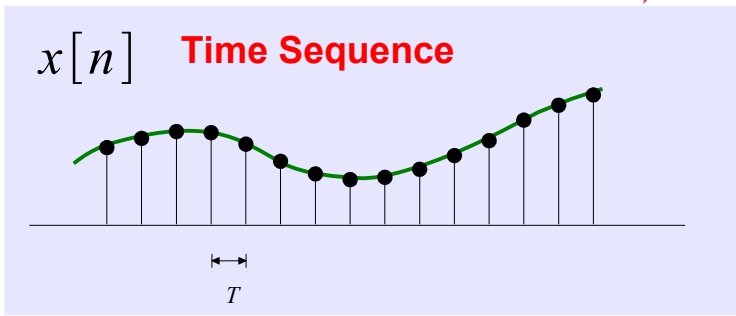

Measuring Rotation Rate

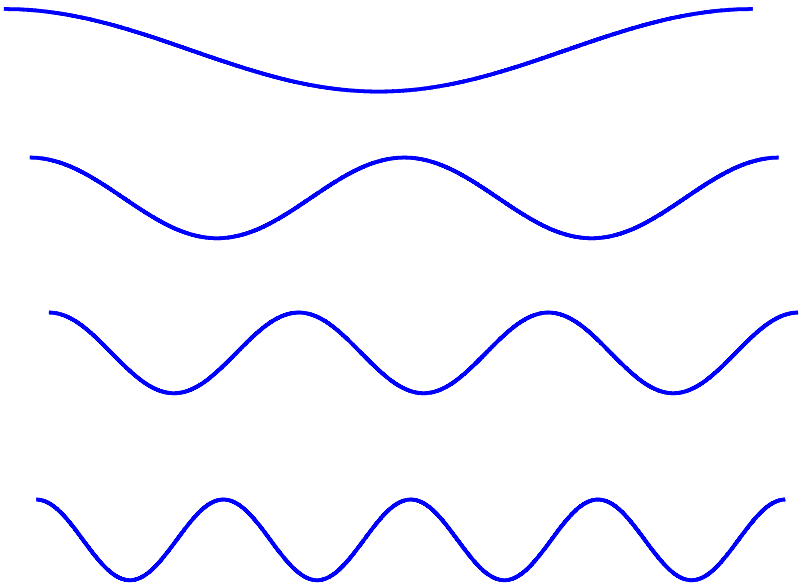

Signals with Harmonic Frequencies (1)

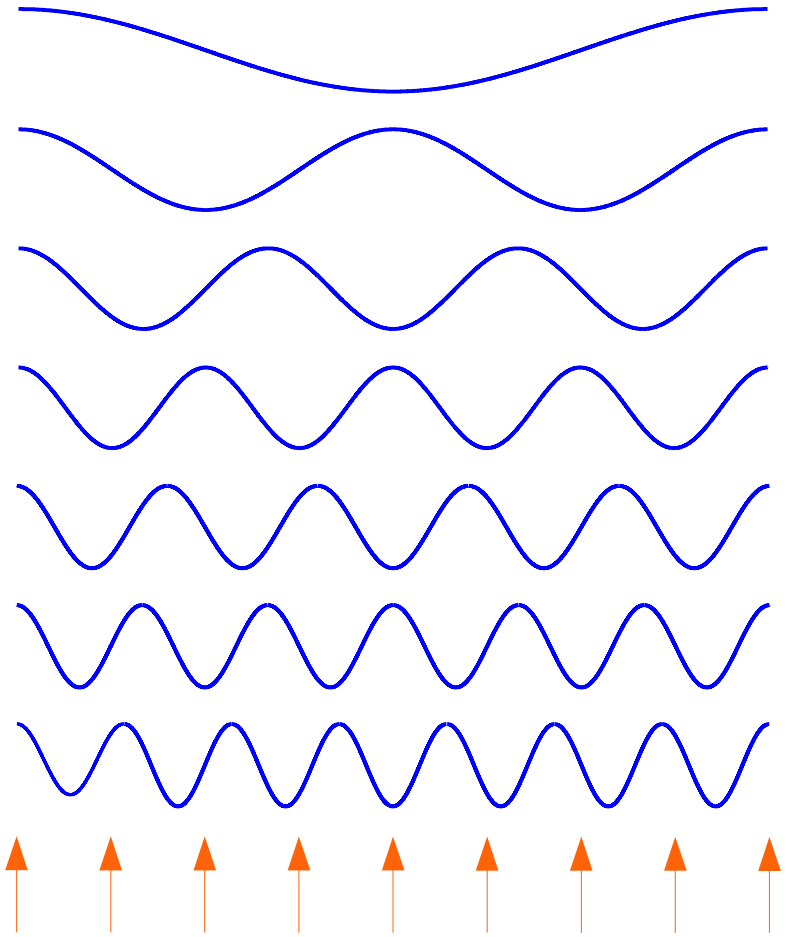

1 Hz
1 cycle / sec

$$\cos(1 \cdot 2\pi t) = \frac{e^{+j(1 \cdot 2\pi)t} + e^{-j(1 \cdot 2\pi)t}}{2}$$

2 Hz
2 cycles / sec

$$\cos(2 \cdot 2\pi t) = \frac{e^{+j(2 \cdot 2\pi)t} + e^{-j(2 \cdot 2\pi)t}}{2}$$

3 Hz
3 cycles / sec

$$\cos(3 \cdot 2\pi t) = \frac{e^{+j(3 \cdot 2\pi)t} + e^{-j(3 \cdot 2\pi)t}}{2}$$

4 Hz
4 cycles / sec

$$\cos(4 \cdot 2\pi t) = \frac{e^{+j(4 \cdot 2\pi)t} + e^{-j(4 \cdot 2\pi)t}}{2}$$

5 Hz
5 cycles / sec

$$\cos(5 \cdot 2\pi t) = \frac{e^{+j(5 \cdot 2\pi)t} + e^{-j(5 \cdot 2\pi)t}}{2}$$

6 Hz
6 cycles / sec

$$\cos(6 \cdot 2\pi t) = \frac{e^{+j(6 \cdot 2\pi)t} + e^{-j(6 \cdot 2\pi)t}}{2}$$

7 Hz
7 cycles / sec

$$\cos(7 \cdot 2\pi t) = \frac{e^{+j(7 \cdot 2\pi)t} + e^{-j(7 \cdot 2\pi)t}}{2}$$

Signals with Harmonic Frequencies (2)

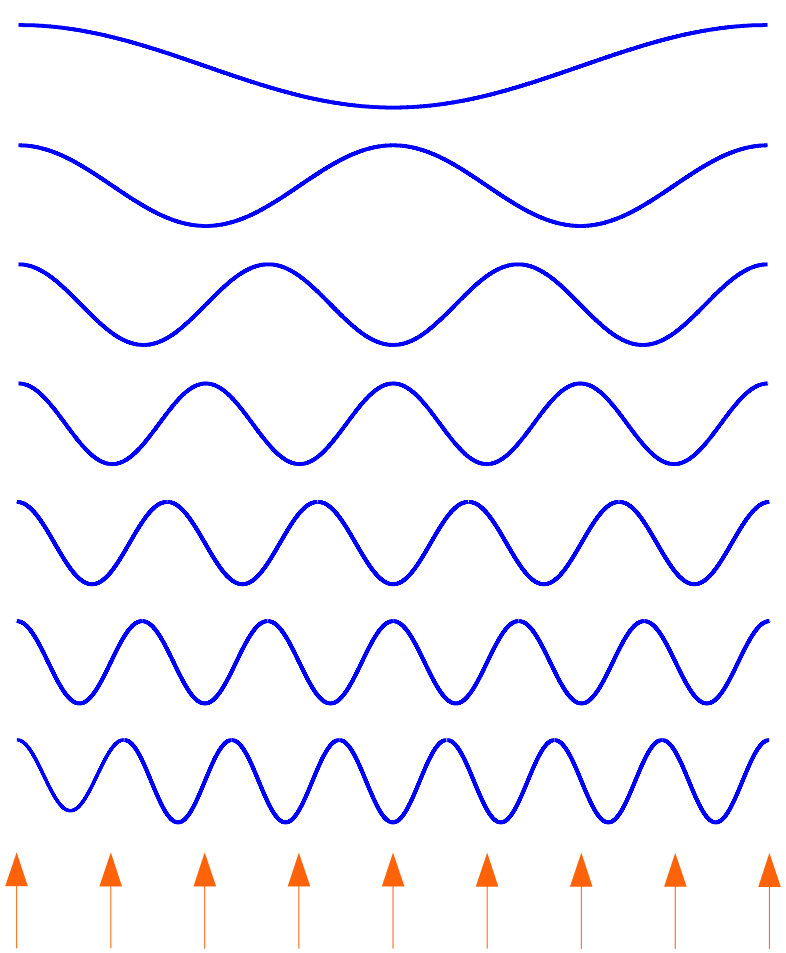

1 Hz
1 cycle / sec

2 Hz
2 cycles / sec

3 Hz
3 cycles / sec

4 Hz
4 cycles / sec

5 Hz
5 cycles / sec

6 Hz
6 cycles / sec

7 Hz
7 cycles / sec

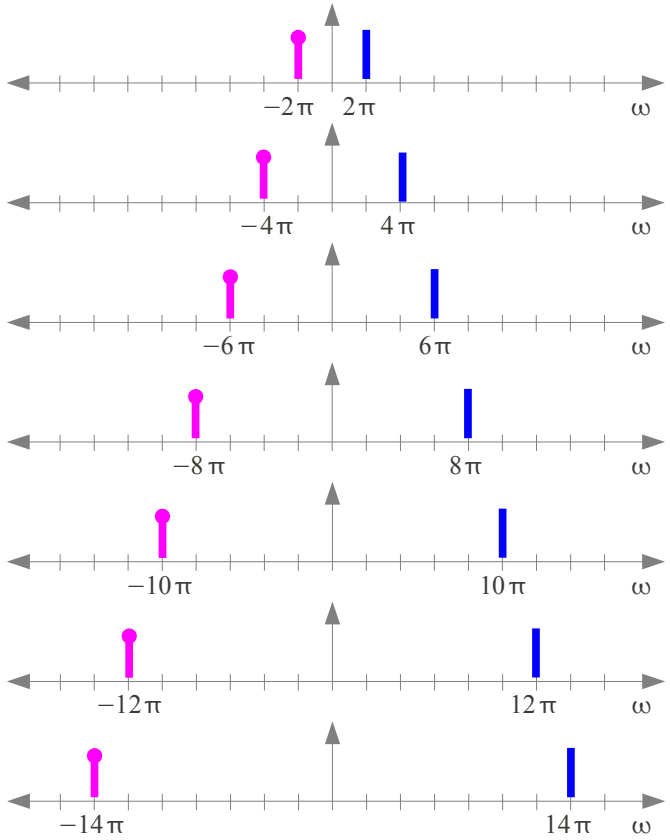

Sampling Frequency

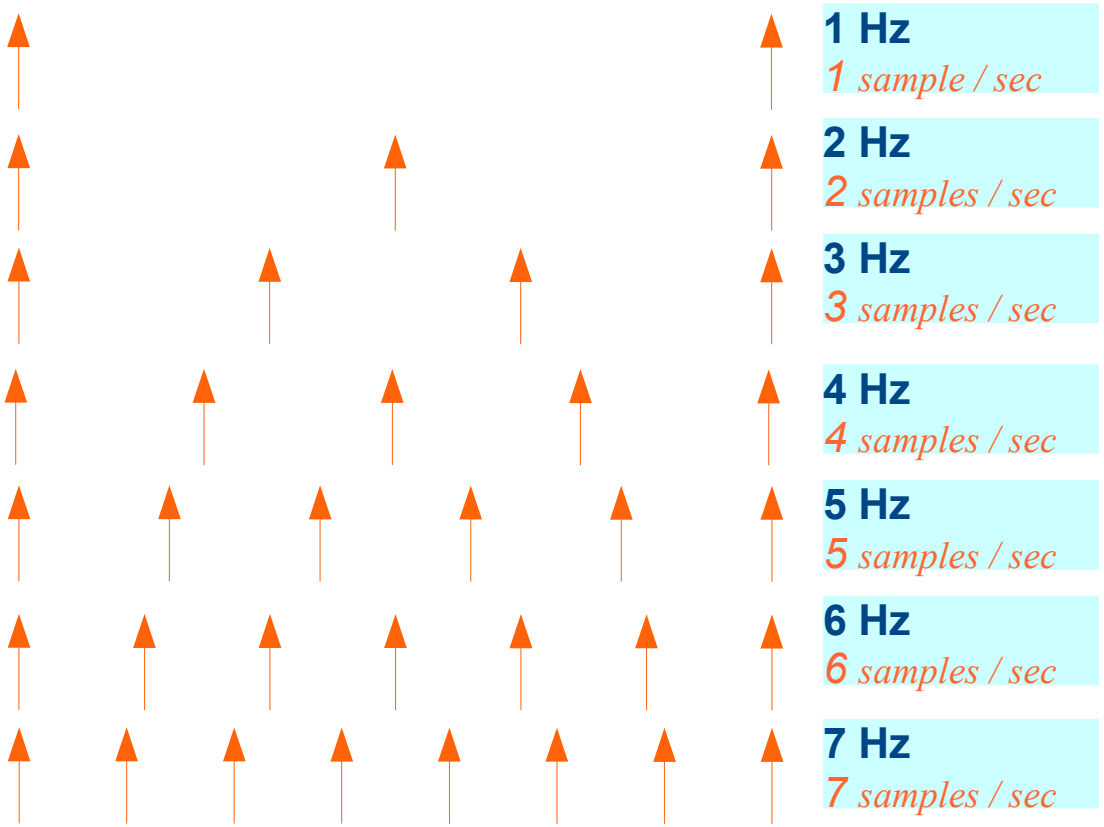

1 Hz
1 sample / sec

2 Hz
2 samples / sec

3 Hz
3 samples / sec

4 Hz
4 samples / sec

5 Hz
5 samples / sec

6 Hz
6 samples / sec

7 Hz
7 samples / sec

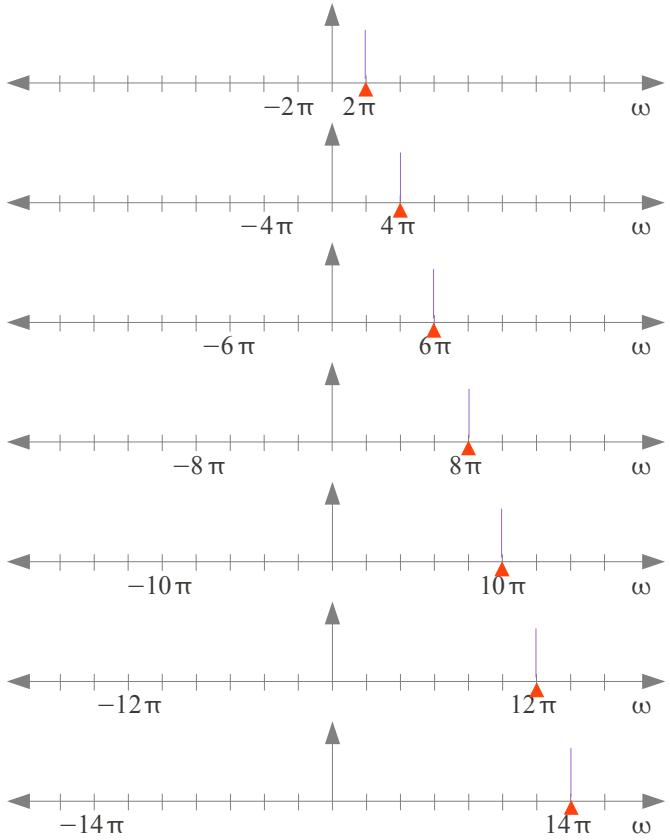

Nyquist Frequency

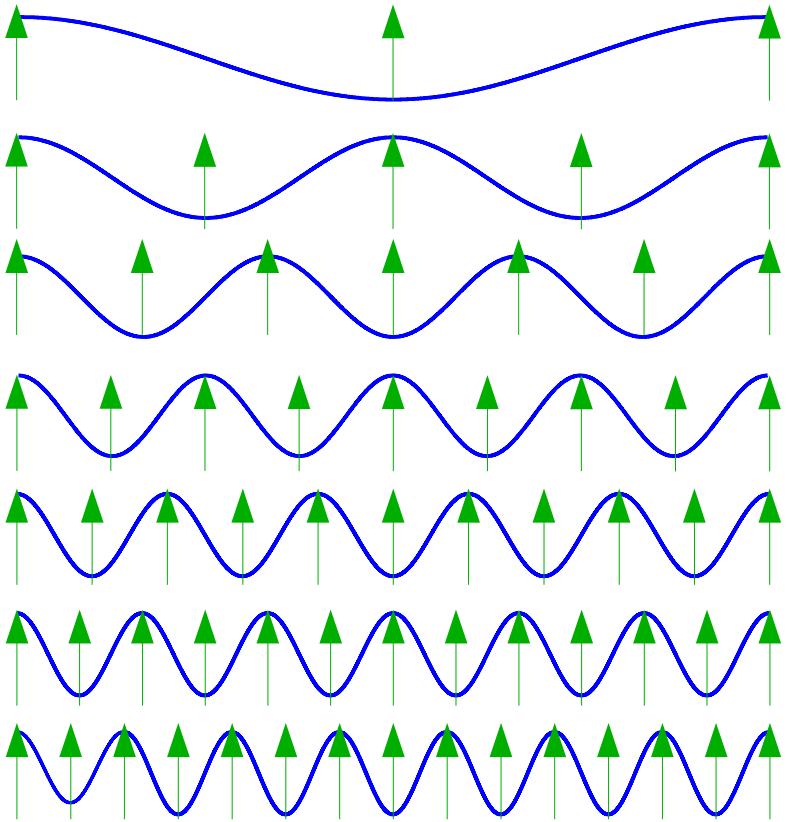

1 Hz *1 cycle / sec*	*2x1 sample / sec*
2 Hz *2 cycles / sec*	*2x2 samples / sec*
3 Hz *3 cycles / sec*	*2x3 samples / sec*
4 Hz *4 cycles / sec*	*2x4 samples / sec*
5 Hz *5 cycles / sec*	*2x5 samples / sec*
6 Hz *6 cycles / sec*	*2x6 samples / sec*
7 Hz *7 cycles / sec*	*2x7 samples / sec*

Aliasing

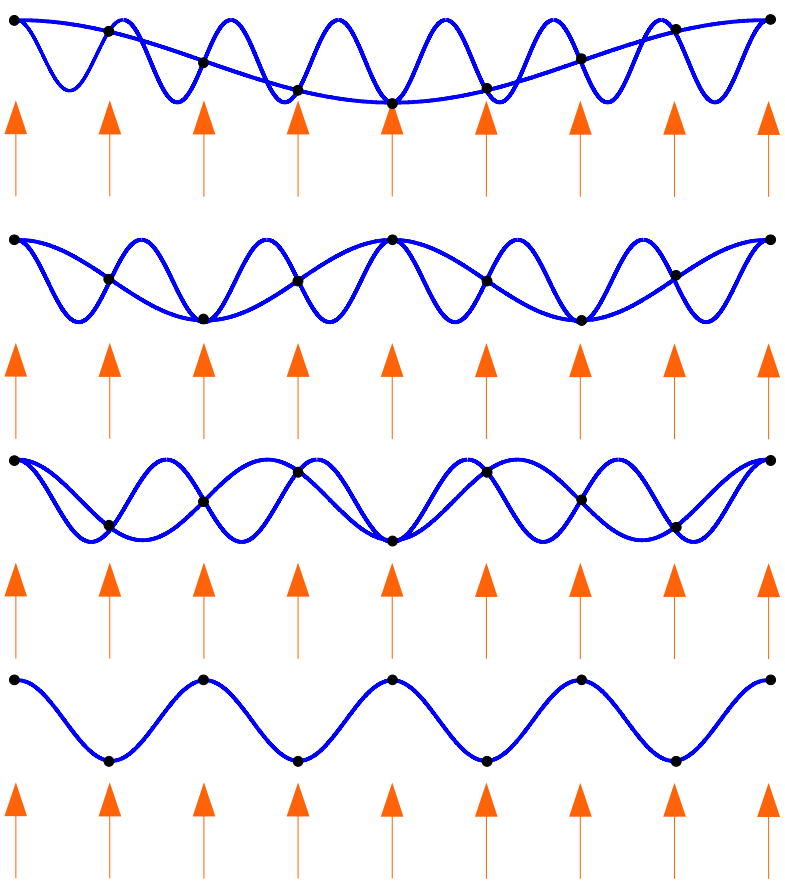

1 Hz
7 Hz

2x4 samples / sec

2 Hz
6 Hz

2x4 samples / sec

3 Hz
5 Hz

2x4 samples / sec

4 Hz

2x4 samples / sec

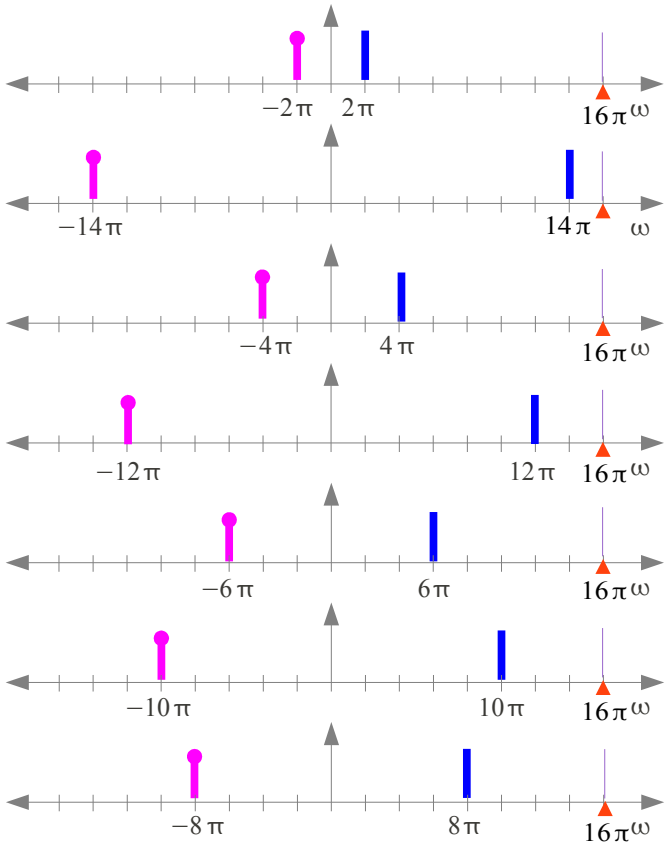

Sampling

$$\omega_s = 2\pi f_s \ (rad/sec)$$

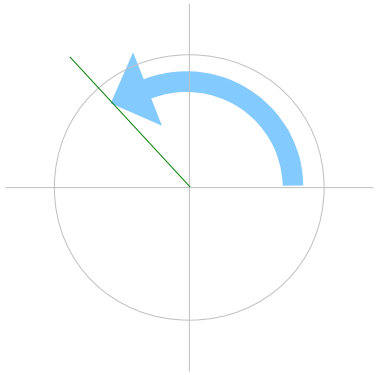

$$\omega_1 = 2\pi f_1 \qquad \omega_2 = 2\pi f_2$$

$$\omega_1 = \frac{\omega_s}{2} \ (rad/sec) \qquad \omega_2 = -\frac{\omega_s}{2} \ (rad/sec)$$

$$f_1 = \frac{f_s}{2} \ (rad/sec) \qquad f_2 = -\frac{f_s}{2} \ (rad/sec)$$

$2\pi \ (rad) \ / \ T_s \ (sec)$

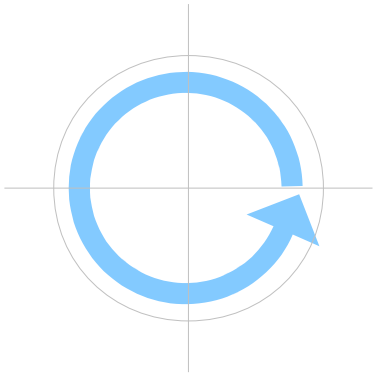

$\pi \ (rad) \ / \ T_s \ (sec)$

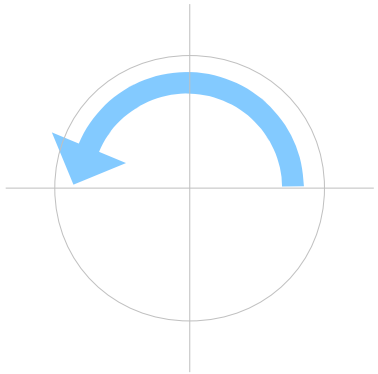

$-\pi \ (rad) \ / \ T_s \ (sec)$

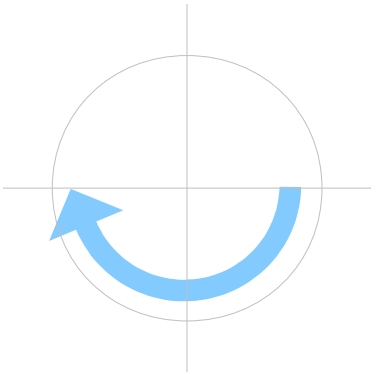

Sampling

$\omega_1 = 2\pi f_1 \ (rad/sec)$

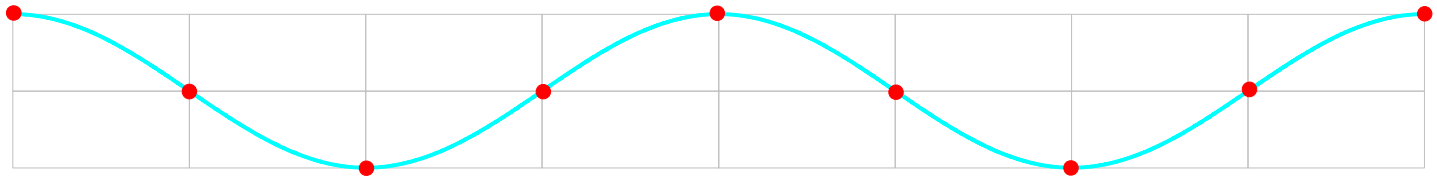

$\omega_s = 2\pi f_s \ (rad/sec)$

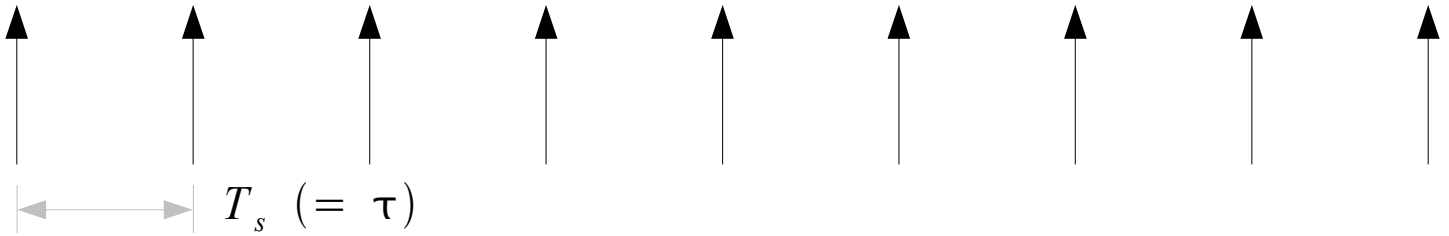

$2\pi \ (rad) \ / \ T_s \ (sec)$

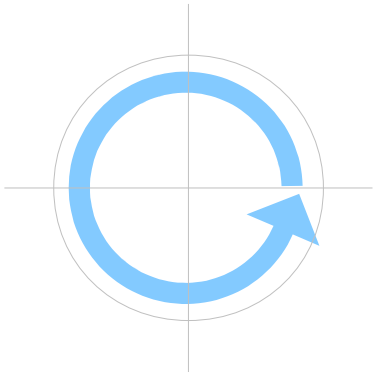

$\frac{\pi}{2} \ (rad) \ / \ T_s \ (sec)$

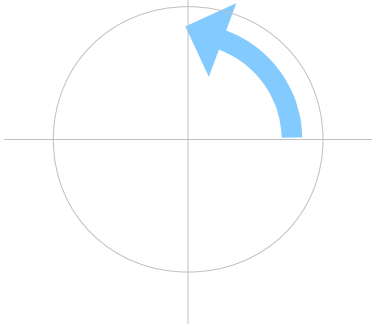

For the period of T_s

Angular displacement $\frac{\pi}{2} \ (rad)$

$$\hat{\omega} = \omega \cdot T_s \ (rad)$$

$$= 2\pi f_1 \cdot T_s \ (rad)$$

$$= 2\pi \frac{f_s}{4} \cdot T_s \ (rad)$$

$$= \frac{\pi}{2} \ (rad)$$

Angular Frequencies in Sampling

continuous-time signals

Signal Frequency

$$f_0 = \frac{1}{T_0}$$

Signal Angular Frequency

$$\omega_0 = 2\pi f_0 \ (rad/sec)$$

sampling sequence

Sampling Frequency

$$f_s = \frac{1}{T_s}$$

Sampling Angular Frequency

$$\omega_s = 2\pi f_s \ (rad/sec)$$

For 1 second $\omega_0 = 2\pi f_0 \ (rad/sec)$

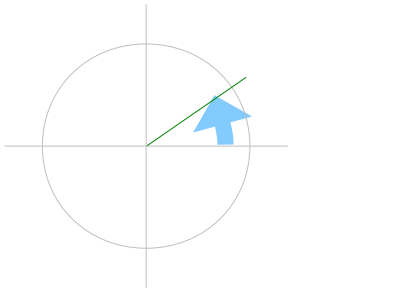

For 1 revolution $2\pi \ (rad) = T_0 \ (sec)$

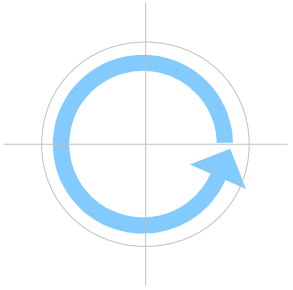

For 1 second $\omega_s = 2\pi f_s \ (rad/sec)$

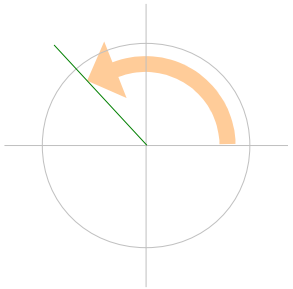

For 1 revolution $2\pi \ (rad) = T_s \ (sec)$

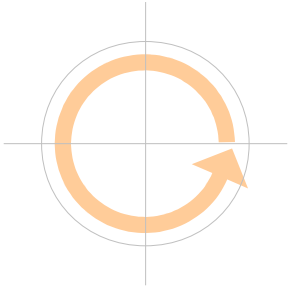

References

[1] http://en.wikipedia.org/
[2] J.H. McClellan, et al., Signal Processing First, Pearson Prentice Hall, 2003
[3] A "graphical interpretation" of the DFT and FFT, by Steve Mann