

Power Systems

Service request numbers

IBM

Power Systems

Service request numbers

IBM

Note

Before using this information and the product it supports, read the information in "Safety notices" on page v, "Notices" on page 1079, the *IBM Systems Safety Notices* manual, G229-9054, and the *IBM Environmental Notices and User Guide*, Z125-5823.

This edition applies to IBM Power Systems™ servers that contain the POWER7 processor and to all associated models.

© Copyright IBM Corporation 2010, 2017.

US Government Users Restricted Rights – Use, duplication or disclosure restricted by GSA ADP Schedule Contract with IBM Corp.

Contents

Safety notices	v
Service request numbers	1
SRNs	1
Notices	1079
Trademarks	1080
Electronic emission notices	1080
Class A Notices	1081
Class B Notices	1084
Terms and conditions	1087

Safety notices

Safety notices may be printed throughout this guide:

- **DANGER** notices call attention to a situation that is potentially lethal or extremely hazardous to people.
- **CAUTION** notices call attention to a situation that is potentially hazardous to people because of some existing condition.
- **Attention** notices call attention to the possibility of damage to a program, device, system, or data.

World Trade safety information

Several countries require the safety information contained in product publications to be presented in their national languages. If this requirement applies to your country, safety information documentation is included in the publications package (such as in printed documentation, on DVD, or as part of the product) shipped with the product. The documentation contains the safety information in your national language with references to the U.S. English source. Before using a U.S. English publication to install, operate, or service this product, you must first become familiar with the related safety information documentation. You should also refer to the safety information documentation any time you do not clearly understand any safety information in the U.S. English publications.

Replacement or additional copies of safety information documentation can be obtained by calling the IBM Hotline at 1-800-300-8751.

German safety information

Das Produkt ist nicht für den Einsatz an Bildschirmarbeitsplätzen im Sinne § 2 der Bildschirmarbeitsverordnung geeignet.

Laser safety information

IBM® servers can use I/O cards or features that are fiber-optic based and that utilize lasers or LEDs.

Laser compliance

IBM servers may be installed inside or outside of an IT equipment rack.

DANGER

When working on or around the system, observe the following precautions:

Electrical voltage and current from power, telephone, and communication cables are hazardous. To avoid a shock hazard:

- Connect power to this unit only with the IBM provided power cord. Do not use the IBM provided power cord for any other product.
- Do not open or service any power supply assembly.
- Do not connect or disconnect any cables or perform installation, maintenance, or reconfiguration of this product during an electrical storm.
- The product might be equipped with multiple power cords. To remove all hazardous voltages, disconnect all power cords.
- Connect all power cords to a properly wired and grounded electrical outlet. Ensure that the outlet supplies proper voltage and phase rotation according to the system rating plate.
- Connect any equipment that will be attached to this product to properly wired outlets.
- When possible, use one hand only to connect or disconnect signal cables.
- Never turn on any equipment when there is evidence of fire, water, or structural damage.
- Disconnect the attached power cords, telecommunications systems, networks, and modems before you open the device covers, unless instructed otherwise in the installation and configuration procedures.
- Connect and disconnect cables as described in the following procedures when installing, moving, or opening covers on this product or attached devices.

To Disconnect:

1. Turn off everything (unless instructed otherwise).
2. Remove the power cords from the outlets.
3. Remove the signal cables from the connectors.
4. Remove all cables from the devices.

To Connect:

1. Turn off everything (unless instructed otherwise).
2. Attach all cables to the devices.
3. Attach the signal cables to the connectors.
4. Attach the power cords to the outlets.
5. Turn on the devices.

(D005)

DANGER

Observe the following precautions when working on or around your IT rack system:

- Heavy equipment—personal injury or equipment damage might result if mishandled.
- Always lower the leveling pads on the rack cabinet.
- Always install stabilizer brackets on the rack cabinet.
- To avoid hazardous conditions due to uneven mechanical loading, always install the heaviest devices in the bottom of the rack cabinet. Always install servers and optional devices starting from the bottom of the rack cabinet.
- Rack-mounted devices are not to be used as shelves or work spaces. Do not place objects on top of rack-mounted devices.



- Each rack cabinet might have more than one power cord. Be sure to disconnect all power cords in the rack cabinet when directed to disconnect power during servicing.
- Connect all devices installed in a rack cabinet to power devices installed in the same rack cabinet. Do not plug a power cord from a device installed in one rack cabinet into a power device installed in a different rack cabinet.
- An electrical outlet that is not correctly wired could place hazardous voltage on the metal parts of the system or the devices that attach to the system. It is the responsibility of the customer to ensure that the outlet is correctly wired and grounded to prevent an electrical shock.

CAUTION

- Do not install a unit in a rack where the internal rack ambient temperatures will exceed the manufacturer's recommended ambient temperature for all your rack-mounted devices.
- Do not install a unit in a rack where the air flow is compromised. Ensure that air flow is not blocked or reduced on any side, front, or back of a unit used for air flow through the unit.
- Consideration should be given to the connection of the equipment to the supply circuit so that overloading of the circuits does not compromise the supply wiring or overcurrent protection. To provide the correct power connection to a rack, refer to the rating labels located on the equipment in the rack to determine the total power requirement of the supply circuit.
- *(For sliding drawers.)* Do not pull out or install any drawer or feature if the rack stabilizer brackets are not attached to the rack. Do not pull out more than one drawer at a time. The rack might become unstable if you pull out more than one drawer at a time.
- *(For fixed drawers.)* This drawer is a fixed drawer and must not be moved for servicing unless specified by the manufacturer. Attempting to move the drawer partially or completely out of the rack might cause the rack to become unstable or cause the drawer to fall out of the rack.

(R001)

CAUTION:

Removing components from the upper positions in the rack cabinet improves rack stability during relocation. Follow these general guidelines whenever you relocate a populated rack cabinet within a room or building:

- Reduce the weight of the rack cabinet by removing equipment starting at the top of the rack cabinet. When possible, restore the rack cabinet to the configuration of the rack cabinet as you received it. If this configuration is not known, you must observe the following precautions:
 - Remove all devices in the 32U position and above.
 - Ensure that the heaviest devices are installed in the bottom of the rack cabinet.
 - Ensure that there are no empty U-levels between devices installed in the rack cabinet below the 32U level.
- If the rack cabinet you are relocating is part of a suite of rack cabinets, detach the rack cabinet from the suite.
- Inspect the route that you plan to take to eliminate potential hazards.
- Verify that the route that you choose can support the weight of the loaded rack cabinet. Refer to the documentation that comes with your rack cabinet for the weight of a loaded rack cabinet.
- Verify that all door openings are at least 760 x 230 mm (30 x 80 in.).
- Ensure that all devices, shelves, drawers, doors, and cables are secure.
- Ensure that the four leveling pads are raised to their highest position.
- Ensure that there is no stabilizer bracket installed on the rack cabinet during movement.
- Do not use a ramp inclined at more than 10 degrees.
- When the rack cabinet is in the new location, complete the following steps:
 - Lower the four leveling pads.
 - Install stabilizer brackets on the rack cabinet.
 - If you removed any devices from the rack cabinet, repopulate the rack cabinet from the lowest position to the highest position.
- If a long-distance relocation is required, restore the rack cabinet to the configuration of the rack cabinet as you received it. Pack the rack cabinet in the original packaging material, or equivalent. Also lower the leveling pads to raise the casters off of the pallet and bolt the rack cabinet to the pallet.

(R002)


(L001)



(L002)



(L003)

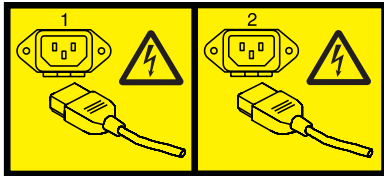

or



All lasers are certified in the U.S. to conform to the requirements of DHHS 21 CFR Subchapter J for class 1 laser products. Outside the U.S., they are certified to be in compliance with IEC 60825 as a class 1 laser product. Consult the label on each part for laser certification numbers and approval information.

CAUTION:

This product might contain one or more of the following devices: CD-ROM drive, DVD-ROM drive, DVD-RAM drive, or laser module, which are Class 1 laser products. Note the following information:

- Do not remove the covers. Removing the covers of the laser product could result in exposure to hazardous laser radiation. There are no serviceable parts inside the device.
- Use of the controls or adjustments or performance of procedures other than those specified herein might result in hazardous radiation exposure.

(C026)

CAUTION:

Data processing environments can contain equipment transmitting on system links with laser modules that operate at greater than Class 1 power levels. For this reason, never look into the end of an optical fiber cable or open receptacle. (C027)

CAUTION:

This product contains a Class 1M laser. Do not view directly with optical instruments. (C028)

CAUTION:

Some laser products contain an embedded Class 3A or Class 3B laser diode. Note the following information: laser radiation when open. Do not stare into the beam, do not view directly with optical instruments, and avoid direct exposure to the beam. (C030)

CAUTION:

The battery contains lithium. To avoid possible explosion, do not burn or charge the battery.

Do Not:

- ___ Throw or immerse into water
- ___ Heat to more than 100°C (212°F)
- ___ Repair or disassemble

Exchange only with the IBM-approved part. Recycle or discard the battery as instructed by local regulations. In the United States, IBM has a process for the collection of this battery. For information, call 1-800-426-4333. Have the IBM part number for the battery unit available when you call. (C003)

Power and cabling information for NEBS (Network Equipment-Building System) GR-1089-CORE

The following comments apply to the IBM servers that have been designated as conforming to NEBS (Network Equipment-Building System) GR-1089-CORE:

The equipment is suitable for installation in the following:

- Network telecommunications facilities
- Locations where the NEC (National Electrical Code) applies

The intrabuilding ports of this equipment are suitable for connection to intrabuilding or unexposed wiring or cabling only. The intrabuilding ports of this equipment *must not* be metallically connected to the interfaces that connect to the OSP (outside plant) or its wiring. These interfaces are designed for use as intrabuilding interfaces only (Type 2 or Type 4 ports as described in GR-1089-CORE) and require isolation from the exposed OSP cabling. The addition of primary protectors is not sufficient protection to connect these interfaces metallically to OSP wiring.

Note: All Ethernet cables must be shielded and grounded at both ends.

The ac-powered system does not require the use of an external surge protection device (SPD).

The dc-powered system employs an isolated DC return (DC-I) design. The DC battery return terminal *shall not* be connected to the chassis or frame ground.

Service request numbers

Service request numbers (SRNs) serve as diagnostic aids to help users determine the source of a hardware problem. Diagnostic applications report problems by using SRNs. The SRN identifies the component that detected the error code and describes the error condition. Use this publication to identify a list of possible failing items and to find information about any additional isolation procedures.

Service request number formats

If your System reference code (SRC) is a 5-digit hexadecimal number or contains a hyphen in the following formats (xxxxx, xxx-xxx, xxx-xxxx, xxxx-xxx, xxxx-xxxx), it is an SRN.

Using Service request numbers

The SRN tables use the following format:

- The Service Request Number (SRN) contains numbers that represent specific failures of specific functions.
- SRNs contain Failing Function Codes (FFCs). The FFC represents field replaceable units (FRUs) of the system unit. When available, the FFC links to the FRU that contains this function for each specific system unit.
- The SRN also contains an action or service response. Typically it is brief description of the failure that this SRN represents and an isolation procedure that should be used when servicing the system.

SRNs

This topic contains descriptions of Service request numbers.

Table 1. SRNs

Type of SRN:	Action to perform																														
Five-digit SRNs	Replace FRU parts in the order by which they appear in the list. For SRNs listed as xxPAA: △P△ denotes the adapter port number. △AA△ denotes the SSA address.																														
SRNs 1xx-xxx through 9xx-xxx, 1xx-xxxx through 9xx-xxxx, and 2xx-xxx	Replace FRU parts in the order by which they are listed.																														
SRNs Axx-xxx and Axx-xxxx	When an "X" appears as the last digit of an SRN in this group, it is encoded as follows: <div style="border: 1px solid black; border-radius: 10px; padding: 10px; margin: 10px 0;"><table style="border-collapse: collapse; margin: 0 auto;"><tr><td style="padding: 0 5px;">8</td><td style="padding: 0 5px;">4</td><td style="padding: 0 5px;">2</td><td style="padding: 0 5px;">1</td><td style="padding: 0 5px;"> </td><td></td></tr><tr><td style="padding: 0 5px;"> </td><td style="padding: 0 5px;"> </td><td style="padding: 0 5px;"> </td><td style="padding: 0 5px;"> </td><td style="padding: 0 5px;"> </td><td>Replace all FRUs listed</td></tr><tr><td style="padding: 0 5px;"> </td><td style="padding: 0 5px;"> </td><td style="padding: 0 5px;"> </td><td style="padding: 0 5px;"> </td><td style="padding: 0 5px;"> </td><td>Hot swap supported</td></tr><tr><td style="padding: 0 5px;"> </td><td style="padding: 0 5px;"> </td><td style="padding: 0 5px;"> </td><td style="padding: 0 5px;"> </td><td style="padding: 0 5px;"> </td><td>Software might be the cause</td></tr><tr><td style="padding: 0 5px;"> </td><td style="padding: 0 5px;"> </td><td style="padding: 0 5px;"> </td><td style="padding: 0 5px;"> </td><td style="padding: 0 5px;"> </td><td>Reserved</td></tr></table></div> Use the physical location codes and FRU numbers listed on the diagnostics Problem Report Screen. FRUs are not used in this group of SRNs.	8	4	2	1								Replace all FRUs listed						Hot swap supported						Software might be the cause						Reserved
8	4	2	1																												
					Replace all FRUs listed																										
					Hot swap supported																										
					Software might be the cause																										
					Reserved																										

10104

Explanation: Format in progress.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive.

10112

Explanation: Format Degraded. A format operation ended before it completed.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive.

1XXXX

Explanation: Disk drive module error.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive.

Note : In this SRN, an *x* represents a digit 0 through F.

101-000

Explanation: The system hung while attempting to configure a device.

Response: Use PFW1540 : Problem isolation procedures.

101-185

Explanation: A checkstop occurred.

Response: Use PFW1540 : Problem isolation procedures.

101-517

Explanation: The system unit failed to IPL.

Response: Use PFW1540 : Problem isolation procedures.

101-518

Explanation: CD-ROM read problems after boot.

Response: Go to MAP0050 SCSI Bus Problems. Note: The boot record was read from the CD-ROM disk. However, errors occurred when trying to mount the CD-ROM file system. This problem can be caused by SCSI device addressing, SCSI terminator, open PTC, SCSI cable, etc.

101-521

Explanation: The configuration manager detected an error.

Response: If you are running the diagnostics from a disk, try running standalone diagnostics. If standalone diagnostics run correctly, the problem may be damaged

data on the disk. Contact your software support facility. If a different problem occurs when you run standalone diagnostics, correct that problem. If you were running standalone at first, have the same problem running standalone diagnostics that you had when running diagnostics from disk, or these actions did not resolve the problem, go to PFW1540 : Problem isolation procedures.

101-522

Explanation: The configuration manager detected an error.

Response: If you are running the diagnostics from a disk, try running standalone diagnostics. If standalone diagnostics run correctly, the problem may be damaged data on the disk. Contact your software support facility. If a different problem occurs when you run standalone diagnostics, correct that problem. If you were running standalone at first, have the same problem running standalone diagnostics that you had when running diagnostics from disk, or these actions did not resolve the problem, go to PFW1540 : Problem isolation procedures.

101-523

Explanation: The configuration manager detected an error.

Response: If you are running the diagnostics from a disk, try running standalone diagnostics. If standalone diagnostics run correctly, the problem may be damaged data on the disk. Contact your software support facility. If a different problem occurs when you run standalone diagnostics, correct that problem. If you were running standalone at first, have the same problem running standalone diagnostics that you had when running diagnostics from disk, or these actions did not resolve the problem, go to PFW1540 : Problem isolation procedures.

101-524

Explanation: The configuration manager detected an error.

Response: If you are running the diagnostics from a disk, try running standalone diagnostics. If standalone diagnostics run correctly, the problem may be damaged data on the disk. Contact your software support facility. If a different problem occurs when you run standalone diagnostics, correct that problem. If you were running standalone at first, have the same problem running standalone diagnostics that you had when running diagnostics from disk, or these actions did not resolve the problem, go to PFW1540 : Problem isolation procedures.

101-525

Explanation: The configuration manager detected an error.

Response: If you are running the diagnostics from a disk, try running standalone diagnostics. If standalone diagnostics run correctly, the problem may be damaged data on the disk. Contact your software support facility. If a different problem occurs when you run standalone diagnostics, correct that problem. If you were running standalone at first, have the same problem running standalone diagnostics that you had when running diagnostics from disk, or these actions did not resolve the problem, go to PFW1540 : Problem isolation procedures.

101-526

Explanation: The configuration manager detected an error.

Response: If you are running the diagnostics from a disk, try running standalone diagnostics. If standalone diagnostics run correctly, the problem may be damaged data on the disk. Contact your software support facility. If a different problem occurs when you run standalone diagnostics, correct that problem. If you were running standalone at first, have the same problem running standalone diagnostics that you had when running diagnostics from disk, or these actions did not resolve the problem, go to PFW1540 : Problem isolation procedures.

101-527

Explanation: The configuration manager detected an error.

Response: If you are running the diagnostics from a disk, try running standalone diagnostics. If standalone diagnostics run correctly, the problem may be damaged data on the disk. Contact your software support facility. If a different problem occurs when you run standalone diagnostics, correct that problem. If you were running standalone at first, have the same problem running standalone diagnostics that you had when running diagnostics from disk, or these actions did not resolve the problem, go to PFW1540 : Problem isolation procedures.

101-528

Explanation: The configuration manager detected an error.

Response: If you are running the diagnostics from a disk, try running standalone diagnostics. If standalone diagnostics run correctly, the problem may be damaged data on the disk. Contact your software support facility. If a different problem occurs when you run standalone diagnostics, correct that problem. If you were running standalone at first, have the same problem running

standalone diagnostics that you had when running diagnostics from disk, or these actions did not resolve the problem, go to PFW1540 : Problem isolation procedures.

101-529

Explanation: The configuration manager detected an error.

Response: If you are running the diagnostics from a disk, try running standalone diagnostics. If standalone diagnostics run correctly, the problem may be damaged data on the disk. Contact your software support facility. If a different problem occurs when you run standalone diagnostics, correct that problem. If you were running standalone at first, have the same problem running standalone diagnostics that you had when running diagnostics from disk, or these actions did not resolve the problem, go to PFW1540 : Problem isolation procedures.

101-530

Explanation: The configuration manager detected an error.

Response: If you are running the diagnostics from a disk, try running standalone diagnostics. If standalone diagnostics run correctly, the problem may be damaged data on the disk. Contact your software support facility. If a different problem occurs when you run standalone diagnostics, correct that problem. If you were running standalone at first, have the same problem running standalone diagnostics that you had when running diagnostics from disk, or these actions did not resolve the problem, go to PFW1540 : Problem isolation procedures.

101-531

Explanation: The configuration manager detected an error.

Response: If you are running the diagnostics from a disk, try running standalone diagnostics. If standalone diagnostics run correctly, the problem may be damaged data on the disk. Contact your software support facility. If a different problem occurs when you run standalone diagnostics, correct that problem. If you were running standalone at first, have the same problem running standalone diagnostics that you had when running diagnostics from disk, or these actions did not resolve the problem, go to PFW1540 : Problem isolation procedures.

101-532

Explanation: The configuration manager detected an error.

Response: If you are running the diagnostics from a disk, try running standalone diagnostics. If standalone

diagnostics run correctly, the problem may be damaged data on the disk. Contact your software support facility. If a different problem occurs when you run standalone diagnostics, correct that problem. If you were running standalone at first, have the same problem running standalone diagnostics that you had when running diagnostics from disk, or these actions did not resolve the problem, go to PFW1540 : Problem isolation procedures.

101-533

Explanation: The configuration manager detected an error.

Response: If you are running the diagnostics from a disk, try running standalone diagnostics. If standalone diagnostics run correctly, the problem may be damaged data on the disk. Contact your software support facility. If a different problem occurs when you run standalone diagnostics, correct that problem. If you were running standalone at first, have the same problem running standalone diagnostics that you had when running diagnostics from disk, or these actions did not resolve the problem, go to PFW1540 : Problem isolation procedures.

101-534

Explanation: The configuration manager detected an error.

Response: If you are running the diagnostics from a disk, try running standalone diagnostics. If standalone diagnostics run correctly, the problem may be damaged data on the disk. Contact your software support facility. If a different problem occurs when you run standalone diagnostics, correct that problem. If you were running standalone at first, have the same problem running standalone diagnostics that you had when running diagnostics from disk, or these actions did not resolve the problem, go to PFW1540 : Problem isolation procedures.

101-535

Explanation: The configuration manager detected an error.

Response: If you are running the diagnostics from a disk, try running standalone diagnostics. If standalone diagnostics run correctly, the problem may be damaged data on the disk. Contact your software support facility. If a different problem occurs when you run standalone diagnostics, correct that problem. If you were running standalone at first, have the same problem running standalone diagnostics that you had when running diagnostics from disk, or these actions did not resolve the problem, go to PFW1540 : Problem isolation procedures.

101-536

Explanation: The configuration manager detected an error.

Response: If you are running the diagnostics from a disk, try running standalone diagnostics. If standalone diagnostics run correctly, the problem may be damaged data on the disk. Contact your software support facility. If a different problem occurs when you run standalone diagnostics, correct that problem. If you were running standalone at first, have the same problem running standalone diagnostics that you had when running diagnostics from disk, or these actions did not resolve the problem, go to PFW1540 : Problem isolation procedures.

101-537

Explanation: The configuration manager detected an error.

Response: If you are running the diagnostics from a disk, try running standalone diagnostics. If standalone diagnostics run correctly, the problem may be damaged data on the disk. Contact your software support facility. If a different problem occurs when you run standalone diagnostics, correct that problem. If you were running standalone at first, have the same problem running standalone diagnostics that you had when running diagnostics from disk, or these actions did not resolve the problem, go to PFW1540 : Problem isolation procedures.

101-538

Explanation: The configuration manager detected an error.

Response: If you are running the diagnostics from a disk, try running standalone diagnostics. If standalone diagnostics run correctly, the problem may be damaged data on the disk. Contact your software support facility. If a different problem occurs when you run standalone diagnostics, correct that problem. If you were running standalone at first, have the same problem running standalone diagnostics that you had when running diagnostics from disk, or these actions did not resolve the problem, go to PFW1540 : Problem isolation procedures.

101-544

Explanation: Disk read problems occurred after booting.

Response: Go to MAP0050 SCSI Bus Problems. Note: The boot record was read from the disk. However, errors occurred when trying to open the disk drive. This problem can be caused by SCSI device addressing, SCSI terminator, open PTC, SCSI cable, etc.

101-551

Explanation: The system hung while loading the software. This can be caused by a hardware or software problem.

Response: Run the standalone diagnostics. If the standalone diagnostics run correctly, the problem may be a damaged disk data. Consider having the customer contact Software Support before reinstalling the operating system on the disk. Otherwise, go to MAP0020 Problem determination procedure. If a different problem occurs when you run the standalone diagnostics, correct that problem. If the standalone diagnostics still produces the same SRN, go to PFW1540 : Problem isolation procedures.

101-552

Explanation: The system hung while loading the software. This can be caused by a hardware or software problem.

Response: Run the standalone diagnostics. If the standalone diagnostics run correctly, the problem may be a damaged disk data. Consider having the customer contact Software Support before reinstalling the operating system on the disk. Otherwise, go to MAP0020 Problem determination procedure. If a different problem occurs when you run the standalone diagnostics, correct that problem. If the standalone diagnostics still produces the same SRN, go to PFW1540 : Problem isolation procedures.

101-553

Explanation: The system hung while loading the software. This can be caused by a hardware or software problem.

Response: Run the standalone diagnostics. If the standalone diagnostics run correctly, the problem may be a damaged disk data. Consider having the customer contact Software Support before reinstalling the operating system on the disk. Otherwise, go to MAP0020 Problem determination procedure. If a different problem occurs when you run the standalone diagnostics, correct that problem. If the standalone diagnostics still produces the same SRN, go to PFW1540 : Problem isolation procedures.

101-554

Explanation: The system hung while loading the software. This can be caused by a hardware or software problem.

Response: Run the standalone diagnostics. If the standalone diagnostics run correctly, the problem may be a damaged disk data. Consider having the customer contact Software Support before reinstalling the operating system on the disk. Otherwise, go to MAP0020 Problem determination procedure. If a

different problem occurs when you run the standalone diagnostics, correct that problem. If the standalone diagnostics still produces the same SRN, go to PFW1540 : Problem isolation procedures.

101-555

Explanation: The system hung while loading the software. This can be caused by a hardware or software problem.

Response: Run the standalone diagnostics. If the standalone diagnostics run correctly, the problem may be a damaged disk data. Consider having the customer contact Software Support before reinstalling the operating system on the disk. Otherwise, go to MAP0020 Problem determination procedure. If a different problem occurs when you run the standalone diagnostics, correct that problem. If the standalone diagnostics still produces the same SRN, go to PFW1540 : Problem isolation procedures.

101-556

Explanation: The system hung while loading the software. This can be caused by a hardware or software problem.

Response: Run the standalone diagnostics. If the standalone diagnostics run correctly, the problem may be a damaged disk data. Consider having the customer contact Software Support before reinstalling the operating system on the disk. Otherwise, go to MAP0020 Problem determination procedure. If a different problem occurs when you run the standalone diagnostics, correct that problem. If the standalone diagnostics still produces the same SRN, go to PFW1540 : Problem isolation procedures.

101-557

Explanation: The system hung while loading the software. This can be caused by a hardware or software problem.

Response: Run the standalone diagnostics. If the standalone diagnostics run correctly, the problem may be a damaged disk data. Consider having the customer contact Software Support before reinstalling the operating system on the disk. Otherwise, go to MAP0020 Problem determination procedure. If a different problem occurs when you run the standalone diagnostics, correct that problem. If the standalone diagnostics still produces the same SRN, go to PFW1540 : Problem isolation procedures.

101-558

Explanation: There is not enough memory to execute diagnostics.

Response: There must be a minimum of 16 MB of installed memory. If the system has 16 MB or more of

memory installed, suspect a problem with a memory card.

101-559

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-560

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-561

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-562

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem

occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-563

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-564

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-565

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-566

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-567

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-568

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-569

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-570

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-571

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-572

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-573

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-574

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-575

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-576

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-577

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation

procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-578

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-579

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-580

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-581

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-582

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-583

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-584

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-585

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-586

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-587

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-588

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation

procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-589

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-590

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-591

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-592

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-593

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-594

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-595

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-596

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures> for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-597

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-598

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-599

Explanation: The system halted while software was loading. This problem may be attributed to either hardware or software.

Response: Use the standalone diagnostics if not yet used. If the same SRN is generated from standalone diagnostics, go to PFW1540 : Problem isolation

procedures for problem isolation. If a different problem occurs when you run the standalone diagnostics, correct that problem.

If the SRN is not generated running standalone diagnostics, suspect a problem with the system's software.

101-662

Explanation: An unexpected system interrupt.

Response: Use PFW1540 : Problem isolation procedures.

101-711

Explanation: The system hung while trying to configure an unknown resource.

Response: Run standalone diagnostics. Start at MAP0020 Problem determination procedure, Step 14. If you still get the same SRN, the failing FRU is listed below. Suspect the device adapter or device itself. If more than one adapter or device is installed, isolate the failing resource by removing the adapters or devices one at a time and checking if the system stops with the same value in the three-digit display.

Failing Item:

- FFC_711

101-712

Explanation: The system hung while trying to configure an unknown resource.

Response: Run standalone diagnostics. Start at MAP0020 Problem determination procedure, Step 14. If you still get the same SRN, refer to the FRU List. Suspect the device adapter or device itself. If more than one adapter or device is installed, isolate the failing resource by removing the adapters or devices one at a time and checking if the system stops with the same value in the three-digit display.

Failing Item:

- FFC_712

101-713

Explanation: The system hung while trying to configure an unknown resource.

Response: Run standalone diagnostics. Start at MAP0020 Problem determination procedure, Step 14. If you still get the same SRN, the failing FRU is listed below. Suspect the device adapter or device itself. If more than one adapter or device is installed, isolate the failing resource by removing the adapters or devices one at a time and checking if the system stops with the same value in the three-digit display.

Failing Item:

101-714 • 101-720

- FFC_713
-

101-714

Explanation: The system hung while trying to configure an unknown resource.

Response: Run standalone diagnostics. Start at MAP0020 Problem determination procedure, Step 14. If you still get the same SRN, the failing FRU is listed below. Suspect the device adapter or device itself. If more than one adapter or device is installed, isolate the failing resource by removing the adapters or devices one at a time and checking if the system stops with the same value in the three-digit display.

Failing Item:

- FFC_714
-

101-715

Explanation: The system hung while trying to configure an unknown resource.

Response: Run standalone diagnostics. Start at MAP0020 Problem determination procedure, Step 14. If you still get the same SRN, the failing FRU is listed below. Suspect the device adapter or device itself. If more than one adapter or device is installed, isolate the failing resource by removing the adapters or devices one at a time and checking if the system stops with the same value in the three-digit display.

Failing Item:

- FFC_715
-

101-716

Explanation: The system hung while trying to configure an unknown resource.

Response: Run standalone diagnostics. Start at MAP0020 Problem determination procedure, Step 14. If you still get the same SRN, the failing FRU is listed below. Suspect the device adapter or device itself. If more than one adapter or device is installed, isolate the failing resource by removing the adapters or devices one at a time and checking if the system stops with the same value in the three-digit display.

Failing Item:

- FFC_716
-

101-717

Explanation: The system hung while trying to configure an unknown resource.

Response: Run standalone diagnostics. Start at MAP0020 Problem determination procedure, Step 14. If you still get the same SRN, the failing FRU is listed below. Suspect the device adapter or device itself. If more than one adapter or device is installed, isolate the

failing resource by removing the adapters or devices one at a time and checking if the system stops with the same value in the three-digit display.

Failing Item:

- FFC_717
-

101-718

Explanation: The system hung while trying to configure an unknown resource.

Response: Run standalone diagnostics. Start at MAP0020 Problem determination procedure, Step 14. If you still get the same SRN, the failing FRU is listed below. Suspect the device adapter or device itself. If more than one adapter or device is installed, isolate the failing resource by removing the adapters or devices one at a time and checking if the system stops with the same value in the three-digit display.

Failing Item:

- FFC_718
-

101-719

Explanation: The system hung while trying to configure an unknown resource.

Response: Run standalone diagnostics. Start at MAP0020 Problem determination procedure, Step 14. If you still get the same SRN, the failing FRU is listed below. Suspect the device adapter or device itself. If more than one adapter or device is installed, isolate the failing resource by removing the adapters or devices one at a time and checking if the system stops with the same value in the three-digit display.

Failing Item:

- FFC_719
-

101-720

Explanation: The system hung while trying to configure an unknown resource.

Response: Run standalone diagnostics. Start at MAP0020 Problem determination procedure, Step 14. If you still get the same SRN, the failing FRU is listed below. Suspect the device adapter or device itself. If more than one adapter or device is installed, isolate the failing resource by removing the adapters or devices one at a time and checking if the system stops with the same value in the three-digit display.

Failing Item:

- FFC_720
-

101-721

Explanation: The system hung while trying to configure an unknown resource.

Response: Run standalone diagnostics. Start at MAP0020 Problem determination procedure, Step 14. If you still get the same SRN, the failing FRU is listed below. Suspect the device adapter or device itself. If more than one adapter or device is installed, isolate the failing resource by removing the adapters or devices one at a time and checking if the system stops with the same value in the three-digit display.

Failing Item:

- FFC_721
-

101-722

Explanation: The system hung while trying to configure an unknown resource.

Response: Run standalone diagnostics. Start at MAP0020 Problem determination procedure, Step 14. If you still get the same SRN, the failing FRU is listed below. Suspect the device adapter or device itself. If more than one adapter or device is installed, isolate the failing resource by removing the adapters or devices one at a time and checking if the system stops with the same value in the three-digit display.

Failing Item:

- FFC_722
-

101-723

Explanation: The system hung while trying to configure an unknown resource.

Response: Run standalone diagnostics. Start at MAP0020 Problem determination procedure, Step 14. If you still get the same SRN, the failing FRU is listed below. Suspect the device adapter or device itself. If more than one adapter or device is installed, isolate the failing resource by removing the adapters or devices one at a time and checking if the system stops with the same value in the three-digit display.

Failing Item:

- FFC_723
-

101-724

Explanation: The system hung while trying to configure an unknown resource.

Response: Run standalone diagnostics. Start at MAP0020 Problem determination procedure, Step 14. If you still get the same SRN, the failing FRU is listed below. Suspect the device adapter or device itself. If more than one adapter or device is installed, isolate the failing resource by removing the adapters or devices one at a time and checking if the system stops with the

same value in the three-digit display.

Failing Item:

- FFC_724
-

101-725

Explanation: The system hung while trying to configure an unknown resource.

Response: Run standalone diagnostics. Start at MAP0020 Problem determination procedure, Step 14. If you still get the same SRN, the failing FRU is listed below. Suspect the device adapter or device itself. If more than one adapter or device is installed, isolate the failing resource by removing the adapters or devices one at a time and checking if the system stops with the same value in the three-digit display.

Failing Item:

- FFC_725
-

101-726

Explanation: The system hung while trying to configure an unknown resource.

Response: Run standalone diagnostics. Start at MAP0020 Problem determination procedure, Step 14. If you still get the same SRN, the failing FRU is listed below. Suspect the device adapter or device itself. If more than one adapter or device is installed, isolate the failing resource by removing the adapters or devices one at a time and checking if the system stops with the same value in the three-digit display.

Failing Item:

- FFC_726
-

101-727

Explanation: The system hung while trying to configure an asynchronous adapter.

Response: Use PFW1540 : Problem isolation procedures. Suspect a problem with one of the async adapters.

101-7C1

Explanation: The system unit halted while configuring an audio subsystem.

Failing Item:

- FFC_7C1
-

101-80C

Explanation: A potential problem with an SSA device exists.

Response: If the system has external SSA devices refer to the SSA Adapters User's Guide and Maintenance

Information . If the system has internal SSA devices, go to the SSA MAP in either the system unit's service guide or user's guide.

Failing Item:

- FFC_80C

101-840

Explanation: An unexpected system interrupt.

Response: Use PFW1540 : Problem isolation procedures. Suspect either a SCSI adapter or integrated SCSI if so equipped.

101-888

Explanation: The system does not IPL.

Failing Item:

- FFC_210
- FFC_227
- FFC_E10

101-C32

Explanation: The system hung while indicating that a direct-attached display was selected as the console.

Response: Use PFW1540 : Problem isolation procedures. Suspect the graphics adapter being used for the display console first.

101-C33

Explanation: The system hung while indicating that a TTY terminal is the system console.

Response: Use PFW1540 : Problem isolation procedures. Suspect the graphics adapter being used for the display console first.

101-C70

Explanation: A problem was encountered mounting the CD-ROM.

Response: Use PFW1540 : Problem isolation procedures.

103-151

Explanation: The time-of-day battery failed.

Failing Item:

- FFC_151

109-200

Explanation: The system crashed while being run by the customer.

Response: Use general problem determination procedures, and get a new SRN.

110-101

Explanation: The diagnostics did not detect an installed resource.

Response: If this SRN appeared when running concurrent diagnostics, then run concurrent using the diag -a command, otherwise use *Missing resource problem resolution* .

110-908

Explanation: The system halted while diagnostics were executing.

Failing Item:

- FFC_908
- FFC_C33
- FFC_C36

110-921

Explanation: The system halted while diagnostics were executing.

Failing Item:

- FFC_921
- FFC_812

110-922

Explanation: The system halted while diagnostics were executing.

Failing Item:

- FFC_922
- FFC_812

110-923

Explanation: The system halted while diagnostics were executing.

Failing Item:

- FFC_923
- FFC_812

110-924

Explanation: The system halted while diagnostics were executing.

Failing Item:

- FFC_924
- FFC_812

110-925

Explanation: The system halted while diagnostics were executing.

Failing Item:

- FFC_925
- FFC_812

110-926

Explanation: The system halted while diagnostics were executing.

Failing Item:

- FFC_926
- FFC_812

110-935

Explanation: The system halted while diagnostics were executing.

Failing Item:

- FFC_935
- FFC_812

110-946

Explanation: The system halted while diagnostics were executing.

Failing Item:

- FFC_946
- FFC_221

111-107

Explanation: A machine check occurred.

Response: Go to MAP0020 Problem determination procedure.

111-108

Explanation: An encoded SRN was displayed.

Response: Go to MAP0020 Problem determination procedure.

111-121

Explanation: There is a display problem. Action: Do problem determination on the display.

111-259

Explanation: Cannot display readable information on the terminal.

Response: Go to MAP0280 : Console and Keyboard Problem Resolution Entry 3.

111-725

Explanation: Cannot display readable information on the display.

Response: Go to MAP0280 : Console and Keyboard Problem Resolution. Note: Suspect the display adapter attached to the console display.

Failing Item:

- FFC_725

111-736

Explanation: The keyboard does not respond.

Response: Go to MAP0280 : Console and Keyboard Problem Resolution Entry 1.

Failing Item:

- FFC_736
- FFC_821

111-78C

Explanation: I/O bus problem.

Problem determination: PCI adapter refers to the adapters you made note of when using Console and keyboard problem resolution.

Failing Item:

- PCI_ADAPTER
- FFC_227
- FFC_E10

111-82C

Explanation: Cannot display readable information on the display.

Response: Go to MAP0280 : Console and Keyboard Problem Resolution Entry 2.

111-921

Explanation: The keyboard does not respond.

Response: Go to MAP0280 : Console and Keyboard Problem Resolution Entry 1.

Failing Item:

- FFC_921
- FFC_821

111-922

Explanation: The keyboard does not respond.

Response: Go to MAP0280 : Console and Keyboard Problem Resolution Entry 1.

Failing Item:

- FFC_922
- FFC_821

111-923

Explanation: The keyboard does not respond.

Response: Go to MAP0280 : Console and Keyboard Problem Resolution Entry 1.

Failing Item:

- FFC_923
- FFC_821

111-947

Explanation: System beeper not functioning correctly.

Failing Item:

- FFC_221

111-999

Explanation: System does not perform a soft reset.

Failing Item:

- FFC_210

199-102

Explanation: A critical failure has occurred on an undefined element.

Response: Go to MAP2010 : I/O enclosure problem determination. This MAP is located in "Common service procedures " chapter of the " *Service Guide for the 5786, 5787, 7031-D24, and 7031-T24* ", order number SA76-0118-xx

Failing Item:

- FFC_199

199-103

Explanation: Non-critical failure has occurred on an undefined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_199

199-104

Explanation: An unrecoverable failure has occurred on an undefined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_199

199-122

Explanation: A critical power supply failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_152

199-123

Explanation: A non-critical power supply failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_152

199-124

Explanation: An unrecoverable power supply failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_152

199-132

Explanation: A critical fan failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_166
- FFC_199

199-133

Explanation: A non-critical fan failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_166

- FFC_199

199-134

Explanation: An unrecoverable fan failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_166
- FFC_199

199-148

Explanation: The enclosure indicates a temperature threshold warning.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_166
- FFC_199

199-149

Explanation: The enclosure indicates a temperature threshold failure.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_166
- FFC_199

199-152

Explanation: A critical repeater card failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_199

199-153

Explanation: A non-critical repeater card failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_199

199-154

Explanation: An unrecoverable repeater card failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_199

199-162

Explanation: A critical VPD module failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_199

199-163

Explanation: A non-critical VPD module failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_199

199-164

Explanation: An unrecoverable VPD module failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_199

199-172

Explanation: A critical enclosure services failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_199

199-173

Explanation: A non-critical enclosure services failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

199-174 • 199-204

- FFC_199
-

199-174

Explanation: An unrecoverable enclosure services failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_199
-

199-182

Explanation: A critical failure has occurred on a user defined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_199
-

199-183

Explanation: A non-critical failure has occurred on a user defined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_199
-

199-184

Explanation: An unrecoverable failure has occurred on a user defined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_199
-

199-192

Explanation: A critical failure has occurred on a user defined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_199
-

199-193

Explanation: A non-critical failure has occurred on a user defined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_199
-

199-194

Explanation: An unrecoverable failure has occurred on a user defined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_199
-

199-201

Explanation: Device configuration error.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_199
 - FFC_891
-

199-202

Explanation: The enclosure failed to open.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_199
 - FFC_891
-

199-203

Explanation: The enclosure failed to return inquiry data.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_199
 - FFC_891
-

199-204

Explanation: There is a critical power supply or fan failure.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_152
 - FFC_166
-

199-205

Explanation: There is a redundant power supply or fan failure.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_152
 - FFC_166
-

101-2004

Explanation: Maximum memory size of partition is too large with respect to the current partition memory size.

Response: Specify a maximum memory size for the partition no larger than 64 times the starting memory size of the partition.

101-2020

Explanation: The system hung while trying to configure the InfiniBand communication manager. This problem may be attributed to software.

Response: Report this problem to the AIX support center.

101-2021

Explanation: The system hung while trying to configure the InfiniB and TCP/IP interface. This problem may be attributed to software.

Response: Report this problem to the AIX support center.

101-XXXX

Explanation: The system hung while configuring a resource. The last three or four digits after the dash (-) identify the failing function code for the resource being configured.

Response: Go to MAP0260 : System hangs during resource configuration.

Failing Item:

- FFC_XXXX
 - FFC_E10
-

110-XXXX

Explanation: The system halted while diagnostics were executing.

Problem determination: xxxx corresponds to the last three or four digits of the SRN following the dash (-). If your 110 SRN is not listed, substitute the last three or four digits of the SRN for xxxx, then proceed to the

FFC table using the substituted digits as your FFC.

Failing Item:

- FFC_221
-

20PAA

Explanation: An open SSA loop was detected.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive and the User's Guide and Maintenance Information for the SSA adapter. Note:

P denotes the adapter port number.

AA denotes the SSA address.

21PAA

Explanation: An SSA Threshold Exceeded link error was detected.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter. Note:

P denotes the adapter port number.

AA denotes the SSA address.

22PAA

Explanation: An SSA Threshold Exceeded link error was detected.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter. Note:

P denotes the adapter port number.

AA denotes the SSA address.

23PAA

Explanation: An SSA Threshold Exceeded link error was detected.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter. Note:

P denotes the adapter port number.

AA denotes the SSA address.

24PAA

Explanation: An SSA Threshold Exceeded link error was detected.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter. Note:

P denotes the adapter port number.

25PAA • 2504-720

AA denotes the SSA address.

25PAA

Explanation: An SSA Threshold Exceeded link error was detected.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.
Note:

P denotes the adapter port number.

AA denotes the SSA address.

2502-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2502
-

2502-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2502
-

2502-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2502
-

2502-720

Explanation: Controller device bus configuration error.

Response: Use MAP3150.

2503-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2503
-

2503-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2503
-

2503-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2503
-

2503-720

Explanation: Controller device bus configuration error.

Response: Use MAP3150.

2504-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2504
-

2504-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2504
-

2504-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2504
-

2504-720

Explanation: Controller device bus configuration error.

Response: Use MAP3150.

2505-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2505
-

2505-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2505
-

2505-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2505
-

2505-720

Explanation: Controller device bus configuration error.

Response: Use MAP3150.

2508-301

Explanation: Error Log Analysis indicates that this adapter has failed due to a reset failure.

Response: Use MAP0210 : General problem resolution

Failing Item:

- FFC_2508
 - FFC_221
-

2508-302

Explanation: EEH error.

Response: Use MAP0210 : General problem resolution

Failing Item:

- FFC_2508
 - FFC_221
-

2508-303

Explanation: Adapter configuration error.

Response: Use MAP0210 : General problem resolution

Failing Item:

- FFC_2508
 - FFC_221
-

2508-304

Explanation: Error Log Analysis indicates that this adapter has failed due to a hardware error.

Response: Use MAP0210 : General problem resolution

Failing Item:

- FFC_2508
 - FFC_221
-

2512-710

Explanation: Permanent adapter failure.

Failing Item:

- FFC_2512
-

2512-711

Explanation: Adapter failure.

Failing Item:

- FFC_2512
-

2512-712

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

Failing Item:

- FFC_2512
-

2512-713

Explanation: Adapter failure.

Failing Item:

- FFC_2512
-

2512-714

Explanation: Temporary adapter failure.

Failing Item:

- FFC_2512
-

2512-715

Explanation: Temporary adapter failure.

Failing Item:

- FFC_2512
-

2512-716

Explanation: PCI bus error detected by EEH.

Failing Item:

- FFC_2512
 - FFC_293
-

2512-717

Explanation: PCI bus error detected by adapter.

Failing Item:

- FFC_2512
 - FFC_293
-

2512-718

Explanation: Temporary PCI bus error detected by adapter

Failing Item:

- FFC_2512
 - FFC_293
-

2512-719

Explanation: Device bus termination power lost or not detected

Response: Use MAP3150.

2512-720

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

2512-721

Explanation: Temporary adapter detected device bus failure.

Response: Use MAP3150.

2512-722

Explanation: Device bus interface problem.

Failing Item:

- FFC_2512
-

2512-723

Explanation: Device bus interface problem.

Response: Use MAP0054.

2512-724

Explanation: Temporary device bus interface problem.

Failing Item:

- FFC_2512
-

2512-725

Explanation: Temporary device bus interface problem.

Response: Use MAP0054.

2513-101

Explanation: Adapter configuration error.

Failing Item:

- FFC_2513
-

2513-710

Explanation: Permanent adapter failure.

Failing Item:

- FFC_2513
-

2513-711

Explanation: Adapter failure.

Failing Item:

- FFC_2513
-

2513-712

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

Failing Item:

- FFC_2513
-

2513-713

Explanation: Adapter failure.

Failing Item:

- FFC_2513
-

2513-714

Explanation: Temporary adapter failure.

Failing Item:

- FFC_2513
-

2513-715

Explanation: Temporary adapter failure.

Failing Item:

- FFC_2513

2513-716

Explanation: PCI bus error detected by EEH.

Failing Item:

- FFC_2513
 - FFC_293
-

2513-717

Explanation: PCI bus error detected by adapter.

Failing Item:

- FFC_2513
 - FFC_293
-

2513-718

Explanation: Temporary PCI bus error detected by adapter

Failing Item:

- FFC_2513
 - FFC_293
-

2513-719

Explanation: Device bus termination power lost or not detected

Response: Use MAP3150.

2513-720

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

2513-721

Explanation: Temporary adapter detected device bus failure.

Response: Use MAP3150.

2513-722

Explanation: Device bus interface problem.

Failing Item:

- FFC_2513
-

2513-723

Explanation: Device bus interface problem.

Response: Use MAP0054.

2513-724

Explanation: Temporary device bus interface problem.

Failing Item:

- FFC_2513
-

2513-725

Explanation: Temporary device bus interface problem.

Response: Use MAP0054.

2514-101

Explanation: Adapter configuration error.

Failing Item:

- FFC_2514
-

2514-710

Explanation: Permanent adapter failure.

Failing Item:

- FFC_2514
-

2514-711

Explanation: Adapter failure.

Failing Item:

- FFC_2514
-

2514-712

Explanation: Adapter device bus configuration error.

Response: Use MAP0050.

Failing Item:

- FFC_2514
-

2514-713

Explanation: Adapter failure.

Failing Item:

- FFC_2514
-

2514-714

Explanation: Temporary adapter failure.

Failing Item:

- FFC_2514
-

2514-715

Explanation: Temporary adapter failure.

Failing Item:

- FFC_2514
-

2514-716

Explanation: PCI bus error detected by EEH.

Failing Item:

- FFC_2514
- FFC_293

2514-717

Explanation: PCI bus error detected by adapter.

Failing Item:

- FFC_2514
- FFC_293

2514-718

Explanation: Temporary PCI bus error detected by adapter

Failing Item:

- FFC_2514
- FFC_293

2514-719

Explanation: Device bus termination power lost or not detected

Response: Use MAP3150.

2514-720

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

2514-721

Explanation: Temporary adapter detected device bus failure.

Response: Use MAP3150.

2514-722

Explanation: Device bus interface problem.

Failing Item:

- FFC_2514

2514-723

Explanation: Device bus interface problem.

Response: Use MAP0054.

2514-724

Explanation: Temporary device bus interface problem.

Failing Item:

- FFC_2514

2514-725

Explanation: Temporary device bus interface problem.

Response: Use MAP0054.

2515-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2515

2515-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2515

2515-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2515

2515-720

Explanation: Controller device bus configuration error.

Response: Use MAP3150.

2516-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2516
-

2516-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2516
-

2516-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2516
-

2516-720

Explanation: Controller device bus configuration error.

Response: Use MAP3150.

2517-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2517
-

2517-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2517
-

2517-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2517
-

2517-720

Explanation: Controller device bus configuration error.

Response: Use MAP3150.

2518-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2518
-

2518-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2518
-

2518-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2518
-

2518-720

Explanation: Controller device bus configuration error.

Response: Use MAP3150.

2519-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2519
-

2519-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2519
-

2519-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2519

2519-720

Explanation: Controller device bus configuration error.

Response: Use MAP3150.

251D-101

Explanation: Adapter configuration error.

Response: Use MAP0210.

Failing Item:

- FFC_251D
-

251D-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_251D
-

251D-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_251D
-

251D-720

Explanation: Controller device bus configuration error.

Response: Use MAP3150.

2520-101

Explanation: Enhanced error handling failure on the bus.

Failing Item:

- FFC_221
-

2520-102

Explanation: Enhanced error handling failure on a PCI-PCI Bridge.

Failing Item:

- FFC_293
-

2520-103

Explanation: Enhanced error handling failure on the adapter.

Failing Item:

- FFC_2520
-

- FFC_221
-

2520-212

Explanation: FIFO empty bit set.

Failing Item:

- FFC_2520
-

2520-213

Explanation: FIFO empty bit clear.

Failing Item:

- FFC_2520
-

2520-214

Explanation: FIFO full bit set.

Failing Item:

- FFC_2520
-

2520-215

Explanation: FIFO full bit clear.

Failing Item:

- FFC_2520
-

2520-216

Explanation: FIFO data miscompare.

Failing Item:

- FFC_2520
-

2520-217

Explanation: SCSI FIFO data miscompare.

Failing Item:

- FFC_2520
-

2520-218

Explanation: SCSI FIFO underflow.

Failing Item:

- FFC_2520
-

2520-219

Explanation: SCSI parity error.

Response: Go to MAP0050 : SCSI Bus Problems.

2520-220

Explanation: SCSI FIFO flags error.

Failing Item:

- FFC_2520
-

2520-221

Explanation: Mismatch during the write/read of configuration register.

Failing Item:

- FFC_2520
 - FFC_293
-

2520-222

Explanation: Error during the write/read of the memory register.

Failing Item:

- FFC_2520
-

2520-223

Explanation: Mismatch during the write/read of the memory I/O register.

2520-224

Explanation: SCSI configuration read or write error.

Failing Item:

- FFC_2520
 - FFC_221
-

2520-226

Explanation: SCSI wrap or PTC error.

Failing Item:

- FFC_2520
-

2520-227

Explanation: SCSI adapter interrupt test failure.

Failing Item:

- FFC_2520
 - FFC_221
-

2520-230

Explanation: Arbitration test failed.

Response: Go to MAP0050 : SCSI Bus Problems.

2520-231

Explanation: Function could not complete.

Response: Go to MAP0050 : SCSI Bus Problems.

2520-232

Explanation: SCSI bus data mismatch.

Response: Go to MAP0050 : SCSI Bus Problems.

2520-240

Explanation: No terminal power.

Response: Go to MAP0050 : SCSI Bus Problems.

2520-242

Explanation: SCSI bus error.

Response: Go to MAP0050 : SCSI Bus Problems.

2520-301

Explanation: Configuration open failed for parent bus.

Failing Item:

- FFC_2520
 - FFC_221
-

2520-801

Explanation: Error Log Analysis indicates a terminator problem.

Response: Run diagnostic on the adapter in System Verification Mode. If an SRN is reported, use the SRN to resolve the problem. If a SRN is not reported, use the SCSI service hints to resolve the problem.

2520-802

Explanation: Error Log Analysis indicates that multiple attempts to reset the SCSI bus have timed out.

Response: Run diagnostic on the adapter in System Verification Mode. If an SRN is reported, use the SRN to resolve the problem. If a SRN is not reported, use the SCSI service hints to resolve the problem.

2520-803

Explanation: Error Log Analysis indicates that multiple SCSI bus errors have occurred.

Response: Run diagnostic on the adapter and the devices in System Verification Mode. If an SRN is reported, use the SRN to resolve the problem. If a SRN is not reported, use the SCSI service hints to resolve the problem.

2521-101

Explanation: Enhanced error handling failure on the bus.

Failing Item:

- FFC_221
-

2521-102

Explanation: Enhanced error handling failure on a PCI-PCI Bridge.

Failing Item:

- FFC_293
-

2521-103

Explanation: Enhanced error handling failure on the adapter.

Failing Item:

- FFC_2521
 - FFC_221
-

2521-227

Explanation: SCSI adapter test failure.

Failing Item:

- FFC_2521
 - FFC_221
-

2521-701

Explanation: Error log analysis indicates a PCI SCSI adapter failure.

Failing Item:

- FFC_2521
-

2521-801

Explanation: Error Log Analysis indicates a terminator problem.

Response: Run diagnostic on the adapter in System Verification Mode. If an SRN is reported, use the SRN to resolve the problem. If a SRN is not reported, use the SCSI service hints to resolve the problem.

2521-802

Explanation: Error Log Analysis indicates that multiple attempts to reset the SCSI bus have timed out.

Response: Run diagnostic on the adapter in System Verification Mode. If an SRN is reported, use the SRN to resolve the problem. If a SRN is not reported, use the SCSI service hints to resolve the problem.

2521-803

Explanation: Error Log Analysis indicates that multiple SCSI bus errors have occurred.

Response: Run diagnostic on the adapter and the devices in System Verification Mode. If an SRN is reported, use the SRN to resolve the problem. If a SRN is not reported, use the SCSI service hints to resolve the problem.

2522-101

Explanation: Adapter configuration error.

Failing Item:

- FFC_2522
-

2522-710

Explanation: Permanent adapter failure.

Failing Item:

- FFC_2522
-

2522-711

Explanation: Adapter failure.

Failing Item:

- FFC_2522
-

2522-712

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

Failing Item:

- FFC_2522
-

2522-713

Explanation: Adapter failure.

Failing Item:

- FFC_2522
-

2522-714

Explanation: Temporary adapter failure.

Failing Item:

- FFC_2522
-

2522-715

Explanation: Temporary adapter failure.

Failing Item:

- FFC_2522
-

2522-716**Explanation:** PCI bus error detected by EEH.**Failing Item:**

- FFC_2522
 - FFC_293
-

2522-717**Explanation:** PCI bus error detected by adapter.**Failing Item:**

- FFC_2522
 - FFC_293
-

2522-718**Explanation:** Temporary PCI bus error detected by adapter**Failing Item:**

- FFC_2522
 - FFC_293
-

2522-719**Explanation:** Device bus termination power lost or not detected**Response:** Use MAP3150.

2522-720**Explanation:** Adapter device bus configuration error.**Response:** Use MAP3150.

2522-721**Explanation:** Temporary adapter detected device bus failure.**Response:** Use MAP3150.

2522-722**Explanation:** Device bus interface problem.**Failing Item:**

- FFC_2522
-

2522-723**Explanation:** Device bus interface problem.**Response:** Use MAP0054.

2522-724**Explanation:** Temporary device bus interface problem.**Failing Item:**

- FFC_2522
-

2522-725**Explanation:** Temporary device bus interface problem.**Response:** Use MAP0054.

2523-101**Explanation:** Adapter configuration error.**Failing Item:**

- FFC_2523
-

2523-710**Explanation:** Permanent adapter failure.**Failing Item:**

- FFC_2523
-

2523-711**Explanation:** Adapter failure.**Failing Item:**

- FFC_2523
-

2523-712**Explanation:** Adapter device bus configuration error.**Response:** Use MAP3150.**Failing Item:**

- FFC_2523
-

2523-713**Explanation:** Adapter failure.**Failing Item:**

- FFC_2523
-

2523-714**Explanation:** Temporary adapter failure.**Failing Item:**

- FFC_2523
-

2523-715**Explanation:** Temporary adapter failure.**Failing Item:**

- FFC_2523
-

2523-716

Explanation: PCI bus error detected by EEH.

Failing Item:

- FFC_2523
- FFC_293

2523-717

Explanation: PCI bus error detected by adapter.

Failing Item:

- FFC_2523
- FFC_293

2523-718

Explanation: Temporary PCI bus error detected by adapter

Failing Item:

- FFC_2523
- FFC_293

2523-719

Explanation: Device bus termination power lost or not detected

Response: Use MAP3150.

2523-720

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

2523-721

Explanation: Temporary adapter detected device bus failure.

Response: Use MAP3150.

2523-722

Explanation: Device bus interface problem.

Failing Item:

- FFC_2523

2523-723

Explanation: Device bus interface problem.

Response: Use MAP0054.

2523-724

Explanation: Temporary device bus interface problem.

Failing Item:

- FFC_2523

2523-725

Explanation: Temporary device bus interface problem.

Response: Use MAP0054.

2524-101

Explanation: Adapter configuration error.

Failing Item:

- FFC_2524

2524-701

Explanation: Error Log Analysis indicates adapter hardware error.

Failing Item:

- FFC_2524

2524-702

Explanation: Error Log Analysis indicates SCSI device error.

Response: Use MAP0050 : SCSI Bus Problems.

2524-703

Explanation: Error Log Analysis indicates hardware system error due to EEH reset problem.

Failing Item:

- FFC_2524
- FFC_221

2524-704

Explanation: Error Log Analysis indicates hardware system error from EEH event.

Failing Item:

- FFC_2524
- FFC_221

2524-705

Explanation: Error Log Analysis indicates PCI bus error.

Failing Item:

- FFC_2524
- FFC_221

2524-706

Explanation: Error Log Analysis indicates adapter hardware error.

Failing Item:

- FFC_2524
-

2524-707

Explanation: Error Log Analysis indicates PCI bus error.

Failing Item:

- FFC_2524
 - FFC_221
-

2524-708

Explanation: Error Log Analysis indicates adapter register timeout error.

Failing Item:

- FFC_2524
-

2527-101

Explanation: Adapter configuration error.

Failing Item:

- FFC_2527
-

2527-710

Explanation: Permanent adapter failure.

Failing Item:

- FFC_2527
-

2527-711

Explanation: Adapter failure.

Failing Item:

- FFC_2527
-

2527-712

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

Failing Item:

- FFC_2527
-

2527-713

Explanation: Adapter failure.

Failing Item:

- FFC_2527
-

2527-714

Explanation: Temporary adapter failure.

Failing Item:

- FFC_2527
-

2527-715

Explanation: Temporary adapter failure.

Failing Item:

- FFC_2527
-

2527-716

Explanation: PCI bus error detected by EEH.

Failing Item:

- FFC_2527
 - FFC_293
-

2527-717

Explanation: PCI bus error detected by adapter.

Failing Item:

- FFC_2527
 - FFC_293
-

2527-718

Explanation: Temporary PCI bus error detected by adapter

Failing Item:

- FFC_2527
 - FFC_293
-

2527-719

Explanation: Device bus termination power lost or not detected

Response: Use MAP3150.

2527-720

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

2527-721

Explanation: Temporary adapter detected device bus failure.

Response: Use MAP3150.

2527-722

Explanation: Device bus interface problem.

Failing Item:

- FFC_2527
-

2527-723

Explanation: Device bus interface problem.

Response: Use MAP0054.

2527-724

Explanation: Temporary device bus interface problem.

Failing Item:

- FFC_2527
-

2527-725

Explanation: Temporary device bus interface problem.

Response: Use MAP0054..

2528-101

Explanation: Adapter configuration error.

Failing Item:

- FFC_2528
-

2528-710

Explanation: Permanent adapter failure.

Failing Item:

- FFC_2528
-

2528-711

Explanation: Adapter failure.

Failing Item:

- FFC_2528
-

2528-712

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

Failing Item:

- FFC_2528
-

2528-713

Explanation: Adapter failure.

Failing Item:

- FFC_2528
-

2528-714

Explanation: Temporary adapter failure.

Failing Item:

- FFC_2528
-

2528-715

Explanation: Temporary adapter failure.

Failing Item:

- FFC_2528
-

2528-716

Explanation: PCI bus error detected by EEH.

Failing Item:

- FFC_2528
 - FFC_293
-

2528-717

Explanation: PCI bus error detected by adapter.

Failing Item:

- FFC_2528
 - FFC_293
-

2528-718

Explanation: Temporary PCI bus error detected by adapter

Failing Item:

- FFC_2528
 - FFC_293
-

2528-719

Explanation: Device bus termination power lost or not detected

Response: Use MAP3150.

2528-720

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

2528-721

Explanation: Temporary adapter detected device bus failure.

Response: Use MAP3150.

2528-722**Explanation:** Device bus interface problem.**Failing Item:**

- FFC_2528
-

2528-723**Explanation:** Device bus interface problem.**Response:** Use MAP0054.

2528-724**Explanation:** Temporary device bus interface problem.**Failing Item:**

- FFC_2528
-

2528-725**Explanation:** Temporary device bus interface problem.**Response:** Use MAP0054.

2529-101**Explanation:** Adapter configuration error.**Failing Item:**

- FFC_2529
-

2529-710**Explanation:** Permanent adapter failure.**Failing Item:**

- FFC_2529
-

2529-711**Explanation:** Adapter failure.**Failing Item:**

- FFC_2529
-

2529-712**Explanation:** Adapter device bus configuration error.**Response:** Use MAP3150.**Failing Item:**

- FFC_2529
-

2529-713**Explanation:** Adapter failure.**Failing Item:**

- FFC_2529
-

2529-714**Explanation:** Temporary adapter failure.**Failing Item:**

- FFC_2529
-

2529-715**Explanation:** Temporary adapter failure.**Failing Item:**

- FFC_2529
-

2529-716**Explanation:** PCI bus error detected by EEH.**Failing Item:**

- FFC_2529
 - FFC_293
-

2529-717**Explanation:** PCI bus error detected by adapter.**Failing Item:**

- FFC_2529
 - FFC_293
-

2529-718**Explanation:** Temporary PCI bus error detected by adapter**Failing Item:**

- FFC_2529
 - FFC_293
-

2529-719**Explanation:** Device bus termination power lost or not detected**Response:** Use MAP3150.

2529-720**Explanation:** Adapter device bus configuration error.**Response:** Use MAP3150.

2529-721**Explanation:** Temporary adapter detected device bus failure.**Response:** Use MAP3150.

2529-722

Explanation: Device bus interface problem.

Failing Item:

- FFC_2529

2529-723

Explanation: Device bus interface problem.

Response: Use MAP0054.

2529-724

Explanation: Temporary device bus interface problem.

Failing Item:

- FFC_2529

2529-725

Explanation: Temporary device bus interface problem.

Response: Use MAP0054.

252B-101

Explanation: Adapter configuration error.

Failing Item:

- FFC_252B

252B-710

Explanation: Permanent adapter failure.

Failing Item:

- FFC_252B

252B-711

Explanation: Adapter failure.

Failing Item:

- FFC_252B

252B-712

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

Failing Item:

- FFC_252B

252B-713

Explanation: Adapter failure.

Failing Item:

- FFC_252B

252B-714

Explanation: Temporary adapter failure.

Failing Item:

- FFC_252B

252B-715

Explanation: Temporary adapter failure.

Failing Item:

- FFC_252B

252B-716

Explanation: PCI bus error detected by EEH.

Failing Item:

- FFC_252B
- FFC_293

252B-717

Explanation: PCI bus error detected by adapter.

Failing Item:

- FFC_252B
- FFC_293

252B-718

Explanation: Temporary PCI bus error detected by adapter

Failing Item:

- FFC_252B
- FFC_293

252B-719

Explanation: Device bus termination power lost or not detected

Response: Use MAP3150.

252B-720

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

252B-721

Explanation: Temporary adapter detected device bus failure.

Response: Use MAP3150.

252B-722**Explanation:** Device bus interface problem.**Failing Item:**

- FFC_252B
-

252B-723**Explanation:** Device bus interface problem.**Response:** Use MAP0054.

252B-724**Explanation:** Temporary device bus interface problem.**Failing Item:**

- FFC_252B
-

252B-725**Explanation:** Temporary device bus interface problem.**Response:** Use MAP0054.

252D-101**Explanation:** Adapter configuration error.**Failing Item:**

- FFC_252D
-

252D-710**Explanation:** Permanent adapter failure.**Failing Item:**

- FFC_252D
-

252D-711**Explanation:** Adapter failure.**Failing Item:**

- FFC_252D
-

252D-712**Explanation:** Adapter device bus configuration error.**Response:** Use MAP3150.**Failing Item:**

- FFC_252D
-

252D-713**Explanation:** Adapter failure.**Failing Item:**

- FFC_252D
-

252D-714**Explanation:** Temporary adapter failure.**Failing Item:**

- FFC_252D
-

252D-715**Explanation:** Temporary adapter failure.**Failing Item:**

- FFC_252D
-

252D-716**Explanation:** PCI bus error detected by EEH.**Failing Item:**

- FFC_252D
 - FFC_293
-

252D-717**Explanation:** PCI bus error detected by adapter.**Failing Item:**

- FFC_252D
 - FFC_293
-

252D-718**Explanation:** Temporary PCI bus error detected by adapter**Failing Item:**

- FFC_252D
 - FFC_293
-

252D-719**Explanation:** Device bus termination power lost or not detected**Response:** Use MAP3150.

252D-720**Explanation:** Adapter device bus configuration error.**Response:** Use MAP3150.

252D-721**Explanation:** Temporary adapter detected device bus failure.**Response:** Use MAP3150.

252D-722

Explanation: Device bus interface problem.

Failing Item:

- FFC_252D

252D-723

Explanation: Device bus interface problem.

Response: Use MAP0054.

252D-724

Explanation: Temporary device bus interface problem.

Failing Item:

- FFC_252D

252D-725

Explanation: Temporary device bus interface problem.

Response: Use MAP0054.

252E-101

Explanation: Adapter configuration error.

Failing Item:

- FFC_252E

252E-710

Explanation: Permanent adapter failure.

Failing Item:

- FFC_252E

252E-711

Explanation: Adapter failure.

Failing Item:

- FFC_252E

252E-712

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

Failing Item:

- FFC_252E

252E-713

Explanation: Adapter failure.

Failing Item:

- FFC_252E

252E-714

Explanation: Temporary adapter failure.

Failing Item:

- FFC_252E

252E-715

Explanation: Temporary adapter failure.

Failing Item:

- FFC_252E

252E-716

Explanation: PCI bus error detected by EEH.

Failing Item:

- FFC_252E

- FFC_293

252E-717

Explanation: PCI bus error detected by adapter.

Failing Item:

- FFC_252E

- FFC_293

252E-718

Explanation: Temporary PCI bus error detected by adapter

Failing Item:

- FFC_252E

- FFC_293

252E-719

Explanation: Device bus termination power lost or not detected

Response: Use MAP3150.

252E-720

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

252E-721

Explanation: Temporary adapter detected device bus failure.

Response: Use MAP3150.

252E-722

Explanation: Device bus interface problem.

Failing Item:

- FFC_252E
-

252E-723

Explanation: Device bus interface problem.

Response: Use MAP0054.

252E-724

Explanation: Temporary device bus interface problem.

Failing Item:

- FFC_252E
-

252E-725

Explanation: Temporary device bus interface problem.

Response: Use MAP0054.

2530-101

Explanation: Enhanced Error Handling failure on bus.

Failing Item:

- FFC_221
-

2530-102

Explanation: Enhanced Error Handling logic failure.

Failing Item:

- FFC_221
-

2530-103

Explanation: Enhanced Error Handling failure on adapter.

Failing Item:

- FFC_2530
-

2530-104

Explanation: Port command test failure.

Failing Item:

- FFC_2530
-

2530-105

Explanation: CU command test failure.

Failing Item:

- FFC_2530
-

2530-106

Explanation: External wrap test failure.

Failing Item:

- FFC_2530
-

2530-107

Explanation: A non-critical error occurred.

Response: Replace the adapter during scheduled maintenance. An encryption authentication problem has been detected.

Failing Item:

- FFC_2530
-

2530-201

Explanation: EEPROM test failure.

Failing Item:

- FFC_2530
 - FFC_221
-

2530-202

Explanation: Internal wrap test failure.

Failing Item:

- FFC_2530
 - FFC_221
-

2530-701

Explanation: Error log analysis indicates that this device has failed to initialize due to a self-test failure.

Failing Item:

- FFC_2530
-

2530-702

Explanation: Error log analysis indicates that this device has failed to initialize due to an EEH hardware error.

Failing Item:

- FFC_2530
-

2530-703

Explanation: Error log analysis indicates that this device has failed to initialize due to a problem with the EEPROM on the adapter.

Failing Item:

- FFC_2530
-

2530-704

Explanation: Error log analysis indicates that this device has failed to initialize due to EEH errors.

Failing Item:

- FFC_2530
- FFC_221

2531-101

Explanation: VPD test failure

Failing Item:

- FFC_2531

2531-102

Explanation: Flash ROM test

Failing Item:

- FFC_2531

2531-103

Explanation: Internal wrap test failure

Failing Item:

- FFC_2531

2531-104

Explanation: External wrap test failure.

Failing Item:

- FFC_2531

2531-105

Explanation: External wrap test with checksum IP offload failure.

Failing Item:

- FFC_2531

2531-106

Explanation: External wrap test with checksum TCP offload failure.

Failing Item:

- FFC_2531

2531-201

Explanation: Registers test failure

Failing Item:

- FFC_2531
- FFC_221

2531-202

Explanation: Enhanced Error Handling Failure while testing adapter

Failing Item:

- FFC_2531
- FFC_221

2531-203

Explanation: Enhanced Error Handling Failure on bus

Failing Item:

- FFC_2531
- FFC_221

2531-204

Explanation: Link test failure, Wrap test ok

Failing Item:

- CABLE
- NETWORK

2531-301

Explanation: Link test failure without wrap test

Failing Item:

- FFC_2531
- CABLE
- NETWORK

2531-701

Explanation: Failure to initialize due to a self-test failure

Failing Item:

- FFC_2531

2531-702

Explanation: Failure to initialize due to a problem while reading the EEPROM on the adapter

Failing Item:

- FFC_2531

2531-703

Explanation: Transmit error due to timeout.

Failing Item:

- FFC_2531
-

2532-101**Explanation:** VPD test failure**Failing Item:**

- FFC_2532
-

2532-102**Explanation:** Flash ROM test**Failing Item:**

- FFC_2532
-

2532-103**Explanation:** Internal wrap test failure**Failing Item:**

- FFC_2532
-

2532-104**Explanation:** External wrap test failure**Failing Item:**

- FFC_2532
-

2532-105**Explanation:** External wrap test with checksum IP offload failure**Failing Item:**

- FFC_2532
-

2532-106**Explanation:** External wrap test with checksum TCP offload failure**Failing Item:**

- FFC_2532
-

2532-201**Explanation:** Registers test failure**Failing Item:**

- FFC_2532
 - FFC_221
-

2532-202**Explanation:** Enhanced Error Handling Failure while testing adapter**Failing Item:**

- FFC_2532
 - FFC_221
-

2532-203**Explanation:** Enhanced Error Handling Failure on bus**Failing Item:**

- FFC_2532
 - FFC_221
-

2532-204**Explanation:** Link test failure, Wrap test ok**Failing Item:**

- CABLE
 - NETWORK
-

2532-301**Explanation:** Link test failure without wrap test**Failing Item:**

- FFC_2532
 - CABLE
 - NETWORK
-

2532-701**Explanation:** Failure to initialize due to a self-test failure.**Failing Item:**

- FFC_2532
-

2532-702**Explanation:** Failure to initialize due to a problem while reading the EEPROM on the adapter.**Failing Item:**

- FFC_2532
-

2532-703**Explanation:** Transmit error due to timeout.**Failing Item:**

- FFC_2532
-

2533-101**Explanation:** Enhanced Error Handling Failure**Failing Item:**

- FFC_2533
-

2533-102**Explanation:** Memory Test Failure**Failing Item:**

- FFC_2533
-

2533-103

Explanation: CA Memory Test Failure

Failing Item:

- FFC_2533
-

2533-104

Explanation: EEPROM Test Failure

Failing Item:

- FFC_2533
-

2533-105

Explanation: Flash ROM Test Failure

Failing Item:

- FFC_2533
-

2533-106

Explanation: Internal Wrap Test Failure

Failing Item:

- FFC_2533
-

2533-107

Explanation: External Wrap Test Failure

Failing Item:

- FFC_2533
-

2533-108

Explanation: External Wrap with IP Checksum Test Failure

Failing Item:

- FFC_2533
-

2533-109

Explanation: External Wrap with UDP Checksum Test Failure

Failing Item:

- FFC_2533
-

2533-110

Explanation: External Wrap with TCP Checksum Test Failure

Failing Item:

- FFC_2533
-

2533-111

Explanation: Network link test failure. (Wrap tests passed. Check ethernet network and cables.)

Failing Item:

- FFC_241
-

2533-201

Explanation: PCI Configuration I/O Test Failure

Failing Item:

- FFC_2533
 - FFC_221
-

2533-202

Explanation: Network link test failure. (Wrap tests not performed.)

Failing Item:

- FFC_241
 - FFC_2533
-

2533-601

Explanation: Error log analysis indicates that this adapter has failed due to a hardware error.

Failing Item:

- FFC_2533
-

2533-602

Explanation: Error log analysis indicates that this adapter has failed due to an EEPROM error.

Failing Item:

- FFC_2533
-

2533-603

Explanation: Error log analysis indicates that this adapter has failed due to transmission errors.

Failing Item:

- FFC_2533
-

2534-101

Explanation: Enhanced Error Handling Failure

Failing Item:

- FFC_2534
-

2534-102

Explanation: Memory Test Failure

Failing Item:

- FFC_2534
-

2534-103

Explanation: CA Memory Test Failure

Failing Item:

- FFC_2534
-

2534-104

Explanation: EEPROM Test Failure

Failing Item:

- FFC_2534
-

2534-105

Explanation: Flash ROM Test Failure

Failing Item:

- FFC_2534
-

2534-106

Explanation: Internal Wrap Test Failure

Failing Item:

- FFC_2534
-

2534-107

Explanation: External Wrap Test Failure

Failing Item:

- FFC_2534
-

2534-108

Explanation: External Wrap with IP Checksum Test Failure

Failing Item:

- FFC_2534
-

2534-109

Explanation: External Wrap with UDP Checksum Test Failure

Failing Item:

- FFC_2534
-

2534-110

Explanation: External Wrap with TCP Checksum Test Failure

Failing Item:

- FFC_2534
-

2534-111

Explanation: Network link test failure. (Wrap tests passed. Check ethernet network and cables.)

Failing Item:

- FFC_241
-

2534-201

Explanation: PCI Configuration I/O Test Failure

Failing Item:

- FFC_2534
 - FFC_221
-

2534-202

Explanation: Network link test failure. (Wrap tests not performed.)

Failing Item:

- FFC_241
 - FFC_2534
-

2534-601

Explanation: Error log analysis indicates that this adapter has failed due to a hardware error.

Failing Item:

- FFC_2534
-

2534-602

Explanation: Error log analysis indicates that this adapter has failed due to an EEPROM error.

Failing Item:

- FFC_2534
-

2534-603

Explanation: Error log analysis indicates that this adapter has failed due to transmission errors.

Failing Item:

- FFC_2534
-

2535-101

Explanation: Enhanced Error Handling Failure on bus.

Failing Item:

- FFC_221
-

2535-103

Explanation: Enhanced Error Handling Failure while testing adapter.

Failing Item:

- FFC_2535
 - FFC_221
-

2535-104

Explanation: Internal wrap test failure (10 Mbps).

Failing Item:

- FFC_2535
-

2535-105

Explanation: Internal wrap test failure (100 Mbps).

Failing Item:

- FFC_2535
-

2535-106

Explanation: Internal wrap test failure (1000 Mbps).

Failing Item:

- FFC_2535
-

2535-107

Explanation: External wrap test failure (10 Mbps).

Failing Item:

- FFC_2535
-

2535-108

Explanation: External wrap test failure (100 Mbps).

Failing Item:

- FFC_2535
-

2535-201

Explanation: Registers test failure.

Failing Item:

- FFC_2535
 - FFC_221
-

2535-701

Explanation: Failure to initialize due to a self-test failure.

Failing Item:

- FFC_2535
-

2535-702

Explanation: Failure to recover from an EEH event.

Failing Item:

- FFC_2535
 - FFC_221
-

2535-703

Explanation: Failure to initialize due to a problem while reading the EEPROM on the adapter.

Failing Item:

- FFC_2535
-

2535-704

Explanation: Device has attempted error recovery.

Failing Item:

- FFC_2535
 - FFC_221
-

2535-705

Explanation: Enhanced Error Handling failure on bus.

Failing Item:

- FFC_25C3
 - FFC_221
-

2537-102

Explanation: Internal wrap test failure (1000 Mbps)

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2537
-

2537-103

Explanation: Internal wrap test failure (100 Mbps)

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2537
-

2537-104**Explanation:** Internal wrap test failure (10 Mbps)**Response:** Use MAP0210 : General problem resolution.**Failing Item:**

- FFC_2537
-

2537-105**Explanation:** External wrap test failure (1000 Mbps)**Response:** Use MAP0210 : General problem resolution.**Failing Item:**

- FFC_2537
-

2537-106**Explanation:** External wrap test failure (100 Mbps)**Response:** Use MAP0210 : General problem resolution.**Failing Item:**

- FFC_2537
-

2537-107**Explanation:** External wrap test failure (10 Mbps)**Response:** Use MAP0210 : General problem resolution.**Failing Item:**

- FFC_2537
-

2537-111**Explanation:** Enhanced Error Handling Failure on bus**Response:** Use MAP0210 : General problem resolution.**Failing Item:**

- FFC_221
-

2537-112**Explanation:** Enhanced error handling failure while testing the adapter.**Response:** Use MAP0210 : General problem resolution.**Failing Item:**

- FFC_2537
 - FFC_221
-

2537-201**Explanation:** Registers test failure.**Response:** Use MAP0210 : General problem resolution.**Failing Item:**

- FFC_2537
-

- FFC_221
-

2537-210**Explanation:** TU 10 interrupt test failure.**Response:** Use MAP0210 : General problem resolution.**Failing Item:**

- FFC_2537
 - FFC_221
-

2537-701**Explanation:** Failure to initialize due to a self-test failure**Response:** Use MAP0210 : General problem resolution.**Failing Item:**

- FFC_2537
-

2537-702**Explanation:** Failure to initialize due to a problem while reading the EEPROM on the adapter**Response:** Use MAP0210 : General problem resolution.**Failing Item:**

- FFC_2537
-

2537-703**Explanation:** EEH service error**Response:** Use MAP0210 : General problem resolution.**Failing Item:**

- FFC_2537
 - FFC_221
-

2538-102**Explanation:** Internal wrap test failure (1000 Mbps)**Response:** Use MAP0210 : General problem resolution.**Failing Item:**

- FFC_2538
-

2538-103**Explanation:** Internal wrap test failure (100 Mbps)**Response:** Use MAP0210 : General problem resolution.**Failing Item:**

- FFC_2538
-

2538-104

Explanation: Internal wrap test failure (10 Mbps)

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2538

2538-105

Explanation: External wrap test failure (1000 Mbps)

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2538

2538-106

Explanation: External wrap test failure (100 Mbps)

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2538

2538-107

Explanation: External wrap test failure (10 Mbps)

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2538

2538-111

Explanation: Enhanced Error Handling Failure on bus

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_221

2538-112

Explanation: Enhanced error handling failure while testing the adapter.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2538
- FFC_221

2538-201

Explanation: Registers test failure.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2538

- FFC_221

2538-210

Explanation: TU 10 interrupt test failure.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2538
- FFC_221

2538-701

Explanation: Failure to initialize due to a self-test failure

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2538

2538-702

Explanation: Failure to initialize due to a problem while reading the EEPROM on the adapter

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2538

2538-703

Explanation: EEH service error

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2538
- FFC_221

254E-201

Explanation: Adapter configuration error.

Failing Item:

- FFC_254E
- FFC_221

254E-601

Explanation: Error log analysis indicates adapter failure.

Failing Item:

- FFC_254E

254E-602

Explanation: Error log analysis indicates an error attention condition.

Failing Item:

- FFC_254E
-

254E-603

Explanation: Error log analysis indicates that the microcode could not be loaded on the adapter.

Failing Item:

- FFC_254E
-

254E-604

Explanation: Error log analysis indicates a permanent adapter failure.

Failing Item:

- FFC_254E
-

254E-605

Explanation: Error log analysis indicates permanent adapter failure is reported on the other port of this adapter.

Failing Item:

- FFC_254E
-

254E-606

Explanation: Error log analysis indicates adapter failure.

Failing Item:

- FFC_254E
-

254E-701

Explanation: Error log analysis indicates permanent adapter failure.

Failing Item:

- FFC_254E
 - FFC_221
-

254E-702

Explanation: Error log analysis indicates permanent adapter failure is reported on the other port of this adapter.

Failing Item:

- FFC_254E
 - FFC_221
-

2550-001

Explanation: Software error.

Failing Item:

- SOFTWARE
-

2550-002

Explanation: Adapter failure.

Failing Item:

- FFC_2550
 - SOFTWARE
-

2550-003

Explanation: Adapter failure.

Failing Item:

- FFC_2550
 - FFC_227
-

2550-004

Explanation: Adapter or display failure.

Failing Item:

- FFC_2550
 - MONITOR
 - CABLE
-

2550-005

Explanation: Adapter or display failure.

Failing Item:

- FFC_2550
 - FFC_227
 - MONITOR
 - CABLE
-

2551-001

Explanation: Software error.

Failing Item:

- SOFTWARE
 - FFC_2551
-

2551-002

Explanation: Adapter failure.

Failing Item:

- FFC_2551
 - SOFTWARE
-

2551-003

Explanation: Adapter failure.

Failing Item:

- FFC_2551
- FFC_227

2551-004

Explanation: Adapter or display failure.

Failing Item:

- FFC_2551
- MONITOR
- CABLE

2551-005

Explanation: Adapter or display failure.

Failing Item:

- FFC_2551
- FFC_227
- MONITOR
- CABLE

2555-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2555

2555-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2555

2555-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2555

2555-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2555

2555-108

Explanation: The bus test failed.

Failing Item:

- FFC_2555

2555-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2555

2555-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2555

2555-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2555

2555-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2555

2555-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2555

2555-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2555
- FFC_B88

2555-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2555

2555-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2555
-

2555-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2555
-

2555-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2555
 - FFC_B88
-

2555-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2555
 - SOFTWARE
-

2555-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2555
 - SOFTWARE
-

2555-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2555
-

2555-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2555
-

2555-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2555-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

2555-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2555
 - FFC_B88
 - SOFTWARE
-

2555-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2555
-

2555-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2555
 - FFC_B88
 - FFC_190
-

2555-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2555
-

2555-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_2555

2555-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2556-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2556

2556-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2556

2556-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2556

2556-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2556

2556-108

Explanation: The bus test failed.

Failing Item:

- FFC_2556

2556-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2556

2556-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2556

2556-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2556

2556-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2556

2556-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2556

2556-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2556
- FFC_B88

2556-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2556

2556-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2556

2556-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2556

2556-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2556
 - FFC_B88
-

2556-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2556
 - SOFTWARE
-

2556-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2556
 - SOFTWARE
-

2556-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2556
-

2556-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2556
-

2556-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2556-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

- SOFTWARE
-

2556-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2556
 - FFC_B88
 - SOFTWARE
-

2556-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2556
-

2556-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2556
 - FFC_B88
 - FFC_190
-

2556-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2556
-

2556-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2556
-

2556-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2557-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2557
-

2557-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2557
-

2557-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2557
-

2557-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2557
-

2557-108

Explanation: The bus test failed.

Failing Item:

- FFC_2557
-

2557-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2557
-

2557-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2557
-

2557-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2557
-

2557-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2557
-

2557-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2557
-

2557-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2557
 - FFC_B88
-

2557-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2557
-

2557-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2557
-

2557-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2557
-

2557-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2557
 - FFC_B88
-

2557-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2557
- SOFTWARE

2557-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2557
 - SOFTWARE
-

2557-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2557
-

2557-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2557
-

2557-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2557-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

2557-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2557
 - FFC_B88
 - SOFTWARE
-

2557-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2557
-

2557-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2557
 - FFC_B88
 - FFC_190
-

2557-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2557
-

2557-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2557
-

2557-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2562-601

Explanation: Error Log Analysis indicates adapter function failure.

Failing Item:

- FFC_2562
-

2564-101

Explanation: Diagnostics indicates adapter configuration failure.

2564-601

Explanation: Error log analysis indicates adapter function failure.

Failing Item:

- FFC_2564
-

2564-602

Explanation: Diagnostics indicates adapter configuration failure.

Failing Item:

- FFC_2564
-

2566-101

Explanation: The diskette-drive selected or deselected failed.

Failing Item:

- FFC_2566
 - FFC_2D02
-

2566-102

Explanation: The diskette-drive selected or deselected failed.

Failing Item:

- FFC_2566
 - FFC_2D02
-

2566-103

Explanation: The diskette failed.

Failing Item:

- FFC_2566
 - FFC_2D02
-

2566-107

Explanation: The diskette failed.

Failing Item:

- FFC_2566
 - FFC_2D02
-

2566-108

Explanation: The diskette read test failed.

Failing Item:

- FFC_2566
-

2566-109

Explanation: The read/write on the diskette drive failed.

Failing Item:

- FFC_2566
 - FFC_2D02
-

2566-110

Explanation: The read/write on the diskette drive failed.

Failing Item:

- FFC_2566
 - FFC_2D02
-

2566-111

Explanation: A diskette drive test failed.

Failing Item:

- FFC_2566
-

2566-114

Explanation: A diskette drive test failed.

Failing Item:

- FFC_2566
-

2566-115

Explanation: The diskette drive test failed.

Failing Item:

- FFC_2566
 - FFC_2D02
-

2566-121

Explanation: The diskette drive test failed.

Failing Item:

- FFC_2566
 - FFC_2D02
-

2566-124

Explanation: Unable to configure the device.

Failing Item:

- FFC_2566
-

2566-125

Explanation: Diagnostics was unable to detect the device.

Failing Item:

- FFC_2566
 - FFC_2D02
-

2566-601

Explanation: ELA detected a non-recoverable Hardware failure on diskette drive.

Failing Item:

- FFC_2566

2566-701

Explanation: ELA detected a Hardware failure on diskette drive.

Failing Item:

- FFC_2566
- FFC_2D02

2566-702

Explanation: ELA detected a communication failure to the diskette drive.

Failing Item:

- FFC_2566
- FFC_2D02

2568-101

Explanation: Unable to open device driver.

Failing Item:

- FFC_2568

2568-201

Explanation: Unable to configure the adapter.

Failing Item:

- FFC_2D02

2568-202

Explanation: Unable to configure the device.

Failing Item:

- FFC_2568
- FFC_2D02
- MEDIA

2568-203

Explanation: Unable to open device driver.

Failing Item:

- FFC_2D02

2568-204

Explanation: The Inquire command failed.

Failing Item:

- MEDIA
- FFC_2568

2568-205

Explanation: The Read Sense Data command failed.

Failing Item:

- FFC_2568
- MEDIA

2568-206

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_2568

2568-207

Explanation: A media error was detected

Response: Try switching out the media. If the problem persists, go to MAP0210 : General problem resolution.

Failing Item:

- MEDIA
- FFC_2568

2568-208

Explanation: The CD-ROM Play Audio command failed.

Failing Item:

- FFC_2568
- MEDIA

2568-209

Explanation: No tone during audio test.

Failing Item:

- FFC_2568

2568-210

Explanation: The Prevent Media Removal or Allow media removal command failed.

Failing Item:

- FFC_2568

2568-211

Explanation: CD-ROM drive indicates an error.

Failing Item:

- FFC_2568
-

2568-212

Explanation: The Write/Read/Compare Test Failed.

Failing Item:

- FFC_2568
- MEDIA

2568-701

Explanation: ELA indicates Drive Hardware failure.

Failing Item:

- FFC_2568

2568-702

Explanation: ELA indicates Drive Hardware failure.

Failing Item:

- FFC_2568

256D-201

Explanation: Adapter configuration error.

Failing Item:

- FFC_256D
- FFC_221

256D-601

Explanation: Error log analysis indicates adapter failure.

Failing Item:

- FFC_256D

256D-602

Explanation: Error log analysis indicates an error attention condition.

Failing Item:

- FFC_256D

256D-603

Explanation: Error log analysis indicates that the microcode could not be loaded on the adapter.

Failing Item:

- FFC_256D

256D-604

Explanation: Error log analysis indicates a permanent adapter failure.

Failing Item:

- FFC_256D

256D-605

Explanation: Error log analysis indicates permanent adapter failure is reported on the other port of this adapter.

Failing Item:

- FFC_256D

256D-606

Explanation: Error log analysis indicates adapter failure.

Failing Item:

- FFC_256D

256D-701

Explanation: Error log analysis indicates permanent adapter failure.

Failing Item:

- FFC_256D
- FFC_221

256D-702

Explanation: Error log analysis indicates permanent adapter failure is reported on the other port of this adapter.

Failing Item:

- FFC_256D
- FFC_221

2570-101

Explanation: DES test failed.

Failing Item:

- FFC_2570

2570-102

Explanation: RSA test failed.

Failing Item:

- FFC_2570

2570-103

Explanation: MAC test failed.

Failing Item:

- FFC_2570

2570-104**Explanation:** DES and SHA test failed.**Failing Item:**

- FFC_2570
-

2570-105**Explanation:** DES to SHA test failed.**Failing Item:**

- FFC_2570
-

2570-106**Explanation:** Enhanced Error Handling Circuitry failure.**Failing Item:**

- FFC_221
-

2570-107**Explanation:** Enhanced Error Handling failure on bus.**Failing Item:**

- FFC_221
-

2570-108**Explanation:** Enhanced Error Handling failure on adapter.**Failing Item:**

- FFC_221
-

2570-201**Explanation:** Register test failed.**Failing Item:**

- FFC_2570
 - FFC_221
-

2570-601**Explanation:** ELA indicates hardware failure has occurred.**Failing Item:**

- FFC_2570
-

2570-602**Explanation:** ELA indicates hardware timeout has occurred.**Failing Item:**

- FFC_2570
-

2570-603**Explanation:** ELA indicates hardware failure and timeout has occurred.**Failing Item:**

- FFC_2570
-

2571-101**Explanation:** Enhanced Error Handling Failure on Bus**Failing Item:**

- FFC_2571
-

2571-102**Explanation:** Adapter I/O Register Test Failure**Failing Item:**

- FFC_2571
-

2571-103**Explanation:** Timer Test Failure**Failing Item:**

- FFC_2571
-

2571-104**Explanation:** Interrupt Test Failure**Failing Item:**

- FFC_2571
-

2571-105**Explanation:** Internal Loop Back Test Failure**Failing Item:**

- FFC_2571
-

2571-106**Explanation:** External Loop Back Test Failure**Failing Item:**

- FFC_2571
-

2571-201**Explanation:** PCI Configuration I/O Test Failure**Failing Item:**

- FFC_2571
 - FFC_221
-

2571-601

Explanation: Error log analysis indicates that this device has failed due to an adapter reset failure.

Failing Item:

- FFC_2571
-

2571-602

Explanation: Error log analysis indicates that this device has failed due to a hardware error.

Failing Item:

- FFC_2571
-

2572-100

Explanation: POST failed: Catastrophic error detected.

Failing Item:

- FFC_2572
-

2572-601

Explanation: ELA indicates: Low Battery Warning.

Failing Item:

- FFC_11A
-

2572-602

Explanation: ELA indicates: Mesh Violation - Tamper.

Failing Item:

- FFC_2572
-

2572-603

Explanation: ELA indicates: 4764 is held in the Reset condition.

Failing Item:

- FFC_2572
-

2572-604

Explanation: ELA indicates: +3, +5, or +12v Overvoltage condition.

Failing Item:

- FFC_2572
-

2572-605

Explanation: ELA indicates: Out of Temperature Specification.

Failing Item:

- FFC_2572
-

2572-606

Explanation: ELA indicates: X-ray or Dead Battery.

Failing Item:

- FFC_2572
-

2572-607

Explanation: ELA indicates: Intrusion latch.

Failing Item:

- FFC_2572
-

2576-101

Explanation: Enhanced Error Handling Failure on Bus

Failing Item:

- FFC_2576
-

2576-102

Explanation: Adapter I/O Register Test Failure

Failing Item:

- FFC_2576
-

2576-103

Explanation: Timer Test Failure

Failing Item:

- FFC_2576
-

2576-104

Explanation: Interrupt Test Failure

Failing Item:

- FFC_2576
-

2576-105

Explanation: Internal Loop Back Test Failure

Failing Item:

- FFC_2576
-

2576-106

Explanation: External Loop Back Test Failure

Failing Item:

- FFC_2576
-

2576-201

Explanation: PCI COnfiguration I/O Test Failure

Failing Item:

- FFC_2576
-

- FFC_221

2576-601

Explanation: Error log analysis indicates that this device has failed due to an adapter reset failure.

Failing Item:

- FFC_2576

2576-602

Explanation: Error log analysis indicates that this device has failed due to a hardware error.

Failing Item:

- FFC_2576

2578-101

Explanation: POST TU Failure

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2578

2578-601

Explanation: Error Log Analysis indicates that this adapter has failed due to an Adapter OS Error

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2578

2578-602

Explanation: Error Log Analysis indicates that this adapter has failed due to a POST Failed

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2578

2578-603

Explanation: Error Log Analysis indicates that this adapter has failed due to a Tamper Error

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2578

2578-604

Explanation: Error Log Analysis indicates that this adapter has failed due to a Low Battery

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2579

2578-605

Explanation: Error Log Analysis indicates that this adapter has failed due to a Request Timeout

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2578

2578-606

Explanation: Error Log Analysis indicates that this adapter has failed due to a MB (Mini Boot) Request Timeout

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2578

2578-607

Explanation: Error Log Analysis indicates that this adapter has failed due to a DMA Timeout

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2578

2580-102

Explanation: A critical failure has occurred on an undefined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_2580

2580-103

Explanation: Non-critical failure has occurred on an undefined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_2580

2580-104

Explanation: An unrecoverable failure has occurred on an undefined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

2580-122 • 2580-154

Failing Item:

- FFC_2580
-

2580-122

Explanation: A critical power supply failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_152
-

2580-123

Explanation: A non-critical power supply failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_152
-

2580-124

Explanation: An unrecoverable power supply failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_152
-

2580-132

Explanation: A critical fan failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_166
-

2580-133

Explanation: A non-critical fan failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_166
-

2580-134

Explanation: An unrecoverable fan failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_166
 - FFC_2580
-

2580-148

Explanation: The enclosure indicates a temperature threshold warning.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_166
 - FFC_2580
-

2580-149

Explanation: The enclosure indicates a temperature threshold failure.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_166
 - FFC_2580
-

2580-152

Explanation: A critical repeater card failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_2580
-

2580-153

Explanation: A non-critical repeater card failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_2580
-

2580-154

Explanation: An unrecoverable repeater card failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_2580
-

2580-162

Explanation: A critical VPD module failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_2580
-

2580-163

Explanation: A non-critical VPD module failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_2580
-

2580-164

Explanation: An unrecoverable VPD module failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_2580
-

2580-172

Explanation: A critical enclosure services failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_2580
-

2580-173

Explanation: A non-critical enclosure services failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_2580
-

2580-174

Explanation: An unrecoverable enclosure services failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_2580
-

2580-182

Explanation: A critical failure has occurred on a user defined element.

Failing Item:

- FFC_2580
-

2580-183

Explanation: A non-critical failure has occurred on a user defined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_2580
-

2580-184

Explanation: An unrecoverable failure has occurred on a user defined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_2580
-

2580-192

Explanation: A critical failure has occurred on a user defined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_2580
-

2580-193

Explanation: A non-critical failure has occurred on a user defined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_2580
-

2580-194

Explanation: An unrecoverable failure has occurred on a user defined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_2580

2580-201

Explanation: Device configuration error.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_2580
- FFC_891

2580-202

Explanation: The enclosure failed to open.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_2580
- FFC_891

2580-203

Explanation: The enclosure failed to return inquiry data.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_2580
- FFC_891

2580-204

Explanation: There is a critical power supply or fan failure.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_152
- FFC_166

2580-205

Explanation: There is a redundant power supply or fan failure.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_152
- FFC_166

2581-101

Explanation: Local Memory Test Failure

Failing Item:

- FFC_2581

2581-102

Explanation: Local Memory Test Failure

Failing Item:

- FFC_2581

2581-103

Explanation: Memory Test Failure

Failing Item:

- FFC_2581

2581-104

Explanation: NVRAM Test Failure

Failing Item:

- FFC_2581

2581-105

Explanation: Flash Test Failure

Failing Item:

- FFC_2581

2581-106

Explanation: Internal Wrap Test Failure

Failing Item:

- FFC_2581

2581-107

Explanation: External Wrap Test Failure

Failing Item:

- FFC_2581

2581-108

Explanation: DMA Test Failure

Failing Item:

- FFC_2581

2581-109

Explanation: Enhanced Error Handling Failure on bus

Failing Item:

- FFC_221

2581-110

Explanation: Enhanced Error Handling Failure on adapter

Failing Item:

- FFC_2581
-

2581-201

Explanation: Configuration and I/O Register Test Failure

Failing Item:

- FFC_2581
 - FFC_221
-

2581-601

Explanation: Error log analysis indicates that the adapter self-test failed.

Failing Item:

- FFC_2581
-

2581-602

Explanation: Error log analysis indicates that an NVRAM failure on the adapter has occurred.

Failing Item:

- FFC_2581
-

2581-603

Explanation: Error log analysis indicates that an adapter error has occurred.

Failing Item:

- FFC_2581
-

2581-604

Explanation: Error log analysis indicates that a fatal error has occurred.

Failing Item:

- FFC_2581
-

2581-605

Explanation: Error log analysis indicates that an adapter error has occurred.

Failing Item:

- FFC_2581
-

2581-606

Explanation: Error log analysis indicates that an unknown adapter hardware error has occurred.

Failing Item:

- FFC_2581
-

2583-101

Explanation: Local Memory Test Failure

Failing Item:

- FFC_2583
-

2583-102

Explanation: Local Memory Test Failure

Failing Item:

- FFC_2583
-

2583-103

Explanation: Memory Test Failure

Failing Item:

- FFC_2583
-

2583-104

Explanation: NVRAM Test Failure

Failing Item:

- FFC_2583
-

2583-105

Explanation: Flash Test Failure

Failing Item:

- FFC_2583
-

2583-106

Explanation: Internal Wrap Test Failure

Failing Item:

- FFC_2583
-

2583-107

Explanation: External Wrap Test Failure

Failing Item:

- FFC_2583
-

2583-108

Explanation: DMA Test Failure

Failing Item:

- FFC_2583
-

2583-109

Explanation: Enhanced Error Handling Failure on bus

Failing Item:

- FFC_221
-

2583-110

Explanation: Enhanced Error Handling Failure on adapter

Failing Item:

- FFC_2583
-

2583-201

Explanation: Configuration and I/O Register Test Failure

Failing Item:

- FFC_2583
 - FFC_221
-

2583-601

Explanation: Error log analysis indicates that the adapter self-test failed.

Failing Item:

- FFC_2583
-

2583-602

Explanation: Error log analysis indicates that an NVRAM failure on the adapter has occurred.

Failing Item:

- FFC_2583
-

2583-603

Explanation: Error log analysis indicates that an adapter error has occurred.

Failing Item:

- FFC_2583
-

2583-604

Explanation: Error log analysis indicates that a fatal error has occurred.

Failing Item:

- FFC_2583

2583-605

Explanation: Error log analysis indicates that an adapter error has occurred.

Failing Item:

- FFC_2583
-

2583-606

Explanation: Error log analysis indicates that an unknown adapter hardware error has occurred.

Failing Item:

- FFC_2583
-

2584-101

Explanation: Unable to open DVD-ROM device driver.

Failing Item:

- FFC_2584
-

2584-201

Explanation: Unable to configure adapter.

Failing Item:

- FFC_25A0
-

2584-202

Explanation: Unable to configure the device.

Failing Item:

- FFC_2584
 - FFC_25A0
 - MEDIA
-

2584-203

Explanation: Unable to open IDE adapter driver.

Failing Item:

- FFC_25A0
-

2584-204

Explanation: The Inquire command failed.

Failing Item:

- MEDIA
 - FFC_2584
-

2584-205

Explanation: The Read Sense Data command failed.

Failing Item:

- FFC_2584
- MEDIA

2584-206

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_2584
-

2584-207

Explanation: A media error was detected.

Response: Try switching out the media. If the problem persists, go to MAP0210 : General problem resolution.

Failing Item:

- MEDIA
 - FFC_2584
-

2584-210

Explanation: The Prevent Media Removal or Allow Media Removal command failed.

Failing Item:

- FFC_2584
-

2584-701

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_2584
-

2584-702

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_2584
-

2585-101

Explanation: Unable to open DVD-ROM device driver.

Failing Item:

- FFC_2585
-

2585-201

Explanation: Unable to configure adapter.

Failing Item:

- FFC_25A0
-

2585-202

Explanation: Unable to configure the device.

Failing Item:

- FFC_2585
 - FFC_25A0
 - MEDIA
-

2585-203

Explanation: Unable to open IDE adapter driver.

Failing Item:

- FFC_25A0
-

2585-204

Explanation: The Inquire command failed.

Failing Item:

- MEDIA
 - FFC_2585
-

2585-205

Explanation: The Read Sense Data command failed.

Failing Item:

- FFC_2585
 - MEDIA
-

2585-206

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_2585
-

2585-207

Explanation: A media error was detected.

Response: Try switching out the media. If the problem persists, go to MAP0210 : General problem resolution.

Failing Item:

- MEDIA
 - FFC_2585
-

2585-210

Explanation: The Prevent Media Removal or Allow Media Removal command failed.

Failing Item:

- FFC_2585
-

2585-701

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_2585
-

2585-702

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_2585
-

2587-101

Explanation: Unable to open device driver.

Failing Item:

- FFC_2587
-

2587-201

Explanation: Unable to configure adapter.

Failing Item:

- FFC_25A0
-

2587-202

Explanation: Unable to configure the device.

Failing Item:

- FFC_2587
 - FFC_25A0
 - MEDIA
-

2587-203

Explanation: Unable to open device driver.

Failing Item:

- FFC_25A0
-

2587-204

Explanation: The Inquire command failed.

Failing Item:

- MEDIA
 - FFC_2587
-

2587-205

Explanation: The Read Sense Data command failed.

Failing Item:

- FFC_2587
 - MEDIA
-

2587-206

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_2587
-

2587-208

Explanation: The DVD-ROM Play Audio command failed.

Failing Item:

- FFC_2587
 - MEDIA
-

2587-209

Explanation: No tone during audio test.

Failing Item:

- FFC_2587
-

2587-210

Explanation: The Prevent Media Removal or Allow Media Removal or command failed.

Failing Item:

- FFC_2587
-

2587-211

Explanation: DVD-ROM drive indicates an error.

Failing Item:

- FFC_2587
-

2587-212

Explanation: The Write/Read/Compare Test Failed.

Failing Item:

- FFC_2587
 - MEDIA
-

2587-701

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_2587
-

2587-702

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_2587
-

2588-101

Explanation: Unable to open device driver.

Failing Item:

- FFC_2588
-

2588-201

Explanation: Unable to configure adapter.

Failing Item:

- FFC_25A0
-

2588-202

Explanation: Unable to configure the device.

Failing Item:

- FFC_2588
 - FFC_25A0
 - MEDIA
-

2588-203

Explanation: Unable to open device driver.

Failing Item:

- FFC_25A0
-

2588-204

Explanation: The Inquire command failed.

Failing Item:

- MEDIA
 - FFC_2588
-

2588-205

Explanation: The Read Sense Data command failed.

Failing Item:

- FFC_2588
 - MEDIA
-

2588-206

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_2588
-

2588-207

Explanation: A media error was detected.

Response: Try switching out the media. If the problem persists, go to MAP0210 : General problem resolution.

Failing Item:

- MEDIA
 - FFC_2588
-

2588-208

Explanation: The DVD-ROM Play Audio command failed.

Failing Item:

- FFC_2588
 - MEDIA
-

2588-209

Explanation: No tone during audio test.

Failing Item:

- FFC_2588
-

2588-210

Explanation: The Prevent Media Removal or Allow Media Removal or command failed.

Failing Item:

- FFC_2588
-

2588-211

Explanation: DVD-ROM drive indicates an error.

Failing Item:

- FFC_2588
-

2588-212

Explanation: The Write/Read/Compare Test Failed.

Failing Item:

- FFC_2588
 - MEDIA
-

2588-701

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_2588
-

2588-702

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_2588
-

2590-101

Explanation: Unable to open CD-ROM device driver.

Failing Item:

- FFC_2590
-

2590-201

Explanation: Unable to configure adapter.

Failing Item:

- FFC_25A0
-

2590-202

Explanation: Unable to configure the device.

Failing Item:

- FFC_2590
 - FFC_25A0
 - MEDIA
-

2590-203

Explanation: Unable to open IDE adapter driver.

Failing Item:

- FFC_25A0
-

2590-204

Explanation: The Inquire command failed.

Failing Item:

- MEDIA
 - FFC_2590
-

2590-205

Explanation: The Read Sense Data command failed.

Failing Item:

- FFC_2590
 - MEDIA
-

2590-206

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_2590
-

2590-207

Explanation: A media error was detected.

Response: Try switching out the media. If the problem persists, go to MAP0210 : General problem resolution.

Failing Item:

- MEDIA
 - FFC_2590
-

2590-208

Explanation: The CD-ROM Play Audio command failed.

Failing Item:

- FFC_2590
 - MEDIA
-

2590-209

Explanation: No tone during audio test.

Failing Item:

- FFC_2590
-

2590-210

Explanation: The Prevent Media Removal or Allow Media Removal command failed.

Failing Item:

- FFC_2590
-

2590-211

Explanation: CD-ROM drive indicates an error.

Failing Item:

- FFC_2590
-

2590-701

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_2590
-

2590-702

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_2590
-

2591-101

Explanation: Unable to open DVD-ROM device driver.

Failing Item:

- FFC_2591
-

2591-201

Explanation: Unable to configure adapter.

Failing Item:

- FFC_25A0
-

2591-202**Explanation:** Unable to configure the device.**Failing Item:**

- FFC_2591
 - FFC_25A0
 - MEDIA
-

2591-203**Explanation:** Unable to open IDE adapter driver.**Failing Item:**

- FFC_25A0
-

2591-204**Explanation:** The Inquire command failed.**Failing Item:**

- MEDIA
 - FFC_2591
-

2591-205**Explanation:** The Read Sense Data command failed.**Failing Item:**

- FFC_2591
 - MEDIA
-

2591-206**Explanation:** The Test Unit Ready command failed.**Failing Item:**

- FFC_2591
-

2591-207**Explanation:** A media error was detected.**Response:** Try switching out the media. If the problem persists, go to MAP0210 : General problem resolution.**Failing Item:**

- MEDIA
 - FFC_2591
-

2591-210**Explanation:** The Prevent Media Removal or Allow Media Removal command failed.**Failing Item:**

- FFC_2591
-

2591-701**Explanation:** ELA indicates drive hardware failure.**Failing Item:**

- FFC_2591
-

2591-702**Explanation:** ELA indicates drive hardware failure.**Failing Item:**

- FFC_2591
-

2592-101**Explanation:** Unable to open slimline DVD-ROM device driver.**Failing Item:**

- FFC_2592
-

2592-201**Explanation:** Unable to configure adapter.**Failing Item:**

- FFC_25A0
-

2592-202**Explanation:** Unable to configure the device.**Failing Item:**

- FFC_2592
 - FFC_25A0
 - MEDIA
-

2592-203**Explanation:** Unable to open IDE adapter driver.**Failing Item:**

- FFC_25A0
-

2592-204**Explanation:** The Inquire command failed.**Failing Item:**

- MEDIA
 - FFC_2592
-

2592-205**Explanation:** The Read Sense Data command failed.**Failing Item:**

- FFC_2592
 - MEDIA
-

2592-206

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_2592

2592-207

Explanation: A media error was detected.

Response: Try switching out the media. If the problem persists, go to MAP0210 : General problem resolution.

Failing Item:

- MEDIA
- FFC_2592

2592-210

Explanation: The Prevent Media Removal or Allow Media Removal command failed.

Failing Item:

- FFC_2592

2592-701

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_2592

2592-702

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_2592

2593-101

Explanation: Unable to open device driver.

Failing Item:

- FFC_2593

2593-201

Explanation: Unable to configure adapter.

Failing Item:

- FFC_25A0

2593-202

Explanation: Unable to configure the device.

Failing Item:

- FFC_2593
- FFC_25A0
- MEDIA

2593-203

Explanation: Unable to open device driver.

Failing Item:

- FFC_25A0

2593-204

Explanation: The Inquire command failed.

Failing Item:

- MEDIA
- FFC_2593

2593-205

Explanation: The Read Sense Data command failed.

Failing Item:

- FFC_2593
- MEDIA

2593-206

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_2593

2593-207

Explanation: A media error was detected.

Response: Try switching out the DVD media. If the problem persists, go to MAP0210 : General problem resolution.

Failing Item:

- MEDIA
- FFC_2593

2593-208

Explanation: The DVD-ROM Play Audio command failed.

Failing Item:

- FFC_2593
- MEDIA

2593-209

Explanation: No tone during audio test.

Failing Item:

- FFC_2593

2593-210

Explanation: The Prevent Media Removal or Allow Media Removal or command failed.

Failing Item:

- FFC_2593
-

2593-211

Explanation: DVD-ROM drive indicates an error.

Failing Item:

- FFC_2593
-

2593-212

Explanation: The Write/Read/Compare Test Failed.

Failing Item:

- FFC_2593
 - MEDIA
-

2593-701

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_2593
-

2593-702

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_2593
-

25A2-101

Explanation: Unable to open device driver.

Failing Item:

- FFC_25A2
-

25A2-201

Explanation: Unable to configure adapter.

Failing Item:

- FFC_2D02
-

25A2-202

Explanation: Unable to configure the device.

Failing Item:

- FFC_25A2
 - FFC_2D02
 - MEDIA
-

25A2-203

Explanation: Unable to open device driver.

Failing Item:

- FFC_2D02
-

25A2-204

Explanation: The Inquire command failed.

Failing Item:

- MEDIA
 - FFC_25A2
-

25A2-205

Explanation: The Read Sense Data command failed.

Failing Item:

- FFC_25A2
 - MEDIA
-

25A2-206

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_25A2
-

25A2-207

Explanation: A media error was detected.

Response: Try switching out the DVD media. If the problem persists, go to MAP0210 : General problem resolution.

Failing Item:

- MEDIA
 - FFC_25A2
-

25A2-208

Explanation: The Play Audio command failed.

Failing Item:

- FFC_25A2
 - MEDIA
-

25A2-209

Explanation: No tone during audio test.

Failing Item:

- FFC_25A2
-

25A2-210

Explanation: The Prevent Media Removal or Allow Media Removal or command failed.

Failing Item:

- FFC_25A2
-

25A2-211

Explanation: Drive indicates an error.

Failing Item:

- FFC_25A2
-

25A2-212

Explanation: The Write/Read/Compare Test Failed.

Failing Item:

- FFC_25A2
 - MEDIA
-

25A2-701

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_25A2
-

25A2-702

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_25A2
-

25A3-101

Explanation: Enhanced Error Handling Failure on Bus

Failing Item:

- FFC_25A3
-

25A3-102

Explanation: Adapter I/O Register Test Failure

Failing Item:

- FFC_25A3
-

25A3-103

Explanation: Timer Test Failure

Failing Item:

- FFC_25A3
-

25A3-104

Explanation: Interrupt Test Failure

Failing Item:

- FFC_25A3
-

25A3-105

Explanation: Internal Loop Back Test Failure

Failing Item:

- FFC_25A3
-

25A3-106

Explanation: External Loop Back Test Failure

Failing Item:

- FFC_25A3
-

25A3-201

Explanation: PCI Configuration I/O Test Failure

Failing Item:

- FFC_25A3
 - FFC_221
-

25A3-601

Explanation: Error log analysis indicates that this device has failed due to an adapter reset failure.

Failing Item:

- FFC_25A3
-

25A3-602

Explanation: Error log analysis indicates that this device has failed due to a hardware error.

Failing Item:

- FFC_25A3
-

25A4-101

Explanation: Enhanced Error Handling Failure on Bus

Failing Item:

- FFC_25A4
-

25A4-102

Explanation: Adapter I/O Register Test Failure

Failing Item:

- FFC_25A4
-

25A4-103**Explanation:** Timer Test Failure**Failing Item:**

- FFC_25A4
-

25A4-104**Explanation:** Interrupt Test Failure**Failing Item:**

- FFC_25A4
-

25A4-105**Explanation:** Internal Loop Back Test Failure**Failing Item:**

- FFC_25A4
-

25A4-106**Explanation:** External Loop Back Test Failure**Failing Item:**

- FFC_25A4
-

25A4-201**Explanation:** PCI COnfiguration I/O Test Failure**Failing Item:**

- FFC_25A4
 - FFC_221
-

25A4-601**Explanation:** Error log analysis indicates that this device has failed due to an adapter reset failure.**Failing Item:**

- FFC_25A4
-

25A4-602**Explanation:** Error log analysis indicates that this device has failed due to a hardware error.**Failing Item:**

- FFC_25A4
-

25B9-101**Explanation:** Local Memory Test Failure**Failing Item:**

- FFC_25B9
-

25B9-102**Explanation:** Local Memory Test Failure**Failing Item:**

- FFC_25B9
-

25B9-103**Explanation:** Memory Test Failure**Failing Item:**

- FFC_25B9
-

25B9-104**Explanation:** NVRAM Test Failure**Failing Item:**

- FFC_25B9
-

25B9-105**Explanation:** Flash Test Failure**Failing Item:**

- FFC_25B9
-

25B9-106**Explanation:** Internal Wrap Test Failure**Failing Item:**

- FFC_25B9
-

25B9-107**Explanation:** External Wrap Test Failure**Failing Item:**

- FFC_25B9
-

25B9-108**Explanation:** DMA Test Failure**Failing Item:**

- FFC_25B9
-

25B9-109**Explanation:** Enhanced Error Handling Failure on bus**Failing Item:**

- FFC_221
-

25B9-110**Explanation:** Enhanced Error Handling Failure on adapter**Failing Item:**

25B9-201 • 25C0-108

- FFC_25B9

25B9-201

Explanation: Configuration and I/O Register Test Failure

Failing Item:

- FFC_25B9
- FFC_221

25B9-601

Explanation: Error log analysis indicates that the adapter self-test failed.

Failing Item:

- FFC_25B9

25B9-602

Explanation: Error log analysis indicates that an NVRAM failure on the adapter has occurred.

Failing Item:

- FFC_25B9

25B9-603

Explanation: Error log analysis indicates that an adapter error has occurred.

Failing Item:

- FFC_25B9

25B9-604

Explanation: Error log analysis indicates that a fatal error has occurred.

Failing Item:

- FFC_25B9

25B9-605

Explanation: Error log analysis indicates that an adapter error has occurred.

Failing Item:

- FFC_25B9

25B9-606

Explanation: Error log analysis indicates that an unknown adapter hardware error has occurred.

Failing Item:

- FFC_25B9

25C0-101

Explanation: Enhanced Error Handling Failure on bus.

Failing Item:

- FFC_221

25C0-102

Explanation: Enhanced Error Handling Logic Failure.

Failing Item:

- FFC_293

25C0-103

Explanation: Enhanced Error Handling Failure while testing adapter.

Failing Item:

- FFC_25C0
- FFC_221

25C0-104

Explanation: Internal wrap test failure (10 Mbps).

Failing Item:

- FFC_25C0

25C0-105

Explanation: Internal wrap test failure (100 Mbps).

Failing Item:

- FFC_25C0

25C0-106

Explanation: Internal wrap test failure (1000 Mbps).

Failing Item:

- FFC_25C0

25C0-107

Explanation: External wrap test failure (10 Mbps).

Failing Item:

- FFC_25C0

25C0-108

Explanation: External wrap test failure (100 Mbps).

Failing Item:

- FFC_25C0
-

25C0-201**Explanation:** Registers test failure.**Failing Item:**

- FFC_25C0
 - FFC_221
-

25C0-701**Explanation:** Failure to initialize due to a self-test failure.**Failing Item:**

- FFC_25C0
-

25C0-702**Explanation:** Failure to recover from an EEH event.**Failing Item:**

- FFC_25C0
 - FFC_221
-

25C0-703**Explanation:** Failure to initialize due to a problem while reading the EEPROM on the adapter.**Failing Item:**

- FFC_25C0
-

25C0-704**Explanation:** Device has attempted error recover.**Failing Item:**

- FFC_25C0
 - FFC_221
-

25C0-705**Explanation:** Device has attempted error recovery.**Failing Item:**

- FFC_25C0
 - FFC_221
-

25C1-101**Explanation:** Enhanced Error Handling Failure on bus.**Failing Item:**

- FFC_221
-

25C1-102**Explanation:** Enhanced Error Handling Logic Failure.**Failing Item:**

- FFC_293
-

25C1-103**Explanation:** Enhanced Error Handling Failure while testing adapter.**Failing Item:**

- FFC_25C1
 - FFC_221
-

25C1-104**Explanation:** Internal wrap test failure (10 Mbps).**Failing Item:**

- FFC_25C1
-

25C1-105**Explanation:** Internal wrap test failure (100 Mbps).**Failing Item:**

- FFC_25C1
-

25C1-106**Explanation:** Internal wrap test failure (1000 Mbps).**Failing Item:**

- FFC_25C1
-

25C1-107**Explanation:** External wrap test failure (10 Mbps).**Failing Item:**

- FFC_25C1
-

25C1-108**Explanation:** External wrap test failure (100 Mbps).**Failing Item:**

- FFC_25C1
-

25C1-201**Explanation:** Registers test failure.**Failing Item:**

- FFC_25C1
 - FFC_221
-

25C1-701**Explanation:** Failure to initialize due to a self-test failure.**Failing Item:**

- FFC_25C1
-

25C1-702

Explanation: Failure to recover from an EEH event.

Failing Item:

- FFC_25C1
 - FFC_221
-

25C1-703

Explanation: Failure to initialize due to a problem while reading the EEPROM on the adapter.

Failing Item:

- FFC_25C1
-

25C1-704

Explanation: Device has attempted error recovery.

Failing Item:

- FFC_25C1
 - FFC_221
-

25C1-705

Explanation: Device has attempted error recovery.

Failing Item:

- FFC_25C1
 - FFC_221
-

25C2-101

Explanation: Enhanced Error Handling Failure on bus.

Failing Item:

- FFC_221
-

25C2-103

Explanation: Enhanced Error Handling Failure while testing adapter.

Failing Item:

- FFC_25C2
 - FFC_221
-

25C2-104

Explanation: Internal wrap test failure (10 Mbps).

Failing Item:

- FFC_25C2
-

25C2-105

Explanation: Internal wrap test failure (100 Mbps).

Failing Item:

- FFC_25C2
-

25C2-106

Explanation: Internal wrap test failure (1000 Mbps).

Failing Item:

- FFC_25C2
-

25C2-107

Explanation: External wrap test failure (10 Mbps).

Failing Item:

- FFC_25C2
-

25C2-108

Explanation: External wrap test failure (100 Mbps).

Failing Item:

- FFC_25C2
-

25C2-201

Explanation: Registers test failure.

Failing Item:

- FFC_25C2
 - FFC_221
-

25C2-701

Explanation: Failure to initialize due to a self-test failure.

Failing Item:

- FFC_25C2
-

25C2-702

Explanation: Failure to recover from an EEH event.

Failing Item:

- FFC_25C2
 - FFC_221
-

25C2-703

Explanation: Failure to initialize due to a problem while reading the EEPROM on the adapter.

Failing Item:

- FFC_25C2
-

25C2-704

Explanation: Device has attempted error recovery.

Failing Item:

- FFC_25C2
 - FFC_221
-

25C2-705**Explanation:** Enhanced Error Handling failure on bus.**Failing Item:**

- FFC_25C3
 - FFC_221
-

25C3-101**Explanation:** Enhanced Error Handling Failure on bus.**Failing Item:**

- FFC_25C3
-

25C3-103**Explanation:** Enhanced Error Handling Failure while testing adapter.**Failing Item:**

- FFC_25C3
 - FFC_221
-

25C3-104**Explanation:** Internal wrap test failure (10 Mbps).**Failing Item:**

- FFC_25C3
-

25C3-105**Explanation:** Internal wrap test failure (100 Mbps).**Failing Item:**

- FFC_25C3
-

25C3-106**Explanation:** Internal wrap test failure (1000 Mbps).**Failing Item:**

- FFC_25C3
-

25C3-107**Explanation:** External wrap test failure (10 Mbps).**Failing Item:**

- FFC_25C3
-

25C3-108**Explanation:** External wrap test failure (100 Mbps).**Failing Item:**

- FFC_25C3
-

25C3-201**Explanation:** Registers test failure.**Failing Item:**

- FFC_25C3
 - FFC_221
-

25C3-701**Explanation:** Failure to initialize due to a self-test failure.**Failing Item:**

- FFC_25C3
-

25C3-702**Explanation:** Failure to recover from an EEH event.**Failing Item:**

- FFC_25C3
 - FFC_221
-

25C3-703**Explanation:** Failure to initialize due to a problem while reading the EEPROM on the adapter.**Failing Item:**

- FFC_25C3
-

25C3-704**Explanation:** Device has attempted error recovery.**Failing Item:**

- FFC_25C3
 - FFC_221
-

25C3-705**Explanation:** Enhanced Error Handling failure on bus.**Failing Item:**

- FFC_25C3
 - FFC_221
-

25C4-201**Explanation:** Configuration Error.**Failing Item:**

- FFC_25C4
 - FFC_221
-

25C4-601

Explanation: Download firmware error.

Failing Item:

- FFC_25C4
-

25C4-602

Explanation: EEPROM read error.

Failing Item:

- FFC_25C4
-

25C4-701

Explanation: Permanent adapter failure.

Failing Item:

- FFC_25C4
 - FFC_221
-

25D0-099

Explanation: Audio System error log entry.

Failing Item:

- FFC_25D0
-

25D0-101

Explanation: Audio Subsystem failed.

Failing Item:

- FFC_25D0
 - SOFTWARE
-

25D0-102

Explanation: CS4232 failed.

Failing Item:

- FFC_25D0
-

25D0-103

Explanation: Clock control failed.

Failing Item:

- FFC_25D0
-

25D0-108

Explanation: Loop back failed.

Failing Item:

- FFC_25D0
-

25D2-101

Explanation: Adapter configuration error .

Failing Item:

- FFC_25D2
-

25D2-710

Explanation: Permanent adapter failure.

Failing Item:

- FFC_25D2
-

25D2-711

Explanation: Excessive temporary adapter failures.

Failing Item:

- FFC_25D2
-

25D3-101

Explanation: Adapter configuration error .

Failing Item:

- FFC_25D3
-

25D3-710

Explanation: Permanent adapter failure.

Failing Item:

- FFC_25D3
-

25D3-711

Explanation: Excessive temporary adapter failures.

Failing Item:

- FFC_25D3
-

25D5-101

Explanation: Adapter configuration error .

Failing Item:

- FFC_25D5
-

25D5-710

Explanation: Permanent adapter failure.

Failing Item:

- FFC_25D5
-

25D5-711

Explanation: Excessive temporary adapter failures.

Failing Item:

- FFC_25D5
-

25E5-001**Explanation:** Adapter problem**Failing Item:**

- FFC_25E5
 - FFC_221
 - MONITOR
 - CABLE
-

25E5-002**Explanation:** Display problem**Failing Item:**

- FFC_25E5
 - MONITOR
 - CABLE
-

25E5-003**Explanation:** Software error**Failing Item:**

- SOFTWARE
 - FFC_25E5
-

25E6-001**Explanation:** Adapter problem**Failing Item:**

- FFC_25E6
 - FFC_221
 - MONITOR_OR_CABLE
 - FFC_25E7
-

25E6-002**Explanation:** Display problem**Failing Item:**

- FFC_25E6
 - MONITOR_OR_CABLE
 - FFC_25E7
-

25E6-003**Explanation:** Software error**Failing Item:**

- SOFTWARE
 - FFC_25E6
-

2502-102E**Explanation:** Reallocation failed due to disk out of alternate sectors.**Response:** If the problem persists, use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_722
-

2502-3002**Explanation:** Addressed device failed to respond to selection.**Response:** If the problem persists, use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_722
-

2502-3010**Explanation:** Disk returned wrong response to adapter.**Response:** If the problem persists, use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_722
-

2502-3020**Explanation:** Storage subsystem configuration error.**Response:** Use MAP3150.

2502-3100**Explanation:** Adapter detected device bus interface error.**Response:** Use MAP3150.

2502-3109**Explanation:** Adapter timed out a disk command.**Response:** Use MAP3150.

2502-3110**Explanation:** Disk bus interface error.**Response:** Use MAP3150.

2502-4010**Explanation:** Configuration error, incorrect connection between cascaded enclosures.**Response:** Use MAP3142.

2502-4020

Explanation: Configuration error, connections exceed IOA design limits.

Response: Use MAP3143.

2502-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP3144.

2502-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP3144.

2502-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146.

2502-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148.

2502-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP3153.

2502-4100

Explanation: Device bus fabric error.

Response: Use MAP3152.

2502-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP3152.

2502-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145.

2502-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2502
 - FFC_221
-

2502-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2502
 - FFC_221
-

2502-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2502-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2502
-

2502-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2502
-

2502-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2502-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2502-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2502-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2502-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2502-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2502-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2502-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2502-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2502-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112.

2502-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190.

2502-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110.

2502-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190.

2502-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113.

2502-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2502-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190.

2502-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2502-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110.

2502-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2502-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190.

2502-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2502-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131.

2502-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132.

2502-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2502-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121.

2502-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111.

2502-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2502-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2502-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2502-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2502-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP3141.

2502-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP3149.

2502-9076

Explanation: Missing remote controller.

Response: Use MAP3147.

2502-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2502-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2502-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2502-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2502-9092**Explanation:** Disk requires Format before use.**Response:** Use MAP3134.

2502-FF3D**Explanation:** Temporary controller failure.**Response:** Use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_2502

2502-FFF3**Explanation:** Disk media format bad.**Response:** Use MAP3135.

2502-FFF4**Explanation:** Disk drive problem.**Response:** Use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_722

2502-FFF6**Explanation:** Disk detected recoverable error.**Response:** Use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_722

2502-FFFA**Explanation:** Temporary disk error.**Response:** Use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_722

2502-FFFE**Explanation:** Temporary disk bus error.**Response:** Use MAP3150.

Note: Device may only identify adapter port, e.g. 00pFFF, where 'p' is port.

2503-102E**Explanation:** Reallocation failed due to disk out of alternate sectors.**Response:** If the problem persists, use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_722

2503-3002**Explanation:** Addressed device failed to respond to selection.**Response:** If the problem persists, use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_722

2503-3010**Explanation:** Disk returned wrong response to adapter.**Response:** If the problem persists, use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_722

2503-3020**Explanation:** Storage subsystem configuration error.**Response:** Use MAP3150.

2503-3100**Explanation:** Adapter detected device bus interface error.**Response:** Use MAP3150.

2503-3109**Explanation:** Adapter timed out a disk command.**Response:** Use MAP3150.

2503-3110**Explanation:** Disk bus interface error.**Response:** Use MAP3150.

2503-4010**Explanation:** Configuration error, incorrect connection between cascaded enclosures.**Response:** Use MAP3142.

2503-4020

Explanation: Configuration error, connections exceed IOA design limits.

Response: Use MAP3143.

2503-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP3144.

2503-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP3144.

2503-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146.

2503-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148.

2503-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP3153.

2503-4100

Explanation: Device bus fabric error.

Response: Use MAP3152.

2503-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP3152.

2503-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145.

2503-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2503
 - FFC_221
-

2503-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2503
 - FFC_221
-

2503-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2503-8008

Explanation: A permanent cache battery pack failure occurred.

Response: Use MAP3100.

Failing Item:

- FFC_2D05
-

2503-8009

Explanation: A permanent cache battery pack failure occurred.

Response: Use MAP3100.

Failing Item:

- FFC_2D05
-

2503-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2503
-

2503-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2503
-

2503-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2503-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2503-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2503-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2503-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2503-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2503-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2503-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2503-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2503-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112.

2503-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190.

2503-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110.

2503-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190.

2503-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113.

2503-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2503-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190.

2503-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2503-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110.

2503-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2503-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190.

2503-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2503-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131.

2503-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132.

2503-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2503-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121.

2503-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111.

2503-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2503-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2503-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2503-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2503-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP3141.

2503-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP3149.

2503-9076

Explanation: Missing remote controller.

Response: Use MAP3147.

2503-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2503-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2503-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2503-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2503-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134.

2503-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2503
-

2503-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135.

2503-FFF4

Explanation: Disk drive problem.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2503-FFF6

Explanation: Disk detected recoverable error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2503-FFFA

Explanation: Temporary disk error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2503-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

Note: Device may only identify adapter port, e.g. 00pFFE, where 'p' is port.

2504-102E

Explanation: Reallocation failed due to disk out of alternate sectors.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2504-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2504-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2504-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

2504-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2504-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

2504-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

2504-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3142.

2504-4020

Explanation: Configuration error, connections exceed IOA design limits.

Response: Use MAP3143.

2504-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP3144.

2504-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP3144.

2504-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146.

2504-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148.

2504-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP3153.

2504-4100

Explanation: Device bus fabric error.

Response: Use MAP3152.

2504-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP3152.

2504-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145.

2504-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2504
 - FFC_221
-

2504-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2504
 - FFC_221
-

2504-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2504-8008

Explanation: A permanent cache battery pack failure occurred.

Response: Use MAP3100.

Failing Item:

- FFC_2D05
-

2504-8009

Explanation: A permanent cache battery pack failure occurred.

Response: Use MAP3100.

Failing Item:

- FFC_2D05
-

2504-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2504
-

2504-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2504
-

2504-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2504-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2504-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2504-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2504-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2504-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2504-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2504-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2504-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2504-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112.

2504-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190.

2504-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110.

2504-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190.

2504-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113.

2504-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2504-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190.

2504-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2504-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110.

2504-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2504-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190.

2504-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2504-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131.

2504-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132.

2504-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2504-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121.

2504-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111.

2504-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2504-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2504-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2504-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2504-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP3141.

2504-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP3149.

2504-9076

Explanation: Missing remote controller.

Response: Use MAP3147.

2504-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2504-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2504-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2504-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2504-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134.

2504-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2504
-

2504-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135.

2504-FFF4

Explanation: Disk drive problem.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2504-FFF6

Explanation: Disk detected recoverable error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2504-FFFA

Explanation: Temporary disk error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2504-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

Note: Device may only identify adapter port, e.g. 00pFFF, where 'p' is port.

2505-102E

Explanation: Reallocation failed due to disk out of alternate sectors.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2505-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2505-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2505-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

2505-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2505-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

2505-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

2505-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3142.

2505-4020

Explanation: Configuration error, connections exceed IOA design limits.

Response: Use MAP3143.

2505-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP3144.

2505-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP3144.

2505-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146.

2505-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148.

2505-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP3153.

2505-4100

Explanation: Device bus fabric error.

Response: Use MAP3152.

2505-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP3152.

2505-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145.

2505-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2505
 - FFC_221
-

2505-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2505
 - FFC_221
-

2505-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722

2505-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2505
-

2505-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2505
-

2505-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2505-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2505-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2505-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2505-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2505-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2505-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2505-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2505-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2505-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112.

2505-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190.

2505-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110.

2505-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190.

2505-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113.

2505-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2505-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190.

2505-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2505-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110.

2505-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2505-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190.

2505-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2505-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131.

2505-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132.

2505-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2505-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121.

2505-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111.

2505-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2505-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2505-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2505-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2505-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP3141.

2505-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP3149.

2505-9076

Explanation: Missing remote controller.

Response: Use MAP3147.

2505-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2505-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2505-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2505-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2505-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134.

2505-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2505
-

2505-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135.

2505-FFF4

Explanation: Disk drive problem.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2505-FFF6

Explanation: Disk detected recoverable error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2505-FFFA

Explanation: Temporary disk error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2505-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

Note: Device may only identify adapter port, e.g. 00pFFF, where 'p' is port.

2512-102E

Explanation: Reallocation failed due to disk out of alternate sectors.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2512-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2512-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2512-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

2512-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2512-3101

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2512-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

2512-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

2512-7001

Explanation: Temporary disk data error.

Failing Item:

- FFC_722
-

2512-8008

Explanation: Permanent cache battery pack failure.

Response: Use MAP3000.

Failing Item:

- FFC_2D01
-

2512-8009

Explanation: Impending cache battery pack failure.

Response: Use MAP3000.

Failing Item:

- FFC_2D01
-

2512-9000

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2512-9001

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2512-9002

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2512-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2512-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2512-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2512-9020

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2512-9021

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2512-9022

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2512-9023

Explanation: One or more disk array members are not a the required physical locations.

Response: Use MAP3012.

2512-9024

Explanation: The physical location of disk array members conflict with another disk array.

Response: Use MAP3190.

2512-9025

Explanation: An incompatible disk is installed at a degraded disk location in the disk array.

Response: Use MAP3110.

2512-9026

Explanation: A previously degraded disk in the disk array was not found at the required physical location.

Response: Use MAP3190. .

2512-9027

Explanation: A disk array is or would become degraded and the parity data is out of synchronization.

Response: Use MAP3113.

2512-9028

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2512-9029

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2512-9030

Explanation: The disk array is degraded due to a missing or failed disk.

Response: Use MAP3110.

2512-9031

Explanation: Automatic reconstruction initiated for the disk array.

Response: Use MAP3110.

2512-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2512-9041

Explanation: Background disk array parity checking detected and corrected errors.

Response: Use MAP3190.

2512-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2512-9050

Explanation: Required cache data cannot be located for one or more disks.

Response: Use MAP3031.

2512-9051

Explanation: Cache data exists for more than one missing or failed disks.

Response: Use MAP3132.

2512-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2512-9054

Explanation: RAID controller resources are not available due to previous problems.

Response: Use MAP3121.

2512-9060

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

2512-9061

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

2512-9062

Explanation: One or more disk pairs are missing from a RAID-0 disk array.

Response: Use MAP3111.

2512-9063

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2512-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2512-9074

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3141.

2512-9081

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

2512-9082

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

2512-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2512-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2512-9092

Explanation: Disk requires formatting before use.

Response: Use MAP3134.

2512-9200

Explanation: Identify disk to be replaced.

Response: Use MAP3131.

2512-FFF3

Explanation: Disk media format bad.

Response: If the problem persists, use MAP3035.

2512-FFF4

Explanation: Disk drive problem.

Response: If the problem persists, use MAP3051.

Failing Item:

- FFC_722
-

2512-FFF6

Explanation: Disk detected recoverable error.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2512-FFFA

Explanation: Temporary disk bus error.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2512-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

2513-102E

Explanation: Reallocation failed due to disk out of alternate sectors.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2513-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2513-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2513-3020**Explanation:** Storage subsystem configuration error.**Response:** Use MAP3150.

2513-3100**Explanation:** Adapter detected device bus interface error.**Response:** Use MAP3150.

2513-3101**Explanation:** Adapter detected device bus interface error.**Response:** Use MAP3150.

2513-3109**Explanation:** Adapter timed out a disk command.**Response:** Use MAP3150.

2513-3110**Explanation:** Disk bus interface error.**Response:** Use MAP3150.

2513-7001**Explanation:** Temporary disk data error.**Failing Item:**

- FFC_722

2513-8008**Explanation:** Permanent cache battery pack failure.**Response:** Use MAP3000.**Failing Item:**

- FFC_2D06

2513-8009**Explanation:** Impending cache battery pack failure.**Response:** Use MAP3000.**Failing Item:**

- FFC_2D06

2513-9000**Explanation:** Controller detected a device error during configuration discovery.**Response:** Use MAP3190.

2513-9001**Explanation:** Controller detected a device error during configuration discovery.**Response:** Use MAP3190.

2513-9002**Explanation:** Controller detected a device error during configuration discovery.**Response:** Use MAP3190.

2513-9008**Explanation:** Controller does not support function expected for one or more disks.**Response:** Use MAP3130.

2513-9010**Explanation:** Cache data associated with attached disks cannot be found.**Response:** Use MAP3120.

2513-9011**Explanation:** Cache data belongs to disks other than those attached.**Response:** Use MAP3190.

2513-9020**Explanation:** Two or more disks are missing from a RAID-5 disk array.**Response:** Use MAP3111.

2513-9021**Explanation:** Two or more disks are missing from a RAID-5 disk array.**Response:** Use MAP3111.

2513-9022**Explanation:** Two or more disks are missing from a RAID-5 disk array.**Response:** Use MAP3111.

2513-9023**Explanation:** One or more disk array members are not at the required physical locations.**Response:** Use MAP3012.

2513-9024

Explanation: The physical location of disk array members conflict with another disk array.

Response: Use MAP3190.

2513-9025

Explanation: An incompatible disk is installed at a degraded disk location in the disk array.

Response: Use MAP3110.

2513-9026

Explanation: A previously degraded disk in the disk array was not found at the required physical location.

Response: Use MAP3190.

2513-9027

Explanation: A disk array is or would become degraded and the parity data is out of synchronization.

Response: Use MAP3113.

2513-9028

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2513-9029

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2513-9030

Explanation: The disk array is degraded due to a missing or failed disk.

Response: Use MAP3110.

2513-9031

Explanation: Automatic reconstruction initiated for the disk array.

Response: Use MAP3110.

2513-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2513-9041

Explanation: Background disk array parity checking detected and corrected errors.

Response: Use MAP3190.

2513-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2513-9050

Explanation: Required cache data cannot be located for one or more disks.

Response: Use MAP3031.

2513-9051

Explanation: Cache data exists for more than one missing or failed disks.

Response: Use MAP3132.

2513-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2513-9054

Explanation: RAID controller resources are not available due to previous problems.

Response: Use MAP3121.

2513-9060

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

2513-9061

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

2513-9062

Explanation: One or more disk pairs are missing from a RAID-0 disk array.

Response: Use MAP3111.

2513-9063

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2513-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2513-9074

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3141.

2513-9081

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

2513-9082

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

2513-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2513-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2513-9092

Explanation: Disk requires formatting before use.

Response: Use MAP3134.

2513-9200

Explanation: Identify disk to be replaced.

Response: Use MAP3131.

2513-FFF3

Explanation: Disk media format bad.

Response: If the problem persists, use MAP3035

2513-FFF4

Explanation: Disk drive problem.

Response: If the problem persists, use MAP3051

Failing Item:

- FFC_722
-

2513-FFF6

Explanation: Disk detected recoverable error.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2513-FFFA

Explanation: Temporary disk bus error.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2513-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

2514-102E

Explanation: Reallocation failed due to disk out of alternate sectors.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2514-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2514-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP3150.

2514-3020 • 2514-9022

Failing Item:

- FFC_722
-

2514-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

2514-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2514-3101

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2514-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

2514-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

2514-7001

Explanation: Temporary disk data error.

Failing Item:

- FFC_722
-

2514-8008

Explanation: Permanent cache battery pack failure.

Response: Use MAP3000.

Failing Item:

- FFC_2D03
-

2514-8009

Explanation: Impending cache battery pack failure.

Response: Use MAP3000.

Failing Item:

- FFC_2D03
-

2514-9000

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2514-9001

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2514-9002

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2514-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2514-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2514-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2514-9020

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2514-9021

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2514-9022

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2514-9023

Explanation: One or more disk array members are not at the required physical locations.

Response: Use MAP3012.

2514-9024

Explanation: The physical location of disk array members conflict with another disk array.

Response: Use MAP3190.

2514-9025

Explanation: An incompatible disk is installed at a degraded disk location in the disk array.

Response: Use MAP3110.

2514-9026

Explanation: A previously degraded disk in the disk array was not found at the required physical location.

Response: Use MAP3190.

2514-9027

Explanation: A disk array is or would become degraded and the parity data is out of synchronization.

Response: Use MAP3113.

2514-9028

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2514-9029

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2514-9030

Explanation: The disk array is degraded due to a missing or failed disk.

Response: Use MAP3110.

2514-9031

Explanation: Automatic reconstruction initiated for the disk array.

Response: Use MAP3110.

2514-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2514-9041

Explanation: Background disk array parity checking detected and corrected errors.

Response: Use MAP3190.

2514-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2514-9050

Explanation: Required cache data cannot be located for one or more disks.

Response: Use MAP3031.

2514-9051

Explanation: Cache data exists for more than one missing or failed disks.

Response: Use MAP3132.

2514-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2514-9054

Explanation: RAID controller resources are not available due to previous problems.

Response: Use MAP3121.

2514-9060

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

2514-9061

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

2514-9062

Explanation: One or more disk pairs are missing from a RAID-0 disk array.

Response: Use MAP3111.

2514-9063

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2514-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2514-9074

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3141.

2514-9081

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

2514-9082

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

2514-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2514-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2514-9092

Explanation: Disk requires formatting before use.

Response: Use MAP3134.

2514-9200

Explanation: Identify disk to be replaced.

Response: Use MAP3131.

2514-FFF3

Explanation: Disk media format bad.

Response: If the problem persists, use MAP3035.

2514-FFF4

Explanation: Disk drive problem.

Response: If the problem persists, use MAP3051.

Failing Item:

- FFC_722
-

2514-FFF6

Explanation: Disk detected recoverable error.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2514-FFFA

Explanation: Temporary disk bus error.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_722
-

2514-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

2515-102E

Explanation: Reallocation failed due to disk out of alternate sectors.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2515-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722

2515-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722

2515-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

2515-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2515-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

2515-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

2515-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3142.

2515-4020

Explanation: Configuration error, connections exceed IOA design limits.

Response: Use MAP3143.

2515-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP3144.

2515-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP3144.

2515-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146.

2515-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148.

2515-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP3153.

2515-4100

Explanation: Device bus fabric error.

Response: Use MAP3152.

2515-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP3152.

2515-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145.

2515-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2515
 - FFC_221
-

2515-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2515
- FFC_221

2515-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722

2515-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2515

2515-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2515

2515-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2515-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2515-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2515-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2515-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2515-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2515-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2515-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2515-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2515-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112.

2515-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190.

2515-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110.

2515-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190.

2515-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113.

2515-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2515-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190.

2515-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2515-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110.

2515-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2515-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190.

2515-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2515-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131.

2515-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132.

2515-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2515-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121.

2515-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111.

2515-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2515-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2515-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2515-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2515-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP3141.

2515-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP3149.

2515-9076

Explanation: Missing remote controller.

Response: Use MAP3147.

2515-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2515-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2515-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2515-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2515-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134.

2515-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2515
-

2515-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135.

2515-FFF4

Explanation: Disk drive problem.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2515-FFF6

Explanation: Disk detected recoverable error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2515-FFFA

Explanation: Temporary disk error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2515-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

Note: Device may only identify adapter port, e.g. 00pFFE, where 'p' is port.

2516-102E

Explanation: Reallocation failed due to disk out of alternate sectors.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2516-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722

2516-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722

2516-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

2516-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2516-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

2516-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

2516-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3142.

2516-4020

Explanation: Configuration error, connections exceed IOA design limits.

Response: Use MAP3143.

2516-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP3144.

2516-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP3144.

2516-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146.

2516-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148.

2516-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP3153.

2516-4100

Explanation: Device bus fabric error.

Response: Use MAP3152.

2516-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP3152.

2516-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145.

2516-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2516
 - FFC_221
-

2516-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2516
- FFC_221

2516-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722

2516-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2516

2516-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2516

2516-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2516-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2516-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2516-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2516-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2516-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2516-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2516-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2516-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2516-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112.

2516-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190.

2516-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110.

2516-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190.

2516-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113.

2516-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2516-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190.

2516-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2516-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110.

2516-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2516-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190.

2516-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2516-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131.

2516-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132.

2516-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2516-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121.

2516-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111.

2516-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2516-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2516-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2516-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2516-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP3141.

2516-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP3149.

2516-9076

Explanation: Missing remote controller.

Response: Use MAP3147.

2516-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2516-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2516-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2516-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2516-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134.

2516-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2516
-

2516-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135.

2516-FFF4

Explanation: Disk drive problem.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2516-FFF6

Explanation: Disk detected recoverable error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2516-FFFA

Explanation: Temporary disk error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2516-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

Note: Device may only identify adapter port, e.g. 00pFFE, where 'p' is port.

2517-102E

Explanation: Reallocation failed due to disk out of alternate sectors.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2517-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722

2517-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722

2517-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

2517-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2517-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

2517-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

2517-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3142.

2517-4020

Explanation: Configuration error, connections exceed IOA design limits.

Response: Use MAP3143.

2517-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP3144.

2517-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP3144.

2517-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146.

2517-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148.

2517-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP3153.

2517-4100

Explanation: Device bus fabric error.

Response: Use MAP3152.

2517-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP3152.

2517-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145.

2517-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2517
 - FFC_221
-

2517-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2517
- FFC_221

2517-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722

2517-8008

Explanation: A permanent cache battery pack failure occurred.

Response: Use MAP3100.

Failing Item:

- FFC_2D03

2517-8009

Explanation: A permanent cache battery pack failure occurred.

Response: Use MAP3100.

Failing Item:

- FFC_2D03

2517-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2517

2517-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2517

2517-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2517-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2517-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2517-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2517-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2517-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2517-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2517-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2517-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2517-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112.

2517-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190.

2517-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110.

2517-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190.

2517-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113.

2517-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2517-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190.

2517-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2517-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110.

2517-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2517-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190.

2517-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2517-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131.

2517-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132.

2517-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2517-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121.

2517-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111.

2517-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2517-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2517-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2517-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2517-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP3141.

2517-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP3149.

2517-9076

Explanation: Missing remote controller.

Response: Use MAP3147.

2517-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2517-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2517-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2517-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2517-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134.

2517-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2517
-

2517-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135.

2517-FFF4

Explanation: Disk drive problem.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2517-FFF6

Explanation: Disk detected recoverable error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2517-FFFA

Explanation: Temporary disk error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2517-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

Note: Device may only identify adapter port, e.g. 00pFFE, where 'p' is port.

2518-102E

Explanation: Reallocation failed due to disk out of alternate sectors.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2518-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2518-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2518-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

2518-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2518-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

2518-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

2518-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3142.

2518-4020

Explanation: Configuration error, connections exceed IOA design limits.

Response: Use MAP3143.

2518-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP3144.

2518-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP3144.

2518-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146.

2518-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148.

2518-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP3153.

2518-4100

Explanation: Device bus fabric error.

Response: Use MAP3152.

2518-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP3152.

2518-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145.

2518-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2518
 - FFC_221
-

2518-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2518
 - FFC_221
-

2518-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2518-8008

Explanation: A permanent cache battery pack failure occurred.

Response: Use MAP3100.

Failing Item:

- FFC_2D0E
-

2518-8009

Explanation: A permanent cache battery pack failure occurred.

Response: Use MAP3100.

Failing Item:

- FFC_2D0E
-

2518-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2518
-

2518-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2518
-

2518-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2518-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2518-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2518-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2518-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2518-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2518-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2518-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2518-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2518-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112.

2518-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190.

2518-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110.

2518-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190.

2518-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113.

2518-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2518-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190.

2518-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2518-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110.

2518-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2518-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190.

2518-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2518-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131.

2518-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132.

2518-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2518-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121.

2518-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111.

2518-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2518-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2518-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2518-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2518-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP3141.

2518-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP3149.

2518-9076

Explanation: Missing remote controller.

Response: Use MAP3147.

2518-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2518-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2518-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2518-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2518-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134.

2518-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2518
-

2518-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135.

2518-FFF4

Explanation: Disk drive problem.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2518-FFF6

Explanation: Disk detected recoverable error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2518-FFFA

Explanation: Temporary disk error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2518-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

Note: Device may only identify adapter port, e.g. 00pFFE, where 'p' is port.

2519-102E

Explanation: Reallocation failed due to disk out of alternate sectors.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2519-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2519-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2519-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

2519-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2519-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

2519-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

2519-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3142.

2519-4020

Explanation: Configuration error, connections exceed IOA design limits.

Response: Use MAP3143.

2519-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP3144.

2519-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP3144.

2519-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146.

2519-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148.

2519-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP3153.

2519-4100

Explanation: Device bus fabric error.

Response: Use MAP3152.

2519-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP3152.

2519-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145.

2519-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2519
 - FFC_221
-

2519-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2519
 - FFC_221
-

2519-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2519-8008

Explanation: A permanent cache battery pack failure occurred.

Response: Use MAP3100.

Failing Item:

- FFC_2D06
-

2519-8009

Explanation: A permanent cache battery pack failure occurred.

Response: Use MAP3100.

Failing Item:

- FFC_2D06
-

2519-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2519
-

2519-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2519
-

2519-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2519-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2519-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2519-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2519-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2519-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2519-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2519-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2519-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2519-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112.

2519-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190.

2519-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110.

2519-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190.

2519-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113.

2519-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2519-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190.

2519-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2519-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110.

2519-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2519-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190.

2519-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2519-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131.

2519-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132.

2519-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2519-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121.

2519-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111.

2519-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2519-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2519-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2519-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2519-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP3141.

2519-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP3149.

2519-9076

Explanation: Missing remote controller.

Response: Use MAP3147.

2519-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2519-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2519-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2519-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2519-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134.

2519-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2519
-

2519-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135.

2519-FFF4

Explanation: Disk drive problem.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2519-FFF6

Explanation: Disk detected recoverable error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2519-FFFA

Explanation: Temporary disk error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2519-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

Note: Device may only identify adapter port, e.g. 00pFFF, where 'p' is port.

251D-102E

Explanation: Reallocation failed due to disk out of alternate sectors.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

251D-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

251D-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

251D-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

251D-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

251D-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

251D-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

251D-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3142.

251D-4020

Explanation: Configuration error, connections exceed IOA design limits.

Response: Use MAP3143.

251D-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP3144.

251D-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP3144.

251D-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146.

251D-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148.

251D-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP3153.

251D-4100

Explanation: Device bus fabric error.

Response: Use MAP3152.

251D-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP3152.

251D-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145.

251D-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_251D
 - FFC_221
-

251D-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_251D
 - FFC_221
-

251D-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

251D-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_251D
-

251D-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_251D
-

251D-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

251D-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

251D-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

251D-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

251D-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

251D-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

251D-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

251D-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

251D-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

251D-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112.

251D-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190.

251D-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110.

251D-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190.

251D-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113.

251D-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

251D-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190.

251D-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

251D-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110.

251D-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

251D-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190.

251D-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

251D-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131.

251D-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132.

251D-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

251D-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121.

251D-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111.

251D-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

251D-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

251D-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

251D-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

251D-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP3141.

251D-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP3149.

251D-9076

Explanation: Missing remote controller.

Response: Use MAP3147.

251D-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

251D-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

251D-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

251D-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

251D-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134.

251D-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_251D
-

251D-FFF3**Explanation:** Disk media format bad.**Response:** Use MAP3135.

251D-FFF4**Explanation:** Disk drive problem.**Response:** Use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_722

251D-FFF6**Explanation:** Disk detected recoverable error.**Response:** Use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_722

251D-FFFA**Explanation:** Temporary disk error.**Response:** Use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_722

251D-FFFFE**Explanation:** Temporary disk bus error.**Response:** Use MAP3150.

Note: Device may only identify adapter port, e.g. 00pFFF, where 'p' is port.

2522-102E**Explanation:** Reallocation failed due to disk out of alternate sectors.**Response:** If the problem persists, use MAP3150.**Failing Item:**

- FFC_722

2522-3002**Explanation:** Addressed device failed to respond to selection.**Response:** If the problem persists, use MAP3150.**Failing Item:**

- FFC_722

2522-3010**Explanation:** Disk returned wrong response to adapter.**Response:** If the problem persists, use MAP3150.**Failing Item:**

- FFC_722

2522-3020**Explanation:** Storage subsystem configuration error.**Response:** Use MAP3150.

2522-3100**Explanation:** Adapter detected device bus interface error.**Response:** Use MAP3150.

2522-3101**Explanation:** Adapter detected device bus interface error.**Response:** Use MAP3150.

2522-3109**Explanation:** Adapter timed out a disk command.**Response:** Use MAP3150.

2522-3110**Explanation:** Disk bus interface error.**Response:** Use MAP3150.

2522-7001**Explanation:** Temporary disk data error.**Failing Item:**

- FFC_722

2522-9000**Explanation:** Controller detected a device error during configuration discovery.**Response:** Use MAP3190.

2522-9001**Explanation:** Controller detected a device error during configuration discovery.**Response:** Use MAP3190.

2522-9002

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2522-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2522-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2522-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2522-9020

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2522-9021

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2522-9022

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2522-9023

Explanation: One or more disk array members are not at the required physical locations.

Response: Use MAP3012.

2522-9024

Explanation: The physical location of disk array members conflict with another disk array.

Response: Use MAP3190.

2522-9025

Explanation: An incompatible disk is installed at a degraded disk location in the disk array.

Response: Use MAP3110.

2522-9026

Explanation: A previously degraded disk in the disk array was not found at the required physical location.

Response: Use MAP3190.

2522-9027

Explanation: A disk array is or would become degraded and the parity data is out of synchronization.

Response: Use MAP3113.

2522-9028

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2522-9029

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2522-9030

Explanation: The disk array is degraded due to a missing or failed disk.

Response: Use MAP3110.

2522-9031

Explanation: Automatic reconstruction initiated for the disk array.

Response: Use MAP3110.

2522-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2522-9041

Explanation: Background disk array parity checking detected and corrected errors.

Response: Use MAP3190.

2522-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2522-9050

Explanation: Required cache data cannot be located for one or more disks.

Response: Use MAP3031.

2522-9051

Explanation: Cache data exists for more than one missing or failed disks.

Response: Use MAP3132.

2522-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2522-9054

Explanation: RAID controller resources are not available due to previous problems.

Response: Use MAP3121.

2522-9060

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

2522-9061

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

2522-9062

Explanation: One or more disk pairs are missing from a RAID-0 disk array.

Response: Use MAP3111.

2522-9063

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2522-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2522-9074

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3141.

2522-9081

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

2522-9082

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

2522-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2522-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2522-9092

Explanation: Disk requires formatting before use.

Response: Use MAP3134.

2522-9200

Explanation: Identify disk to be replaced.

Response: Use MAP3131.

2522-FFF3

Explanation: Disk media format bad.

Response: If the problem persists, use MAP3035

2522-FFF4

Explanation: Disk drive problem.

Response: If the problem persists, use MAP3051.

Failing Item:

- FFC_722
-

2522-FFF6

Explanation: Disk detected recoverable error.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2522-FFFA

Explanation: Temporary disk bus error.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2522-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

2523-102E

Explanation: Reallocation failed due to disk out of alternate sectors.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2523-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2523-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2523-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

2523-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2523-3101

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2523-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

2523-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

2523-7001

Explanation: Temporary disk data error.

Failing Item:

- FFC_722
-

2523-8008

Explanation: Permanent cache battery pack failure.

Response: Use MAP3000.

Failing Item:

- FFC_2526
-

2523-8009

Explanation: Impending cache battery pack failure.

Response: Use MAP3000.

Failing Item:

- FFC_2526
-

2523-9000

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2523-9001

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2523-9002

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2523-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2523-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2523-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2523-9020

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2523-9021

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2523-9022

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2523-9023

Explanation: One or more disk array members are not at the required physical locations.

Response: Use MAP3012.

2523-9024

Explanation: The physical location of disk array members conflict with another disk array.

Response: Use MAP3190.

2523-9025

Explanation: An incompatible disk is installed at a degraded disk location in the disk array.

Response: Use MAP3110.

2523-9026

Explanation: A previously degraded disk in the disk array was not found at the required physical location.

Response: Use MAP3190.

2523-9027

Explanation: A disk array is or would become degraded and the parity data is out of synchronization.

Response: Use MAP3113.

2523-9028

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2523-9029

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2523-9030

Explanation: The disk array is degraded due to a missing or failed disk.

Response: Use MAP3110.

2523-9031

Explanation: Automatic reconstruction initiated for the disk array.

Response: Use MAP3110.

2523-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2523-9041

Explanation: Background disk array parity checking detected and corrected errors.

Response: Use MAP3190.

2523-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2523-9050

Explanation: Required cache data cannot be located for one or more disks.

Response: Use MAP3031.

2523-9051

Explanation: Cache data exists for more than one missing or failed disks.

Response: Use MAP3132.

2523-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2523-9054

Explanation: RAID controller resources are not available due to previous problems.

Response: Use MAP3121.

2523-9060

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

2523-9061

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

2523-9062

Explanation: One or more disk pairs are missing from a RAID-0 disk array.

Response: Use MAP3111.

2523-9063

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2523-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2523-9074

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3141.

2523-9081

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

2523-9082

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

2523-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2523-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2523-9092

Explanation: Disk requires formatting before use.

Response: Use MAP3134.

2523-9200

Explanation: Identify disk to be replaced.

Response: Use MAP3131.

2523-FFF3

Explanation: Disk media format bad.

Response: If the problem persists, use MAP3035.

2523-FFF4

Explanation: Disk drive problem.

Response: If the problem persists, use MAP3051.

Failing Item:

- FFC_722
-

2523-FFF6

Explanation: Disk detected recoverable error.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2523-FFFA

Explanation: Temporary disk bus error.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_722
-

2523-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

2527-102E

Explanation: Reallocation failed due to disk out of alternate sectors.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2527-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2527-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2527-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

Failing Item:

- FFC_2527
-

2527-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

Failing Item:

- FFC_2527
-

2527-3101

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

Failing Item:

- FFC_2527
-

2527-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

Failing Item:

- FFC_2527
-

2527-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

Failing Item:

- FFC_2527
-

2527-7001

Explanation: Description: Temporary disk data error.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2527-8008

Explanation: Permanent Cache Battery Pack failure.

Response: Use MAP3000.

Failing Item:

- FFC_2D01

2527-8009

Explanation: Impending Cache Battery Pack failure.

Response: Use MAP3000.

Failing Item:

- FFC_2D01

2527-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2527-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2527-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2527-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2527-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2527-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2527-9020

Explanation: Description: Two or more disks are missing from a RAID-5 Disk Array.

Response: Use MAP3111.

2527-9021

Explanation: Two or more disks are missing from a RAID-5 Disk Array.

Response: Use MAP3111.

2527-9022

Explanation: Two or more disks are missing from a RAID-5 Disk Array.

Response: Use MAP3111.

2527-9023

Explanation: Description: One or more Disk Array members are not at required physical locations.

Response: Use MAP3012.

2527-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3090.

2527-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110.

2527-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190.

2527-9027

Explanation: Description: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113.

2527-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2527-9029

Explanation: Maximum number of functional Disk Array disks has been exceeded.

Response: Use MAP3190.

2527-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2527-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110.

2527-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2527-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190.

2527-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2527-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3031

2527-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132.

2527-9052

Explanation: Description: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2527-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121.

2527-9060

Explanation: Description: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111.

2527-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2527-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2527-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2527-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2527-9074

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3141.

2527-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3090.

2527-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3090.

2527-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2527-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3033.

2527-9092

Explanation: Description: Disk requires Format before use.

Response: Use MAP3134.

2527-9200

Explanation: Identify disk to be replaced.

Response: Use MAP3131.

2527-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135.

2527-FFF4

Explanation: Description: Disk drive problem.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2527-FFF6

Explanation: Description: Disk detected recoverable error.

Response: If the problem persists, use MAP3051.

Failing Item:

- FFC_722
-

2527-FFFA

Explanation: Temporary disk error.

Response: If the problem persists, use MAP3051.

2527-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

Failing Item:

- FFC_722
-

2528-102E

Explanation: Reallocation failed due to disk out of alternate sectors.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2528-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2528-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2528-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

2528-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2528-3101

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2528-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

2528-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

2528-7001

Explanation: Temporary disk data error.

Failing Item:

- FFC_722
-

2528-9000

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2528-9001

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2528-9002

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2528-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2528-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2528-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2528-9020

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2528-9021

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2528-9022

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2528-9023

Explanation: One or more disk array members are not at the required physical locations.

Response: Use MAP3012.

2528-9024

Explanation: The physical location of disk array members conflict with another disk array.

Response: Use MAP3190.

2528-9025

Explanation: An incompatible disk is installed at a degraded disk location in the disk array.

Response: Use MAP3110.

2528-9026

Explanation: A previously degraded disk in the disk array was not found at the required physical location.

Response: Use MAP3190.

2528-9027

Explanation: A disk array is or would become degraded and the parity data is out of synchronization.

Response: Use MAP3113.

2528-9028

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2528-9029

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2528-9030

Explanation: The disk array is degraded due to a missing or failed disk.

Response: Use MAP3110.

2528-9031

Explanation: Automatic reconstruction initiated for the disk array.

Response: Use MAP3110.

2528-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2528-9041

Explanation: Background disk array parity checking detected and corrected errors.

Response: Use MAP3190.

2528-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2528-9050

Explanation: Required cache data cannot be located for one or more disks.

Response: Use MAP3031

2528-9051

Explanation: Cache data exists for more than one missing or failed disks.

Response: Use MAP3132.

2528-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2528-9054

Explanation: RAID controller resources are not available due to previous problems.

Response: Use MAP3121.

2528-9060

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

2528-9061

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

2528-9062

Explanation: One or more disk pairs are missing from a RAID-0 disk array.

Response: Use MAP3111.

2528-9063

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2528-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2528-9074

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3141.

2528-9081

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

2528-9082

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

2528-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2528-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2528-9092

Explanation: Disk requires formatting before use.

Response: Use MAP3134.

2528-9200

Explanation: Identify disk to be replaced.

Response: Use MAP3131.

2528-FFF3

Explanation: Disk media format bad.

Response: If the problem persists, use MAP3035.

2528-FFF4

Explanation: Disk drive problem.

Response: If the problem persists, use MAP3051.

Failing Item:

- FFC_722
-

2528-FFF6

Explanation: Disk detected recoverable error.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2528-FFFA

Explanation: Temporary disk bus error.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_722
-

2528-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

2529-102E

Explanation: Reallocation failed due to disk out of alternate sectors.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2529-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2529-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2529-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

2529-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2529-3101

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2529-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

2529-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

2529-7001

Explanation: Temporary disk data error.

Failing Item:

- FFC_722
-

2529-8008

Explanation: Permanent cache battery pack failure.

Response: Use MAP3000.

Failing Item:

- FFC_2526

2529-8009

Explanation: Impending cache battery pack failure.

Response: Use MAP3000.

Failing Item:

- FFC_2526

2529-9000

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2529-9001

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2529-9002

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2529-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2529-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2529-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2529-9020

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2529-9021

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2529-9022

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2529-9023

Explanation: One or more disk array members are not a the required physical locations.

Response: Use MAP3012.

2529-9024

Explanation: The physical location of disk array members conflict with another disk array.

Response: Use MAP3190.

2529-9025

Explanation: An incompatible disk is installed at a degraded disk location in the disk array.

Response: Use MAP3110.

2529-9026

Explanation: A previously degraded disk in the disk array was not found at the required physical location.

Response: Use MAP3190.

2529-9027

Explanation: A disk array is or would become degraded and the parity data is out of synchronization.

Response: Use MAP3113.

2529-9028

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2529-9029

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2529-9030

Explanation: The disk array is degraded due to a missing or failed disk.

Response: Use MAP3110.

2529-9031

Explanation: Automatic reconstruction initiated for the disk array.

Response: Use MAP3110.

2529-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2529-9041

Explanation: Background disk array parity checking detected and corrected errors.

Response: Use MAP3190.

2529-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2529-9050

Explanation: Required cache data cannot be located for one or more disks.

Response: Use MAP3031.

2529-9051

Explanation: Cache data exists for more than one missing or failed disks.

Response: Use MAP3132.

2529-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2529-9054

Explanation: RAID controller resources are not available due to previous problems.

Response: Use MAP3121.

2529-9060

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

2529-9061

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

2529-9062

Explanation: One or more disk pairs are missing from a RAID-0 disk array.

Response: Use MAP3111.

2529-9063

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2529-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2529-9074

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3141.

2529-9081

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

2529-9082

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

2529-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2529-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2529-9092

Explanation: Disk requires formatting before use.

Response: Use MAP3134.

2529-9200

Explanation: Identify disk to be replaced.

Response: Use MAP3131.

2529-FFF3

Explanation: Disk media format bad.

Response: If the problem persists, use MAP3035.

2529-FFF4

Explanation: Disk drive problem.

Response: If the problem persists, use MAP3051.

Failing Item:

- FFC_722
-

2529-FFF6

Explanation: Disk detected recoverable error.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2529-FFFA

Explanation: Temporary disk bus error.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_722
-

2529-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

252B-102E

Explanation: Reallocation failed due to disk out of alternate sectors.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

252B-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

252B-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

252B-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

252B-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

252B-3101

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

252B-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

252B-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

252B-7001

Explanation: Temporary disk data error.

Failing Item:

- FFC_722
-

252B-9000

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

252B-9001

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

252B-9002

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

252B-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

252B-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

252B-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

252B-9020

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

252B-9021

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

252B-9022

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

252B-9023

Explanation: One or more disk array members are not at the required physical locations.

Response: Use MAP3012.

252B-9024

Explanation: The physical location of disk array members conflict with another disk array.

Response: Use MAP3190.

252B-9025

Explanation: An incompatible disk is installed at a degraded disk location in the disk array.

Response: Use MAP3110.

252B-9026

Explanation: A previously degraded disk in the disk array was not found at the required physical location.

Response: Use MAP3190. .

252B-9027

Explanation: A disk array is or would become degraded and the parity data is out of synchronization.

Response: Use MAP3113.

252B-9028

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

252B-9029

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

252B-9030

Explanation: The disk array is degraded due to a missing or failed disk.

Response: Use MAP3110.

252B-9031

Explanation: Automatic reconstruction initiated for the disk array.

Response: Use MAP3110.

252B-9032

Explanation: Disk Array is degraded due to missing failed disk.

Response: Use MAP3110.

252B-9041

Explanation: Background disk array parity checking detected and corrected errors.

Response: Use MAP3190.

252B-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

252B-9050

Explanation: Required cache data cannot be located for one or more disks.

Response: Use MAP3031

252B-9051

Explanation: Cache data exists for more than one missing or failed disks.

Response: Use MAP3132.

252B-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

252B-9054

Explanation: RAID controller resources are not available due to previous problems.

Response: Use MAP3121.

252B-9060

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

252B-9061

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

252B-9062

Explanation: One or more disk pairs are missing from a RAID-0 disk array.

Response: Use MAP3111.

252B-9063

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

252B-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

252B-9074

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3141.

252B-9081

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

252B-9082

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

252B-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

252B-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

252B-9092

Explanation: Disk requires formatting before use.

Response: Use MAP3134.

252B-9200

Explanation: Identify disk to be replaced.

Response: Use MAP3131.

252B-FFF3

Explanation: Disk media format bad.

Response: If the problem persists, use MAP3035.

252B-FFF4

Explanation: Disk drive problem.

Response: If the problem persists, use MAP3051.

Failing Item:

- FFC_722
-

252B-FFF6

Explanation: Disk detected recoverable error.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

252B-FFFA

Explanation: Temporary disk bus error.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_722
-

252B-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

252D-102E

Explanation: Reallocation failed due to disk out of alternate sectors.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

252D-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

252D-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

252D-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

252D-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

252D-3101

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

252D-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

252D-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

252D-7001

Explanation: Temporary disk data error.

Failing Item:

- FFC_722
-

252D-9000

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

252D-9001

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

252D-9002

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

252D-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

252D-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

252D-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

252D-9020

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

252D-9021

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

252D-9022

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

252D-9023

Explanation: One or more disk array members are not at the required physical locations.

Response: Use MAP3012.

252D-9024

Explanation: The physical location of disk array members conflict with another disk array.

Response: Use MAP3190.

252D-9025

Explanation: An incompatible disk is installed at a degraded disk location in the disk array.

Response: Use MAP3110.

252D-9026

Explanation: A previously degraded disk in the disk array was not found at the required physical location.

Response: Use MAP3190.

252D-9027

Explanation: A disk array is or would become degraded and the parity data is out of synchronization.

Response: Use MAP3113.

252D-9028

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

252D-9029

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

252D-9030

Explanation: The disk array is degraded due to a missing or failed disk.

Response: Use MAP3110.

252D-9031

Explanation: Automatic reconstruction initiated for the disk array.

Response: Use MAP3110.

252D-9032

Explanation: Disk Array is degraded due to missing failed disk.

Response: Use MAP3110.

252D-9041

Explanation: Background disk array parity checking detected and corrected errors.

Response: Use MAP3190.

252D-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

252D-9050

Explanation: Required cache data cannot be located for one or more disks.

Response: Use MAP3031

252D-9051

Explanation: Cache data exists for more than one missing or failed disks.

Response: Use MAP3132.

252D-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

252D-9054

Explanation: RAID controller resources are not available due to previous problems.

Response: Use MAP3121.

252D-9060

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

252D-9061

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

252D-9062

Explanation: One or more disk pairs are missing from a RAID-0 disk array.

Response: Use MAP3111.

252D-9063

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

252D-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

252D-9074

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3141.

252D-9081

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

252D-9082

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

252D-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

252D-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

252D-9092

Explanation: Disk requires formatting before use.

Response: Use MAP3134.

252D-9200

Explanation: Identify disk to be replaced.

Response: Use MAP3131.

252D-FFF3

Explanation: Disk media format bad.

Response: If the problem persists, use MAP3035.

252D-FFF4

Explanation: Disk drive problem.

Response: If the problem persists, use MAP3051.

Failing Item:

- FFC_722
-

252D-FFF6

Explanation: Disk detected recoverable error.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

252D-FFFA

Explanation: Temporary disk bus error.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_722
-

252D-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

252E-102E

Explanation: Reallocation failed due to disk out of alternate sectors.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

252E-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

252E-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

252E-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

252E-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

252E-3101

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

252E-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

252E-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

252E-7001

Explanation: Temporary disk data error.

Failing Item:

- FFC_722
-

252E-8008

Explanation: Permanent cache battery pack failure.

Response: Use MAP3000.

Failing Item:

- FFC_2D06
-

252E-8009

Explanation: Impending cache battery pack failure.

Response: Use MAP3000.

Failing Item:

- FFC_2D06

252E-9000

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

252E-9001

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

252E-9002

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

252E-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

252E-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

252E-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

252E-9020

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

252E-9021

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

252E-9022

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

252E-9023

Explanation: One or more disk array members are not at the required physical locations.

Response: Use MAP3012.

252E-9024

Explanation: The physical location of disk array members conflict with another disk array.

Response: Use MAP3190.

252E-9025

Explanation: An incompatible disk is installed at a degraded disk location in the disk array.

Response: Use MAP3110.

252E-9026

Explanation: A previously degraded disk in the disk array was not found at the required physical location.

Response: Use MAP3190. .

252E-9027

Explanation: A disk array is or would become degraded and the parity data is out of synchronization.

Response: Use MAP3113.

252E-9028

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

252E-9029

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

252E-9030

Explanation: The disk array is degraded due to a missing or failed disk.

Response: Use MAP3110.

252E-9031

Explanation: Automatic reconstruction initiated for the disk array.

Response: Use MAP3110.

252E-9032

Explanation: Disk Array is degraded due to missing failed disk.

Response: Use MAP3110.

252E-9041

Explanation: Background disk array parity checking detected and corrected errors.

Response: Use MAP3190.

252E-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

252E-9050

Explanation: Required cache data cannot be located for one or more disks.

Response: Use MAP3031

252E-9051

Explanation: Cache data exists for more than one missing or failed disks.

Response: Use MAP3132.

252E-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

252E-9054

Explanation: RAID controller resources are not available due to previous problems.

Response: Use MAP3121.

252E-9060

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

252E-9061

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

252E-9062

Explanation: One or more disk pairs are missing from a RAID-0 disk array.

Response: Use MAP3111.

252E-9063

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

252E-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

252E-9074

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3141.

252E-9081

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

252E-9082

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

252E-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

252E-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

252E-9092

Explanation: Disk requires formatting before use.

Response: Use MAP3134.

252E-9200**Explanation:** Identify disk to be replaced.**Response:** Use MAP3131.

252E-FFF3**Explanation:** Disk media format bad.**Response:** If the problem persists, use MAP3035.

252E-FFF4**Explanation:** Disk drive problem.**Response:** If the problem persists, use MAP3051.**Failing Item:**

- FFC_722

252E-FFF6**Explanation:** Disk detected recoverable error.**Response:** If the problem persists, use MAP3150.**Failing Item:**

- FFC_722

252E-FFFA**Explanation:** Temporary disk bus error.**Response:** If the problem persists, use MAP3150.**Failing Item:**

- FFC_722

252E-FFFE**Explanation:** Temporary disk bus error.**Response:** Use MAP3150.

256E-2101**Explanation:** Error log analysis indicates an adapter failure.**Response:** Use MAP0210 : General problem resolution.**Failing Item:**

- FFC_256E

256E-2103**Explanation:** Error log analysis indicates a hardware error.**Response:** Use MAP0210 : General problem resolution.**Failing Item:**

- FFC_256E
- FFC_221

256E-2202**Explanation:** Error log analysis indicates an adapter failure.**Response:** Use MAP0210 : General problem resolution.**Failing Item:**

- FFC_256E

256E-2501**Explanation:** Register Test Failed**Response:** Use MAP0210 : General problem resolution.**Failing Item:**

- FFC_256E

256E-2502**Explanation:** External wrap test failure**Response:** Use MAP0210 : General problem resolution.**Failing Item:**

- FFC_256E

256E-2503**Explanation:** External wrap test failure**Response:** Use MAP0210 : General problem resolution.**Failing Item:**

- FFC_256E

256E-2504**Explanation:** External wrap test failure**Response:** Use MAP0210 : General problem resolution.**Failing Item:**

- FFC_256E

256E-2505**Explanation:** Internal wrap test failure**Response:** Use MAP0210 : General problem resolution.**Failing Item:**

- FFC_256E
- FFC_221

256E-2506**Explanation:** Internal wrap test failure**Response:** Use MAP0210 : General problem resolution.**Failing Item:**

- FFC_256E

256E-2507

Explanation: Internal wrap test failure

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_256E

256E-2511

Explanation: Enhanced error handling failure on bus.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_221

256E-2601

Explanation: Registers test failure

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_256E
- FFC_221

256E-2610

Explanation: Interrupt test failure

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_256E
- FFC_221

256E-2612

Explanation: Enhanced error handling failure while testing the adapter.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_256E
- FFC_221

26PAA

Explanation: An SSA Threshold Exceeded link error was detected.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.
Note:

P denotes the adapter port number.

AA denotes the SSA address.

2600-101

Explanation: The Fibre Channel Adapter configuration failed.

Failing Item:

- FFC_2600

2600-102

Explanation: The Reset test failed.

Failing Item:

- FFC_2600

2600-103

Explanation: The Register test failed.

Failing Item:

- FFC_2600

2600-104

Explanation: The SRAM test failed.

Failing Item:

- FFC_2600

2600-105

Explanation: The Internal Wrap test failed.

Failing Item:

- FFC_2600

2600-106

Explanation: The Gigabaud Link Module (GLM) Wrap Test Failure.

Failing Item:

- FFC_2600

2600-107

Explanation: The External Wrap test failed.

Failing Item:

- FFC_2600

2600-109

Explanation: Enhanced Error Handling Failure on EADs chip.

Failing Item:

- FFC_221
-

2600-110

Explanation: Enhanced Error Handling Failure on adapter.

Failing Item:

- FFC_2600
-

2600-201

Explanation: The Configuration Register test failed.

Failing Item:

- FFC_2600
 - FFC_221
-

2600-202

Explanation: The Interrupt test failed.

Failing Item:

- FFC_2600
 - FFC_221
-

2600-203

Explanation: The PCI Wrap test failed.

Failing Item:

- FFC_2600
 - FFC_221
-

2600-204

Explanation: The DMA test failed.

Failing Item:

- FFC_2600
 - FFC_221
-

2600-205

Explanation: I/O error on a read/write operation.

Failing Item:

- FFC_2600
 - FFC_221
-

2600-701

Explanation: Error log analysis indicates that an error has occurred with the adapter.

Failing Item:

- FFC_2600
 - FFC_221
-

2600-703

Explanation: Error log analysis indicates that an unknown adapter error has occurred.

Failing Item:

- FFC_2600
-

2600-704

Explanation: Error log analysis indicates that an adapter error has occurred.

Failing Item:

- FFC_2600
-

2600-705

Explanation: A parity error has been detected. The adapter must be replaced immediately. Failure to do so could result in data being read or written incorrectly.

Failing Item:

- FFC_2600
-

2600-706

Explanation: A fatal hardware error has occurred. This adapter was successfully taken offline. It will remain offline until reconfigured or the system is rebooted. This adapter must be replaced and not brought back online. Failure to adhere to this action could result in data being read or written incorrectly or in the loss of data.

Failing Item:

- FFC_2600
-

2601-102

Explanation: The Reset test failed.

Failing Item:

- FFC_2601
-

2601-103

Explanation: The Register test failed.

Failing Item:

- FFC_2601
-

2601-104

Explanation: The SRAM test failed.

Failing Item:

- FFC_2601
-

2601-105

Explanation: The Internal Wrap test failed.

Failing Item:

- FFC_2601
-

2601-106

Explanation: The Gigabaud Link Module (GLM) Wrap Test Failure.

Failing Item:

- FFC_2601
-

2601-107

Explanation: The External Wrap test failed.

Failing Item:

- FFC_2601
-

2601-108

Explanation: Enhanced Error Handling Failure on bus

Failing Item:

- FFC_221
-

2601-110

Explanation: Enhanced Error Handling Failure on adapter

Failing Item:

- FFC_2601
-

2601-201

Explanation: The Configuration Register test failed.

Failing Item:

- FFC_2601
 - FFC_221
-

2601-202

Explanation: The Interrupt test failed.

Failing Item:

- FFC_2601
 - FFC_221
-

2601-203

Explanation: The PCI Wrap test failed.

Failing Item:

- FFC_2601
-

2601-204

Explanation: The DMA test failed.

Failing Item:

- FFC_2601
 - FFC_221
-

2601-205

Explanation: I/O error on a read/write operation.

Failing Item:

- FFC_2601
 - FFC_221
-

2601-701

Explanation: Error log analysis indicates that an error has occurred with the adapter.

Failing Item:

- FFC_2601
-

2601-703

Explanation: Error log analysis indicates that an unknown adapter error has occurred.

Failing Item:

- FFC_2601
-

2601-704

Explanation: Error log analysis indicates that an adapter error has occurred.

Failing Item:

- FFC_2601
-

2601-705

Explanation: A parity error has been detected. The adapter must be replaced immediately. Failure to do so could result in data being read or written incorrectly.

Failing Item:

- FFC_2601
-

2601-706

Explanation: A fatal hardware error has occurred. This adapter was successfully taken offline. It will remain offline until reconfigured or the system is rebooted. This adapter must be replaced and not brought back online. Failure to adhere to this action could result in data being read or written incorrectly or in the loss of data.

Failing Item:

- FFC_2601
-

2602-102

Explanation: The Reset test failed.

Failing Item:

- FFC_2602
-

2602-103

Explanation: The Register test failed.

Failing Item:

- FFC_2602
-

2602-104

Explanation: The SRAM test failed.

Failing Item:

- FFC_2602
-

2602-105

Explanation: The Internal Wrap test failed.

Failing Item:

- FFC_2602
-

2602-106

Explanation: The Gigabaud Link Module (GLM) Wrap Test Failure.

Failing Item:

- FFC_2602
-

2602-107

Explanation: The External Wrap test failed.

Failing Item:

- FFC_2602
-

2602-108

Explanation: Enhanced Error Handling Failure on bus

Failing Item:

- FFC_221
-

2602-110

Explanation: Enhanced Error Handling Failure on adapter

Failing Item:

- FFC_2602
-

2602-201

Explanation: The Configuration Register test failed.

Failing Item:

- FFC_2602
 - FFC_221
-

2602-202

Explanation: The Interrupt test failed.

Failing Item:

- FFC_2602
 - FFC_221
-

2602-203

Explanation: The PCI Wrap test failed.

Failing Item:

- FFC_2602
-

2602-204

Explanation: The DMA test failed.

Failing Item:

- FFC_2602
 - FFC_221
-

2602-205

Explanation: I/O error on a read/write operation.

Failing Item:

- FFC_2602
 - FFC_221
-

2602-701

Explanation: Error log analysis indicates that an error has occurred with the adapter.

Failing Item:

- FFC_2602
-

2602-703

Explanation: Error log analysis indicates that an unknown adapter error has occurred.

Failing Item:

- FFC_2602
-

2602-704

Explanation: Error log analysis indicates that an adapter error has occurred.

Failing Item:

2602-705 • 2603-205

- FFC_2602

2602-705

Explanation: A parity error has been detected. The adapter must be replaced immediately. Failure to do so could result in data being read or written incorrectly.

Failing Item:

- FFC_2602

2602-706

Explanation: A fatal hardware error has occurred. This adapter was successfully taken offline. It will remain offline until reconfigured or the system is rebooted. This adapter must be replaced and not brought back online. Failure to adhere to this action could result in data being read or written incorrectly or in the loss of data.

Failing Item:

- FFC_2602

2603-102

Explanation: The Reset test failed.

Failing Item:

- FFC_2603

2603-103

Explanation: The Register test failed.

Failing Item:

- FFC_2603

2603-104

Explanation: The SRAM test failed.

Failing Item:

- FFC_2603

2603-105

Explanation: The Internal Wrap test failed.

Failing Item:

- FFC_2603

2603-106

Explanation: The Gigabaud Link Module (GLM) Wrap Test Failure.

Failing Item:

- FFC_2603

2603-107

Explanation: The External Wrap test failed.

Failing Item:

- FFC_2603

2603-108

Explanation: Enhanced Error Handling Failure on bus

Failing Item:

- FFC_221

2603-110

Explanation: Enhanced Error Handling Failure on adapter

Failing Item:

- FFC_2603

2603-201

Explanation: The Configuration Register test failed.

Failing Item:

- FFC_2603
- FFC_221

2603-202

Explanation: The Interrupt test failed.

Failing Item:

- FFC_2603
- FFC_221

2603-203

Explanation: The PCI Wrap test failed.

Failing Item:

- FFC_2603

2603-204

Explanation: The DMA test failed.

Failing Item:

- FFC_2603
- FFC_221

2603-205

Explanation: I/O error on a read/write operation.

Failing Item:

- FFC_2603
- FFC_221

2603-701

Explanation: Error log analysis indicates that an error has occurred with the adapter.

Failing Item:

- FFC_2603
-

2603-703

Explanation: Error log analysis indicates that an unknown adapter error has occurred.

Failing Item:

- FFC_2603
-

2603-704

Explanation: Error log analysis indicates that an adapter error has occurred.

Failing Item:

- FFC_2603
-

2603-705

Explanation: A parity error has been detected. The adapter must be replaced immediately. Failure to do so could result in data being read or written incorrectly.

Failing Item:

- FFC_2603
-

2603-706

Explanation: A fatal hardware error has occurred. This adapter was successfully taken offline. It will remain offline until reconfigured or the system is rebooted. This adapter must be replaced and not brought back online. Failure to adhere to this action could result in data being read or written incorrectly or in the loss of data.

Failing Item:

- FFC_2603
-

2604-101

Explanation: The fibre channel adapter configuration failed.

Failing Item:

- FFC_2604
-

2604-102

Explanation: The Reset test failed.

Failing Item:

- FFC_2604
-

2604-103

Explanation: The Register test failed.

Failing Item:

- FFC_2604
-

2604-104

Explanation: The SRAM test failed.

Failing Item:

- FFC_2604
-

2604-105

Explanation: The Internal Wrap test failed.

Failing Item:

- FFC_2604
-

2604-106

Explanation: The Gigabaud Link Module (GLM) Wrap Test Failure.

Failing Item:

- FFC_2604
-

2604-107

Explanation: The External Wrap test failed.

Failing Item:

- FFC_2604
-

2604-108

Explanation: Enhanced Error Handling Failure on bus

Failing Item:

- FFC_221
-

2604-110

Explanation: Enhanced Error Handling Failure on adapter

Failing Item:

- FFC_2604
-

2604-201

Explanation: The Configuration Register test failed.

Failing Item:

- FFC_2604
 - FFC_221
-

2604-202

Explanation: The Interrupt test failed.

Failing Item:

- FFC_2604
- FFC_221

2604-203

Explanation: The PCI Wrap test failed.

Failing Item:

- FFC_2604

2604-204

Explanation: The DMA test failed.

Failing Item:

- FFC_2604
- FFC_221

2604-205

Explanation: I/O error on a read/write operation.

Failing Item:

- FFC_2604
- FFC_221

2604-701

Explanation: Error log analysis indicates that an error has occurred with the adapter.

Failing Item:

- FFC_2604

2604-703

Explanation: Error log analysis indicates that an unknown adapter error has occurred.

Failing Item:

- FFC_2604

2604-704

Explanation: Error log analysis indicates that an adapter error has occurred.

Failing Item:

- FFC_2604

2604-705

Explanation: A parity error has been detected. The adapter must be replaced immediately. Failure to do so could result in data being read or written incorrectly.

Failing Item:

- FFC_2604

2604-706

Explanation: A fatal hardware error has occurred. This adapter was successfully taken offline. It will remain offline until reconfigured or the system is rebooted. This adapter must be replaced and not brought back online. Failure to adhere to this action could result in data being read or written incorrectly or in the loss of data.

Failing Item:

- FFC_2604

2606-102

Explanation: The Reset test failed.

Failing Item:

- FFC_2606

2606-103

Explanation: The Register test failed.

Failing Item:

- FFC_2606

2606-104

Explanation: The SRAM test failed.

Failing Item:

- FFC_2606

2606-105

Explanation: The Internal Wrap test failed.

Failing Item:

- FFC_2606

2606-106

Explanation: The Gigabaud Link Module (GLM) Wrap Test Failure.

Failing Item:

- FFC_2606

2606-107

Explanation: The External Wrap test failed.

Failing Item:

- FFC_2606
-

2606-108

Explanation: Enhanced Error Handling Failure on bus

Failing Item:

- FFC_221
-

2606-110

Explanation: Enhanced Error Handling Failure on adapter

Failing Item:

- FFC_2606
-

2606-201

Explanation: The Configuration Register test failed.

Failing Item:

- FFC_2606
 - FFC_221
-

2606-202

Explanation: The Interrupt test failed.

Failing Item:

- FFC_2606
 - FFC_221
-

2606-203

Explanation: The PCI Wrap test failed.

Failing Item:

- FFC_2606
-

2606-204

Explanation: The DMA test failed.

Failing Item:

- FFC_2606
 - FFC_221
-

2606-205

Explanation: I/O error on a read/write operation.

Failing Item:

- FFC_2606
 - FFC_221
-

2606-701

Explanation: Error log analysis indicates that an error has occurred with the adapter.

Failing Item:

- FFC_2606
-

2606-703

Explanation: Error log analysis indicates that an unknown adapter error has occurred.

Failing Item:

- FFC_2606
-

2606-704

Explanation: Error log analysis indicates that an adapter error has occurred.

Failing Item:

- FFC_2606
-

2606-705

Explanation: A parity error has been detected. The adapter must be replaced immediately. Failure to do so could result in data being read or written incorrectly.

Failing Item:

- FFC_2606
-

2606-706

Explanation: A fatal hardware error has occurred. This adapter was successfully taken offline. It will remain offline until reconfigured or the system is rebooted. This adapter must be replaced and not brought back online. Failure to adhere to this action could result in data being read or written incorrectly or in the loss of data.

Failing Item:

- FFC_2606
-

2608-102

Explanation: The Reset test failed.

Failing Item:

- FFC_2608
-

2608-103

Explanation: The Register test failed.

Failing Item:

- FFC_2608
-

2608-104

Explanation: The SRAM test failed.

Failing Item:

- FFC_2608
-

2608-105

Explanation: The Internal Wrap test failed.

Failing Item:

- FFC_2608
-

2608-106

Explanation: The Gigabaud Link Module (GLM) Wrap Test Failure.

Failing Item:

- FFC_2608
-

2608-107

Explanation: The External Wrap test failed.

Failing Item:

- FFC_2608
-

2608-108

Explanation: Enhanced Error Handling Failure on bus

Failing Item:

- FFC_221
-

2608-110

Explanation: Enhanced Error Handling Failure on adapter

Failing Item:

- FFC_2608
-

2608-201

Explanation: The Configuration Register test failed.

Failing Item:

- FFC_2608
 - FFC_221
-

2608-202

Explanation: The Interrupt test failed.

Failing Item:

- FFC_2608
 - FFC_221
-

2608-203

Explanation: The PCI Wrap test failed.

Failing Item:

- FFC_2608
-

2608-204

Explanation: The DMA test failed.

Failing Item:

- FFC_2608
 - FFC_221
-

2608-205

Explanation: I/O error on a read/write operation.

Failing Item:

- FFC_2608
 - FFC_221
-

2608-701

Explanation: Error log analysis indicates that an error has occurred with the adapter.

Failing Item:

- FFC_2608
-

2608-703

Explanation: Error log analysis indicates that an unknown adapter error has occurred.

Failing Item:

- FFC_2608
-

2608-704

Explanation: Error log analysis indicates that an adapter error has occurred.

Failing Item:

- FFC_2608
-

2608-705

Explanation: A parity error has been detected. The adapter must be replaced immediately. Failure to do so could result in data being read or written incorrectly.

Failing Item:

- FFC_2608
-

2608-706

Explanation: A fatal hardware error has occurred. This adapter was successfully taken offline. It will remain offline until reconfigured or the system is rebooted. This adapter must be replaced and not brought back online. Failure to adhere to this action could result in data being read or written incorrectly or in the loss of data.

Failing Item:

- FFC_2608
-

2609-101

Explanation: The Configuration Register test failed.

Response: Use MAP0210: General Problem Resolution.

Failing Item:

- FFC_2609
 - FFC_221
-

2609-102

Explanation: The register test failed.

Response: Use MAP0210: General Problem Resolution.

Failing Item:

- FFC_2609
-

2609-103

Explanation: The SRAM test test failed.

Response: Use MAP0210: General Problem Resolution.

Failing Item:

- FFC_2609
-

2609-104

Explanation: The reset test failed.

Response: Use MAP0210: General Problem Resolution.

Failing Item:

- FFC_2609
-

2609-105

Explanation: The PCI loopback test failed.

Response: Use MAP0210: General Problem Resolution.

Failing Item:

- FFC_2609
-

2609-106

Explanation: The DMA test failed.

Response: Use MAP0210: General Problem Resolution.

Failing Item:

- FFC_2609
-

2609-107

Explanation: The Internal loopback test failed.

Response: Use MAP0210: General Problem Resolution.

Failing Item:

- FFC_2609
-

2609-108

Explanation: The Interrupt test failed.

Response: Use MAP0210: General Problem Resolution.

Failing Item:

- FFC_2609
 - FFC_221
-

2609-109

Explanation: The External loopback test failed.

Response: Use MAP0210: General Problem Resolution.

Failing Item:

- FFC_2609
-

2609-601

Explanation: Error log analysis indicates that an error has occurred with the adapter.

Response: Use MAP0210: General Problem Resolution.

Failing Item:

- FFC_2609
-

2611-110

Explanation: The Reserve command failed.

Failing Item:

- FFC_2611
-

2611-120

Explanation: The Inquiry command failed.

Failing Item:

- FFC_2611
-

2611-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2611
 - MEDIA
-

2611-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the

instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2611
-

2611-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2611
 - MEDIA
-

2611-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2611
-

2611-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_2611
-

2611-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2611
 - MEDIA
-

2611-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2611
-

2611-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2611
 - MEDIA
-

2611-161

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2611
-

2611-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2611
-

2611-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2611
- MEDIA

2611-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2611
- FFC_B88
- MEDIA

2611-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2611
- FFC_B88

2611-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2611
- MEDIA

2611-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2611

2611-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2611
- MEDIA

2611-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2611

2611-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_2611

2611-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2611
- MEDIA

2611-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

2611-210 • 2611-412

- MEDIA
- FFC_2611

2611-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2611
- MEDIA

2611-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2611

2611-220

Explanation: The Release command failed.

Failing Item:

- FFC_2611

2611-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_2611

2611-240

Explanation: The Openx command failed.

Failing Item:

- FFC_2611

2611-300

Explanation: The device configuration failed.

Failing Item:

- FFC_2611
- SOFTWARE

2611-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
- FFC_2611
- SOFTWARE

2611-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2611
- MEDIA

2611-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2611

2611-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-417

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-418

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-419

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-511

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2611
 - FFC_B88
-

2611-512

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2611
- FFC_B88

2611-513

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2611
- FFC_B88

2611-514

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2611
- FFC_B88

2611-515

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2611
- FFC_B88

2611-516

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2611
- FFC_B88

2611-517

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2611
- FFC_B88

2611-518

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2611
- FFC_B88

2611-519

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2611
- FFC_B88

2611-520

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2611
- FFC_B88

2611-521

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2611
- FFC_B88

2611-522

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2611
- FFC_B88

2611-523

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2611
- FFC_B88

2611-611

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-612

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2611
 - FFC_B88
 - SOFTWARE
-

2611-613

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2611
 - FFC_B88
 - SOFTWARE
-

2611-614

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2611
 - FFC_B88
 - SOFTWARE
-

2611-615

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2611
 - FFC_B88
 - SOFTWARE
-

2611-616

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2611
 - FFC_B88
 - SOFTWARE
-

2611-617

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2611
 - FFC_B88
 - SOFTWARE
-

2611-618

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2611
 - FFC_B88
 - SOFTWARE
-

2611-619

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2611
 - FFC_B88
 - SOFTWARE
-

2611-620

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2611
 - FFC_B88
 - SOFTWARE
-

2611-621

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2611
 - FFC_B88
 - SOFTWARE
-

2611-622

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2611
 - FFC_B88
 - SOFTWARE
-

2611-623

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2611
 - FFC_B88
 - SOFTWARE
-

2611-711

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-712

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-713

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-714

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-715

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-716

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-717

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-718

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-719

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-720

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-721

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2611
- FFC_B88
- SOFTWARE

2611-722

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2611
 - FFC_B88
 - SOFTWARE
-

2611-723

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2611
 - FFC_B88
 - SOFTWARE
-

2612-110

Explanation: The Reserve command failed.

Failing Item:

- FFC_2612
-

2612-120

Explanation: The Inquiry command failed.

Failing Item:

- FFC_2612
-

2612-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2612
 - MEDIA
-

2612-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2612
-

2612-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2612
 - MEDIA
-

2612-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2612
-

2612-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_2612
-

2612-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2612
 - MEDIA
-

2612-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2612
-

2612-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2612
- MEDIA

2612-161

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2612

2612-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2612

2612-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2612
- MEDIA

2612-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2612
- FFC_B88
- MEDIA

2612-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2612
- FFC_B88

2612-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2612
- MEDIA

2612-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2612

2612-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2612
 - MEDIA
-

2612-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2612
-

2612-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_2612
-

2612-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2612
 - MEDIA
-

2612-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2612
-

2612-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2612
 - MEDIA
-

2612-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2612
-

2612-220

Explanation: The Release command failed.

Failing Item:

- FFC_2612
-

2612-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_2612
-

2612-240

Explanation: The Openx command failed.

Failing Item:

- FFC_2612
-

2612-300

Explanation: The device configuration failed.

Failing Item:

- FFC_2612
 - SOFTWARE
-

2612-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
 - FFC_2612
 - SOFTWARE
-

2612-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2612
- MEDIA

2612-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2612

2612-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-417

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-418

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-419

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2612
 - FFC_B88
 - SOFTWARE
-

2612-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2612
 - FFC_B88
 - SOFTWARE
-

2612-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2612
 - FFC_B88
 - SOFTWARE
-

2612-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2612
 - FFC_B88
 - SOFTWARE
-

2612-511

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2612
 - FFC_B88
-

2612-512

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2612
 - FFC_B88
-

2612-513

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2612
 - FFC_B88
-

2612-514

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2612
 - FFC_B88
-

2612-515

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2612
 - FFC_B88
-

2612-516

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2612
 - FFC_B88
-

2612-517

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2612
 - FFC_B88
-

2612-518

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2612
 - FFC_B88
-

2612-519

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2612
 - FFC_B88
-

2612-520

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2612
- FFC_B88

2612-521

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2612
- FFC_B88

2612-522

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2612
- FFC_B88

2612-523

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2612
- FFC_B88

2612-611

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-612

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-613

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-614

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-615

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-616

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-617

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-618

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-619

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2612
 - FFC_B88
 - SOFTWARE
-

2612-620

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2612
 - FFC_B88
 - SOFTWARE
-

2612-621

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2612
 - FFC_B88
 - SOFTWARE
-

2612-622

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2612
 - FFC_B88
 - SOFTWARE
-

2612-623

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2612
 - FFC_B88
 - SOFTWARE
-

2612-711

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2612
 - FFC_B88
 - SOFTWARE
-

2612-712

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2612
 - FFC_B88
 - SOFTWARE
-

2612-713

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2612
 - FFC_B88
 - SOFTWARE
-

2612-714

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2612
 - FFC_B88
 - SOFTWARE
-

2612-715

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2612
 - FFC_B88
 - SOFTWARE
-

2612-716

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2612
 - FFC_B88
 - SOFTWARE
-

2612-717

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2612
 - FFC_B88
 - SOFTWARE
-

2612-718

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2612
 - FFC_B88
 - SOFTWARE
-

2612-719

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-720

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-721

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-722

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2612-723

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2612
- FFC_B88
- SOFTWARE

2613-110

Explanation: The Reserve command failed.

Failing Item:

- FFC_2613

2613-120

Explanation: The Inquiry command failed.

Failing Item:

- FFC_2613

2613-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2613
- MEDIA

2613-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2613

2613-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2613
- MEDIA

2613-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2613

2613-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_2613

2613-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2613
 - MEDIA
-

2613-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2613
-

2613-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2613
 - MEDIA
-

2613-161

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2613
-

2613-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2613
-

2613-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2613
 - MEDIA
-

2613-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2613
 - FFC_B88
 - MEDIA
-

2613-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2613
 - FFC_B88
-

2613-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

2613-181 • 2613-230

- FFC_2613
- MEDIA

2613-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2613

2613-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2613
- MEDIA

2613-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2613

2613-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_2613

2613-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2613
- MEDIA

2613-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2613

2613-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2613
- MEDIA

2613-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2613

2613-220

Explanation: The Release command failed.

Failing Item:

- FFC_2613

2613-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_2613

2613-240

Explanation: The Openx command failed.

Failing Item:

- FFC_2613
-

2613-300

Explanation: The device configuration failed.

Failing Item:

- FFC_2613
 - SOFTWARE
-

2613-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
 - FFC_2613
 - SOFTWARE
-

2613-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2613
 - MEDIA
-

2613-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2613
-

2613-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2613
 - FFC_B88
 - SOFTWARE
-

2613-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2613
 - FFC_B88
 - SOFTWARE
-

2613-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2613
 - FFC_B88
 - SOFTWARE
-

2613-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2613
 - FFC_B88
 - SOFTWARE
-

2613-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2613
 - FFC_B88
 - SOFTWARE
-

2613-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2613
 - FFC_B88
 - SOFTWARE
-

2613-417

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2613
 - FFC_B88
 - SOFTWARE
-

2613-418

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-419

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-511

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2613
- FFC_B88

2613-512

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2613
- FFC_B88

2613-513

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2613
- FFC_B88

2613-514

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2613
- FFC_B88

2613-515

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2613
- FFC_B88

2613-516

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2613
- FFC_B88

2613-517

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2613
- FFC_B88

2613-518

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2613
- FFC_B88

2613-519

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2613
- FFC_B88

2613-520

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2613
- FFC_B88

2613-521

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2613
- FFC_B88

2613-522

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2613
- FFC_B88

2613-523

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2613
- FFC_B88

2613-611

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-612

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-613

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-614

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-615

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-616

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-617

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-618

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-619

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-620

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-621

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-622

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-623

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-711

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-712

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-713

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-714

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2613
- FFC_B88
- SOFTWARE

2613-715

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2613
 - FFC_B88
 - SOFTWARE
-

2613-716

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2613
 - FFC_B88
 - SOFTWARE
-

2613-717

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2613
 - FFC_B88
 - SOFTWARE
-

2613-718

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2613
 - FFC_B88
 - SOFTWARE
-

2613-719

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2613
 - FFC_B88
 - SOFTWARE
-

2613-720

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2613
 - FFC_B88
 - SOFTWARE
-

2613-721

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2613
 - FFC_B88
 - SOFTWARE
-

2613-722

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2613
 - FFC_B88
 - SOFTWARE
-

2613-723

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2613
 - FFC_B88
 - SOFTWARE
-

2614-110

Explanation: The Reserve command failed.

Failing Item:

- FFC_2614
-

2614-120

Explanation: The Inquiry command failed.

Failing Item:

- FFC_2614
-

2614-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2614
 - MEDIA
-

2614-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2614
-

2614-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2614
- MEDIA

2614-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2614

2614-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_2614

2614-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2614
- MEDIA

2614-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2614

2614-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2614
- MEDIA

2614-161

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2614

2614-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2614

2614-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2614
- MEDIA

2614-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2614
- FFC_B88
- MEDIA

2614-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2614
- FFC_B88

2614-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2614
- MEDIA

2614-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2614

2614-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2614
- MEDIA

2614-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2614

2614-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_2614

2614-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2614
- MEDIA

2614-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2614

2614-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

2614-211 • 2614-414

- FFC_2614
- MEDIA

2614-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2614

2614-220

Explanation: The Release command failed.

Failing Item:

- FFC_2614

2614-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_2614

2614-240

Explanation: The Openx command failed.

Failing Item:

- FFC_2614

2614-300

Explanation: The device configuration failed.

Failing Item:

- FFC_2614
- SOFTWARE

2614-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
- FFC_2614
- SOFTWARE

2614-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the

instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2614
- MEDIA

2614-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2614

2614-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2614
 - FFC_B88
 - SOFTWARE
-

2614-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2614
 - FFC_B88
 - SOFTWARE
-

2614-417

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2614
 - FFC_B88
 - SOFTWARE
-

2614-418

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2614
 - FFC_B88
 - SOFTWARE
-

2614-419

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2614
 - FFC_B88
 - SOFTWARE
-

2614-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2614
 - FFC_B88
 - SOFTWARE
-

2614-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2614
 - FFC_B88
 - SOFTWARE
-

2614-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2614
 - FFC_B88
 - SOFTWARE
-

2614-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2614
 - FFC_B88
 - SOFTWARE
-

2614-511

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2614
 - FFC_B88
-

2614-512

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2614
 - FFC_B88
-

2614-513

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2614
 - FFC_B88
-

2614-514

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2614
- FFC_B88

2614-515

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2614
- FFC_B88

2614-516

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2614
- FFC_B88

2614-517

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2614
- FFC_B88

2614-518

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2614
- FFC_B88

2614-519

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2614
- FFC_B88

2614-520

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2614
- FFC_B88

2614-521

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2614
- FFC_B88

2614-522

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2614
- FFC_B88

2614-523

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_2614
- FFC_B88

2614-611

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-612

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-613

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-614

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2614
 - FFC_B88
 - SOFTWARE
-

2614-615

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2614
 - FFC_B88
 - SOFTWARE
-

2614-616

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2614
 - FFC_B88
 - SOFTWARE
-

2614-617

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2614
 - FFC_B88
 - SOFTWARE
-

2614-618

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2614
 - FFC_B88
 - SOFTWARE
-

2614-619

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2614
 - FFC_B88
 - SOFTWARE
-

2614-620

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2614
 - FFC_B88
 - SOFTWARE
-

2614-621

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2614
 - FFC_B88
 - SOFTWARE
-

2614-622

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2614
 - FFC_B88
 - SOFTWARE
-

2614-623

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_2614
 - FFC_B88
 - SOFTWARE
-

2614-711

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2614
 - FFC_B88
 - SOFTWARE
-

2614-712

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2614
 - FFC_B88
 - SOFTWARE
-

2614-713

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-714

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-715

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-716

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-717

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-718

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-719

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-720

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-721

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-722

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2614-723

Explanation: A device timeout error occurred.

Failing Item:

- FFC_2614
- FFC_B88
- SOFTWARE

2615-110

Explanation: The Reserve command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
-

2615-120

Explanation: The Inquiry command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
-

2615-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - MEDIA
-

2615-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2615
-

2615-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - MEDIA
-

2615-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2615
-

2615-140

Explanation: The Mode Select command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
-

2615-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - MEDIA
-

2615-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2615
-

2615-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - MEDIA
-

2615-161

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2615

2615-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2615

2615-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- MEDIA

2615-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- MEDIA

2615-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA

- FFC_2615
- FFC_B88

2615-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- MEDIA

2615-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2615

2615-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- MEDIA

2615-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2615

2615-190

Explanation: The Mode Select command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
-

2615-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - MEDIA
-

2615-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2615
-

2615-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - MEDIA
-

2615-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2615
-

2615-220

Explanation: The Release command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
-

2615-230

Explanation: The Request Sense command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
-

2615-240

Explanation: The Openx command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
-

2615-300

Explanation: The device configuration failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - SOFTWARE
-

2615-310

Explanation: SCSI adapter configuration failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_B88
 - FFC_2615
 - SOFTWARE
-

2615-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- MEDIA

2615-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2615

2615-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-412

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-413

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-414

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-415

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-416

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-417

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-418

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-419

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615

- FFC_B88
- SOFTWARE

2615-420

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-421

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-422

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-423

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-511

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615

- FFC_B88

2615-512

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88

2615-513

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88

2615-514

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88

2615-515

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88

2615-516

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88

2615-517

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88

2615-518

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88

2615-519

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88

2615-520

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88

2615-521

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88

2615-522

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88

2615-523

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88

2615-611

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-612

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-613

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - FFC_B88
 - SOFTWARE
-

2615-614

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - FFC_B88
 - SOFTWARE
-

2615-615

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - FFC_B88
 - SOFTWARE
-

2615-616

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - FFC_B88
 - SOFTWARE
-

2615-617

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - FFC_B88
 - SOFTWARE
-

2615-618

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - FFC_B88
 - SOFTWARE
-

2615-619

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - FFC_B88
 - SOFTWARE
-

2615-620

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - FFC_B88
 - SOFTWARE
-

2615-621

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - FFC_B88
 - SOFTWARE
-

2615-622

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - FFC_B88
 - SOFTWARE
-

2615-623

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - FFC_B88
 - SOFTWARE
-

2615-711

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-712

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-713

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-714

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-715

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-716

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-717

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-718

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-719

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
- FFC_B88
- SOFTWARE

2615-720

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - FFC_B88
 - SOFTWARE
-

2615-721

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - FFC_B88
 - SOFTWARE
-

2615-722

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - FFC_B88
 - SOFTWARE
-

2615-723

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2615
 - FFC_B88
 - SOFTWARE
-

2616-110

Explanation: The Reserve command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
-

2616-120

Explanation: The Inquiry command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
-

2616-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - MEDIA
-

2616-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2616
-

2616-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - MEDIA
-

2616-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2616
-

2616-140

Explanation: The Mode Select command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
-

2616-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- MEDIA

2616-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2616

2616-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- MEDIA

2616-161

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2616

2616-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2616

2616-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- MEDIA

2616-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- MEDIA

2616-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2616
- FFC_B88

2616-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- MEDIA

2616-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2616

2616-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- MEDIA

2616-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2616

2616-190

Explanation: The Mode Select command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616

2616-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- MEDIA

2616-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2616

2616-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- MEDIA

2616-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2616

2616-220

Explanation: The Release command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616

2616-230

Explanation: The Request Sense command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616

2616-240

Explanation: The Openx command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616

2616-300

Explanation: The device configuration failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- SOFTWARE

2616-310

Explanation: SCSI adapter configuration failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_B88
- FFC_2616
- SOFTWARE

2616-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- MEDIA

2616-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the

instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2616

2616-411

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- SOFTWARE

2616-412

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- SOFTWARE

2616-413

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- SOFTWARE

2616-414

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- SOFTWARE

2616-415

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2616-416

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2616-417

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2616-418

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2616-419

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2616-420

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2616-421

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2616-422

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2616-423

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2616-511

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
-

2616-512

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88

2616-513

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88

2616-514

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88

2616-515

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88

2616-516

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88

2616-517

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88

2616-518

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88

2616-519

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88

2616-520

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88

2616-521

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
-

2616-522

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
-

2616-523

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
-

2616-611

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2616-612

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2616-613

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2616-614

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2616-615

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2616-616

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2616-617

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2616-618

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2616-619

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- SOFTWARE

2616-620

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- SOFTWARE

2616-621

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- SOFTWARE

2616-622

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- SOFTWARE

2616-623

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- SOFTWARE

2616-711

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- SOFTWARE

2616-712

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- SOFTWARE

2616-713

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- SOFTWARE

2616-714

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
- FFC_B88
- SOFTWARE

2616-715

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2616-716

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2616-717

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2616-718

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2616-719

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2616-720

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2616-721

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2616-722

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2616-723

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2616
 - FFC_B88
 - SOFTWARE
-

2617-110

Explanation: The Reserve command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
-

2617-120

Explanation: The Inquiry command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
-

2617-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- MEDIA

2617-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2617

2617-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- MEDIA

2617-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2617

2617-140

Explanation: The Mode Select command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617

2617-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- MEDIA

2617-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2617

2617-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- MEDIA

2617-161

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2617

2617-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2617

2617-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- MEDIA

2617-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- MEDIA

2617-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2617
- FFC_B88

2617-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- MEDIA

2617-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2617

2617-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- MEDIA

2617-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2617

2617-190

Explanation: The Mode Select command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617

2617-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- MEDIA

2617-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2617

2617-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- MEDIA

2617-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2617

2617-220

Explanation: The Release command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617

2617-230

Explanation: The Request Sense command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617

2617-240

Explanation: The Openx command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617

2617-300

Explanation: The device configuration failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- SOFTWARE

2617-310

Explanation: SCSI adapter configuration failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_B88
- FFC_2617
- SOFTWARE

2617-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- MEDIA

2617-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the

instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2617

2617-411

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-412

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-413

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-414

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-415

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-416

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-417

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-418

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-419

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-420

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-421

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-422

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-423

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-511

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88

2617-512

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88

2617-513

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88

2617-514

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88

2617-515

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88

2617-516

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
-

2617-517

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
-

2617-518

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
-

2617-519

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
-

2617-520

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
-

2617-521

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
-

2617-522

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
-

2617-523

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
-

2617-611

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
 - SOFTWARE
-

2617-612

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
 - SOFTWARE
-

2617-613

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
 - SOFTWARE
-

2617-614

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-615

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-616

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-617

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-618

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-619

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-620

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-621

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-622

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-623

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
 - SOFTWARE
-

2617-711

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
 - SOFTWARE
-

2617-712

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
 - SOFTWARE
-

2617-713

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
 - SOFTWARE
-

2617-714

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
 - SOFTWARE
-

2617-715

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
 - SOFTWARE
-

2617-716

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
 - SOFTWARE
-

2617-717

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
 - SOFTWARE
-

2617-718

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
 - SOFTWARE
-

2617-719

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
 - SOFTWARE
-

2617-720

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
 - FFC_B88
 - SOFTWARE
-

2617-721

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-722

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2617-723

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2617
- FFC_B88
- SOFTWARE

2618-110

Explanation: The Reserve command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618

2618-120

Explanation: The Inquiry command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618

2618-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- MEDIA

2618-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2618

2618-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- MEDIA

2618-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2618

2618-140

Explanation: The Mode Select command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618

2618-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
 - MEDIA
-

2618-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2618
-

2618-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
 - MEDIA
-

2618-161

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2618
-

2618-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2618
-

2618-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
 - MEDIA
-

2618-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_B88
 - MEDIA
-

2618-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2618
 - FFC_B88
-

2618-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- MEDIA

2618-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2618

2618-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- MEDIA

2618-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2618

2618-190

Explanation: The Mode Select command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618

2618-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- MEDIA

2618-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2618

2618-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- MEDIA

2618-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2618

2618-220

Explanation: The Release command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618

2618-230

Explanation: The Request Sense command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
-

2618-240

Explanation: The Openx command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
-

2618-300

Explanation: The device configuration failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
 - SOFTWARE
-

2618-310

Explanation: SCSI adapter configuration failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2680
 - FFC_2618
 - SOFTWARE
-

2618-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
 - MEDIA
-

2618-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the

instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2618
-

2618-411

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_2680
 - SOFTWARE
-

2618-412

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_2680
 - SOFTWARE
-

2618-413

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_2680
 - SOFTWARE
-

2618-414

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_2680
 - SOFTWARE
-

2618-415

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-416

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-417

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-418

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-419

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-420

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-421

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-422

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-423

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-511

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680

2618-512

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_2680
-

2618-513

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_2680
-

2618-514

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_2680
-

2618-515

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_2680
-

2618-516

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_2680
-

2618-517

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_2680
-

2618-518

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_2680
-

2618-519

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_2680
-

2618-520

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_2680
-

2618-521

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_2680
-

2618-522

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680

2618-523

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680

2618-611

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-612

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-613

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-614

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-615

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-616

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-617

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-618

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-619

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_2680
 - SOFTWARE
-

2618-620

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_2680
 - SOFTWARE
-

2618-621

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_2680
 - SOFTWARE
-

2618-622

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_2680
 - SOFTWARE
-

2618-623

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_2680
 - SOFTWARE
-

2618-711

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_2680
 - SOFTWARE
-

2618-712

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_2680
 - SOFTWARE
-

2618-713

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_2680
 - SOFTWARE
-

2618-714

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_2680
 - SOFTWARE
-

2618-715

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
 - FFC_2680
 - SOFTWARE
-

2618-716

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-717

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-718

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-719

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-720

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-721

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-722

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2618-723

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2618
- FFC_2680
- SOFTWARE

2619-110

Explanation: The Reserve command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619

2619-120

Explanation: The Inquiry command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619

2619-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- MEDIA

2619-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2619

2619-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- MEDIA

2619-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2619

2619-140

Explanation: The Mode Select command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619

2619-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- MEDIA

2619-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2619

2619-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- MEDIA

2619-161

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2619

2619-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2619

2619-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- MEDIA

2619-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_B88
- MEDIA

2619-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2619
- FFC_B88

2619-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- MEDIA

2619-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2619

2619-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- MEDIA

2619-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2619

2619-190

Explanation: The Mode Select command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619

2619-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- MEDIA

2619-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2619

2619-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- MEDIA

2619-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2619

2619-220

Explanation: The Release command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619

2619-230

Explanation: The Request Sense command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619

2619-240

Explanation: The Openx command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619

2619-300

Explanation: The device configuration failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- SOFTWARE

2619-310

Explanation: SCSI adapter configuration failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2680
- FFC_2619
- SOFTWARE

2619-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- MEDIA

2619-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the

2619-411 • 2619-419

instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2619
-

2619-411

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-412

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-413

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-414

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-415

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-416

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-417

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-418

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-419

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-420

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-421

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-422

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-423

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-511

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
-

2619-512

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
-

2619-513

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
-

2619-514

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
-

2619-515

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
-

2619-516

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
-

2619-517

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680

2619-518

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680

2619-519

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680

2619-520

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680

2619-521

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680

2619-522

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680

2619-523

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680

2619-611

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680
- SOFTWARE

2619-612

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680
- SOFTWARE

2619-613

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-614

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-615

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-616

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-617

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-618

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-619

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-620

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-621

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-622

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-623

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-711

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680
- SOFTWARE

2619-712

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680
- SOFTWARE

2619-713

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680
- SOFTWARE

2619-714

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680
- SOFTWARE

2619-715

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680
- SOFTWARE

2619-716

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680
- SOFTWARE

2619-717

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680
- SOFTWARE

2619-718

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680
- SOFTWARE

2619-719

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
- FFC_2680
- SOFTWARE

2619-720

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-721

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-722

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2619-723

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2619
 - FFC_2680
 - SOFTWARE
-

2621-101

Explanation: Configuration failed.

Failing Item:

- FFC_2621
-

2621-102

Explanation: Queue pair create failure.

Failing Item:

- FFC_2621
-

2621-103

Explanation: Internal loop back test failure

Failing Item:

- FFC_2621
-

2621-701

Explanation: Error Log Analysis indicates that this adapter has failed due to a internal error.

Failing Item:

- FFC_2621
-

2621-702

Explanation: Error Log Analysis indicates that this adapter has failed due to a failure with the uplink interface used to connect this device to the host processor.

Failing Item:

- FFC_2621
-

2621-703

Explanation: Error Log Analysis indicates that this adapter has failed due to a memory error.

Failing Item:

- FFC_2621
-

2621-704

Explanation: Error Log Analysis indicates that this adapter has failed due to a unrecoverable internal parity error.

Failing Item:

- FFC_2621
-

2621-705

Explanation: Error Log Analysis indicates that this adapter has failed due to a internal error.

Failing Item:

- FFC_2621
-

2621-706

Explanation: Error Log Analysis indicates that this adapter has failed due to a memory error.

Failing Item:

- FFC_2621
-

2625-101

Explanation: Configuration failed.

Failing Item:

- FFC_2625
-

2625-102

Explanation: Queue pair create failure.

Failing Item:

- FFC_2625
-

2625-103

Explanation: Internal loop back test failure

Failing Item:

- FFC_2625
-

2625-201

Explanation: Loop back test failure

Failing Item:

- CABLE
 - NETWORK
-

2625-301

Explanation: Loop back test failure

Failing Item:

- CABLE
 - NETWORK
 - FFC_2625
-

2625-701

Explanation: Error Log Analysis indicates that this adapter has failed due to a internal error.

Failing Item:

- FFC_2625
-

2625-702

Explanation: Error Log Analysis indicates that this adapter has failed due to a failure with the uplink interface used to connect this device to the host processor.

Failing Item:

- FFC_2625
-

2625-703

Explanation: Error Log Analysis indicates that this adapter has failed due to a memory error.

Failing Item:

- FFC_2625
-

2625-704

Explanation: Error Log Analysis indicates that this adapter has failed due to a unrecoverable internal parity error.

Failing Item:

- FFC_2625
-

2625-705

Explanation: Error Log Analysis indicates that this adapter has failed due to a internal error.

Failing Item:

- FFC_2625
-

2625-706

Explanation: Error Log Analysis indicates that this adapter has failed due to a memory error.

Failing Item:

- FFC_2625
-

2628-101

Explanation: Configuration failed.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2628
-

2628-102

Explanation: Queue pair create failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2628
-

2628-103

Explanation: Internal loop back test failure

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2628
-

2628-104

Explanation: IO Register test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2628
-

2628-105**Explanation:** Checksum verification test failed**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2628
-

2628-106**Explanation:** BIST test failed**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2628
-

2628-107**Explanation:** Link Detection test failed**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2628
-

2628-108**Explanation:** Link Detection test failed**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2628
-

2628-201**Explanation:** Loop back test failure**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- CABLE
 - NETWORK
-

2628-202**Explanation:** Configuration register test failed**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2628
 - FFC_221
-

2628-203**Explanation:** EEH failure during test**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2628
 - FFC_221
-

2628-301**Explanation:** Loop back test failure**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- CABLE
 - NETWORK
 - FFC_2628
-

2628-601**Explanation:** Error Log Analysis indicates adapter hardware error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2628
-

2628-602**Explanation:** Error Log Analysis indicates adapter configuration error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2628
-

2628-603**Explanation:** Error Log Analysis indicates adapter EEH service error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2628
-

2628-701**Explanation:** Error Log Analysis indicates that this adapter has failed due to a internal error.**Response:** Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2628
-

2628-702

Explanation: Error Log Analysis indicates that this adapter has failed due to a failure with the uplink interface used to connect this device to the host processor.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2628
-

2628-703

Explanation: Error Log Analysis indicates that this adapter has failed due to a memory error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2628
-

2628-704

Explanation: Error Log Analysis indicates that this adapter has failed due to a unrecoverable internal parity error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2628
-

2628-705

Explanation: Error Log Analysis indicates that this adapter has failed due to a internal error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2628
-

2628-706

Explanation: Error Log Analysis indicates that this adapter has failed due to a memory error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2628
-

262B-101

Explanation: Configuration failed.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_262B
-

262B-102

Explanation: Queue pair create failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_262B
-

262B-103

Explanation: Internal loop back test failure

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_262B
-

262B-104

Explanation: IO Register test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_262B
-

262B-105

Explanation: Checksum verification test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_262B
-

262B-106

Explanation: BIST test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_262B
-

262B-107**Explanation:** Link Detection test failed**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_262B
-

262B-108**Explanation:** Link Detection test failed**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_262B
-

262B-201**Explanation:** Loop back test failure**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- CABLE
 - NETWORK
-

262B-202**Explanation:** Configuration register test failed**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_262B
 - FFC_221
-

262B-203**Explanation:** EEH failure during test**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_262B
 - FFC_221
-

262B-301**Explanation:** Loop back test failure**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- CABLE
- NETWORK

- FFC_262B
-

262B-601**Explanation:** Error Log Analysis indicates adapter hardware error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_262B
-

262B-602**Explanation:** Error Log Analysis indicates adapter configuration error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_262B
-

262B-603**Explanation:** Error Log Analysis indicates adapter EEH service error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_262B
-

262B-701**Explanation:** Error Log Analysis indicates that this adapter has failed due to a internal error.**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_262B
-

262B-702**Explanation:** Error Log Analysis indicates that this adapter has failed due to a failure with the uplink interface used to connect this device to the host processor.**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_262B
-

262B-703

Explanation: Error Log Analysis indicates that this adapter has failed due to a memory error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_262B

262B-704

Explanation: Error Log Analysis indicates that this adapter has failed due to a unrecoverable internal parity error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_262B

262B-705

Explanation: Error Log Analysis indicates that this adapter has failed due to a internal error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_262B

262B-706

Explanation: Error Log Analysis indicates that this adapter has failed due to a memory error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_262B

262D-101

Explanation: Configuration failed.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_262D

262D-102

Explanation: Queue pair create failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_262D

262D-103

Explanation: Internal loop back test failure

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_262D

262D-104

Explanation: IO Register test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_262D

262D-105

Explanation: Checksum verification test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_262D

262D-106

Explanation: BIST test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_262D

262D-107

Explanation: Link Detection test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_262D

262D-108

Explanation: Link Detection test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_262D

262D-201

Explanation: Loop back test failure

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- CABLE
 - NETWORK
-

262D-202

Explanation: Configuration register test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_262D
 - FFC_221
-

262D-203

Explanation: EEH failure during test

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_262D
 - FFC_221
-

262D-301

Explanation: Loop back test failure

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- CABLE
 - NETWORK
 - FFC_262D
-

262D-601

Explanation: Error Log Analysis indicates adapter hardware error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_262D
-

262D-602

Explanation: Error Log Analysis indicates adapter configuration error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_262D
-

262D-603

Explanation: Error Log Analysis indicates adapter EEH service error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_262D
-

262D-701

Explanation: Error Log Analysis indicates that this adapter has failed due to a internal error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_262D
-

262D-702

Explanation: Error Log Analysis indicates that this adapter has failed due to a failure with the uplink interface used to connect this device to the host processor.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_262D
-

262D-703

Explanation: Error Log Analysis indicates that this adapter has failed due to a memory error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_262D
-

262D-704

Explanation: Error Log Analysis indicates that this adapter has failed due to a unrecoverable internal parity error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_262D
-

262D-705

Explanation: Error Log Analysis indicates that this adapter has failed due to a internal error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_262D
-

262D-706

Explanation: Error Log Analysis indicates that this adapter has failed due to a memory error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_262D
-

2640-114

Explanation: IDE Disk diagnostic failure

Failing Item:

- FFC_2640
-

2640-115

Explanation: IDE disk error on open or configuring device

Failing Item:

- FFC_2640
 - FFC_2631
-

2640-121

Explanation: Physical volume hardware error

Failing Item:

- FFC_2640
-

2640-131

Explanation: Smart status threshold exceeded

Failing Item:

- FFC_2640
-

2640-132

Explanation: Command timeouts threshold exceeded

Failing Item:

- FFC_2640
-

2640-133

Explanation: Command timeout with error condition

Failing Item:

- FFC_2640
-

2640-134

Explanation: Hardware command or DMA failure

Failing Item:

- FFC_2640
-

2640-135

Explanation: IDE DMA error with no error status

Failing Item:

- FFC_2640
-

2640-136

Explanation: TimeOut waiting for controller or drive with no busy status

Response: Go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2640
 - FFC_2631
-

2641-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2641
-

2641-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2641
-

2641-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2641
-

2641-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2641
-

2641-108

Explanation: The bus test failed.

Failing Item:

- FFC_2641
-

2641-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2641
-

2641-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2641
-

2641-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2641
-

2641-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2641
-

2641-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2641
-

2641-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2641
 - FFC_B88
-

2641-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2641
-

2641-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2641
-

2641-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2641
-

2641-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2641
 - FFC_B88
-

2641-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2641
 - SOFTWARE
-

2641-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2641
 - SOFTWARE
-

2641-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2641
-

2641-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2641
-

2641-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2641-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

2641-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2641
 - FFC_B88
 - SOFTWARE
-

2641-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2641
-

2641-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2641
 - FFC_B88
 - FFC_190
-

2641-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2641
-

2641-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2641
-

2641-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2642-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2642
-

2642-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2642
-

2642-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2642
-

2642-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2642
-

2642-108

Explanation: The bus test failed.

Failing Item:

- FFC_2642
-

2642-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2642
-

2642-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2642
-

2642-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2642
-

2642-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2642
-

2642-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2642
-

2642-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2642
 - FFC_B88
-

2642-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2642
-

2642-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2642
-

2642-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2642
-

2642-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2642
 - FFC_B88
-

2642-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2642
 - SOFTWARE
-

2642-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2642
 - SOFTWARE
-

2642-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2642
-

2642-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2642
-

2642-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2642-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

- SOFTWARE

2642-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2642
- FFC_B88
- SOFTWARE

2642-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2642

2642-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2642
- FFC_B88
- FFC_190

2642-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2642

2642-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_2642

2642-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2643-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2643

2643-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2643

2643-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2643

2643-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2643

2643-108

Explanation: The bus test failed.

Failing Item:

- FFC_2643

2643-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2643

2643-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2643

2643-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2643

2643-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2643

2643-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2643

2643-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2643
- FFC_B88

2643-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2643

2643-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2643

2643-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2643

2643-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2643
- FFC_B88

2643-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2643
- SOFTWARE

2643-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2643
- SOFTWARE

2643-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2643

2643-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2643

2643-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

2643-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

2643-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2643
- FFC_B88
- SOFTWARE

2643-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2643

2643-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2643
- FFC_B88
- FFC_190

2643-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2643

2643-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_2643

2643-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2644-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2644

2644-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2644

2644-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2644

2644-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2644

2644-108

Explanation: The bus test failed.

Failing Item:

- FFC_2644

2644-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2644

2644-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2644

2644-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2644

2644-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2644

2644-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2644

2644-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2644
- FFC_B88

2644-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2644
-

2644-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2644
-

2644-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2644
-

2644-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2644
 - FFC_B88
-

2644-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2644
 - SOFTWARE
-

2644-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2644
 - SOFTWARE
-

2644-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2644
-

2644-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2644
-

2644-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2644-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

2644-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2644
 - FFC_B88
 - SOFTWARE
-

2644-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2644
-

2644-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2644
 - FFC_B88
 - FFC_190
-

2644-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2644

2644-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_2644

2644-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2645-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2645

2645-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2645

2645-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2645

2645-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2645

2645-108

Explanation: The bus test failed.

Failing Item:

- FFC_2645

2645-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2645

2645-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2645

2645-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2645

2645-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2645

2645-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2645

2645-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2645
- FFC_B88

2645-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2645

2645-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2645

2645-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2645

2645-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2645
 - FFC_B88
-

2645-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2645
 - SOFTWARE
-

2645-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2645
 - SOFTWARE
-

2645-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2645
-

2645-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2645
-

2645-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2645-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

- SOFTWARE
-

2645-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2645
 - FFC_B88
 - SOFTWARE
-

2645-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2645
-

2645-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2645
 - FFC_B88
 - FFC_190
-

2645-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2645
-

2645-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2645
-

2645-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2646-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2646
-

2646-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2646
-

2646-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2646
-

2646-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2646
-

2646-108

Explanation: The bus test failed.

Failing Item:

- FFC_2646
-

2646-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2646
-

2646-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2646
-

2646-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2646
-

2646-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2646
-

2646-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2646
-

2646-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2646
 - FFC_B88
-

2646-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2646
-

2646-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2646
-

2646-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2646
-

2646-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2646
 - FFC_B88
-

2646-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2646
- SOFTWARE

2646-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2646
 - SOFTWARE
-

2646-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2646
-

2646-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2646
-

2646-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2646-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

2646-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2646
 - FFC_B88
 - SOFTWARE
-

2646-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2646
-

2646-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2646
 - FFC_B88
 - FFC_190
-

2646-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2646
-

2646-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2646
-

2646-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2647-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2647
-

2647-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2647
-

2647-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2647
-

2647-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2647
-

2647-108

Explanation: The bus test failed.

Failing Item:

- FFC_2647
-

2647-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2647
-

2647-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2647
-

2647-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2647
-

2647-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2647
-

2647-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2647
-

2647-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2647
 - FFC_B88
-

2647-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2647
-

2647-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2647
-

2647-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2647
-

2647-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2647
 - FFC_B88
-

2647-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2647
 - SOFTWARE
-

2647-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2647
 - SOFTWARE
-

2647-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2647
-

2647-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2647
-

2647-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2647-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

2647-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2647
 - FFC_B88
 - SOFTWARE
-

2647-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2647
-

2647-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2647
 - FFC_B88
 - FFC_190
-

2647-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2647
-

2647-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2647
-

2647-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2648-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2648
-

2648-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2648
-

2648-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2648
-

2648-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2648
-

2648-108

Explanation: The bus test failed.

Failing Item:

- FFC_2648
-

2648-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2648
-

2648-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2648
-

2648-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2648
-

2648-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2648
-

2648-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2648
-

2648-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2648
 - FFC_B88
-

2648-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2648
-

2648-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2648
-

2648-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2648

2648-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2648
 - FFC_B88
-

2648-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2648
 - SOFTWARE
-

2648-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2648
 - SOFTWARE
-

2648-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2648
-

2648-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2648
-

2648-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2648-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88

- SOFTWARE

2648-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2648
 - FFC_B88
 - SOFTWARE
-

2648-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2648
-

2648-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2648
 - FFC_B88
 - FFC_190
-

2648-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2648
-

2648-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2648
-

2648-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2649-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2649
-

2649-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2649
-

2649-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2649
-

2649-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2649
-

2649-108

Explanation: The bus test failed.

Failing Item:

- FFC_2649
-

2649-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2649
-

2649-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2649
-

2649-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2649
-

2649-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2649
-

2649-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2649
-

2649-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2649
 - FFC_B88
-

2649-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2649
-

2649-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2649
-

2649-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2649
-

2649-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2649
 - FFC_B88
-

2649-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2649
 - SOFTWARE
-

2649-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2649
 - SOFTWARE
-

2649-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2649
-

2649-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2649
-

2649-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2649-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

2649-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2649
 - FFC_B88
 - SOFTWARE
-

2649-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2649
-

2649-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2649
 - FFC_B88
 - FFC_190
-

2649-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2649
-

2649-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2649
-

2649-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

264B-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_264B
-

264B-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_264B
-

264B-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_264B
-

264B-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_264B
-

264B-108

Explanation: The bus test failed.

Failing Item:

- FFC_264B
-

264B-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_264B
-

264B-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_264B
-

264B-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_264B
-

264B-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_264B
-

264B-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_264B
-

264B-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_264B
 - FFC_B88
-

264B-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_264B

264B-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_264B

264B-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_264B

264B-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_264B
- FFC_B88

264B-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_264B
- SOFTWARE

264B-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_264B
- SOFTWARE

264B-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_264B

264B-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_264B

264B-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

264B-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

264B-135

Explanation: The device failed to configure.

Failing Item:

- FFC_264B
- FFC_B88
- SOFTWARE

264B-136

Explanation: The certify operation failed.

Failing Item:

- FFC_264B

264B-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_264B
- FFC_B88
- FFC_190

264B-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_264B

264B-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_264B
-

264B-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

264D-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_264D
-

264D-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_264D
-

264D-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_264D
-

264D-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_264D
-

264D-108

Explanation: The bus test failed.

Failing Item:

- FFC_264D
-

264D-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_264D
-

264D-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_264D
-

264D-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_264D
-

264D-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_264D
-

264D-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_264D
-

264D-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_264D
 - FFC_B88
-

264D-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_264D
-

264D-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_264D
-

264D-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_264D
-

264D-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_264D
- FFC_B88

264D-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_264D
- SOFTWARE

264D-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_264D
- SOFTWARE

264D-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_264D

264D-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_264D

264D-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

264D-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88

- SOFTWARE

264D-135

Explanation: The device failed to configure.

Failing Item:

- FFC_264D
- FFC_B88
- SOFTWARE

264D-136

Explanation: The certify operation failed.

Failing Item:

- FFC_264D

264D-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_264D
- FFC_B88
- FFC_190

264D-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_264D

264D-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_264D

264D-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

264E-102**Explanation:** An unrecoverable media error occurred.**Failing Item:**

- FFC_264E
-

264E-104**Explanation:** The motor failed to restart.**Failing Item:**

- FFC_264E
-

264E-105**Explanation:** The drive did not become ready.**Failing Item:**

- FFC_264E
-

264E-106**Explanation:** The electronics card test failed.**Failing Item:**

- FFC_264E
-

264E-108**Explanation:** The bus test failed.**Failing Item:**

- FFC_264E
-

264E-110**Explanation:** The media format is corrupted.**Failing Item:**

- FFC_264E
-

264E-112**Explanation:** The diagnostic test failed.**Failing Item:**

- FFC_264E
-

264E-114**Explanation:** An unrecoverable hardware error.**Failing Item:**

- FFC_264E
-

264E-116**Explanation:** A protocol error.**Response:** Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_264E
-

264E-117**Explanation:** A write-protect error occurred.**Failing Item:**

- FFC_264E
-

264E-118**Explanation:** A SCSI command time-out occurred.**Failing Item:**

- FFC_264E
 - FFC_B88
-

264E-120**Explanation:** A SCSI busy or command error.**Failing Item:**

- FFC_264E
-

264E-122**Explanation:** A SCSI reservation conflict error.**Failing Item:**

- FFC_264E
-

264E-124**Explanation:** A SCSI check condition error occurred.**Failing Item:**

- FFC_264E
-

264E-126**Explanation:** A software error was caused by a hardware failure.**Failing Item:**

- FFC_264E
 - FFC_B88
-

264E-128**Explanation:** The error log analysis indicates a hardware failure.**Failing Item:**

- FFC_190
- FFC_B88
- FFC_264E
- SOFTWARE

264E-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_264E
- SOFTWARE

264E-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_264E

264E-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_264E

264E-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

264E-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

264E-135

Explanation: The device failed to configure.

Failing Item:

- FFC_264E
- FFC_B88
- SOFTWARE

264E-136

Explanation: The certify operation failed.

Failing Item:

- FFC_264E

264E-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_264E
- FFC_B88
- FFC_190

264E-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_264E

264E-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_264E

264E-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2650-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2650

2650-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2650

2650-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2650

2650-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2650
-

2650-108

Explanation: The bus test failed.

Failing Item:

- FFC_2650
-

2650-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2650
-

2650-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2650
-

2650-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2650
-

2650-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2650
-

2650-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2650
-

2650-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2650
 - FFC_B88
-

2650-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2650
-

2650-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2650
-

2650-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2650
-

2650-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2650
 - FFC_B88
-

2650-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2650
 - SOFTWARE
-

2650-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2650
 - SOFTWARE
-

2650-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2650
-

2650-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2650
-

2650-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2650-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

2650-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2650
 - FFC_B88
 - SOFTWARE
-

2650-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2650
-

2650-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2650
 - FFC_B88
 - FFC_190
-

2650-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2650
-

2650-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2650
-

2650-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2651-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2651
-

2651-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2651
-

2651-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2651
-

2651-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2651
-

2651-108

Explanation: The bus test failed.

Failing Item:

- FFC_2651
-

2651-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2651

2651-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2651
-

2651-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2651
-

2651-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2651
-

2651-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2651
-

2651-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2651
 - FFC_B88
-

2651-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2651
-

2651-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2651
-

2651-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2651
-

2651-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2651
 - FFC_B88
-

2651-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2651
 - SOFTWARE
-

2651-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2651
 - SOFTWARE
-

2651-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2651
-

2651-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2651
-

2651-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2651-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

- SOFTWARE

2651-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2651
- FFC_B88
- SOFTWARE

2651-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2651

2651-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2651
- FFC_B88
- FFC_190

2651-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2651

2651-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_2651

2651-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2652-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2652

2652-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2652

2652-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2652

2652-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2652

2652-108

Explanation: The bus test failed.

Failing Item:

- FFC_2652

2652-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2652

2652-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2652

2652-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2652

2652-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2652

2652-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2652

2652-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2652
- FFC_B88

2652-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2652

2652-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2652

2652-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2652

2652-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2652
- FFC_B88

2652-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2652
- SOFTWARE

2652-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2652
- SOFTWARE

2652-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2652

2652-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2652

2652-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

2652-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

2652-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2652
- FFC_B88
- SOFTWARE

2652-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2652

2652-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2652
- FFC_B88
- FFC_190

2652-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2652

2652-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_2652

2652-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2653-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2653

2653-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2653

2653-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2653

2653-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2653

2653-108

Explanation: The bus test failed.

Failing Item:

- FFC_2653

2653-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2653

2653-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2653

2653-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2653

2653-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2653

2653-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2653

2653-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2653
- FFC_B88

2653-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2653
-

2653-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2653
-

2653-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2653
-

2653-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2653
 - FFC_B88
-

2653-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2653
 - SOFTWARE
-

2653-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2653
 - SOFTWARE
-

2653-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2653
-

2653-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2653
-

2653-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2653-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

2653-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2653
 - FFC_B88
 - SOFTWARE
-

2653-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2653
-

2653-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2653
 - FFC_B88
 - FFC_190
-

2653-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2653

2653-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_2653

2653-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2654-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2654

2654-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2654

2654-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2654

2654-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2654

2654-108

Explanation: The bus test failed.

Failing Item:

- FFC_2654

2654-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2654

2654-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2654

2654-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2654

2654-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2651

2654-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2654

2654-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2654
- FFC_B88

2654-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2654

2654-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2654

2654-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2654

2654-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2654
 - FFC_B88
-

2654-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2654
 - SOFTWARE
-

2654-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2654
 - SOFTWARE
-

2654-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2654
-

2654-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2654
-

2654-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2654-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

- SOFTWARE
-

2654-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2654
 - FFC_B88
 - SOFTWARE
-

2654-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2654
-

2654-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2654
 - FFC_B88
 - FFC_190
-

2654-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2654
-

2654-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2654
-

2654-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2655-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2655
-

2655-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2655
-

2655-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2655
-

2655-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2655
-

2655-108

Explanation: The bus test failed.

Failing Item:

- FFC_2655
-

2655-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2655
-

2655-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2655
-

2655-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2655
-

2655-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2651
-

2655-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2655
-

2655-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2655
 - FFC_B88
-

2655-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2655
-

2655-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2655
-

2655-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2655
-

2655-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2655
 - FFC_B88
-

2655-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2655
- SOFTWARE

2655-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2655
 - SOFTWARE
-

2655-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2655
-

2655-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2655
-

2655-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2655-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

2655-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2655
 - FFC_B88
 - SOFTWARE
-

2655-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2655
-

2655-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2655
 - FFC_B88
 - FFC_190
-

2655-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2655
-

2655-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2655
-

2655-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2656-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2656
-

2656-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2656
-

2656-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2656
-

2656-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2656
-

2656-108

Explanation: The bus test failed.

Failing Item:

- FFC_2656
-

2656-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2656
-

2656-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2656
-

2656-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2656
-

2656-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2651
-

2656-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2656
-

2656-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2656
 - FFC_B88
-

2656-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2656
-

2656-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2656
-

2656-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2656
-

2656-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2656
 - FFC_B88
-

2656-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2656
 - SOFTWARE
-

2656-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2656
 - SOFTWARE
-

2656-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2656
-

2656-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2656
-

2656-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2656-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

2656-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2656
 - FFC_B88
 - SOFTWARE
-

2656-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2656
-

2656-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2656
 - FFC_B88
 - FFC_190
-

2656-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2656
-

2656-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2656
-

2656-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2657-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2657
-

2657-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2657
-

2657-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2657
-

2657-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2657
-

2657-108

Explanation: The bus test failed.

Failing Item:

- FFC_2657
-

2657-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2657

2657-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2657
-

2657-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2657
-

2657-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2651
-

2657-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2657
-

2657-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2657
 - FFC_B88
-

2657-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2657
-

2657-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2657
-

2657-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2657
-

2657-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2657
 - FFC_B88
-

2657-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2657
 - SOFTWARE
-

2657-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2657
 - SOFTWARE
-

2657-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2657
-

2657-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2657
-

2657-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2657-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

- SOFTWARE

2657-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2657
 - FFC_B88
 - SOFTWARE
-

2657-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2657
-

2657-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2657
 - FFC_B88
 - FFC_190
-

2657-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2657
-

2657-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2657
-

2657-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2658-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2658
-

2658-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2658
-

2658-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2658
-

2658-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2658
-

2658-108

Explanation: The bus test failed.

Failing Item:

- FFC_2658
-

2658-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2658
-

2658-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2658
-

2658-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2658
-

2658-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2651
-

2658-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2658
-

2658-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2658
 - FFC_B88
-

2658-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2658
-

2658-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2658
-

2658-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2658
-

2658-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2658
 - FFC_B88
-

2658-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2658
 - SOFTWARE
-

2658-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2658
 - SOFTWARE
-

2658-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2658
-

2658-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2658
-

2658-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2658-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

2658-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2658
 - FFC_B88
 - SOFTWARE
-

2658-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2658
-

2658-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2658
 - FFC_B88
 - FFC_190
-

2658-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2658
-

2658-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2658
-

2658-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2659-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2659
-

2659-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2659
-

2659-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2659
-

2659-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2659
-

2659-108

Explanation: The bus test failed.

Failing Item:

- FFC_2659
-

2659-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2659
-

2659-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2659
-

2659-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2659
-

2659-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2651
-

2659-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2659
-

2659-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2659
 - FFC_B88
-

2659-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2659
-

2659-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2659
-

2659-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2659
-

2659-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2659
 - FFC_B88
-

2659-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2659
 - SOFTWARE
-

2659-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2659
 - SOFTWARE
-

2659-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2659
-

2659-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2659
-

2659-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2659-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

2659-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2659
 - FFC_B88
 - SOFTWARE
-

2659-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2659
-

2659-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2659
 - FFC_B88
 - FFC_190
-

2659-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2659

2659-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2659
-

2659-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

265B-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_265B
-

265B-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_265B
-

265B-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_265B
-

265B-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_265B
-

265B-108

Explanation: The bus test failed.

Failing Item:

- FFC_265B
-

265B-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_265B
-

265B-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_265B
-

265B-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_265B
-

265B-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2651
-

265B-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_265B
-

265B-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_265B
 - FFC_B88
-

265B-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_265B
-

265B-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_265B
-

265B-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_265B
-

265B-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_265B
- FFC_B88

265B-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_265B
- SOFTWARE

265B-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_265B
- SOFTWARE

265B-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_265B

265B-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_265B

265B-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

265B-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88

- SOFTWARE

265B-135

Explanation: The device failed to configure.

Failing Item:

- FFC_265B
- FFC_B88
- SOFTWARE

265B-136

Explanation: The certify operation failed.

Failing Item:

- FFC_265B

265B-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_265B
- FFC_B88
- FFC_190

265B-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_265B

265B-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_265B

265B-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2667-125

Explanation: A power supply error condition has occurred.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_153
-

2667-135

Explanation: A fan error condition has occurred.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_166
-

2667-145

Explanation: The enclosure indicates a temperature threshold condition.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_166
-

2667-155

Explanation: An expander card error condition has occurred.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2667
-

2667-175

Explanation: An enclosure services error condition has occurred.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2667
-

2667-201

Explanation: Device configuration error.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2667
 - FFC_2680
-

2667-202

Explanation: The enclosure failed to open.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2667
 - FFC_2680
-

2667-203

Explanation: The enclosure failed to return inquiry data.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2667
 - FFC_2680
-

2667-210

Explanation: The enclosure indicates a power fault to a media bay.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_2681
 - CABLE
-

2667-239

Explanation: The enclosure indicates a voltage threshold condition.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_153
 - FFC_2667
-

2667-246

Explanation: The enclosure indicates a temperature threshold condition.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_166
 - FFC_2667
-

2670-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2670
-

2670-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2670
-

2670-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2670
-

2670-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2670
-

2670-108

Explanation: The bus test failed.

Failing Item:

- FFC_2670
-

2670-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2670
-

2670-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2670
-

2670-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2670
-

2670-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2670
-

2670-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2670
-

2670-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2670
 - FFC_B88
-

2670-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2670
-

2670-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2670
-

2670-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2670
-

2670-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2670
 - FFC_B88
-

2670-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2670
 - SOFTWARE
-

2670-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2670
 - SOFTWARE
-

2670-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2670
-

2670-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2670
-

2670-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2670-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

2670-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2670
 - FFC_B88
 - SOFTWARE
-

2670-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2670
-

2670-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2670
 - FFC_B88
 - FFC_190
-

2670-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2670
-

2670-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2670
-

2670-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2671-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2671
-

2671-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2671
-

2671-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2671
-

2671-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2671
-

2671-108

Explanation: The bus test failed.

Failing Item:

- FFC_2671
-

2671-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2671
-

2671-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2671
-

2671-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2671
-

2671-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2671
-

2671-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2671
-

2671-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2671
 - FFC_B88
-

2671-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2671
-

2671-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2671
-

2671-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2671
-

2671-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2671
 - FFC_B88
-

2671-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2671
 - SOFTWARE
-

2671-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2671
 - SOFTWARE
-

2671-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2671
-

2671-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2671
-

2671-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2671-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

2671-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2671
 - FFC_B88
 - SOFTWARE
-

2671-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2671
-

2671-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2671
 - FFC_B88
 - FFC_190
-

2671-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2671
-

2671-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2671
-

2671-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2672-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2672
-

2672-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2672
-

2672-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2672
-

2672-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2672
-

2672-108

Explanation: The bus test failed.

Failing Item:

- FFC_2672
-

2672-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2672

2672-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2672
-

2672-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2672
-

2672-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2672
-

2672-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2672
-

2672-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2672
 - FFC_B88
-

2672-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2672
-

2672-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2672
-

2672-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2672
-

2672-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2672
 - FFC_B88
-

2672-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2672
 - SOFTWARE
-

2672-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2672
 - SOFTWARE
-

2672-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2672
-

2672-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2672
-

2672-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2672-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

- SOFTWARE

2672-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2672
 - FFC_B88
 - SOFTWARE
-

2672-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2672
-

2672-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2672
 - FFC_B88
 - FFC_190
-

2672-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2672
-

2672-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2672
-

2672-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2679-101

Explanation: Device failure indicated

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2679
-

2679-201

Explanation: Unable to configure adapter.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_25A0
-

2679-202

Explanation: Unable to configure the device.

Response: Try switching out the DVD media. If the problem persists, go to MAP0210 : General problem resolution.

Failing Item:

- MEDIA
 - FFC_2679
 - FFC_25A0
-

2679-203

Explanation: Device failure indicated

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_25A0
-

2679-204

Explanation: The Inquire command failed.

Response: Try switching out the DVD media. If the problem persists, go to MAP0210 : General problem resolution.

Failing Item:

- MEDIA
 - FFC_2679
-

2679-205

Explanation: The Read Sense Data command failed.

Response: Try switching out the DVD media. If the problem persists, go to MAP0210 : General problem resolution.

Failing Item:

- MEDIA
- FFC_2679

2679-206

Explanation: The Test Unit Ready command failed.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2679

2679-207

Explanation: A media error was detected.

Response: Try switching out the DVD media. If the problem persists, go to MAP0210 : General problem resolution.

Failing Item:

- MEDIA
- FFC_2679

2679-210

Explanation: The Prevent Media Removal or Allow Media Removal or command failed.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2679

2679-211

Explanation: DVD-ROM drive indicates an error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2679

2679-212

Explanation: The Write/Read/Compare Test Failed.

Response: Try switching out the DVD media. If the problem persists, go to MAP0210 : General problem resolution.

Failing Item:

- MEDIA
- FFC_2679

2679-701

Explanation: ELA indicates drive hardware failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2679

2679-702

Explanation: ELA indicates drive hardware failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2679

2679-703

Explanation: Error log analysis indicates a track following error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2679

267B-101

Explanation: Unable to open device driver.

Failing Item:

- FFC_267B

267B-201

Explanation: Unable to configure adapter.

Failing Item:

- FFC_25A0

267B-202

Explanation: Unable to configure the device.

Failing Item:

- FFC_267B
- FFC_25A0
- MEDIA

267B-203

Explanation: Unable to open adapter driver.

Failing Item:

- FFC_25A0

267B-204

Explanation: The Inquire command failed.

Failing Item:

- MEDIA
 - FFC_267B
-

267B-205

Explanation: The Read Sense Data command failed.

Failing Item:

- FFC_267B
 - MEDIA
-

267B-206

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_267B
-

267B-207

Explanation: A media error was detected.

Response: Try switching out the media. If the problem persists, go to MAP0210 : General problem resolution.

Failing Item:

- MEDIA
 - FFC_267B
-

267B-210

Explanation: The Prevent Media Removal or Allow Media Removal command failed.

Failing Item:

- FFC_267B
-

267B-701

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_267B
-

267B-702

Explanation: ELA indicates drive hardware failure.

Failing Item:

- FFC_267B
-

2682-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2682
-

2682-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2682
-

2682-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2682
-

2682-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2682
-

2682-108

Explanation: The bus test failed.

Failing Item:

- FFC_2682
-

2682-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2682
-

2682-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2682
-

2682-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2682
-

2682-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2682
-

2682-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2682
-

2682-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2682
 - FFC_B88
-

2682-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2682
-

2682-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2682
-

2682-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2682
-

2682-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2682
 - FFC_B88
-

2682-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2682
 - SOFTWARE
-

2682-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2682
 - SOFTWARE
-

2682-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2682
-

2682-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2682
-

2682-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2682-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

2682-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2682
 - FFC_B88
 - SOFTWARE
-

2682-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2682
-

2682-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2682
 - FFC_B88
 - FFC_190
-

2682-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2682
-

2682-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2682
-

2682-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2684-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2684
-

2684-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2684
-

2684-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2684
-

2684-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2684
-

2684-108

Explanation: The bus test failed.

Failing Item:

- FFC_2684
-

2684-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2684
-

2684-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2684
-

2684-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2684
-

2684-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2684
-

2684-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2684
-

2684-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2684
 - FFC_B88
-

2684-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2684

2684-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2684

2684-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2684

2684-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2684
- FFC_B88

2684-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2684
- SOFTWARE

2684-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2684
- SOFTWARE

2684-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2684

2684-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2684

2684-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

2684-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

2684-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2684
- FFC_B88
- SOFTWARE

2684-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2684

2684-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2684
- FFC_B88
- FFC_190

2684-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2684

2684-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_2684

2684-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2685-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2685

2685-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2685

2685-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2685

2685-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2685

2685-108

Explanation: The bus test failed.

Failing Item:

- FFC_2685

2685-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2685

2685-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2685

2685-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2685

2685-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2685

2685-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2685

2685-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2685
- FFC_B88

2685-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2685

2685-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2685

2685-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2685

2685-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2685
- FFC_B88

2685-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2685
- SOFTWARE

2685-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2685
- SOFTWARE

2685-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2685

2685-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2685

2685-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

2685-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88

- SOFTWARE

2685-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2685
- FFC_B88
- SOFTWARE

2685-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2685

2685-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2685
- FFC_B88
- FFC_190

2685-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2685

2685-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_2685

2685-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2687-102**Explanation:** An unrecoverable media error occurred.**Failing Item:**

- FFC_2687
-

2687-104**Explanation:** The motor failed to restart.**Failing Item:**

- FFC_2687
-

2687-105**Explanation:** The drive did not become ready.**Failing Item:**

- FFC_2687
-

2687-106**Explanation:** The electronics card test failed.**Failing Item:**

- FFC_2687
-

2687-108**Explanation:** The bus test failed.**Failing Item:**

- FFC_2687
-

2687-110**Explanation:** The media format is corrupted.**Failing Item:**

- FFC_2687
-

2687-112**Explanation:** The diagnostic test failed.**Failing Item:**

- FFC_2687
-

2687-114**Explanation:** An unrecoverable hardware error.**Failing Item:**

- FFC_2687
-

2687-116**Explanation:** A protocol error.**Response:** Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2687
-

2687-117**Explanation:** A write-protect error occurred.**Failing Item:**

- FFC_2687
-

2687-118**Explanation:** A SCSI command time-out occurred.**Failing Item:**

- FFC_2687
 - FFC_B88
-

2687-120**Explanation:** A SCSI busy or command error.**Failing Item:**

- FFC_2687
-

2687-122**Explanation:** A SCSI reservation conflict error.**Failing Item:**

- FFC_2687
-

2687-124**Explanation:** A SCSI check condition error occurred.**Failing Item:**

- FFC_2687
-

2687-126**Explanation:** A software error was caused by a hardware failure.**Failing Item:**

- FFC_2687
 - FFC_B88
-

2687-128**Explanation:** The error log analysis indicates a hardware failure.**Failing Item:**

- FFC_190
- FFC_B88
- FFC_2687
- SOFTWARE

2687-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2687
- SOFTWARE

2687-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2687

2687-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2687

2687-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

2687-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

2687-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2687
- FFC_B88
- SOFTWARE

2687-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2687

2687-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2687
- FFC_B88
- FFC_190

2687-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2687

2687-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_2687

2687-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2690-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2690

2690-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2690

2690-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2690

2690-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2690
-

2690-108

Explanation: The bus test failed.

Failing Item:

- FFC_2690
-

2690-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2690
-

2690-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2690
-

2690-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2690
-

2690-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2690
-

2690-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2690
-

2690-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2690
 - FFC_B88
-

2690-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2690
-

2690-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2690
-

2690-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2690
-

2690-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2690
 - FFC_B88
-

2690-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2690
 - SOFTWARE
-

2690-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2690
 - SOFTWARE
-

2690-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2690
-

2690-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2690
-

2690-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2690-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

2690-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2690
 - FFC_B88
 - SOFTWARE
-

2690-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2690
-

2690-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2690
 - FFC_B88
 - FFC_190
-

2690-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2690
-

2690-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2690
-

2690-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2699-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2699
-

2699-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2699
-

2699-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2699
-

2699-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2699
-

2699-108

Explanation: The bus test failed.

Failing Item:

- FFC_2699
-

2699-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2699

2699-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2699
-

2699-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2699
-

2699-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2699
-

2699-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2699
-

2699-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2699
 - FFC_B88
-

2699-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2699
-

2699-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2699
-

2699-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2699
-

2699-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2699
 - FFC_B88
-

2699-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2699
 - SOFTWARE
-

2699-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2699
 - SOFTWARE
-

2699-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2699
-

2699-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2699
-

2699-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2699-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

- SOFTWARE

2699-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2699
- FFC_B88
- SOFTWARE

2699-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2699

2699-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2699
- FFC_B88
- FFC_190

2699-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2699

2699-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_2699

2699-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

26B4-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_26B4

26B4-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_26B4

26B4-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_26B4

26B4-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_26B4

26B4-108

Explanation: The bus test failed.

Failing Item:

- FFC_26B4

26B4-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_26B4

26B4-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_26B4

26B4-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_26B4

26B4-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_26B4
- FFC_26BD

26B4-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_26B4

26B4-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_26B4
- FFC_26BD
- FFC_B88

26B4-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_26B4
- FFC_26BD

26B4-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_26B4
- FFC_26BD

26B4-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_26B4
- FFC_26BD

26B4-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_26B4
- FFC_26BD
- FFC_B88

26B4-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_26BD
- FFC_B88
- FFC_26B4
- SOFTWARE

26B4-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_26BD
- FFC_B88
- FFC_26B4
- SOFTWARE

26B4-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_26B4

26B4-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_26B4
- FFC_26BD

26B4-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

26B4-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

26B4-135

Explanation: The device failed to configure.

Failing Item:

- FFC_26B4

26B4-136 • 26B8-116

- FFC_26BD
- FFC_B88
- SOFTWARE

26B4-136

Explanation: The certify operation failed.

Failing Item:

- FFC_26B4

26B4-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_26B4
- FFC_26BD
- FFC_B88

26B4-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_26B4

26B4-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_26BD
- FFC_B88
- FFC_26B4

26B4-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

26B8-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_26B8

26B8-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_26B8

26B8-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_26B8

26B8-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_26B8

26B8-108

Explanation: The bus test failed.

Failing Item:

- FFC_26B8

26B8-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_26B8

26B8-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_26B8

26B8-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_26B8

26B8-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_26B8

26B8-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_26B8
-

26B8-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_26B8
 - FFC_B88
-

26B8-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_26B8
-

26B8-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_26B8
-

26B8-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_26B8
-

26B8-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_26B8
 - FFC_B88
-

26B8-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_26B8
 - SOFTWARE
-

26B8-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_26B8
 - SOFTWARE
-

26B8-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_26B8
-

26B8-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_26B8
-

26B8-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

26B8-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

26B8-135

Explanation: The device failed to configure.

Failing Item:

- FFC_26B8
 - FFC_B88
 - SOFTWARE
-

26B8-136

Explanation: The certify operation failed.

Failing Item:

- FFC_26B8
-

26B8-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_26B8
- FFC_B88
- FFC_190

26B8-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_26B8

26B8-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_26B8

26B8-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

26D0-110

Explanation: The Reserve command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0

26D0-120

Explanation: The Inquiry command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0

26D0-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- MEDIA

26D0-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26D0

26D0-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- MEDIA

26D0-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26D0

26D0-140

Explanation: The Mode Select command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0

26D0-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- MEDIA

26D0-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26D0

26D0-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- MEDIA

26D0-161

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26D0

26D0-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26D0

26D0-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- MEDIA

26D0-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_B88
- MEDIA

26D0-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26D0
- FFC_B88

26D0-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- MEDIA

26D0-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26D0

26D0-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- MEDIA

26D0-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26D0

26D0-190

Explanation: The Mode Select command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0

26D0-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- MEDIA

26D0-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26D0

26D0-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- MEDIA

26D0-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_26D0
-

26D0-220

Explanation: The Release command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
-

26D0-230

Explanation: The Request Sense command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
-

26D0-240

Explanation: The Openx command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
-

26D0-300

Explanation: The device configuration failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - SOFTWARE
-

26D0-310

Explanation: SCSI adapter configuration failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2680
 - FFC_26D0
 - SOFTWARE
-

26D0-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - MEDIA
-

26D0-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_26D0
-

26D0-411

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-412

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-413

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-414

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0

26D0-415 • 26D0-511

- FFC_2680
- SOFTWARE

26D0-415

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680
- SOFTWARE

26D0-416

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680
- SOFTWARE

26D0-417

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680
- SOFTWARE

26D0-418

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680
- SOFTWARE

26D0-419

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680

- SOFTWARE

26D0-420

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680
- SOFTWARE

26D0-421

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680
- SOFTWARE

26D0-422

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680
- SOFTWARE

26D0-423

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680
- SOFTWARE

26D0-511

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680

26D0-512

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
-

26D0-513

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
-

26D0-514

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
-

26D0-515

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
-

26D0-516

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
-

26D0-517

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
-

26D0-518

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
-

26D0-519

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
-

26D0-520

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
-

26D0-521

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
-

26D0-522

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680

26D0-523

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680

26D0-611

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680
- SOFTWARE

26D0-612

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680
- SOFTWARE

26D0-613

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680
- SOFTWARE

26D0-614

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680
- SOFTWARE

26D0-615

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680
- SOFTWARE

26D0-616

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680
- SOFTWARE

26D0-617

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680
- SOFTWARE

26D0-618

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-619

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-620

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-621

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-622

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-623

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-711

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-712

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-713

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-714

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-715

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
 - FFC_2680
 - SOFTWARE
-

26D0-716

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680
- SOFTWARE

26D0-717

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680
- SOFTWARE

26D0-718

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680
- SOFTWARE

26D0-719

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680
- SOFTWARE

26D0-720

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680
- SOFTWARE

26D0-721

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680
- SOFTWARE

26D0-722

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680
- SOFTWARE

26D0-723

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D0
- FFC_2680
- SOFTWARE

26D1-110

Explanation: The Reserve command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1

26D1-120

Explanation: The Inquiry command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1

26D1-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- MEDIA

26D1-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26D1

26D1-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- MEDIA

26D1-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26D1

26D1-140

Explanation: The Mode Select command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1

26D1-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- MEDIA

26D1-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26D1

26D1-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- MEDIA

26D1-161

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26D1

26D1-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

26D1-169 • 26D1-200

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26D1

26D1-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- MEDIA

26D1-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_B88
- MEDIA

26D1-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26D1
- FFC_B88

26D1-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- MEDIA

26D1-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26D1

26D1-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- MEDIA

26D1-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26D1

26D1-190

Explanation: The Mode Select command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1

26D1-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- MEDIA

26D1-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26D1

26D1-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- MEDIA

26D1-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26D1

26D1-220

Explanation: The Release command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1

26D1-230

Explanation: The Request Sense command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1

26D1-240

Explanation: The Openx command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1

26D1-300

Explanation: The device configuration failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- SOFTWARE

26D1-310

Explanation: SCSI adapter configuration failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D02
- FFC_26D1
- SOFTWARE

26D1-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- MEDIA

26D1-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the

26D1-411 • 26D1-419

instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_26D1
-

26D1-411

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-412

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-413

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-414

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-415

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-416

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-417

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-418

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-419

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-420

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-421

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-422

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-423

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-511

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02

26D1-512

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
-

26D1-513

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
-

26D1-514

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
-

26D1-515

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
-

26D1-516

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
-

26D1-517

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02

26D1-518

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02

26D1-519

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02

26D1-520

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02

26D1-521

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02

26D1-522

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02

26D1-523

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02

26D1-611

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02
- SOFTWARE

26D1-612

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02
- SOFTWARE

26D1-613

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-614

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-615

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-616

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-617

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-618

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-619

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-620

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-621

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-622

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-623

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-711

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02
- SOFTWARE

26D1-712

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02
- SOFTWARE

26D1-713

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02
- SOFTWARE

26D1-714

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02
- SOFTWARE

26D1-715

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02
- SOFTWARE

26D1-716

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02
- SOFTWARE

26D1-717

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02
- SOFTWARE

26D1-718

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02
- SOFTWARE

26D1-719

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
- FFC_2D02
- SOFTWARE

26D1-720

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-721

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-722

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D1-723

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26D1
 - FFC_2D02
 - SOFTWARE
-

26D2-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_26D2
-

26D2-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_26D2
-

26D2-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_26D2
-

26D2-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_26D2
-

26D2-108

Explanation: The bus test failed.

Failing Item:

- FFC_26D2
-

26D2-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_26D2
-

26D2-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_26D2
-

26D2-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_26D2
-

26D2-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_26D2
-

26D2-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_26D2
-

26D2-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_26D2
 - FFC_B88
-

26D2-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_26D2
-

26D2-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_26D2
-

26D2-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_26D2
-

26D2-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_26D2
 - FFC_B88
-

26D2-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_26D2
 - SOFTWARE
-

26D2-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_26D2
 - SOFTWARE
-

26D2-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_26D2
-

26D2-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_26D2
-

26D2-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

26D2-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

26D2-135

Explanation: The device failed to configure.

Failing Item:

- FFC_26D2
 - FFC_B88
 - SOFTWARE
-

26D2-136

Explanation: The certify operation failed.

Failing Item:

- FFC_26D2
-

26D2-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_26D2
 - FFC_B88
 - FFC_190
-

26D2-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_26D2

26D2-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_26D2

26D2-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

26D3-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_26D3

26D3-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_26D3

26D3-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_26D3

26D3-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_26D3

26D3-108

Explanation: The bus test failed.

Failing Item:

- FFC_26D3

26D3-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_26D3

26D3-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_26D3

26D3-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_26D3

26D3-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_26D3

26D3-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_26D3

26D3-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_26D3
- FFC_B88

26D3-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_26D3

26D3-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_26D3

26D3-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_26D3

26D3-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_26D3
- FFC_B88

26D3-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_26D3
- SOFTWARE

26D3-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_26D3
- SOFTWARE

26D3-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_26D3

26D3-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_26D3

26D3-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

26D3-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88

- SOFTWARE

26D3-135

Explanation: The device failed to configure.

Failing Item:

- FFC_26D3
- FFC_B88
- SOFTWARE

26D3-136

Explanation: The certify operation failed.

Failing Item:

- FFC_26D3

26D3-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_26D3
- FFC_B88
- FFC_190

26D3-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_26D3

26D3-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_26D3

26D3-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

26DD-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_26DD
-

26DD-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_26DD
-

26DD-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_26DD
-

26DD-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_26DD
-

26DD-108

Explanation: The bus test failed.

Failing Item:

- FFC_26DD
-

26DD-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_26DD
-

26DD-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_26DD
-

26DD-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_26DD
-

26DD-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_26DD
-

26DD-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_26DD
-

26DD-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_26DD
 - FFC_B88
-

26DD-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_26DD
-

26DD-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_26DD
-

26DD-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_26DD
-

26DD-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_26DD
 - FFC_B88
-

26DD-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_26DD
- SOFTWARE

26DD-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_26DD
 - SOFTWARE
-

26DD-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_26DD
-

26DD-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_26DD
-

26DD-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

26DD-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

26DD-135

Explanation: The device failed to configure.

Failing Item:

- FFC_26DD
 - FFC_B88
 - SOFTWARE
-

26DD-136

Explanation: The certify operation failed.

Failing Item:

- FFC_26DD
-

26DD-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_26DD
 - FFC_B88
 - FFC_190
-

26DD-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_26DD
-

26DD-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_26DD
-

26DD-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

26E0-101

Explanation: Dock failure reported

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E0
-

26E0-102

Explanation: Cartridge failure reported

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E2
-

26E0-601

Explanation: ELA failure reported

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E0
-

26E1-101

Explanation: Dock failure reported

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E1
-

26E1-102

Explanation: Cartridge failure reported

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E2
-

26E1-601

Explanation: ELA failure reported

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E1
-

26E5-110

Explanation: The Reserve command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
-

26E5-120

Explanation: The Inquiry command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
-

26E5-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - MEDIA
-

26E5-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_26E5
-

26E5-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - MEDIA
-

26E5-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_26E5
-

26E5-140

Explanation: The Mode Select command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5

26E5-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- MEDIA

26E5-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26E5

26E5-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- MEDIA

26E5-161

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26E5

26E5-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26E5

26E5-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- MEDIA

26E5-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_B88
- MEDIA

26E5-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_26E5
- FFC_B88

26E5-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - MEDIA
-

26E5-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_26E5
-

26E5-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - MEDIA
-

26E5-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_26E5
-

26E5-190

Explanation: The Mode Select command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
-

26E5-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - MEDIA
-

26E5-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_26E5
-

26E5-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - MEDIA
-

26E5-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_26E5
-

26E5-220

Explanation: The Release command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
-

26E5-230

Explanation: The Request Sense command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
-

26E5-240

Explanation: The Openx command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
-

26E5-300

Explanation: The device configuration failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - SOFTWARE
-

26E5-310

Explanation: SCSI adapter configuration failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2680
 - FFC_26E5
 - SOFTWARE
-

26E5-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - MEDIA
-

26E5-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_26E5
-

26E5-411

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - FFC_2680
 - SOFTWARE
-

26E5-412

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - FFC_2680
 - SOFTWARE
-

26E5-413

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - FFC_2680
 - SOFTWARE
-

26E5-414

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5

- FFC_2680
- SOFTWARE

26E5-415

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680
- SOFTWARE

26E5-416

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680
- SOFTWARE

26E5-417

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680
- SOFTWARE

26E5-418

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680
- SOFTWARE

26E5-419

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680

- SOFTWARE

26E5-420

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680
- SOFTWARE

26E5-421

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680
- SOFTWARE

26E5-422

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680
- SOFTWARE

26E5-423

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680
- SOFTWARE

26E5-511

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680

26E5-512

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680

26E5-513

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680

26E5-514

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680

26E5-515

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680

26E5-516

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680

26E5-517

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680

26E5-518

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680

26E5-519

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680

26E5-520

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680

26E5-521

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - FFC_2680
-

26E5-522

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - FFC_2680
-

26E5-523

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - FFC_2680
-

26E5-611

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - FFC_2680
 - SOFTWARE
-

26E5-612

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - FFC_2680
 - SOFTWARE
-

26E5-613

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - FFC_2680
 - SOFTWARE
-

26E5-614

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - FFC_2680
 - SOFTWARE
-

26E5-615

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - FFC_2680
 - SOFTWARE
-

26E5-616

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - FFC_2680
 - SOFTWARE
-

26E5-617

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - FFC_2680
 - SOFTWARE
-

26E5-618

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - FFC_2680
 - SOFTWARE
-

26E5-619

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680
- SOFTWARE

26E5-620

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680
- SOFTWARE

26E5-621

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680
- SOFTWARE

26E5-622

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680
- SOFTWARE

26E5-623

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680
- SOFTWARE

26E5-711

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680
- SOFTWARE

26E5-712

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680
- SOFTWARE

26E5-713

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680
- SOFTWARE

26E5-714

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
- FFC_2680
- SOFTWARE

26E5-715

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - FFC_2680
 - SOFTWARE
-

26E5-716

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - FFC_2680
 - SOFTWARE
-

26E5-717

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - FFC_2680
 - SOFTWARE
-

26E5-718

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - FFC_2680
 - SOFTWARE
-

26E5-719

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - FFC_2680
 - SOFTWARE
-

26E5-720

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - FFC_2680
 - SOFTWARE
-

26E5-721

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - FFC_2680
 - SOFTWARE
-

26E5-722

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - FFC_2680
 - SOFTWARE
-

26E5-723

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E5
 - FFC_2680
 - SOFTWARE
-

26E7-101

Explanation: Dock failure reported

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E7
-

26E7-102

Explanation: Cartridge failure reported

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E2
-

26E7-601

Explanation: ELA failure reported

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E7
-

26E9-101

Explanation: Dock failure reported

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E9
-

26E9-102

Explanation: Cartridge failure reported

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E2
-

26E9-601

Explanation: ELA failure reported

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_26E9
-

2679-2712

Explanation: Device failure indicated

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2712
 - FFC_2679
-

2679-2713

Explanation: Device failure indicated

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2713
 - FFC_2679
-

2699-1001

Explanation: A disk has failed or is not responding and needs to be replaced.

Response: Use MAP5000

Failing Item:

- FFC_2699
-

26B8-1001

Explanation: A disk has failed or is not responding and needs to be replaced.

Response: Use MAP5000

Failing Item:

- FFC_26B8
-

26DD-1001

Explanation: A disk has failed or is not responding and needs to be replaced.

Response: Use MAP5000

Failing Item:

- FFC_26DD
-

27PAA

Explanation: An SSA Threshold Exceeded link error was detected.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

Note:

P denotes the adapter port number.

AA denotes the SSA address.

2710-101

Explanation: Diagnostics indicates adapter configuration failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2710
-

2710-601

Explanation: Error log analysis indicates adapter function failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2710
-

2714-201

Explanation: Configuration register test failed.

Response: Use MAP0210 : General problem resolution, located in your host server service guide.

Failing Item:

- FFC_2714
 - FFC_221
-

2714-202

Explanation: IO Register test failed.

Response: Use MAP0210 : General problem resolution, located in your host server service guide.

Failing Item:

- FFC_2714
 - FFC_221
-

2714-203

Explanation: VPD test failed.

Response: Use MAP0210 : General problem resolution, located in your host server service guide.

Failing Item:

- FFC_2714
 - FFC_221
-

2714-204

Explanation: EEH failure during test.

Response: Use MAP0210 : General problem resolution, located in your host server service guide.

Failing Item:

- FFC_221
 - FFC_2714
-

2714-205

Explanation: Adapet failure during test.

Response: Use MAP0210 : General problem resolution, located in your host server service guide.

Failing Item:

- FFC_2714
-

2714-602

Explanation: USB Adapter Hardware Permanent Error.

Response: Use MAP0210 : General problem resolution, located in your host server service guide.

Failing Item:

- FFC_2714
-

2715-201

Explanation: Configuration register test failed.

Response: Use MAP0210 : General problem resolution, located in your host server service guide.

Failing Item:

- FFC_2715
 - FFC_221
-

2715-202

Explanation: IO Register test failed.

Response: Use MAP0210 : General problem resolution, located in your host server service guide.

Failing Item:

- FFC_2715
 - FFC_221
-

2715-203

Explanation: VPD test failed.

Response: Use MAP0210 : General problem resolution, located in your host server service guide.

Failing Item:

- FFC_2715
 - FFC_221
-

2715-204

Explanation: EEH failure during test.

Response: Use MAP0210 : General problem resolution, located in your host server service guide.

Failing Item:

- FFC_221
 - FFC_2715
-

2715-205

Explanation: Adapet failure during test.

Response: Use MAP0210 : General problem resolution, located in your host server service guide.

Failing Item:

- FFC_2715
-

2715-602

Explanation: USB Adapter Hardware Permanent Error.

Response: Use MAP0210 : General problem resolution, located in your host server service guide.

Failing Item:

- FFC_2715
-

2720-101

Explanation: Device failure indicated

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2720
-

2720-201

Explanation: Unable to configure adapter.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_25A0
-

2720-202

Explanation: Unable to configure the device.

Response: Try switching out the DVD media. If the problem persists, go to MAP0210 : General problem resolution.

Failing Item:

- MEDIA
 - FFC_2720
 - FFC_25A0
-

2720-203

Explanation: Device failure indicated

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_25A0
-

2720-204

Explanation: The Inquire command failed.

Response: Try switching out the DVD media. If the problem persists, go to MAP0210 : General problem resolution.

Failing Item:

- MEDIA
 - FFC_2720
-

2720-205

Explanation: The Read Sense Data command failed.

Response: Try switching out the DVD media. If the problem persists, go to MAP0210 : General problem resolution.

Failing Item:

- MEDIA
 - FFC_2720
-

2720-206

Explanation: The Test Unit Ready command failed.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2720
-

2720-207

Explanation: A media error was detected.

Response: Try switching out the DVD media. If the problem persists, go to MAP0210 : General problem resolution.

Failing Item:

- MEDIA
 - FFC_2720
-

2720-210

Explanation: The Prevent Media Removal or Allow Media Removal or command failed.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2720
-

2720-211

Explanation: DVD-ROM drive indicates an error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2720
-

2720-212

Explanation: The Write/Read/Compare Test Failed.

Response: Try switching out the DVD media. If the problem persists, go to MAP0210 : General problem resolution.

Failing Item:

- MEDIA
 - FFC_2720
-

2720-701

Explanation: ELA indicates drive hardware failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2720
-

2720-702

Explanation: ELA indicates drive hardware failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2720
-

2720-703

Explanation: Error log analysis indicates a track following error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2720
-

2722-110

Explanation: The Reserve command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
-

2722-120

Explanation: The Inquiry command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
-

2722-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
 - MEDIA
-

2722-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2722
-

2722-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
 - MEDIA
-

2722-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2722
-

2722-140

Explanation: The Mode Select command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
-

2722-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
 - MEDIA
-

2722-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the

instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2722
-

2722-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
 - MEDIA
-

2722-161

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2722
-

2722-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2722
-

2722-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
-

- MEDIA
-

2722-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
 - FFC_B88
 - MEDIA
-

2722-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2722
 - FFC_B88
-

2722-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
 - MEDIA
-

2722-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2722
-

2722-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
 - MEDIA
-

2722-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2722
-

2722-190

Explanation: The Mode Select command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
-

2722-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
 - MEDIA
-

2722-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2722
-

2722-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
 - MEDIA
-

2722-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_2722
-

2722-220

Explanation: The Release command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
-

2722-230

Explanation: The Request Sense command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
-

2722-240

Explanation: The Openx command failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
-

2722-300

Explanation: The device configuration failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
- SOFTWARE

2722-310

Explanation: SCSI adapter configuration failed.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2680
- FFC_2722
- SOFTWARE

2722-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
- MEDIA

2722-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_2722

2722-411

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
- FFC_2680
- SOFTWARE

2722-412

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
- FFC_2680
- SOFTWARE

2722-413

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
- FFC_2680
- SOFTWARE

2722-414

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
- FFC_2680
- SOFTWARE

2722-415

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
- FFC_2680
- SOFTWARE

2722-416

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
 - FFC_2680
 - SOFTWARE
-

2722-417

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
 - FFC_2680
 - SOFTWARE
-

2722-418

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
 - FFC_2680
 - SOFTWARE
-

2722-419

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
 - FFC_2680
 - SOFTWARE
-

2722-420

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
 - FFC_2680
 - SOFTWARE
-

2722-421

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
 - FFC_2680
 - SOFTWARE
-

2722-422

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
 - FFC_2680
 - SOFTWARE
-

2722-423

Explanation: A reservation conflict occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
 - FFC_2680
 - SOFTWARE
-

2722-511

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
 - FFC_2680
-

2722-512

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
 - FFC_2680
-

2722-513

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
 - FFC_2680
-

2722-514

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
- FFC_2680

2722-515

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
- FFC_2680

2722-516

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
- FFC_2680

2722-517

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
- FFC_2680

2722-518

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
- FFC_2680

2722-519

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
- FFC_2680

2722-520

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
- FFC_2680

2722-521

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
- FFC_2680

2722-522

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
- FFC_2680

2722-523

Explanation: The drive returned bad or non-extended sense data.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
 - FFC_2680
-

2722-611

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
 - FFC_2680
 - SOFTWARE
-

2722-612

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
 - FFC_2680
 - SOFTWARE
-

2722-613

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
 - FFC_2680
 - SOFTWARE
-

2722-614

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
 - FFC_2680
 - SOFTWARE
-

2722-615

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
 - FFC_2680
 - SOFTWARE
-

2722-616

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
 - FFC_2680
 - SOFTWARE
-

2722-617

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
 - FFC_2680
 - SOFTWARE
-

2722-618

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
 - FFC_2680
 - SOFTWARE
-

2722-619

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
 - FFC_2680
 - SOFTWARE
-

2722-620

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
 - FFC_2680
 - SOFTWARE
-

2722-621

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
- FFC_2680
- SOFTWARE

2722-622

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
- FFC_2680
- SOFTWARE

2722-623

Explanation: An adapter or bus I/O error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
- FFC_2680
- SOFTWARE

2722-711

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
- FFC_2680
- SOFTWARE

2722-712

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
- FFC_2680
- SOFTWARE

2722-713

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
- FFC_2680
- SOFTWARE

2722-714

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
- FFC_2680
- SOFTWARE

2722-715

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
- FFC_2680
- SOFTWARE

2722-716

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
- FFC_2680
- SOFTWARE

2722-717

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
 - FFC_2680
 - SOFTWARE
-

2722-718

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
 - FFC_2680
 - SOFTWARE
-

2722-719

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
 - FFC_2680
 - SOFTWARE
-

2722-720

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
 - FFC_2680
 - SOFTWARE
-

2722-721

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
 - FFC_2680
 - SOFTWARE
-

2722-722

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
 - FFC_2680
 - SOFTWARE
-

2722-723

Explanation: A device timeout error occurred.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2722
 - FFC_2680
 - SOFTWARE
-

2740-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2740
-

2740-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2740
-

2740-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2740
-

2740-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2740
-

2740-108

Explanation: The bus test failed.

Failing Item:

- FFC_2740
-

2740-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2740
-

2740-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2740
-

2740-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2740

2740-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2740

2740-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2740

2740-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2740
- FFC_B88

2740-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2740

2740-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2740

2740-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2740

2740-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2740

- FFC_B88

2740-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2740
- SOFTWARE

2740-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2740
- SOFTWARE

2740-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2740

2740-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2740

2740-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

2740-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

2740-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2740
 - FFC_B88
 - SOFTWARE
-

2740-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2740
-

2740-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2740
 - FFC_B88
 - FFC_190
-

2740-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2740
-

2740-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2740
-

2740-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2743-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2743
-

2743-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2743
-

2743-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2743
-

2743-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2743
-

2743-108

Explanation: The bus test failed.

Failing Item:

- FFC_2743
-

2743-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2743
-

2743-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2743
-

2743-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2743
-

2743-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2743
-

2743-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2743
-

2743-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2743
 - FFC_B88
-

2743-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2743
-

2743-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2743
-

2743-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2743
-

2743-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2743
 - FFC_B88
-

2743-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2743
 - SOFTWARE
-

2743-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2743
 - SOFTWARE
-

2743-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2743
-

2743-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2743
-

2743-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2743-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

2743-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2743
 - FFC_B88
 - SOFTWARE
-

2743-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2743
-

2743-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2743
 - FFC_B88
 - FFC_190
-

2743-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2743
-

2743-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2743
-

2743-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

274E-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_274E
-

274E-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_274E
-

274E-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_274E
-

274E-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_274E
-

274E-108

Explanation: The bus test failed.

Failing Item:

- FFC_274E
-

274E-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_274E
-

274E-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_274E
-

274E-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_274E
-

274E-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_274E
-

274E-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_274E
-

274E-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_274E
 - FFC_B88
-

274E-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_274E

274E-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_274E

274E-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_274E

274E-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_274E
- FFC_B88

274E-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_274E
- SOFTWARE

274E-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_274E
- SOFTWARE

274E-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_274E

274E-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_274E

274E-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

274E-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

274E-135

Explanation: The device failed to configure.

Failing Item:

- FFC_274E
- FFC_B88
- SOFTWARE

274E-136

Explanation: The certify operation failed.

Failing Item:

- FFC_274E

274E-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_274E
- FFC_B88
- FFC_190

274E-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_274E

274E-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_274E

274E-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2751-201

Explanation: Adapter configuration error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2751
- FFC_221

2751-601

Explanation: Adapter taken off-line.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2751

2751-602

Explanation: Adapter parity error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2751

2751-603

Explanation: Permanent adapter failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2751

2751-604

Explanation: Adapter down error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2751

2752-201

Explanation: Adapter configuration error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2752
- FFC_221

2752-601

Explanation: Adapter taken off-line.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2752

2752-602

Explanation: Adapter parity error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2752

2752-603

Explanation: Permanent adapter failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2752

2752-604

Explanation: Adapter down error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2752

2753-201

Explanation: Adapter configuration error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2753
- FFC_221

2753-601

Explanation: Adapter taken off-line.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2753

2753-602

Explanation: Adapter parity error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2753

2753-603

Explanation: Permanent adapter failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2753

2753-604

Explanation: Adapter down error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2753

2754-201

Explanation: Adapter configuration error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2754
- FFC_221

2754-601

Explanation: Adapter taken off-line.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2754

2754-602

Explanation: Adapter parity error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2754

2754-603

Explanation: Permanent adapter failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2754

2754-604

Explanation: Adapter down error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2754

2756-101

Explanation: Configuration Register Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2756
- FFC_221

2756-102

Explanation: Register Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2756
-

2756-103**Explanation:** SRAM Test error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2756
-

2756-104**Explanation:** Reset Test error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2756
-

2756-105**Explanation:** PCI Loopback Test error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2756
-

2756-106**Explanation:** DMA Test error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2756
-

2756-107**Explanation:** Internal Loopback Test error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2756
-

2756-108**Explanation:** Interrupt Test error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2756
 - FFC_221
-

2756-109**Explanation:** External Loopback Test error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2756
-

2756-601**Explanation:** Adapter taken off-line.**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2756
-

2756-602**Explanation:** Adapter parity error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2756
-

2756-603**Explanation:** Permanent adapter failure.**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2756
-

2756-604**Explanation:** Adapter down error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2756
-

2757-201**Explanation:** Adapter configuration error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2757
 - FFC_221
-

2757-601

Explanation: Adapter taken off-line.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2757

2757-602

Explanation: Adapter parity error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2757

2757-603

Explanation: Permanent adapter failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2757

2757-604

Explanation: Adapter down error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2757

2776-104

Explanation: IO Register test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2776

2776-105

Explanation: Checksum verification test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2776

2776-106

Explanation: BIST test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2776

2776-107

Explanation: Link Detection test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2776

2776-108

Explanation: Link Detection test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2776

2776-109

Explanation: Interrupt Test Failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2776

2776-110

Explanation: Interrupt Test Failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2776

2776-202

Explanation: Configuration register test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2776
 - FFC_221
-

2776-203**Explanation:** EEH failure during test**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2776
 - FFC_221
-

2776-601**Explanation:** Error Log Analysis indicates adapter hardware error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2776
-

2776-602**Explanation:** Error Log Analysis indicates adapter configuration error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2776
-

2776-603**Explanation:** Error Log Analysis indicates adapter EEH service error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2776
-

2777-101**Explanation:** Configuration failed.**Failing Item:**

- FFC_2777
-

2777-102**Explanation:** Queue pair create failure.**Failing Item:**

- FFC_2777
-

2777-103**Explanation:** Internal loop back test failure**Failing Item:**

- FFC_2777
-

2777-201**Explanation:** Loop back test failure**Failing Item:**

- CABLE
 - NETWORK
-

2777-301**Explanation:** Loop back test failure**Failing Item:**

- CABLE
 - NETWORK
 - FFC_2777
-

2777-701**Explanation:** Error Log Analysis indicates that this adapter has failed due to an internal error.**Failing Item:**

- FFC_2777
-

2777-702**Explanation:** Error Log Analysis indicates that this adapter has failed due to a failure with the uplink interface used to connect this device to the host processor.**Failing Item:**

- FFC_2777
-

2777-703**Explanation:** Error Log Analysis indicates that this adapter has failed due to a memory error.**Failing Item:**

- FFC_2777
-

2777-704**Explanation:** Error Log Analysis indicates that this adapter has failed due to an unrecoverable internal parity error.**Failing Item:**

- FFC_2777
-

2777-705

Explanation: Error Log Analysis indicates that this adapter has failed due to a internal error.

Failing Item:

- FFC_2777

2777-706

Explanation: Error Log Analysis indicates that this adapter has failed due to a memory error.

Failing Item:

- FFC_2777

2780-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2780

2780-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2780

2780-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2780

2780-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2780

2780-108

Explanation: The bus test failed.

Failing Item:

- FFC_2780

2780-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2780

2780-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2780

2780-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2780

2780-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2780

2780-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2780

2780-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2780
- FFC_B88

2780-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2780

2780-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2780

2780-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2780

2780-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2780
 - FFC_B88
-

2780-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2780
 - SOFTWARE
-

2780-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2780
 - SOFTWARE
-

2780-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2780
-

2780-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2780
-

2780-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2780-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

- SOFTWARE
-

2780-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2780
 - FFC_B88
 - SOFTWARE
-

2780-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2780
-

2780-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2780
 - FFC_B88
 - FFC_190
-

2780-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2780
-

2780-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2780
-

2780-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2782-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_2782
-

2782-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_2782
-

2782-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_2782
-

2782-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_2782
-

2782-108

Explanation: The bus test failed.

Failing Item:

- FFC_2782
-

2782-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_2782
-

2782-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_2782
-

2782-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_2782
-

2782-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_2782
-

2782-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_2782
-

2782-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_2782
 - FFC_B88
-

2782-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_2782
-

2782-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_2782
-

2782-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_2782
-

2782-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_2782
 - FFC_B88
-

2782-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_2782
- SOFTWARE

2782-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_2782
 - SOFTWARE
-

2782-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_2782
-

2782-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_2782
-

2782-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

2782-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

2782-135

Explanation: The device failed to configure.

Failing Item:

- FFC_2782
 - FFC_B88
 - SOFTWARE
-

2782-136

Explanation: The certify operation failed.

Failing Item:

- FFC_2782
-

2782-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_2782
 - FFC_B88
 - FFC_190
-

2782-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_2782
-

2782-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_2782
-

2782-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

27D2-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_27D2
-

27D2-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_27D2
-

27D2-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_27D2
-

27D2-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_27D2
-

27D2-108

Explanation: The bus test failed.

Failing Item:

- FFC_27D2
-

27D2-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_27D2
-

27D2-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_27D2
-

27D2-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_27D2
-

27D2-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_27D2
-

27D2-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_27D2
-

27D2-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_27D2
 - FFC_B88
-

27D2-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_27D2
-

27D2-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_27D2
-

27D2-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_27D2
-

27D2-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_27D2
 - FFC_B88
-

27D2-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_27D2
 - SOFTWARE
-

27D2-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_27D2
 - SOFTWARE
-

27D2-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_27D2
-

27D2-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_27D2
-

27D2-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

27D2-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

27D2-135

Explanation: The device failed to configure.

Failing Item:

- FFC_27D2
 - FFC_B88
 - SOFTWARE
-

27D2-136

Explanation: The certify operation failed.

Failing Item:

- FFC_27D2
-

27D2-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_27D2
 - FFC_B88
 - FFC_190
-

27D2-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_27D2
-

27D2-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_27D2
-

27D2-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

27E3-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_27E3
-

27E3-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_27E3
-

27E3-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_27E3
-

27E3-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_27E3
-

27E3-108

Explanation: The bus test failed.

Failing Item:

- FFC_27E3
-

27E3-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_27E3

27E3-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_27E3
-

27E3-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_27E3
-

27E3-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_27E3
-

27E3-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_27E3
-

27E3-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_27E3
 - FFC_B88
-

27E3-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_27E3
-

27E3-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_27E3
-

27E3-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_27E3

27E3-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_27E3
 - FFC_B88
-

27E3-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_27E3
 - SOFTWARE
-

27E3-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_27E3
 - SOFTWARE
-

27E3-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_27E3
-

27E3-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_27E3
-

27E3-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

27E3-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88

- SOFTWARE

27E3-135

Explanation: The device failed to configure.

Failing Item:

- FFC_27E3
 - FFC_B88
 - SOFTWARE
-

27E3-136

Explanation: The certify operation failed.

Failing Item:

- FFC_27E3
-

27E3-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_27E3
 - FFC_B88
 - FFC_190
-

27E3-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_27E3
-

27E3-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_27E3
-

27E3-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

27E4-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_27E4
-

27E4-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_27E4
-

27E4-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_27E4
-

27E4-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_27E4
-

27E4-108

Explanation: The bus test failed.

Failing Item:

- FFC_27E4
-

27E4-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_27E4
-

27E4-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_27E4
-

27E4-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_27E4
-

27E4-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

27E4-117 • 27E4-136

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_27E4
-

27E4-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_27E4
-

27E4-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_27E4
 - FFC_B88
-

27E4-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_27E4
-

27E4-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_27E4
-

27E4-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_27E4
-

27E4-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_27E4
 - FFC_B88
-

27E4-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_27E4
 - SOFTWARE
-

27E4-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_27E4
 - SOFTWARE
-

27E4-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_27E4
-

27E4-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_27E4
-

27E4-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

27E4-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

27E4-135

Explanation: The device failed to configure.

Failing Item:

- FFC_27E4
 - FFC_B88
 - SOFTWARE
-

27E4-136

Explanation: The certify operation failed.

Failing Item:

- FFC_27E4
-

27E4-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_27E4
 - FFC_B88
 - FFC_190
-

27E4-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_27E4
-

27E4-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_27E4
-

27E4-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

27E5-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_27E5
-

27E5-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_27E5
-

27E5-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_27E5
-

27E5-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_27E5
-

27E5-108

Explanation: The bus test failed.

Failing Item:

- FFC_27E5
-

27E5-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_27E5
-

27E5-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_27E5
-

27E5-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_27E5
-

27E5-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_27E5
-

27E5-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_27E5
-

27E5-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_27E5
 - FFC_B88
-

27E5-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_27E5

27E5-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_27E5

27E5-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_27E5

27E5-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_27E5
- FFC_B88

27E5-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_27E5
- SOFTWARE

27E5-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_27E5
- SOFTWARE

27E5-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_27E5

27E5-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_27E5

27E5-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

27E5-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

27E5-135

Explanation: The device failed to configure.

Failing Item:

- FFC_27E5
- FFC_B88
- SOFTWARE

27E5-136

Explanation: The certify operation failed.

Failing Item:

- FFC_27E5

27E5-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_27E5
- FFC_B88
- FFC_190

27E5-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_27E5

27E5-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_27E5

27E5-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

2720-2712

Explanation: Device failure indicated

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2712
- FFC_2720

2720-2713

Explanation: Device failure indicated

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2713
- FFC_2720

2740-1001

Explanation: A disk has failed or is not responding and needs to be replaced.

Response: Use MAP5000

Failing Item:

- FFC_2740

2743-1001

Explanation: A disk has failed or is not responding and needs to be replaced.

Response: Use MAP5000

Failing Item:

- FFC_2743

28PAA

Explanation: An SSA Threshold Exceeded link error was detected.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.
Note:

P denotes the adapter port number.

AA denotes the SSA address.

29PAA

Explanation: An SSA Threshold Exceeded link error was detected.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.
Note:

P denotes the adapter port number.

AA denotes the SSA address.

2A002

Explanation: Async code 02 was received. Probably, a software error occurred.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive and the User's Guide and Maintenance Information for the SSA adapter.

2A003

Explanation: Async code 03 was received. Probably, a software error occurred.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive and the User's Guide and Maintenance Information for the SSA adapter.

2A004

Explanation: Async code 04 was received. Probably, a software error occurred.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive and the User's Guide and Maintenance Information for the SSA adapter.

2A005

Explanation: Async code 05 was received. This code indicates that a disk drive module detected the loss of redundant power or cooling.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive.

2A006

Explanation: Async code 06 was received. This code indicates that a disk drive module detected the loss of redundant power or cooling.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive.

2A106

Explanation: Async code 06 was received. This code indicates that multiple disk drive modules detected loss of redundant power or cooling.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive.

2A206

Explanation: A disk drive module detected that one of its SSA links failed the POST.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive.

2D07-101

Explanation: Adapter configuration error.

Failing Item:

- FFC_2D07

2D07-710

Explanation: Permanent adapter failure.

Failing Item:

- FFC_2D07

2D07-711

Explanation: Adapter failure.

Failing Item:

- FFC_2D07

2D07-712

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

Failing Item:

- FFC_2D07

2D07-713

Explanation: Adapter failure.

Failing Item:

- FFC_2D07

2D07-714

Explanation: Temporary adapter failure.

Failing Item:

- FFC_2D07

2D07-715

Explanation: Temporary adapter failure.

Failing Item:

- FFC_2D07

2D07-716

Explanation: PCI bus error detected by EEH.

Failing Item:

- FFC_2D07
- FFC_293

2D07-717

Explanation: PCI bus error detected by adapter.

Failing Item:

- FFC_2D07
- FFC_293

2D07-718

Explanation: Temporary PCI bus error detected by adapter

Failing Item:

- FFC_2D07
- FFC_293

2D07-719

Explanation: Device bus termination power lost or not detected

Response: Use MAP3150.

2D07-720

Explanation: Adapter device bus configuration error.

Response: Use MAP3150.

2D07-721

Explanation: Temporary adapter detected device bus failure.

Response: Use MAP3150.

2D07-722

Explanation: Device bus interface problem.

Failing Item:

- FFC_2D07
-

2D07-723

Explanation: Device bus interface problem.

Response: Use MAP0054.

2D07-724

Explanation: Temporary device bus interface problem.

Failing Item:

- FFC_2D07
-

2D07-725

Explanation: Temporary device bus interface problem.

Response: Use MAP0054.

2D0B-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D0B
-

2D0B-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D0B
-

2D0B-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D0B
-

2D0B-720

Explanation: Controller device bus configuration error.

Response: Use MAP3150.

2D11-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D11
-

2D11-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D11
-

2D11-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D11
-

2D11-720

Explanation: Controller device bus configuration error.

Response: Use MAP3250.

2D14-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D14
-

2D14-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D14
-

2D14-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D14
-

2D14-720

Explanation: Controller device bus configuration error.

Response: Use MAP4150.

2D15-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D15
-

2D15-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D15
-

2D15-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D15
-

2D15-720

Explanation: Controller device bus configuration error.

Response: Use MAP4150.

2D16-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D16
-

2D16-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D16
-

2D16-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D16
-

2D16-720

Explanation: Controller device bus configuration error.

Response: Use MAP4050.

2D17-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D17
-

2D17-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D17
-

2D17-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D17
-

2D17-720

Explanation: Controller device bus configuration error.

Response: Use MAP4050.

2D18-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D18
-

2D18-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D18
-

2D18-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D18
-

2D18-720

Explanation: Controller device bus configuration error.

Response: Use MAP4050.

2D1D-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D1D
-

2D1D-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D1D
-

2D1D-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D1D
-

2D1D-720

Explanation: Controller device bus configuration error.

Response: Use MAP3250.

2D1F-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D1F
-

2D1F-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D1F
-

2D1F-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D1F
-

2D1F-720

Explanation: Controller device bus configuration error.

Response: Use MAP3250.

2D20-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D20
-

2D20-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D20
-

2D20-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D20
-

2D20-720

Explanation: Controller device bus configuration error.

Response: Use MAP3250.

2D21-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D21
-

2D21-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D21
-

2D21-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D21
-

2D21-720

Explanation: Controller device bus configuration error.

Response: Use MAP3250.

2D23-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D23
-

2D23-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D23
-

2D23-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D23
-

2D23-720

Explanation: Controller device bus configuration error.

Response: Use MAP3150.

2D24-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D24
-

2D24-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D24
-

2D24-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D24
-

2D24-720

Explanation: Controller device bus configuration error.

Response: Use MAP3250.

2D25-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D25
-

2D25-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D25
-

2D25-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D25
-

2D25-720

Explanation: Controller device bus configuration error.

Response: Use MAP3150.

2D26-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D26
-

2D26-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D26
-

2D26-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D26
-

2D26-720

Explanation: Controller device bus configuration error.

Response: Use MAP4050.

2D27-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D27
-

2D27-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D27
-

2D27-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D27
-

2D27-720

Explanation: Controller device bus configuration error.

Response: Use MAP4050.

2D28-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D28
-

2D28-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D28
-

2D28-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D28
-

2D28-720

Explanation: Controller device bus configuration error.

Response: Use MAP4050.

2D35-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D35
-

2D35-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D35
-

2D35-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D35
-

2D35-720

Explanation: Controller device bus configuration error.

Response: Use MAP3250.

2D36-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D36
-

2D36-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D36
-

2D36-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D36
-

2D36-720

Explanation: Controller device bus configuration error.

Response: Use MAP3250.

2D40-101

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D40
-

2D40-710

Explanation: Permanent controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D40
-

2D40-713

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D40
-

2D40-720

Explanation: Controller device bus configuration error.

Response: Use MAP3150.

2D07-102E

Explanation: Reallocation failed due to disk out of alternate sectors.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2D07-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2D07-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2D07-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

2D07-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2D07-3101

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2D07-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

2D07-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

2D07-7001

Explanation: Temporary disk data error.

Failing Item:

- FFC_722
-

2D07-8008

Explanation: Permanent cache battery pack failure.

Response: Use MAP3000.

Failing Item:

- FFC_2D01
-

2D07-8009

Explanation: Impending cache battery pack failure.

Response: Use MAP3000.

Failing Item:

- FFC_2D01
-

2D07-9000

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2D07-9001

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2D07-9002

Explanation: Controller detected a device error during configuration discovery.

Response: Use MAP3190.

2D07-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2D07-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2D07-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2D07-9020

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2D07-9021

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2D07-9022

Explanation: Two or more disks are missing from a RAID-5 disk array.

Response: Use MAP3111.

2D07-9023

Explanation: One or more disk array members are not a the required physical locations.

Response: Use MAP3012

2D07-9024

Explanation: The physical location of disk array members conflict with another disk array.

Response: Use MAP3190.

2D07-9025

Explanation: An incompatible disk is installed at a degraded disk location in the disk array.

Response: Use MAP3110.

2D07-9026

Explanation: A previously degraded disk in the disk array was not found at the required physical location.

Response: Use MAP3190

2D07-9027

Explanation: A disk array is or would become degraded and the parity data is out of synchronization.

Response: Use MAP3113.

2D07-9028

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2D07-9029

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2D07-9030

Explanation: The disk array is degraded due to a missing or failed disk.

Response: Use MAP3110.

2D07-9031

Explanation: Automatic reconstruction initiated for the disk array.

Response: Use MAP3110.

2D07-9032

Explanation: Disk Array is degraded due to missing failed disk.

Response: Use MAP3110.

2D07-9041

Explanation: Background disk array parity checking detected and corrected errors.

Response: Use MAP3190.

2D07-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190

2D07-9050

Explanation: Required cache data cannot be located for one or more disks.

Response: Use MAP3031

2D07-9051

Explanation: Cache data exists for more than one missing or failed disks.

Response: Use MAP3132.

2D07-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2D07-9054

Explanation: RAID controller resources are not available due to previous problems.

Response: Use MAP3121.

2D07-9060

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

2D07-9061

Explanation: One or more disk pairs are missing from a RAID-10 disk array.

Response: Use MAP3111.

2D07-9062

Explanation: One or more disk pairs are missing from a RAID-0 disk array.

Response: Use MAP3111.

2D07-9063

Explanation: The maximum number of functional disk arrays has been exceeded.

Response: Use MAP3190.

2D07-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2D07-9074

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3141.

2D07-9081

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

2D07-9082

Explanation: Controller detected a device error during an internal media recovery.

Response: Use MAP3190.

2D07-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2D07-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2D07-9092

Explanation: Disk requires formatting before use.

Response: Use MAP3134.

2D07-9200

Explanation: Identify disk to be replaced.

Response: Use MAP3131.

2D07-FFF3

Explanation: Disk media format bad.

Response: If the problem persists, use MAP3035.

2D07-FFF4

Explanation: Disk drive problem.

Response: If the problem persists, use MAP3051.

Failing Item:

- FFC_722
-

2D07-FFF6

Explanation: Disk detected recoverable error.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2D07-FFFA

Explanation: Temporary disk bus error.

Response: If the problem persists, use MAP3150.

Failing Item:

- FFC_722
-

2D07-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

2D0B-102E

Explanation: Reallocation failed due to disk out of alternate sectors.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D0B-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D0B-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D0B-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

2D0B-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2D0B-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

2D0B-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

2D0B-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3142.

2D0B-4020

Explanation: Configuration error, connections exceed IOA design limits.

Response: Use MAP3143.

2D0B-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP3144

2D0B-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP3144

2D0B-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146.

2D0B-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148.

2D0B-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP3153.

2D0B-4100

Explanation: Device bus fabric error.

Response: Use MAP3152.

2D0B-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP3152.

2D0B-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145.

2D0B-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D0B
 - FFC_221
-

2D0B-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D0B
 - FFC_221
-

2D0B-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D0B-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D0B
-

2D0B-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D0B
-

2D0B-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2D0B-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2D0B-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2D0B-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2D0B-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2D0B-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2D0B-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2D0B-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2D0B-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D0B-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112.

2D0B-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190.

2D0B-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110.

2D0B-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190.

2D0B-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113.

2D0B-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2D0B-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190.

2D0B-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2D0B-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110.

2D0B-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2D0B-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190.

2D0B-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2D0B-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131.

2D0B-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132.

2D0B-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2D0B-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121.

2D0B-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111.

2D0B-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2D0B-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2D0B-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2D0B-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140

2D0B-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP3141.

2D0B-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP3149

2D0B-9076

Explanation: Missing remote controller.

Response: Use MAP3147.

2D0B-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2D0B-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2D0B-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2D0B-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2D0B-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134.

2D0B-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D0B
-

2D0B-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135.

2D0B-FFF4

Explanation: Disk drive problem.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D0B-FFF6

Explanation: Disk detected recoverable error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D0B-FFFA

Explanation: Temporary disk error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D0B-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

Note: Device may only identify adapter port, e.g. 00pFFF, where 'p' is port.

2D11-102E

Explanation: Reallocation failed due to disk out of alternate sectors.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D11-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D11-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D11-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3250.

2D11-3100

Explanation: Controller detected device bus interface error.

Response: Use MAP3250.

2D11-3109

Explanation: Controller timed out a device command.

Response: Use MAP3250 during concurrent maintenance.

2D11-310C

Explanation: Device T10 DIF device bus error.

Response: Use MAP3250.

2D11-310D

Explanation: Controller T10 DIF device bus error.

Response: Use MAP3250.

2D11-3110

Explanation: Device bus interface error.

Response: Use MAP3250.

2D11-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3242

2D11-4020

Explanation: Configuration error, connections exceed controller design limits.

Response: Use MAP3243

2D11-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP3244.

2D11-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP3244.

2D11-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3246

2D11-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3248

2D11-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP3253.

2D11-4080

Explanation: Thermal error, controller exceeded maximum operating temperature.

Response: Use MAP3295.

2D11-4085

Explanation: Please contact your next level of support or service provider.

Response: Use MAP3290.

2D11-4100

Explanation: Device bus fabric error.

Response: Use MAP3252.

2D11-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP3252.

2D11-4102

Explanation: Device bus fabric performance degradation.

Response: Use MAP3254.

2D11-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3245

2D11-4120

Explanation: Configuration error, cable VPD cannot be read.

Response: Use MAP3261

2D11-4121

Explanation: Configuration error, required cable is missing.

Response: Use MAP3261

2D11-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D11
 - FFC_221
-

2D11-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D11
 - FFC_221
-

2D11-4170

Explanation: Controller T10 DIF host bus error.

Response: Use MAP3260.

2D11-4171

Explanation: Controller recovered T10 DIF host bus error.

Response: Use MAP3260.

2D11-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D11-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D11
-

2D11-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D11
-

2D11-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3290

2D11-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3290

2D11-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3290

2D11-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3230

2D11-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3220

2D11-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3290

2D11-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3211

2D11-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3211

2D11-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3211

2D11-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3212

2D11-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3290

2D11-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3210

2D11-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3290

2D11-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3213

2D11-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3290

2D11-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3290

2D11-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3210

2D11-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3210

2D11-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3210

2D11-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3290

2D11-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3290

2D11-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3231

2D11-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3232

2D11-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3290

2D11-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3221

2D11-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3211

2D11-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3211

2D11-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3211

2D11-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3290

2D11-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3240.

2D11-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP3241.

2D11-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP3249.

2D11-9076

Explanation: Missing remote controller.

Response: Use MAP3247.

2D11-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3290

2D11-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3290

2D11-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3233

2D11-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3233

2D11-9092

Explanation: Disk requires Format before use.

Response: Use MAP3234.

2D11-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D11
-

2D11-FFF3

Explanation: Disk media format bad.

Response: Use MAP3235.

2D11-FFF4

Explanation: Device problem.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D11-FFF6

Explanation: Device detected recoverable error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D11-FFFA

Explanation: Temporary device bus error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D11-FFFC

Explanation: Device recovered T10 DIF device bus error.

Response: Use MAP3250.

Failing Item:

- FFC_722
-

2D11-FFFD

Explanation: Controller recovered T10 DIF device bus error.

Response: Use MAP3250.

2D11-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3250.

2D14-102E

Explanation: Reallocation failed due to disk out of alternate sectors.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D14-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D14-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D14-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP4150.

2D14-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP4150.

2D14-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP4150.

2D14-3110

Explanation: Disk bus interface error.

Response: Use MAP4150.

2D14-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3142

2D14-4020

Explanation: Configuration error, connections exceed IOA design limits.

Response: Use MAP3143

2D14-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP4144.

2D14-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP4144.

2D14-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146

2D14-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148

2D14-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP4153.

2D14-4100

Explanation: Device bus fabric error.

Response: Use MAP4152.

2D14-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP4152.

2D14-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145

2D14-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D14
 - FFC_221
-

2D14-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D14
 - FFC_221
-

2D14-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D14-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D14
-

2D14-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D14

2D14-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D14-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D14-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D14-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130

2D14-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120

2D14-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190

2D14-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D14-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D14-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D14-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112

2D14-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190

2D14-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110

2D14-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190

2D14-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113

2D14-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190

2D14-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190

2D14-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110

2D14-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110

2D14-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110

2D14-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190

2D14-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190

2D14-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131

2D14-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132

2D14-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190

2D14-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121

2D14-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111

2D14-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111

2D14-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111

2D14-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190

2D14-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP4140.

2D14-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP4141.

2D14-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP4149.

2D14-9076

Explanation: Missing remote controller.

Response: Use MAP4147.

2D14-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190

2D14-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190

2D14-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133

2D14-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133

2D14-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134

2D14-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D14
-

2D14-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135

2D14-FFF4

Explanation: Disk drive problem.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D14-FFF6

Explanation: Disk detected recoverable error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D14-FFFA

Explanation: Temporary disk error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D14-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP4150.

Note: Device may only identify adapter port, e.g. 00pFFF, where 'p' is port.

2D15-102E

Explanation: Reallocation failed due to disk out of alternate sectors.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D15-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D15-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D15-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP4150.

2D15-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP4150.

2D15-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP4150.

2D15-3110

Explanation: Disk bus interface error.

Response: Use MAP4150.

2D15-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3142

2D15-4020

Explanation: Configuration error, connections exceed IOA design limits.

Response: Use MAP3143

2D15-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP4144.

2D15-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP4144.

2D15-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146

2D15-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148

2D15-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP4153.

2D15-4100

Explanation: Device bus fabric error.

Response: Use MAP4152.

2D15-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP4152.

2D15-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145

2D15-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D15
 - FFC_221
-

2D15-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D15
 - FFC_221
-

2D15-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D15-8008

Explanation: A permanent Cache Battery Pack failure occurred.

Response: Use MAP3100

Failing Item:

- FFC_2D19
-

2D15-8009

Explanation: Impending Cache Battery Pack failure.

Response: Use MAP3100

Failing Item:

- FFC_2D19

2D15-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D15

2D15-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D15

2D15-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D15-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D15-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D15-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130

2D15-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120

2D15-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190

2D15-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D15-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D15-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D15-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112

2D15-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190

2D15-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110

2D15-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190

2D15-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113

2D15-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190

2D15-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190

2D15-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110

2D15-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110

2D15-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110

2D15-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190

2D15-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190

2D15-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131

2D15-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132

2D15-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190

2D15-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121

2D15-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111

2D15-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111

2D15-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111

2D15-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190

2D15-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP4140.

2D15-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP4141.

2D15-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP4149.

2D15-9076

Explanation: Missing remote controller.

Response: Use MAP4147.

2D15-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190

2D15-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190

2D15-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133

2D15-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133

2D15-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134

2D15-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D15
-

2D15-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135

2D15-FFF4

Explanation: Disk drive problem.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D15-FFF6

Explanation: Disk detected recoverable error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D15-FFFA

Explanation: Temporary disk error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D15-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP4150.

Note: Device may only identify adapter port, e.g. 00pFFF, where 'p' is port.

2D16-102E

Explanation: Reallocation failed due to disk out of alternate sectors.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D16-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D16-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D16-3020**Explanation:** Storage subsystem configuration error.**Response:** Use MAP4050.

2D16-3100**Explanation:** Adapter detected device bus interface error.**Response:** Use MAP4050.

2D16-3109**Explanation:** Adapter timed out a disk command.**Response:** Use MAP4050.

2D16-3110**Explanation:** Disk bus interface error.**Response:** Use MAP4050.

2D16-4010**Explanation:** Configuration error, incorrect connection between cascaded enclosures.**Response:** Use MAP3142

2D16-4020**Explanation:** Configuration error, connections exceed IOA design limits.**Response:** Use MAP3143

2D16-4030**Explanation:** Configuration error, incorrect multipath connection.**Response:** Use MAP4044.

2D16-4040**Explanation:** Configuration error, incomplete multipath connection between controller and enclosure detected.**Response:** Use MAP4044.

2D16-4041**Explanation:** Configuration error, incomplete multipath connection between enclosure and device detected.**Response:** Use MAP3146

2D16-4050**Explanation:** Attached enclosure does not support required multipath function.**Response:** Use MAP3148

2D16-4060**Explanation:** Multipath redundancy level got worse.**Response:** Use MAP4053.

2D16-4100**Explanation:** Device bus fabric error.**Response:** Use MAP4052.

2D16-4101**Explanation:** Temporary device bus fabric error.**Response:** Use MAP4052.

2D16-4110**Explanation:** Unsupported enclosure function detected.**Response:** Use MAP3145

2D16-4150**Explanation:** PCI bus error detected by controller.**Response:** Use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_2D16
- FFC_221

2D16-4160**Explanation:** PCI bus error detected by controller.**Response:** Use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_2D16
- FFC_221

2D16-7001**Explanation:** Temporary disk data error.**Response:** Use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_722

2D16-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D16
-

2D16-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D16
-

2D16-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D16-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D16-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D16-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130

2D16-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120

2D16-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190

2D16-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D16-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D16-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D16-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112

2D16-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190

2D16-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110

2D16-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190

2D16-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113

2D16-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190

2D16-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190

2D16-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110

2D16-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110

2D16-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110

2D16-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190

2D16-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190

2D16-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131

2D16-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132

2D16-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190

2D16-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121

2D16-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111

2D16-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111

2D16-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111

2D16-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190

2D16-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP4040.

2D16-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP4041.

2D16-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP4049.

2D16-9076

Explanation: Missing remote controller.

Response: Use MAP4047.

2D16-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190

2D16-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190

2D16-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133

2D16-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133

2D16-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134

2D16-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D16
-

2D16-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135

2D16-FFF4

Explanation: Disk drive problem.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D16-FFF6

Explanation: Disk detected recoverable error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D16-FFFA

Explanation: Temporary disk error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D16-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP4050.

Note: Device may only identify adapter port, e.g. 00pFFF, where 'p' is port.

2D17-102E

Explanation: Reallocation failed due to disk out of alternate sectors.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D17-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D17-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D17-3020**Explanation:** Storage subsystem configuration error.**Response:** Use MAP4050.

2D17-3100**Explanation:** Adapter detected device bus interface error.**Response:** Use MAP4050.

2D17-3109**Explanation:** Adapter timed out a disk command.**Response:** Use MAP4050.

2D17-3110**Explanation:** Disk bus interface error.**Response:** Use MAP4050.

2D17-4010**Explanation:** Configuration error, incorrect connection between cascaded enclosures.**Response:** Use MAP3142

2D17-4020**Explanation:** Configuration error, connections exceed IOA design limits.**Response:** Use MAP3143

2D17-4030**Explanation:** Configuration error, incorrect multipath connection.**Response:** Use MAP4044.

2D17-4040**Explanation:** Configuration error, incomplete multipath connection between controller and enclosure detected.**Response:** Use MAP4044.

2D17-4041**Explanation:** Configuration error, incomplete multipath connection between enclosure and device detected.**Response:** Use MAP3146

2D17-4050**Explanation:** Attached enclosure does not support required multipath function.**Response:** Use MAP3148

2D17-4060**Explanation:** Multipath redundancy level got worse.**Response:** Use MAP4053.

2D17-4100**Explanation:** Device bus fabric error.**Response:** Use MAP4052.

2D17-4101**Explanation:** Temporary device bus fabric error.**Response:** Use MAP4052.

2D17-4110**Explanation:** Unsupported enclosure function detected.**Response:** Use MAP3145

2D17-4150**Explanation:** PCI bus error detected by controller.**Response:** Use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_2D17
- FFC_221

2D17-4160**Explanation:** PCI bus error detected by controller.**Response:** Use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_2D17
- FFC_221

2D17-7001**Explanation:** Temporary disk data error.**Response:** Use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_722

2D17-8008

Explanation: A permanent Cache Battery Pack failure occurred.

Response: Use MAP3100

Failing Item:

- FFC_2D1B
-

2D17-8009

Explanation: Impending Cache Battery Pack failure.

Response: Use MAP3100

Failing Item:

- FFC_2D1B
-

2D17-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D17
-

2D17-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D17
-

2D17-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D17-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D17-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D17-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130

2D17-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120

2D17-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190

2D17-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D17-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D17-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D17-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112

2D17-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190

2D17-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110

2D17-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190

2D17-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113

2D17-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190

2D17-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190

2D17-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110

2D17-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110

2D17-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110

2D17-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190

2D17-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190

2D17-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131

2D17-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132

2D17-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190

2D17-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121

2D17-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111

2D17-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111

2D17-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111

2D17-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190

2D17-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP4040.

2D17-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP4041.

2D17-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP4049.

2D17-9076

Explanation: Missing remote controller.

Response: Use MAP4047.

2D17-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190

2D17-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190

2D17-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133

2D17-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133

2D17-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134

2D17-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D17
-

2D17-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135

2D17-FFF4

Explanation: Disk drive problem.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D17-FFF6

Explanation: Disk detected recoverable error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D17-FFFA

Explanation: Temporary disk error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D17-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP4050.

Note: Device may only identify adapter port, e.g. 00pFFE, where 'p' is port.

2D18-102E

Explanation: Reallocation failed due to disk out of alternate sectors.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D18-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722

2D18-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D18-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP4050.

2D18-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP4050.

2D18-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP4050.

2D18-3110

Explanation: Disk bus interface error.

Response: Use MAP4050.

2D18-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3142

2D18-4020

Explanation: Configuration error, connections exceed IOA design limits.

Response: Use MAP3143

2D18-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP4044.

2D18-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP4044.

2D18-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146

2D18-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148

2D18-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP4053.

2D18-4100

Explanation: Device bus fabric error.

Response: Use MAP4052.

2D18-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP4052.

2D18-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145

2D18-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D18
 - FFC_221
-

2D18-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D18
- FFC_221

2D18-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722

2D18-8008

Explanation: A permanent Cache Battery Pack failure occurred.

Response: Use MAP3100

Failing Item:

- FFC_2D1B

2D18-8009

Explanation: Impending Cache Battery Pack failure.

Response: Use MAP3100

Failing Item:

- FFC_2D1B

2D18-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D18

2D18-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D18

2D18-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D18-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D18-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D18-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130

2D18-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120

2D18-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190

2D18-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D18-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D18-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D18-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112

2D18-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190

2D18-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110

2D18-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190

2D18-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113

2D18-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190

2D18-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190

2D18-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110

2D18-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110

2D18-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110

2D18-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190

2D18-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190

2D18-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131

2D18-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132

2D18-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190

2D18-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121

2D18-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111

2D18-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111

2D18-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111

2D18-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190

2D18-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP4040.

2D18-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP4041.

2D18-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP4049.

2D18-9076

Explanation: Missing remote controller.

Response: Use MAP4047.

2D18-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190

2D18-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190

2D18-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133

2D18-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133

2D18-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134

2D18-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D18
-

2D18-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135

2D18-FFF4

Explanation: Disk drive problem.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D18-FFF6

Explanation: Disk detected recoverable error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D18-FFFA

Explanation: Temporary disk error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D18-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP4050.

Note: Device may only identify adapter port, e.g. 00pFFF, where 'p' is port.

2D1D-102E

Explanation: Reallocation failed due to disk out of alternate sectors.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D1D-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D1D-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D1D-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3250.

2D1D-3100

Explanation: Controller detected device bus interface error.

Response: Use MAP3250.

2D1D-3109

Explanation: Controller timed out a device command.

Response: Use MAP3250 during concurrent maintenance.

2D1D-310C

Explanation: Device T10 DIF device bus error.

Response: Use MAP3250.

2D1D-310D

Explanation: Controller T10 DIF device bus error.

Response: Use MAP3250.

2D1D-3110

Explanation: Device bus interface error.

Response: Use MAP3250.

2D1D-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3242

2D1D-4020

Explanation: Configuration error, connections exceed controller design limits.

Response: Use MAP3243

2D1D-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP3244.

2D1D-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP3244.

2D1D-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3246

2D1D-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3248

2D1D-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP3253.

2D1D-4080

Explanation: Thermal error, controller exceeded maximum operating temperature.

Response: Use MAP3295.

2D1D-4085

Explanation: Please contact your next level of support or service provider.

Response: Use MAP3290.

2D1D-4100

Explanation: Device bus fabric error.

Response: Use MAP3252.

2D1D-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP3252.

2D1D-4102

Explanation: Device bus fabric performance degradation.

Response: Use MAP3254.

2D1D-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3245

2D1D-4120

Explanation: Configuration error, cable VPD cannot be read.

Response: Use MAP3261

2D1D-4121

Explanation: Configuration error, required cable is missing.

Response: Use MAP3261

2D1D-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D1D
 - FFC_221
-

2D1D-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D1D
 - FFC_221
-

2D1D-4170

Explanation: Controller T10 DIF host bus error.

Response: Use MAP3260.

2D1D-4171

Explanation: Controller recovered T10 DIF host bus error.

Response: Use MAP3260.

2D1D-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D1D-8008

Explanation: A permanent Cache Power Pack failure occurred.

Response: Use MAP3200.

Failing Item:

- FFC_2D1D
-

2D1D-8009

Explanation: Impending Cache Power Pack failure.

Response: Use MAP3200.

Failing Item:

- FFC_2D1D

2D1D-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D1D
-

2D1D-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D1D
-

2D1D-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3290

2D1D-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3290

2D1D-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3290

2D1D-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3230

2D1D-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3220

2D1D-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3290

2D1D-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3211

2D1D-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3211

2D1D-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3211

2D1D-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3212

2D1D-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3290

2D1D-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3210

2D1D-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3290

2D1D-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3213

2D1D-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3290

2D1D-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3290

2D1D-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3210

2D1D-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3210

2D1D-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3210

2D1D-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3290

2D1D-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3290

2D1D-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3231

2D1D-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3232

2D1D-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3290

2D1D-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3221

2D1D-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3211

2D1D-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3211

2D1D-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3211

2D1D-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3290

2D1D-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3240.

2D1D-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP3241.

2D1D-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP3249.

2D1D-9076

Explanation: Missing remote controller.

Response: Use MAP3247.

2D1D-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3290

2D1D-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3290

2D1D-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3233

2D1D-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3233

2D1D-9092

Explanation: Disk requires Format before use.

Response: Use MAP3234

2D1D-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D1D
-

2D1D-FFF3

Explanation: Disk media format bad.

Response: Use MAP3235

2D1D-FFF4

Explanation: Device problem.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D1D-FFF6

Explanation: Device detected recoverable error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D1D-FFFA

Explanation: Temporary device bus error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D1D-FFFC

Explanation: Device recovered T10 DIF device bus error.

Response: Use MAP3250.

Failing Item:

- FFC_722
-

2D1D-FFFF

Explanation: Controller recovered T10 DIF device bus error.

Response: Use MAP3250.

2D1D-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3250.

2D1F-102E

Explanation: Reallocation failed due to disk out of alternate sectors.

Response: If the problem persists, use MAP0210 : General Problem Resolution,

Failing Item:

- FFC_722
-

2D1F-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722

2D1F-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722

2D1F-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3250.

2D1F-3100

Explanation: Controller detected device bus interface error.

Response: Use MAP3250.

2D1F-3109

Explanation: Controller timed out a device command.

Response: Use MAP3250 during concurrent maintenance.

2D1F-310C

Explanation: Device T10 DIF device bus error.

Response: Use MAP3250.

2D1F-310D

Explanation: Controller T10 DIF device bus error.

Response: Use MAP3250.

2D1F-3110

Explanation: Device bus interface error.

Response: Use MAP3250.

2D1F-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3242

2D1F-4020

Explanation: Configuration error, connections exceed controller design limits.

Response: Use MAP3243

2D1F-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP3244.

2D1F-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP3244.

2D1F-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3246

2D1F-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3248

2D1F-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP3253.

2D1F-4080

Explanation: Thermal error, controller exceeded maximum operating temperature.

Response: Use MAP3295.

2D1F-4085

Explanation: Please contact your next level of support or service provider.

Response: Use MAP3290.

2D1F-4100

Explanation: Device bus fabric error.

Response: Use MAP3252.

2D1F-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP3252.

2D1F-4102

Explanation: Device bus fabric performance degradation.

Response: Use MAP3254.

2D1F-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3245

2D1F-4120

Explanation: Configuration error, cable VPD cannot be read.

Response: Use MAP3261

2D1F-4121

Explanation: Configuration error, required cable is missing.

Response: Use MAP3261

2D1F-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D1F
 - FFC_221
-

2D1F-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D1F
 - FFC_221
-

2D1F-4170

Explanation: Controller T10 DIF host bus error.

Response: Use MAP3260.

2D1F-4171

Explanation: Controller recovered T10 DIF host bus error.

Response: Use MAP3260.

2D1F-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D1F-8008

Explanation: A permanent Cache Power Pack failure occurred.

Response: Use MAP3200.

Failing Item:

- FFC_2D1F
-

2D1F-8009

Explanation: Impending Cache Power Pack failure.

Response: Use MAP3200.

Failing Item:

- FFC_2D1F
-

2D1F-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D1F
-

2D1F-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D1F
-

2D1F-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3290

2D1F-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3290

2D1F-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3290

2D1F-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3230

2D1F-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3220

2D1F-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3290

2D1F-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3211

2D1F-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3211

2D1F-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3211

2D1F-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3212

2D1F-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3290

2D1F-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3210

2D1F-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3290

2D1F-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3213

2D1F-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3290

2D1F-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3290

2D1F-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3210

2D1F-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3210

2D1F-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3210

2D1F-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3290

2D1F-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3290

2D1F-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3231

2D1F-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3232

2D1F-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3290

2D1F-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3221

2D1F-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3211

2D1F-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3211

2D1F-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3211

2D1F-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3290

2D1F-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3240.

2D1F-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP3241.

2D1F-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP3249.

2D1F-9076

Explanation: Missing remote controller.

Response: Use MAP3247.

2D1F-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3290

2D1F-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3290

2D1F-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3233

2D1F-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3233

2D1F-9092

Explanation: Disk requires Format before use.

Response: Use MAP3234

2D1F-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D1F
-

2D1F-FFF3

Explanation: Disk media format bad.

Response: Use MAP3235

2D1F-FFF4

Explanation: Device problem.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D1F-FFF6

Explanation: Device detected recoverable error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D1F-FFFA

Explanation: Temporary device bus error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D1F-FFFC

Explanation: Device recovered T10 DIF device bus error.

Response: Use MAP3250.

Failing Item:

- FFC_722
-

2D1F-FFFD

Explanation: Controller recovered T10 DIF device bus error.

Response: Use MAP3250.

2D1F-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3250.

2D20-102E

Explanation: Reallocation failed due to disk out of alternate sectors.

Response: If the problem persists, use MAP0210 : General Problem Resolution,

Failing Item:

- FFC_722
-

2D20-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D20-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D20-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3250.

2D20-3100

Explanation: Controller detected device bus interface error.

Response: Use MAP3250.

2D20-3109

Explanation: Controller timed out a device command.

Response: Use MAP3250 during concurrent maintenance.

2D20-310C**Explanation:** Device T10 DIF device bus error.**Response:** Use MAP3250.

2D20-310D**Explanation:** Controller T10 DIF device bus error.**Response:** Use MAP3250.

2D20-3110**Explanation:** Device bus interface error.**Response:** Use MAP3250.

2D20-4010**Explanation:** Configuration error, incorrect connection between cascaded enclosures.**Response:** Use MAP3242

2D20-4020**Explanation:** Configuration error, connections exceed controller design limits.**Response:** Use MAP3243

2D20-4030**Explanation:** Configuration error, incorrect multipath connection.**Response:** Use MAP3244.

2D20-4040**Explanation:** Configuration error, incomplete multipath connection between controller and enclosure detected.**Response:** Use MAP3244.

2D20-4041**Explanation:** Configuration error, incomplete multipath connection between enclosure and device detected.**Response:** Use MAP3246

2D20-4050**Explanation:** Attached enclosure does not support required multipath function.**Response:** Use MAP3248

2D20-4060**Explanation:** Multipath redundancy level got worse.**Response:** Use MAP3253.

2D20-4080**Explanation:** Thermal error, controller exceeded maximum operating temperature.**Response:** Use MAP3295.

2D20-4085**Explanation:** Please contact your next level of support or service provider.**Response:** Use MAP3290.

2D20-4100**Explanation:** Device bus fabric error.**Response:** Use MAP3252.

2D20-4101**Explanation:** Temporary device bus fabric error.**Response:** Use MAP3252.

2D20-4102**Explanation:** Device bus fabric performance degradation.**Response:** Use MAP3254.

2D20-4110**Explanation:** Unsupported enclosure function detected.**Response:** Use MAP3245

2D20-4120**Explanation:** Configuration error, cable VPD cannot be read.**Response:** Use MAP3261

2D20-4121**Explanation:** Configuration error, required cable is missing.**Response:** Use MAP3261

2D20-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D20
- FFC_221

2D20-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D20
- FFC_221

2D20-4170

Explanation: Controller T10 DIF host bus error.

Response: Use MAP3260.

2D20-4171

Explanation: Controller recovered T10 DIF host bus error.

Response: Use MAP3260.

2D20-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722

2D20-8008

Explanation: A permanent Cache Power Pack failure occurred.

Response: Use MAP3200.

Failing Item:

- FFC_2D20

2D20-8009

Explanation: Impending Cache Power Pack failure.

Response: Use MAP3200.

Failing Item:

- FFC_2D20

2D20-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D20

2D20-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D20

2D20-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3290

2D20-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3290

2D20-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3290

2D20-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3230

2D20-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3220

2D20-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3290

2D20-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3211

2D20-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3211

2D20-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3211

2D20-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3212

2D20-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3290

2D20-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3210

2D20-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3290

2D20-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3213

2D20-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3290

2D20-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3290

2D20-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3210

2D20-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3210

2D20-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3210

2D20-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3290

2D20-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3290

2D20-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3231

2D20-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3232

2D20-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3290

2D20-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3221

2D20-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3211

2D20-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3211

2D20-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3211

2D20-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3290

2D20-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3240.

2D20-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP3241.

2D20-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP3249.

2D20-9076

Explanation: Missing remote controller.

Response: Use MAP3247.

2D20-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3290

2D20-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3290

2D20-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3233

2D20-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3233

2D20-9092

Explanation: Disk requires Format before use.

Response: Use MAP3234

2D20-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D20
-

2D20-FFF3

Explanation: Disk media format bad.

Response: Use MAP3235

2D20-FFF4

Explanation: Device problem.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D20-FFF6

Explanation: Device detected recoverable error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D20-FFFA

Explanation: Temporary device bus error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D20-FFFC

Explanation: Device recovered T10 DIF device bus error.

Response: Use MAP3250.

Failing Item:

- FFC_722
-

2D20-FFFD

Explanation: Controller recovered T10 DIF device bus error.

Response: Use MAP3250.

2D20-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3250.

2D21-102E

Explanation: Reallocation failed due to disk out of alternate sectors.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D21-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D21-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D21-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3250.

2D21-3100

Explanation: Controller detected device bus interface error.

Response: Use MAP3250.

2D21-3109

Explanation: Controller timed out a device command.

Response: Use MAP3250 during concurrent maintenance.

2D21-310C

Explanation: Device T10 DIF device bus error.

Response: Use MAP3250.

2D21-310D

Explanation: Controller T10 DIF device bus error.

Response: Use MAP3250.

2D21-3110

Explanation: Device bus interface error.

Response: Use MAP3250.

2D21-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3242

2D21-4020

Explanation: Configuration error, connections exceed controller design limits.

Response: Use MAP3243

2D21-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP3244.

2D21-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP3244.

2D21-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3246

2D21-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3248

2D21-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP3253.

2D21-4080

Explanation: Thermal error, controller exceeded maximum operating temperature.

Response: Use MAP3295.

2D21-4085

Explanation: Please contact your next level of support or service provider.

Response: Use MAP3290.

2D21-4100

Explanation: Device bus fabric error.

Response: Use MAP3252.

2D21-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP3252.

2D21-4102

Explanation: Device bus fabric performance degradation.

Response: Use MAP3254.

2D21-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3245

2D21-4120

Explanation: Configuration error, cable VPD cannot be read.

Response: Use MAP3261

2D21-4121

Explanation: Configuration error, required cable is missing.

Response: Use MAP3261

2D21-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D21
 - FFC_221
-

2D21-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D21
 - FFC_221
-

2D21-4170

Explanation: Controller T10 DIF host bus error.

Response: Use MAP3260.

2D21-4171

Explanation: Controller recovered T10 DIF host bus error.

Response: Use MAP3260.

2D21-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D21-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D21
-

2D21-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D21
-

2D21-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3290

2D21-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3290

2D21-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3290

2D21-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3230

2D21-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3220

2D21-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3290

2D21-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3211

2D21-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3211

2D21-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3211

2D21-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3212

2D21-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3290

2D21-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3210

2D21-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3290

2D21-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3213

2D21-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3290

2D21-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3290

2D21-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3210

2D21-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3210

2D21-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3210

2D21-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3290

2D21-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3290

2D21-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3231

2D21-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3232

2D21-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3290

2D21-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3221

2D21-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3211

2D21-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3211

2D21-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3211

2D21-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3290

2D21-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3240.

2D21-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP3241.

2D21-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP3249.

2D21-9076**Explanation:** Missing remote controller.**Response:** Use MAP3247.

2D21-9081**Explanation:** Controller detected device error during internal media recovery.**Response:** Use MAP3290

2D21-9082**Explanation:** Controller detected device error during internal media recovery.**Response:** Use MAP3290

2D21-9090**Explanation:** Disk has been modified after last known status.**Response:** Use MAP3233

2D21-9091**Explanation:** Incorrect disk configuration change has been detected.**Response:** Use MAP3233

2D21-9092**Explanation:** Disk requires Format before use.**Response:** Use MAP3234.

2D21-FF3D**Explanation:** Temporary controller failure.**Response:** Use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_2D21

2D21-FFF3**Explanation:** Disk media format bad.**Response:** Use MAP3235.

2D21-FFF4**Explanation:** Device problem.**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_722

2D21-FFF6**Explanation:** Device detected recoverable error.**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_722

2D21-FFFA**Explanation:** Temporary device bus error.**Response:** Use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_722

2D21-FFFC**Explanation:** Device recovered T10 DIF device bus error.**Response:** Use MAP3250.**Failing Item:**

- FFC_722

2D21-FFFD**Explanation:** Controller recovered T10 DIF device bus error.**Response:** Use MAP3250.

2D21-FFFE**Explanation:** Temporary disk bus error.**Response:** Use MAP3250.

2D23-102E**Explanation:** Reallocation failed due to disk out of alternate sectors.**Response:** If the problem persists, use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_722

2D23-3002**Explanation:** Addressed device failed to respond to selection.**Response:** If the problem persists, use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_722

2D23-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D23-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

2D23-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2D23-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

2D23-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

2D23-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3142.

2D23-4020

Explanation: Configuration error, connections exceed IOA design limits.

Response: Use MAP3143.

2D23-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP3144.

2D23-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP3144.

2D23-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146.

2D23-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148.

2D23-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP3153.

2D23-4100

Explanation: Device bus fabric error.

Response: Use MAP3152.

2D23-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP3152.

2D23-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145.

2D23-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D23
 - FFC_221
-

2D23-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D23
 - FFC_221
-

2D23-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D23-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D23
-

2D23-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D23
-

2D23-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2D23-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2D23-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2D23-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2D23-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2D23-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2D23-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2D23-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2D23-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2D23-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112.

2D23-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190.

2D23-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110.

2D23-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190.

2D23-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113.

2D23-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2D23-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190.

2D23-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2D23-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110.

2D23-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2D23-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190.

2D23-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2D23-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131.

2D23-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132.

2D23-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2D23-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121.

2D23-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111.

2D23-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2D23-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2D23-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2D23-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2D23-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP3141.

2D23-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP3149.

2D23-9076

Explanation: Missing remote controller.

Response: Use MAP3147.

2D23-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2D23-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2D23-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2D23-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2D23-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134.

2D23-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D23
-

2D23-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135.

2D23-FFF4

Explanation: Disk drive problem.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D23-FFF6

Explanation: Disk detected recoverable error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D23-FFFA

Explanation: Temporary disk error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D23-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

Note: Device may only identify adapter port, e.g. 00pFFF, where 'p' is port.

2D24-102E

Explanation: Reallocation failed due to disk out of alternate sectors.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D24-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D24-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D24-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3250.

2D24-3100

Explanation: Controller detected device bus interface error.

Response: Use MAP3250.

2D24-3109

Explanation: Controller timed out a device command.

Response: Use MAP3250 during concurrent maintenance.

2D24-310C

Explanation: Device T10 DIF device bus error.

Response: Use MAP3250.

2D24-310D

Explanation: Controller T10 DIF device bus error.

Response: Use MAP3250.

2D24-3110

Explanation: Device bus interface error.

Response: Use MAP3250.

2D24-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3242

2D24-4020

Explanation: Configuration error, connections exceed controller design limits.

Response: Use MAP3243

2D24-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP3244.

2D24-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP3244.

2D24-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3246

2D24-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3248

2D24-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP3253.

2D24-4080

Explanation: Thermal error, controller exceeded maximum operating temperature.

Response: Use MAP3295.

2D24-4085

Explanation: Please contact your next level of support or service provider.

Response: Use MAP3290.

2D24-4100

Explanation: Device bus fabric error.

Response: Use MAP3252.

2D24-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP3252.

2D24-4102

Explanation: Device bus fabric performance degradation.

Response: Use MAP3254.

2D24-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3245

2D24-4120

Explanation: Configuration error, cable VPD cannot be read.

Response: Use MAP3261

2D24-4121

Explanation: Configuration error, required cable is missing.

Response: Use MAP3261

2D24-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D24
 - FFC_221
-

2D24-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D24
 - FFC_221
-

2D24-4170

Explanation: Controller T10 DIF host bus error.

Response: Use MAP3260.

2D24-4171

Explanation: Controller recovered T10 DIF host bus error.

Response: Use MAP3260.

2D24-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D24-8008

Explanation: A permanent Cache Power Pack failure occurred.

Response: Use MAP3200.

Failing Item:

- FFC_2D24
-

2D24-8009

Explanation: Impending Cache Power Pack failure.

Response: Use MAP3200.

Failing Item:

- FFC_2D24
-

2D24-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D24
-

2D24-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D24
-

2D24-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3290

2D24-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3290

2D24-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3290

2D24-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3230

2D24-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3220

2D24-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3290

2D24-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3211

2D24-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3211

2D24-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3211

2D24-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3212

2D24-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3290

2D24-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3210

2D24-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3290

2D24-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3213

2D24-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3290

2D24-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3290

2D24-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3210

2D24-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3210

2D24-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3210

2D24-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3290

2D24-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3290

2D24-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3231

2D24-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3232

2D24-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3290

2D24-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3221

2D24-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3211

2D24-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3211

2D24-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3211

2D24-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3290

2D24-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3240.

2D24-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP3241.

2D24-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP3249.

2D24-9076

Explanation: Missing remote controller.

Response: Use MAP3247.

2D24-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3290

2D24-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3290

2D24-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3233

2D24-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3233

2D24-9092

Explanation: Disk requires Format before use.

Response: Use MAP3234.

2D24-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D24
-

2D24-FFF3

Explanation: Disk media format bad.

Response: Use MAP3235.

2D24-FFF4

Explanation: Device problem.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D24-FFF6

Explanation: Device detected recoverable error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D24-FFFA

Explanation: Temporary device bus error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D24-FFFC

Explanation: Device recovered T10 DIF device bus error.

Response: Use MAP3250.

Failing Item:

- FFC_722
-

2D24-FFFD

Explanation: Controller recovered T10 DIF device bus error.

Response: Use MAP3250.

2D24-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3250.

2D25-102E

Explanation: Reallocation failed due to disk out of alternate sectors.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D25-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D25-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D25-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

2D25-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2D25-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

2D25-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

2D25-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3142.

2D25-4020

Explanation: Configuration error, connections exceed IOA design limits.

Response: Use MAP3143.

2D25-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP3144.

2D25-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP3144.

2D25-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146.

2D25-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148.

2D25-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP3153.

2D25-4100

Explanation: Device bus fabric error.

Response: Use MAP3152.

2D25-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP3152.

2D25-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145.

2D25-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D25
 - FFC_221
-

2D25-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D25
 - FFC_221
-

2D25-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D25-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D25
-

2D25-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D25
-

2D25-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2D25-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2D25-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2D25-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2D25-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2D25-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2D25-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2D25-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2D25-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2D25-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112.

2D25-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190.

2D25-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110.

2D25-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190.

2D25-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113.

2D25-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2D25-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190.

2D25-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2D25-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110.

2D25-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2D25-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190.

2D25-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2D25-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131.

2D25-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132.

2D25-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2D25-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121.

2D25-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111.

2D25-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2D25-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2D25-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2D25-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2D25-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP3141.

2D25-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP3149.

2D25-9076

Explanation: Missing remote controller.

Response: Use MAP3147.

2D25-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2D25-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190.

2D25-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133.

2D25-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133.

2D25-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134.

2D25-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D25
-

2D25-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135.

2D25-FFF4

Explanation: Disk drive problem.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D25-FFF6

Explanation: Disk detected recoverable error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D25-FFFA

Explanation: Temporary disk error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D25-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3150.

Note: Device may only identify adapter port, e.g. 00pFFF, where 'p' is port.

2D26-102E

Explanation: Reallocation failed due to disk out of alternate sectors.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D26-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D26-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D26-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP4050.

2D26-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP4050.

2D26-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP4050.

2D26-3110

Explanation: Disk bus interface error.

Response: Use MAP4050.

2D26-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3142

2D26-4020

Explanation: Configuration error, connections exceed IOA design limits.

Response: Use MAP3143

2D26-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP4044.

2D26-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP4044.

2D26-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146

2D26-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148

2D26-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP4053.

2D26-4100

Explanation: Device bus fabric error.

Response: Use MAP4052.

2D26-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP4052.

2D26-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145

2D26-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D26
 - FFC_221
-

2D26-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D26
 - FFC_221
-

2D26-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D26-8008

Explanation: A permanent Cache Battery Pack failure occurred.

Response: Use MAP3100

Failing Item:

- FFC_2D1B
-

2D26-8009

Explanation: Impending Cache Battery Pack failure.

Response: Use MAP3100

Failing Item:

- FFC_2D1B
-

2D26-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D26
-

2D26-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D26

2D26-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D26-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D26-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D26-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130

2D26-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120

2D26-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190

2D26-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D26-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D26-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D26-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112

2D26-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190

2D26-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110

2D26-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190

2D26-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113

2D26-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190

2D26-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190

2D26-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110

2D26-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110

2D26-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110

2D26-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190

2D26-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190

2D26-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131

2D26-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132

2D26-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190

2D26-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121

2D26-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111

2D26-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111

2D26-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111

2D26-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190

2D26-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP4040.

2D26-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP4041.

2D26-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP4049.

2D26-9076

Explanation: Missing remote controller.

Response: Use MAP4047.

2D26-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190

2D26-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190

2D26-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133

2D26-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133

2D26-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134

2D26-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D26
-

2D26-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135

2D26-FFF4

Explanation: Disk drive problem.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D26-FFF6

Explanation: Disk detected recoverable error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D26-FFFA

Explanation: Temporary disk error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D26-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP4050.

Note: Device may only identify adapter port, e.g. 00pFFE, where 'p' is port.

2D27-102E

Explanation: Reallocation failed due to disk out of alternate sectors.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D27-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D27-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D27-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP4050.

2D27-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP4050.

2D27-3109**Explanation:** Adapter timed out a disk command.**Response:** Use MAP4050.

2D27-3110**Explanation:** Disk bus interface error.**Response:** Use MAP4050.

2D27-4010**Explanation:** Configuration error, incorrect connection between cascaded enclosures.**Response:** Use MAP3142

2D27-4020**Explanation:** Configuration error, connections exceed IOA design limits.**Response:** Use MAP3143

2D27-4030**Explanation:** Configuration error, incorrect multipath connection.**Response:** Use MAP4044.

2D27-4040**Explanation:** Configuration error, incomplete multipath connection between controller and enclosure detected.**Response:** Use MAP4044.

2D27-4041**Explanation:** Configuration error, incomplete multipath connection between enclosure and device detected.**Response:** Use MAP3146

2D27-4050**Explanation:** Attached enclosure does not support required multipath function.**Response:** Use MAP3148

2D27-4060**Explanation:** Multipath redundancy level got worse.**Response:** Use MAP4053.

2D27-4100**Explanation:** Device bus fabric error.**Response:** Use MAP4052.

2D27-4101**Explanation:** Temporary device bus fabric error.**Response:** Use MAP4052.

2D27-4110**Explanation:** Unsupported enclosure function detected.**Response:** Use MAP3145

2D27-4150**Explanation:** PCI bus error detected by controller.**Response:** Use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_2D27
- FFC_221

2D27-4160**Explanation:** PCI bus error detected by controller.**Response:** Use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_2D27
- FFC_221

2D27-7001**Explanation:** Temporary disk data error.**Response:** Use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_722

2D27-8150**Explanation:** Controller failure.**Response:** Use MAP0210 : General Problem Resolution.**Failing Item:**

- FFC_2D27
-

2D27-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D27

2D27-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D27-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D27-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D27-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130

2D27-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120

2D27-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190

2D27-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D27-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D27-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D27-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112

2D27-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190

2D27-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110

2D27-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190

2D27-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113

2D27-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190

2D27-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190

2D27-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110

2D27-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110

2D27-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110

2D27-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190

2D27-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190

2D27-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131

2D27-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132

2D27-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190

2D27-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121

2D27-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111

2D27-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111

2D27-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111

2D27-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190

2D27-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP4040.

2D27-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP4041.

2D27-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP4049.

2D27-9076

Explanation: Missing remote controller.

Response: Use MAP4047.

2D27-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190

2D27-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190

2D27-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133

2D27-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133

2D27-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134

2D27-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D27
-

2D27-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135

2D27-FFF4

Explanation: Disk drive problem.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D27-FFF6

Explanation: Disk detected recoverable error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D27-FFFA

Explanation: Temporary disk error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D27-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP4050.

Note: Device may only identify adapter port, e.g. 00pFFF, where 'p' is port.

2D28-102E

Explanation: Reallocation failed due to disk out of alternate sectors.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D28-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D28-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D28-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP4050.

2D28-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP4050.

2D28-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP4050.

2D28-3110

Explanation: Disk bus interface error.

Response: Use MAP4050.

2D28-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3142

2D28-4020

Explanation: Configuration error, connections exceed IOA design limits.

Response: Use MAP3143

2D28-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP4044.

2D28-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP4044.

2D28-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146

2D28-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148

2D28-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP4053.

2D28-4100

Explanation: Device bus fabric error.

Response: Use MAP4052.

2D28-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP4052.

2D28-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145

2D28-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D28
 - FFC_221
-

2D28-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D28
 - FFC_221
-

2D28-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D28-8008

Explanation: A permanent Cache Battery Pack failure occurred.

Response: Use MAP3100

Failing Item:

- FFC_2D1B
-

2D28-8009

Explanation: Impending Cache Battery Pack failure.

Response: Use MAP3100

Failing Item:

- FFC_2D1B

2D28-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D28

2D28-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D28

2D28-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D28-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D28-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190

2D28-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130

2D28-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120

2D28-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190

2D28-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D28-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D28-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111

2D28-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112

2D28-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190

2D28-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110

2D28-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190

2D28-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113

2D28-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190

2D28-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190

2D28-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110

2D28-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110

2D28-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110

2D28-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190

2D28-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190

2D28-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131

2D28-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132

2D28-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190

2D28-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121

2D28-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111

2D28-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111

2D28-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111

2D28-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190

2D28-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP4040.

2D28-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP4041.

2D28-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP4049.

2D28-9076

Explanation: Missing remote controller.

Response: Use MAP4047.

2D28-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190

2D28-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3190

2D28-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3133

2D28-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3133

2D28-9092

Explanation: Disk requires Format before use.

Response: Use MAP3134

2D28-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D28
-

2D28-FFF3

Explanation: Disk media format bad.

Response: Use MAP3135

2D28-FFF4

Explanation: Disk drive problem.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D28-FFF6

Explanation: Disk detected recoverable error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D28-FFFA

Explanation: Temporary disk error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D28-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP4050.

Note: Device may only identify adapter port, e.g. 00pFFF, where 'p' is port.

2D35-102E

Explanation: Reallocation failed due to disk out of alternate sectors.

Response: If the problem persists, use MAP0210 : General Problem Resolution,

Failing Item:

- FFC_722
-

2D35-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D35-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D35-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3250.

2D35-3100

Explanation: Controller detected device bus interface error.

Response: Use MAP3250.

2D35-3109

Explanation: Controller timed out a device command.

Response: Use MAP3250 during concurrent maintenance.

2D35-310C

Explanation: Device T10 DIF device bus error.

Response: Use MAP3250.

2D35-310D

Explanation: Controller T10 DIF device bus error.

Response: Use MAP3250.

2D35-3110

Explanation: Device bus interface error.

Response: Use MAP3250.

2D35-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3242

2D35-4020

Explanation: Configuration error, connections exceed controller design limits.

Response: Use MAP3243

2D35-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP3244.

2D35-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP3244.

2D35-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3246

2D35-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3248

2D35-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP3253.

2D35-4080

Explanation: Thermal error, controller exceeded maximum operating temperature.

Response: Use MAP3295.

2D35-4085

Explanation: Please contact your next level of support or service provider.

Response: Use MAP3290.

2D35-4100

Explanation: Device bus fabric error.

Response: Use MAP3252.

2D35-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP3252.

2D35-4102

Explanation: Device bus fabric performance degradation.

Response: Use MAP3254.

2D35-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3245

2D35-4120

Explanation: Configuration error, cable VPD cannot be read.

Response: Use MAP3261

2D35-4121

Explanation: Configuration error, required cable is missing.

Response: Use MAP3261

2D35-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D35
 - FFC_221
-

2D35-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D35
 - FFC_221
-

2D35-4170

Explanation: Controller T10 DIF host bus error.

Response: Use MAP3260.

2D35-4171

Explanation: Controller recovered T10 DIF host bus error.

Response: Use MAP3260.

2D35-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D35-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D35
-

2D35-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D35
-

2D35-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3290

2D35-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3290

2D35-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3290

2D35-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3230

2D35-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3220

2D35-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3290

2D35-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3211

2D35-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3211

2D35-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3211

2D35-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3212

2D35-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3290

2D35-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3210

2D35-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3290

2D35-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3213

2D35-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3290

2D35-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3290

2D35-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3210

2D35-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3210

2D35-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3210

2D35-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3290

2D35-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3290

2D35-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3231

2D35-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3232

2D35-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3290

2D35-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3221

2D35-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3211

2D35-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3211

2D35-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3211

2D35-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3290

2D35-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3240.

2D35-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP3241.

2D35-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP3249.

2D35-9076

Explanation: Missing remote controller.

Response: Use MAP3247.

2D35-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3290

2D35-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3290

2D35-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3233

2D35-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3233

2D35-9092

Explanation: Disk requires Format before use.

Response: Use MAP3234

2D35-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D35
-

2D35-FFF3

Explanation: Disk media format bad.

Response: Use MAP3235

2D35-FFF4

Explanation: Device problem.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D35-FFF6

Explanation: Device detected recoverable error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D35-FFFA

Explanation: Temporary device bus error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D35-FFFC

Explanation: Device recovered T10 DIF device bus error.

Response: Use MAP3250.

Failing Item:

- FFC_722
-

2D35-FFFD

Explanation: Controller recovered T10 DIF device bus error.

Response: Use MAP3250.

2D35-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3250.

2D36-102E

Explanation: Reallocation failed due to disk out of alternate sectors.

Response: If the problem persists, use MAP0210 : General Problem Resolution,

Failing Item:

- FFC_722
-

2D36-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D36-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D36-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3250.

2D36-3100

Explanation: Controller detected device bus interface error.

Response: Use MAP3250.

2D36-3109

Explanation: Controller timed out a device command.

Response: Use MAP3250 during concurrent maintenance.

2D36-310C

Explanation: Device T10 DIF device bus error.

Response: Use MAP3250.

2D36-310D

Explanation: Controller T10 DIF device bus error.

Response: Use MAP3250.

2D36-3110

Explanation: Device bus interface error.

Response: Use MAP3250.

2D36-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3242

2D36-4020

Explanation: Configuration error, connections exceed controller design limits.

Response: Use MAP3243

2D36-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP3244.

2D36-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP3244.

2D36-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3246

2D36-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3248

2D36-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP3253.

2D36-4080

Explanation: Thermal error, controller exceeded maximum operating temperature.

Response: Use MAP3295.

2D36-4085

Explanation: Please contact your next level of support or service provider.

Response: Use MAP3290.

2D36-4100

Explanation: Device bus fabric error.

Response: Use MAP3252.

2D36-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP3252.

2D36-4102

Explanation: Device bus fabric performance degradation.

Response: Use MAP3254.

2D36-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3245

2D36-4120

Explanation: Configuration error, cable VPD cannot be read.

Response: Use MAP3261

2D36-4121

Explanation: Configuration error, required cable is missing.

Response: Use MAP3261

2D36-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D36
 - FFC_221
-

2D36-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D36
 - FFC_221
-

2D36-4170

Explanation: Controller T10 DIF host bus error.

Response: Use MAP3260.

2D36-4171

Explanation: Controller recovered T10 DIF host bus error.

Response: Use MAP3260.

2D36-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D36-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D36
-

2D36-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D36
-

2D36-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3290

2D36-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3290

2D36-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3290

2D36-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3230

2D36-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3220

2D36-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3290

2D36-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3211

2D36-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3211

2D36-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3211

2D36-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3212

2D36-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3290

2D36-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3210

2D36-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3290

2D36-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3213

2D36-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3290

2D36-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3290

2D36-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3210

2D36-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3210

2D36-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3210

2D36-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3290

2D36-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3290

2D36-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3231

2D36-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3232

2D36-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3290

2D36-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3221

2D36-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3211

2D36-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3211

2D36-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3211

2D36-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3290

2D36-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3240.

2D36-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP3241.

2D36-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP3249.

2D36-9076

Explanation: Missing remote controller.

Response: Use MAP3247.

2D36-9081

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3290

2D36-9082

Explanation: Controller detected device error during internal media recovery.

Response: Use MAP3290

2D36-9090

Explanation: Disk has been modified after last known status.

Response: Use MAP3233

2D36-9091

Explanation: Incorrect disk configuration change has been detected.

Response: Use MAP3233

2D36-9092

Explanation: Disk requires Format before use.

Response: Use MAP3234

2D36-FF3D

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D36
-

2D36-FFF3

Explanation: Disk media format bad.

Response: Use MAP3235

2D36-FFF4

Explanation: Device problem.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722

2D36-FFF6

Explanation: Device detected recoverable error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D36-FFFA

Explanation: Temporary device bus error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D36-FFFC

Explanation: Device recovered T10 DIF device bus error.

Response: Use MAP3250.

Failing Item:

- FFC_722
-

2D36-FFFD

Explanation: Controller recovered T10 DIF device bus error.

Response: Use MAP3250.

2D36-FFFE

Explanation: Temporary disk bus error.

Response: Use MAP3250.

2D40-102E

Explanation: Reallocation failed due to disk out of alternate sectors.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D40-3002

Explanation: Addressed device failed to respond to selection.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722

2D40-3010

Explanation: Disk returned wrong response to adapter.

Response: If the problem persists, use MAP0210 : General Problem Resolution

Failing Item:

- FFC_722
-

2D40-3020

Explanation: Storage subsystem configuration error.

Response: Use MAP3150.

2D40-3100

Explanation: Adapter detected device bus interface error.

Response: Use MAP3150.

2D40-3109

Explanation: Adapter timed out a disk command.

Response: Use MAP3150.

2D40-3110

Explanation: Disk bus interface error.

Response: Use MAP3150.

2D40-4010

Explanation: Configuration error, incorrect connection between cascaded enclosures.

Response: Use MAP3142.

2D40-4020

Explanation: Configuration error, connections exceed IOA design limits.

Response: Use MAP3143.

2D40-4030

Explanation: Configuration error, incorrect multipath connection.

Response: Use MAP3144.

2D40-4040

Explanation: Configuration error, incomplete multipath connection between controller and enclosure detected.

Response: Use MAP3144.

2D40-4041

Explanation: Configuration error, incomplete multipath connection between enclosure and device detected.

Response: Use MAP3146.

2D40-4050

Explanation: Attached enclosure does not support required multipath function.

Response: Use MAP3148.

2D40-4060

Explanation: Multipath redundancy level got worse.

Response: Use MAP3153.

2D40-4100

Explanation: Device bus fabric error.

Response: Use MAP3152.

2D40-4101

Explanation: Temporary device bus fabric error.

Response: Use MAP3152.

2D40-4110

Explanation: Unsupported enclosure function detected.

Response: Use MAP3145.

2D40-4150

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D40
 - FFC_221
-

2D40-4160

Explanation: PCI bus error detected by controller.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_2D40
 - FFC_221
-

2D40-7001

Explanation: Temporary disk data error.

Response: Use MAP0210 : General Problem Resolution.

Failing Item:

- FFC_722
-

2D40-8150

Explanation: Controller failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D40
-

2D40-8157

Explanation: Temporary controller failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2D40
-

2D40-9000

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2D40-9001

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2D40-9002

Explanation: Controller detected device error during configuration discovery.

Response: Use MAP3190.

2D40-9008

Explanation: Controller does not support function expected for one or more disks.

Response: Use MAP3130.

2D40-9010

Explanation: Cache data associated with attached disks cannot be found.

Response: Use MAP3120.

2D40-9011

Explanation: Cache data belongs to disks other than those attached.

Response: Use MAP3190.

2D40-9020

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2D40-9021

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2D40-9022

Explanation: Two or more disks are missing from a RAID-5 or RAID 6 Disk Array.

Response: Use MAP3111.

2D40-9023

Explanation: One or more Disk Array members are not at required physical locations.

Response: Use MAP3112.

2D40-9024

Explanation: Physical location of Disk Array members conflict with another Disk Array.

Response: Use MAP3190.

2D40-9025

Explanation: Incompatible disk installed at degraded disk location in Disk Array.

Response: Use MAP3110.

2D40-9026

Explanation: Previously degraded disk in Disk Array not found at required physical location.

Response: Use MAP3190.

2D40-9027

Explanation: Disk Array is or would become degraded and parity data is out of synchronization.

Response: Use MAP3113.

2D40-9028

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2D40-9029

Explanation: Maximum number of functional Disk Arrays disks has been exceeded.

Response: Use MAP3190.

2D40-9030

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2D40-9031

Explanation: Automatic reconstruction initiated for Disk Array.

Response: Use MAP3110.

2D40-9032

Explanation: Disk Array is degraded due to missing/failed disk.

Response: Use MAP3110.

2D40-9041

Explanation: Background Disk Array parity checking detected and corrected errors.

Response: Use MAP3190.

2D40-9042

Explanation: Background Disk Array parity checking detected and corrected errors on specified disk.

Response: Use MAP3190.

2D40-9050

Explanation: Required cache data can not be located for one or more disks.

Response: Use MAP3131.

2D40-9051

Explanation: Cache data exists for one or more missing/failed disks.

Response: Use MAP3132.

2D40-9052

Explanation: Cache data exists for one or more modified disks.

Response: Use MAP3190.

2D40-9054

Explanation: RAID controller resources not available due to previous problems.

Response: Use MAP3121.

2D40-9060

Explanation: One or more disk pairs are missing from a RAID-10 Disk Array.

Response: Use MAP3111.

2D40-9061

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2D40-9062

Explanation: One or more disks are missing from a RAID-0 Disk Array.

Response: Use MAP3111.

2D40-9063

Explanation: Maximum number of functional Disk Arrays has been exceeded.

Response: Use MAP3190.

2D40-9073

Explanation: Multiple controllers connected in an invalid configuration.

Response: Use MAP3140.

2D40-9074

Explanation: Multiple controllers not capable of similar functions or controlling same set of devices.

Response: Use MAP3141.

2D40-9075

Explanation: Incomplete multipath connection between controller and remote controller

Response: Use MAP3149.

2D40-9076**Explanation:** Missing remote controller.**Response:** Use MAP3147.

2D40-9081**Explanation:** Controller detected device error during internal media recovery.**Response:** Use MAP3190.

2D40-9082**Explanation:** Controller detected device error during internal media recovery.**Response:** Use MAP3190.

2D40-9090**Explanation:** Disk has been modified after last known status.**Response:** Use MAP3133.

2D40-9091**Explanation:** Incorrect disk configuration change has been detected.**Response:** Use MAP3133.

2D40-9092**Explanation:** Disk requires Format before use.**Response:** Use MAP3134.

2D40-FF3D**Explanation:** Temporary controller failure.**Response:** Use MAP0210.**Failing Item:**

- FFC_2D40

2D40-FFF3**Explanation:** Disk media format bad.**Response:** Use MAP3135.

2D40-FFF4**Explanation:** Disk drive problem.**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_722

2D40-FFF6**Explanation:** Disk detected recoverable error.**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_722

2D40-FFFA**Explanation:** Temporary disk error.**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_722

2D40-FFFE**Explanation:** Temporary disk bus error.**Response:** Use MAP3150.

Note: Device may only identify adapter port, e.g. 00pFFF, where 'p' is port.

2FFFF**Explanation:** An async code that is not valid was received.**Response:** Refer to the SRN table in the Service Guide for the unit containing the disk drive and the User's Guide and Maintenance Information for the SSA adapter.

2E6-101**Explanation:** Enhanced error handling failure on the bus.**Failing Item:**

- FFC_221

2E6-102**Explanation:** Enhanced error handling failure on a PCI-PCI Bridge.**Failing Item:**

- FFC_293

2E6-103**Explanation:** Enhanced error handling failure on the adapter.**Failing Item:**

- FFC_2E6
- FFC_221

2E6-212

Explanation: FIFO empty bit set.

Failing Item:

- FFC_2E6
-

2E6-213

Explanation: FIFO empty bit clear.

Failing Item:

- FFC_2E6
-

2E6-214

Explanation: FIFO full bit set.

Failing Item:

- FFC_2E6
-

2E6-215

Explanation: FIFO full bit clear.

Failing Item:

- FFC_2E6
-

2E6-216

Explanation: FIFO data miscompare.

Failing Item:

- FFC_2E6
-

2E6-217

Explanation: SCSI FIFO data miscompare.

Failing Item:

- FFC_2E6
-

2E6-218

Explanation: SCSI FIFO underflow.

Failing Item:

- FFC_2E6
-

2E6-219

Explanation: SCSI parity error.

Response: Use MAP0050 : SCSI Bus Problems.

Failing Item:

- FFC_2E6
-

2E6-220

Explanation: SCSI FIFO flags error.

Failing Item:

- FFC_2E6
-

2E6-221

Explanation: Miscompare during the write/read of the configuration register.

Failing Item:

- FFC_2E6
 - FFC_221
-

2E6-222

Explanation: Error during the write/read of the memory register.

Failing Item:

- FFC_2E6
-

2E6-223

Explanation: Miscompare during the write/read of the memory I/O register.

Response: Use MAP0050 : SCSI Bus Problems.

Failing Item:

- FFC_2E6
-

2E6-224

Explanation: SCSI configuration register read or write error.

Failing Item:

- FFC_2E6
 - FFC_221
-

2E6-225

Explanation: Adapter POST failed.

Failing Item:

- FFC_2E6
-

2E6-226

Explanation: SCSI wrap or PTC failure.

Response: Use MAP0050 : SCSI Bus Problems.

2E6-227

Explanation: SCSI adapter test failure.

Failing Item:

- FFC_2E6

- FFC_221

2E6-230

Explanation: Arbitration test failed.

Response: Use MAP0050 : SCSI Bus Problems.

2E6-231

Explanation: Function could not complete.

Response: Use MAP0050 : SCSI Bus Problems.

2E6-232

Explanation: SCSI bus data miscompare.

Response: Use MAP0050 : SCSI Bus Problems.

2E6-240

Explanation: No terminal power.

Response: Use MAP0050 : SCSI Bus Problems.

2E6-242

Explanation: SCSI bus problem.

Response: Use MAP0050 : SCSI Bus Problems.

2E6-301

Explanation: The parent device open failed.

Failing Item:

- FFC_2E6
 - FFC_221
-

2E6-701

Explanation: Error log analysis indicates a PCI SCSI adapter failure.

Failing Item:

- FFC_2E6
-

2E6-801

Explanation: Error log analysis indicates a terminator problem.

Response: Run the diagnostics on the adapter in system verification mode. If an SRN is reported, use the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in General SCSI configuration checks to resolve the problem.

2E6-802

Explanation: Error log analysis indicates that multiple attempts to reset the SCSI bus have timed out.

Response: Run the diagnostics on the adapter in system verification mode. If an SRN is reported, use the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in

General SCSI configuration checks to resolve the problem.

2E6-803

Explanation: Error log analysis indicates that multiple SCSI bus errors have occurred.

Response: Run the diagnostics on the adapter in system verification mode. If an SRN is reported, use the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in General SCSI configuration checks to resolve the problem.

2E7-101

Explanation: Enhanced error handling failure on the bus.

Failing Item:

- FFC_221
-

2E7-102

Explanation: Enhanced error handling failure on a PCI-PCI Bridge.

Failing Item:

- FFC_293
-

2E7-103

Explanation: Enhanced error handling failure on the adapter.

Failing Item:

- FFC_2E7
 - FFC_221
-

2E7-212

Explanation: FIFO empty bit set.

Failing Item:

- FFC_2E7
-

2E7-213

Explanation: FIFO empty bit clear.

Failing Item:

- FFC_2E7
-

2E7-214

Explanation: FIFO full bit set.

Failing Item:

- FFC_2E7
-

2E7-215

Explanation: FIFO full bit clear.

Failing Item:

- FFC_2E7
-

2E7-216

Explanation: FIFO data miscompare.

Failing Item:

- FFC_2E7
-

2E7-217

Explanation: SCSI FIFO data miscompare.

Failing Item:

- FFC_2E7
-

2E7-218

Explanation: SCSI FIFO underflow.

Failing Item:

- FFC_2E7
-

2E7-219

Explanation: SCSI parity error.

Response: Use MAP0050 : SCSI Bus Problems.

2E7-220

Explanation: SCSI FIFO flags error.

Failing Item:

- FFC_2E7
-

2E7-221

Explanation: Miscompare during the write/read of the configuration register.

Failing Item:

- FFC_2E7
 - FFC_221
-

2E7-222

Explanation: Error during the write/read of the memory register.

Failing Item:

- FFC_2E7
-

2E7-223

Explanation: Miscompare during the write/read of the memory I/O register.

Response: Use MAP0050 : SCSI Bus Problems.

Failing Item:

- FFC_2E7
-

2E7-224

Explanation: SCSI configuration register read or write error.

Failing Item:

- FFC_2E7
 - FFC_221
-

2E7-225

Explanation: Adapter POST failed.

Failing Item:

- FFC_2E7
-

2E7-226

Explanation: SCSI wrap or PTC failure.

Response: Use MAP0050 : SCSI Bus Problems.

2E7-227

Explanation: SCSI adapter test failure.

Failing Item:

- FFC_2E7
 - FFC_221
-

2E7-230

Explanation: Arbitration test failed.

Response: Use MAP0050 : SCSI Bus Problems.

2E7-231

Explanation: Function could not complete.

Response: Use MAP0050 : SCSI Bus Problems.

2E7-232**Explanation:** SCSI bus data miscompare.**Response:** Use MAP0050 : SCSI Bus Problems.

2E7-240**Explanation:** No terminal power.**Response:** Use MAP0050 : SCSI Bus Problems.

2E7-242**Explanation:** SCSI bus problem.**Response:** Use MAP0050 : SCSI Bus Problems.

2E7-301**Explanation:** Configuration open failed for parent bus.**Failing Item:**

- FFC_2E7

2E7-701**Explanation:** Error log analysis indicates a PCI SCSI adapter failure.**Failing Item:**

- FFC_2E7

2E7-801**Explanation:** Error log analysis indicates a terminator problem.**Response:** Run the diagnostics on the adapter in system verification mode. If an SRN is reported, use the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in General SCSI configuration checks to resolve the problem.

2E7-802**Explanation:** Error log analysis indicates that multiple attempts to reset the SCSI bus have timed out.**Response:** Run the diagnostics on the adapter in system verification mode. If an SRN is reported, use the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in

General SCSI configuration checks to resolve the problem.

2E7-803**Explanation:** Error log analysis indicates that multiple SCSI bus errors have occurred.**Response:** Run the diagnostics on the adapter in system verification mode. If an SRN is reported, use

the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in General SCSI configuration checks to resolve the problem.

2EF-101**Explanation:** Post indicates an adapter failure.**Failing Item:**

- FFC_751

2E01-101**Explanation:** Register Test Failure**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E01

2E01-102**Explanation:** VPD Checksum Test Failure**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E01

2E01-103**Explanation:** Flash Test Failure**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E01

2E01-104**Explanation:** Internal Wrap Test Failure**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E01

2E01-105**Explanation:** External Wrap Test Failure**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E01
-

2E01-106

Explanation: External Wrap with IP Checksum Test Failure

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E01
-

2E01-107

Explanation: External Wrap with TCP Checksum Test Failure

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E01
-

2E01-108

Explanation: Network link test failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E01
-

2E01-109

Explanation: Network link test failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E01
-

2E01-201

Explanation: Enhanced Error Handling Failure

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E01
-

2E01-202

Explanation: Network link test failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E01
-

2E01-601

Explanation: Error log analysis indicates a hardware error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E01
-

2E01-602

Explanation: Error log analysis indicates an EEH error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E01
-

2E01-603

Explanation: Error log analysis indicates an EEPROM error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E01
-

2E01-604

Explanation: Error log analysis indicates transmission errors.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E01
-

2E02-101

Explanation: Register Test Failure

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E02
-

2E02-102

Explanation: VPD Checksum Test Failure

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E02
-

2E02-103**Explanation:** Flash Test Failure**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E02
-

2E02-104**Explanation:** Internal Wrap Test Failure**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E02
-

2E02-105**Explanation:** External Wrap Test Failure**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E02
-

2E02-106**Explanation:** External Wrap with IP Checksum Test Failure**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E02
-

2E02-107**Explanation:** External Wrap with TCP Checksum Test Failure**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E02
-

2E02-108**Explanation:** Network link test failure.**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E02
-

2E02-109**Explanation:** Network link test failure.**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E02
-

2E02-201**Explanation:** Enhanced Error Handling Failure**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E02
-

2E02-202**Explanation:** Network link test failure.**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E02
-

2E02-601**Explanation:** Error log analysis indicates a hardware error.**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E02
-

2E02-602**Explanation:** Error log analysis indicates an EEH error.**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E02
-

2E02-603**Explanation:** Error log analysis indicates an EEPROM error.**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E02
-

2E02-604

Explanation: Error log analysis indicates transmission errors.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E02

2E03-101

Explanation: Failure to initialize due to a self-test failure

Failing Item:

- FFC_2E03

2E03-102

Explanation: Internal Wrap Test Failure (10Gbps)

Failing Item:

- FFC_2E03

2E03-103

Explanation: External Wrap Test Failure (10Gbps)

Failing Item:

- FFC_2E03

2E03-104

Explanation: Failure to initialize due to a problem while reading the EEPROM on the adapter

Failing Item:

- FFC_2E03

2E03-105

Explanation: Failure to initialize due to a physical Interface test failure

Failing Item:

- FFC_2E03

2E03-106

Explanation: External IP Wrap Test Failure (10Gbps)

Failing Item:

- FFC_2E03

2E03-107

Explanation: External UDP Wrap Test Failure (10Gbps)

Failing Item:

- FFC_2E03

2E03-108

Explanation: External TCP Wrap Test Failure (10Gbps)

Failing Item:

- FFC_2E03

2E03-109

Explanation: External Wrap Loopback Test Failure (10Gbps)

Failing Item:

- FFC_2E03

2E03-110

Explanation: External Link Test Failure (10Gbps)

Failing Item:

- FFC_2E03

2E03-111

Explanation: Failure to initialize due to a EEH Failure

Failing Item:

- FFC_2E03

2E03-201

Explanation: Error log analysis indicates that an adapter error has occurred.

Failing Item:

- FFC_2E03
- FFC_221

2E03-202

Explanation: External Link Test Failure without External Wrap Test (10Gbps)

Failing Item:

- FFC_2E03
- FFC_221

2E03-601

Explanation: Error log analysis indicates that a fatal error has occurred.

Failing Item:

- FFC_2E03
-

2E03-602

Explanation: Error log analysis indicates that an adapter error has occurred.

Failing Item:

- FFC_2E03
-

2E04-101

Explanation: Failure to initialize due to a self-test failure

Failing Item:

- FFC_2E04
-

2E04-102

Explanation: Internal Wrap Test Failure (10Gbps)

Failing Item:

- FFC_2E04
-

2E04-103

Explanation: External Wrap Test Failure (10Gbps)

Failing Item:

- FFC_2E04
-

2E04-104

Explanation: Failure to initialize due to a problem while reading the EEPROM on the adapter

Failing Item:

- FFC_2E04
-

2E04-105

Explanation: Failure to initialize due to a physical Interface test failure

Failing Item:

- FFC_2E04
-

2E04-106

Explanation: External IP Wrap Test Failure (10Gbps)

Failing Item:

- FFC_2E04
-

2E04-107

Explanation: External UDP Wrap Test Failure (10Gbps)

Failing Item:

- FFC_2E04
-

2E04-108

Explanation: External TCP Wrap Test Failure (10Gbps)

Failing Item:

- FFC_2E04
-

2E04-109

Explanation: External Wrap Loopback Test Failure (10Gbps)

Failing Item:

- FFC_2E04
-

2E04-110

Explanation: External Link Test Failure (10Gbps)

Failing Item:

- FFC_2E04
-

2E04-111

Explanation: Failure to initialize due to a EEH Failure

Failing Item:

- FFC_2E04
-

2E04-201

Explanation: Error log analysis indicates that an adapter error has occurred.

Failing Item:

- FFC_2E04
 - FFC_221
-

2E04-202

Explanation: External Link Test Failure without External Wrap Test (10Gbps)

Failing Item:

- FFC_2E04
 - FFC_221
-

2E04-601

Explanation: Error log analysis indicates that a fatal error has occurred.

Failing Item:

- FFC_2E04
-

2E04-602

Explanation: Error log analysis indicates that an adapter error has occurred.

Failing Item:

2E07-101 • 2E08-103

- FFC_2E04

2E07-101

Explanation: Failure to initialize due to a self-test failure

Failing Item:

- FFC_2E07

2E07-102

Explanation: Configuration register test failure

Failing Item:

- FFC_2E07

2E07-103

Explanation: EEPROM checksum error

Failing Item:

- FFC_2E07

2E07-104

Explanation: Flash checksum error

Failing Item:

- FFC_2E07

2E07-105

Explanation: Internal loopback test failure

Failing Item:

- FFC_2E07

2E07-106

Explanation: Internal loopback - IP checksum test failure

Failing Item:

- FFC_2E07

2E07-107

Explanation: Internal loopback - TCP checksum test failure

Failing Item:

- FFC_2E07

2E07-108

Explanation: External loopback test failure

Failing Item:

- FFC_2E07

2E07-109

Explanation: External loopback - IP checksum test failure

Failing Item:

- FFC_2E07

2E07-110

Explanation: External loopback - TCP checksum test failure

Failing Item:

- FFC_2E07

2E07-111

Explanation: Failure to initialize due to a EEH failure

Failing Item:

- FFC_2E07
- FFC_221

2E07-201

Explanation: External link test failure without external wrap test (10Gbps)

Failing Item:

- FFC_2E07

2E07-202

Explanation: External link test failure without external wrap test (1Gbps)

Failing Item:

- FFC_2E07

2E08-101

Explanation: Failure to initialize due to a self-test failure

Failing Item:

- FFC_2E08

2E08-102

Explanation: Configuration register test failure

Failing Item:

- FFC_2E08

2E08-103

Explanation: EEPROM checksum error

Failing Item:

- FFC_2E08

2E08-104**Explanation:** Flash checksum error**Failing Item:**

- FFC_2E08
-

2E08-105**Explanation:** Internal loopback test failure**Failing Item:**

- FFC_2E08
-

2E08-106**Explanation:** Internal loopback - IP checksum test failure**Failing Item:**

- FFC_2E08
-

2E08-107**Explanation:** Internal loopback - TCP checksum test failure**Failing Item:**

- FFC_2E08
-

2E08-108**Explanation:** External loopback test failure**Failing Item:**

- FFC_2E08
-

2E08-109**Explanation:** External loopback - IP checksum test failure**Failing Item:**

- FFC_2E08
-

2E08-110**Explanation:** External loopback - TCP checksum test failure**Failing Item:**

- FFC_2E08
-

2E08-111**Explanation:** Failure to initialize due to a EEH failure**Failing Item:**

- FFC_2E08
 - FFC_221
-

2E08-201**Explanation:** External link test failure without external wrap test (10Gbps)**Failing Item:**

- FFC_2E08
-

2E08-202**Explanation:** External link test failure without external wrap test (1Gbps)**Failing Item:**

- FFC_2E08
-

2E0B-101**Explanation:** Failure to initialize due to a self-test failure**Failing Item:**

- FFC_2E0B
-

2E0B-102**Explanation:** Configuration register test failure**Failing Item:**

- FFC_2E0B
-

2E0B-103**Explanation:** EEPROM checksum error**Failing Item:**

- FFC_2E0B
-

2E0B-104**Explanation:** Flash checksum error**Failing Item:**

- FFC_2E0B
-

2E0B-105**Explanation:** Internal loopback test failure**Failing Item:**

- FFC_2E0B
-

2E0B-106**Explanation:** Internal loopback - IP checksum test failure**Failing Item:**

- FFC_2E0B
-

2E0B-107

Explanation: Internal loopback - TCP checksum test failure

Failing Item:

- FFC_2E0B

2E0B-108

Explanation: External loopback test failure

Failing Item:

- FFC_2E0B

2E0B-109

Explanation: External loopback - IP checksum test failure

Failing Item:

- FFC_2E0B

2E0B-110

Explanation: External loopback - TCP checksum test failure

Failing Item:

- FFC_2E0B

2E0B-111

Explanation: Failure to initialize due to a EEH failure

Failing Item:

- FFC_2E0B
- FFC_221

2E0B-201

Explanation: External link test failure without external wrap test (10Gbps)

Failing Item:

- FFC_2E0B

2E0B-202

Explanation: External link test failure without external wrap test (1Gbps)

Failing Item:

- FFC_2E0B

2E12-201

Explanation: Adapter configuration error.

Failing Item:

- FFC_2E12

- FFC_221

2E12-601

Explanation: Error log analysis indicates adapter failure.

Failing Item:

- FFC_2E12

2E12-602

Explanation: Error log analysis indicates an error attention condition.

Failing Item:

- FFC_2E12

2E12-603

Explanation: Error log analysis indicates that the microcode could not be loaded on the adapter.

Failing Item:

- FFC_2E12

2E12-604

Explanation: Error log analysis indicates a permanent adapter failure.

Failing Item:

- FFC_2E12

2E12-605

Explanation: Error log analysis indicates permanent adapter failure is reported on the other port of this adapter.

Failing Item:

- FFC_2E12

2E12-606

Explanation: Error log analysis indicates adapter failure.

Failing Item:

- FFC_2E12

2E12-701

Explanation: Error log analysis indicates permanent adapter failure.

Failing Item:

- FFC_2E12
- FFC_221

2E12-702

Explanation: Error log analysis indicates permanent adapter failure is reported on the other port of this adapter.

Failing Item:

- FFC_2E12
 - FFC_221
-

2E17-101

Explanation: Flash test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E17
-

2E17-102

Explanation: Interrupt test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E17
-

2E17-103

Explanation: Register test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E17
-

2E17-104

Explanation: External link test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E17
-

2E17-105

Explanation: DMA test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E17
-

2E17-106

Explanation: Internal parallel path wrap test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E17
-

2E17-107

Explanation: Internal serial path wrap test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E17
-

2E17-108

Explanation: External wrap test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E17
-

2E17-110

Explanation: EEH error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E17
-

2E17-201

Explanation: Adapter configuration error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E17
 - FFC_221
-

2E17-202

Explanation: Configuration register test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E17
 - FFC_221
-

2E17-203

Explanation: VPD test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E17
- FFC_221

2E17-601

Explanation: Error Log Analysis indicates adapter failure

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E17

2E17-602

Explanation: Error Log Analysis indicates an Error Attention condition

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E17

2E17-603

Explanation: Error Log Analysis indicates that the microcode could not be loaded on the adapter

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E17

2E17-604

Explanation: Error Log Analysis indicates a permanent adapter failure

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E17

2E17-605

Explanation: Error Log Analysis indicates permanent adapter failure is reported on the other port of this adapter.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E17

2E17-606

Explanation: Error Log Analysis indicates adapter failure

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E17

2E17-701

Explanation: Error Log Analysis indicates permanent adapter failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E17
- FFC_221

2E17-702

Explanation: Error Log Analysis indicates permanent adapter failure is reported on the other port of this adapter.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E17
- FFC_221

2E20-201

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E20
- FFC_221

2E20-601

Explanation: Error log analysis indicates adapter failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E20

2E20-602

Explanation: Error log analysis indicates an error attention condition.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E20
-

2E20-603

Explanation: Error log analysis indicates that the microcode could not be loaded on the adapter.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E20
-

2E20-604

Explanation: Error log analysis indicates a permanent adapter failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E20
-

2E20-605

Explanation: Error log analysis indicates permanent adapter failure is reported on the other port of this adapter.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E20
-

2E20-606

Explanation: Error log analysis indicates adapter failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E20
-

2E20-701

Explanation: Error log analysis indicates permanent adapter failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E20
 - FFC_221
-

2E20-702

Explanation: Error log analysis indicates permanent adapter failure is reported on the other port of this adapter.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E20
 - FFC_221
-

2E22-101

Explanation: Register Test Failure

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E22
-

2E22-102

Explanation: VPD Checksum Test Failure

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E22
-

2E22-103

Explanation: Flash Test Failure

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E22
-

2E22-104

Explanation: Internal Wrap Test Failure

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E22
-

2E22-105

Explanation: External Wrap Test Failure

Response: Use MAP0210 : General Problem Resolution

Failing Item:

2E22-106 • 2E24-601

- FFC_2E22

2E22-106

Explanation: External Wrap with IP Checksum Test Failure

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E22

2E22-107

Explanation: External Wrap with TCP Checksum Test Failure

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E22

2E22-108

Explanation: External Wrap with UDP Checksum Test Failure

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E22

2E22-109

Explanation: Network link test failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E22

2E22-201

Explanation: Enhanced Error Handling Failure

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E22

2E22-202

Explanation: Network link test failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E22

2E22-601

Explanation: Error log analysis indicates a hardware error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E22

2E22-602

Explanation: Error log analysis indicates an EEH error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E22

2E22-603

Explanation: Error log analysis indicates an EEPROM error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E22

2E22-604

Explanation: Error log analysis indicates transmission errors.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E22

2E24-201

Explanation: Adapter configuration error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E24
- FFC_221

2E24-601

Explanation: Adapter taken off-line.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E24

2E24-602**Explanation:** Adapter parity error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E24
-

2E24-603**Explanation:** Permanent adapter failure.**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E24
-

2E24-604**Explanation:** Adapter down error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E24
-

2E26-201**Explanation:** Adapter configuration error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E26
 - FFC_221
-

2E26-601**Explanation:** Adapter taken off-line.**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E26
-

2E26-602**Explanation:** Adapter parity error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E26
-

2E26-603**Explanation:** Permanent adapter failure.**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E26
-

2E26-604**Explanation:** Adapter down error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E26
-

2E30-111**Explanation:** Enhanced Error Handling failure on bus**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E30
-

2E30-112**Explanation:** Enhanced Error Handling failure while testing adapter**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E30
 - FFC_221
-

2E30-140**Explanation:** DMA read test failed**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E30
-

2E30-141**Explanation:** DMA write test failed**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E30
-

2E30-142

Explanation: DMA read-write test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E30

2E30-151

Explanation: Internal loopback test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E30

2E30-152

Explanation: Internal loopback IP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E30

2E30-153

Explanation: Internal loopback TCP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E30

2E30-154

Explanation: Internal loopback UDP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E30

2E30-155

Explanation: Internal loopback LSO test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E30

2E30-161

Explanation: External loopback test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E30

2E30-162

Explanation: External loopback IP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E30

2E30-163

Explanation: External loopback TCP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E30

2E30-164

Explanation: External loopback UDP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E30

2E30-165

Explanation: External loopback LSO test test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E30

2E30-201

Explanation: Registers test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E30
- FFC_221

2E30-701**Explanation:** Adapter hardware error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E30
-

2E30-702**Explanation:** EEH service error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E30
 - FFC_221
-

2E30-703**Explanation:** Failure to initialize due to a problem while reading the EEPROM on the adapter**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E30
-

2E31-111**Explanation:** Enhanced Error Handling failure on bus**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E31
-

2E31-112**Explanation:** Enhanced Error Handling failure while testing adapter**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E31
 - FFC_221
-

2E31-140**Explanation:** DMA read test failed**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E31
-

2E31-141**Explanation:** DMA write test failed**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E31
-

2E31-142**Explanation:** DMA read-write test failed**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E31
-

2E31-151**Explanation:** Internal loopback test failed**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E31
-

2E31-152**Explanation:** Internal loopback IP checksum offload test failed**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E31
-

2E31-153**Explanation:** Internal loopback TCP checksum offload test failed**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E31
-

2E31-154**Explanation:** Internal loopback UDP checksum offload test failed**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E31
-

2E31-155

Explanation: Internal loopback LSO test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E31
-

2E31-161

Explanation: External loopback test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E31
-

2E31-162

Explanation: External loopback IP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E31
-

2E31-163

Explanation: External loopback TCP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E31
-

2E31-164

Explanation: External loopback UDP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E31
-

2E31-165

Explanation: External loopback LSO test test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E31

2E31-201

Explanation: Registers test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E31
 - FFC_221
-

2E31-701

Explanation: Adapter hardware error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E31
-

2E31-702

Explanation: EEH service error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E31
 - FFC_221
-

2E31-703

Explanation: Failure to initialize due to a problem while reading the EEPROM on the adapter

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E31
-

2E38-111

Explanation: Enhanced Error Handling failure on bus

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E38
-

2E38-112

Explanation: Enhanced Error Handling failure while testing adapter

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E38
- FFC_221

2E38-140

Explanation: DMA read test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E38
-

2E38-141

Explanation: DMA write test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E38
-

2E38-142

Explanation: DMA read-write test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E38
-

2E38-151

Explanation: Internal loopback test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E38
-

2E38-152

Explanation: Internal loopback IP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E38
-

2E38-153

Explanation: Internal loopback TCP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E38
-

2E38-154

Explanation: Internal loopback UDP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E38
-

2E38-155

Explanation: Internal loopback LSO test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E38
-

2E38-161

Explanation: External loopback test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E38
-

2E38-162

Explanation: External loopback IP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E38
-

2E38-163

Explanation: External loopback TCP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E38
-

2E38-164

Explanation: External loopback UDP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E38
-

2E38-165

Explanation: External loopback LSO test test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E38
-

2E38-201

Explanation: Registers test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E38
 - FFC_221
-

2E38-701

Explanation: Adapter hardware error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E38
-

2E38-702

Explanation: EEH service error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E38
 - FFC_221
-

2E38-703

Explanation: Failure to initialize due to a problem while reading the EEPROM on the adapter

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E38
-

2E39-111

Explanation: Enhanced Error Handling failure on bus

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E39
-

2E39-112

Explanation: Enhanced Error Handling failure while testing adapter

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E39
 - FFC_221
-

2E39-140

Explanation: DMA read test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E39
-

2E39-141

Explanation: DMA write test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E39
-

2E39-142

Explanation: DMA read-write test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E39
-

2E39-151

Explanation: Internal loopback test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E39
-

2E39-152

Explanation: Internal loopback IP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E39
-

2E39-153

Explanation: Internal loopback TCP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E39
-

2E39-154

Explanation: Internal loopback UDP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E39
-

2E39-155

Explanation: Internal loopback LSO test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E39
-

2E39-161

Explanation: External loopback test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E39
-

2E39-162

Explanation: External loopback IP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E39
-

2E39-163

Explanation: External loopback TCP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E39
-

2E39-164

Explanation: External loopback UDP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E39
-

2E39-165

Explanation: External loopback LSO test test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E39
-

2E39-201

Explanation: Registers test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E39
 - FFC_221
-

2E39-701

Explanation: Adapter hardware error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E39
-

2E39-702

Explanation: EEH service error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E39
 - FFC_221
-

2E39-703

Explanation: Failure to initialize due to a problem while reading the EEPROM on the adapter

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E39
-

2E3B-111

Explanation: Enhanced Error Handling failure on bus

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E3B
-

2E3B-112

Explanation: Enhanced Error Handling failure while testing adapter

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E3B
 - FFC_221
-

2E3B-140

Explanation: DMA read test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E3B
-

2E3B-141

Explanation: DMA write test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E3B
-

2E3B-142

Explanation: DMA read-write test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E3B
-

2E3B-151

Explanation: Internal loopback test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E3B
-

2E3B-152

Explanation: Internal loopback IP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E3B
-

2E3B-153

Explanation: Internal loopback TCP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E3B
-

2E3B-154

Explanation: Internal loopback UDP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E3B
-

2E3B-155

Explanation: Internal loopback LSO test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E3B
-

2E3B-161

Explanation: External loopback test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E3B
-

2E3B-162

Explanation: External loopback IP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E3B
-

2E3B-163

Explanation: External loopback TCP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E3B
-

2E3B-164

Explanation: External loopback UDP checksum offload test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E3B
-

2E3B-165

Explanation: External loopback LSO test test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E3B
-

2E3B-201

Explanation: Registers test failed

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E3B
 - FFC_221
-

2E3B-701

Explanation: Adapter hardware error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E3B
-

2E3B-702

Explanation: EEH service error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E3B
 - FFC_221
-

2E3B-703

Explanation: Failure to initialize due to a problem while reading the EEPROM on the adapter

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E3B
-

2E41-101

Explanation: PCI Configuration Registers Test Failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E41
 - FFC_221
-

2E41-102

Explanation: I/O Registers Test Failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E41
-

2E41-103

Explanation: NVRAM and Checksum Verification Failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E41
-

2E41-104

Explanation: Adapter Memory Test Failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E41
-

2E41-111

Explanation: Internal Loopback Test Failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E41
-

2E41-121

Explanation: External Loopback Test Failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E41
-

2E41-201

Explanation: Adapter configuration error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E41
 - FFC_221
-

2E41-601

Explanation: Download firmware error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E41
-

2E41-602

Explanation: EEPROM read error.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E41
-

2E41-701

Explanation: Permanent adapter failure.

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E41
 - FFC_221
-

2E42-301

Explanation: Error Log Analysis indicates that this adapter has failed due to a hardware error.

Response: Use MAP0210 : General problem resolution

Failing Item:

- FFC_2E42
 - FFC_221
-

2E42-302

Explanation: EEH error.

Response: Use MAP0210 : General problem resolution

Failing Item:

- FFC_2E42
 - FFC_221
-

2E42-400

Explanation: Open Test failed.

Response: Use MAP0210 : General problem resolution

Failing Item:

- FFC_2E42
 - FFC_221
-

2E42-401

Explanation: Registers test failed.

Response: Use MAP0210 : General problem resolution

Failing Item:

- FFC_2E42
 - FFC_221
-

2E42-402

Explanation: Registers test failed.

Response: Use MAP0210 : General problem resolution

Failing Item:

- FFC_2E42
 - FFC_221
-

2E42-403

Explanation: Checksum Verification Test failed.

Response: Use MAP0210 : General problem resolution

Failing Item:

- FFC_2E42
 - FFC_221
-

2E42-404

Explanation: Memory Test failed.

Response: Use MAP0210 : General problem resolution

Failing Item:

- FFC_2E42
 - FFC_221
-

2E42-411

Explanation: Internal 10 Mbps test failed.

Response: Use MAP0210 : General problem resolution

Failing Item:

- FFC_2E42
 - FFC_221
-

2E42-412

Explanation: Internal 100 Mbps test failed.

Response: Use MAP0210 : General problem resolution

Failing Item:

- FFC_2E42
 - FFC_221
-

2E42-413

Explanation: Internal 1000 Mbps test failed.

Response: Use MAP0210 : General problem resolution

Failing Item:

- FFC_2E42
 - FFC_221
-

2E42-421

Explanation: External 10 Mbps test failed.

Response: Use MAP0210 : General problem resolution

Failing Item:

- FFC_2E42
 - FFC_221
-

2E42-422

Explanation: External 100 Mbps test failed.

Response: Use MAP0210 : General problem resolution

Failing Item:

- FFC_2E42
 - FFC_221
-

2E42-423

Explanation: External 1000 Mbps test failed.

Response: Use MAP0210 : General problem resolution

Failing Item:

- FFC_2E42
 - FFC_221
-

2E42-4FF

Explanation: Close Test failed.

Response: Use MAP0210 : General problem resolution

Failing Item:

- FFC_2E42
 - FFC_221
-

2E43-301

Explanation: Error Log Analysis indicates that this adapter has failed due to a hardware error.

Response: Use MAP0210 : General problem resolution

Failing Item:

- FFC_2E43
 - FFC_221
-

2E43-302

Explanation: EEH error.

Response: Use MAP0210 : General problem resolution

Failing Item:

- FFC_2E43
 - FFC_221
-

2E43-400

Explanation: Open Test failed.

Response: Use MAP0210 : General problem resolution

Failing Item:

- FFC_2E43
 - FFC_221
-

2E43-401

Explanation: Registers test failed.

Response: Use MAP0210 : General problem resolution

Failing Item:

- FFC_2E43
 - FFC_221
-

2E43-402

Explanation: Registers test failed.

Response: Use MAP0210 : General problem resolution

Failing Item:

- FFC_2E43
 - FFC_221
-

2E43-403

Explanation: Checksum Verification Test failed.

Response: Use MAP0210 : General problem resolution

Failing Item:

- FFC_2E43
- FFC_221

2E43-404

Explanation: Memory Test failed.

Response: Use MAP0210 : General problem resolution

Failing Item:

- FFC_2E43
- FFC_221

2E43-411

Explanation: Internal 10 Mbps test failed.

Response: Use MAP0210 : General problem resolution

Failing Item:

- FFC_2E43
- FFC_221

2E43-412

Explanation: Internal 100 Mbps test failed.

Response: Use MAP0210 : General problem resolution

Failing Item:

- FFC_2E43
- FFC_221

2E43-413

Explanation: Internal 1000 Mbps test failed.

Response: Use MAP0210 : General problem resolution

Failing Item:

- FFC_2E43
- FFC_221

2E43-421

Explanation: External 10 Mbps test failed.

Response: Use MAP0210 : General problem resolution

Failing Item:

- FFC_2E43
- FFC_221

2E43-422

Explanation: External 100 Mbps test failed.

Response: Use MAP0210 : General problem resolution

Failing Item:

- FFC_2E43
- FFC_221

2E43-423

Explanation: External 1000 Mbps test failed.

Response: Use MAP0210 : General problem resolution

Failing Item:

- FFC_2E43
- FFC_221

2E43-4FF

Explanation: Close Test failed.

Response: Use MAP0210 : General problem resolution

Failing Item:

- FFC_2E43
- FFC_221

2E54-101

Explanation: Configuration Register Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E54
- FFC_221

2E54-140

Explanation: DMA Read Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E54

2E54-141

Explanation: DMA Write Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E54
-

2E54-142

Explanation: DMA Read and Write Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E54
-

2E54-151

Explanation: Normal Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E54
-

2E54-152

Explanation: IP Checksum Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E54
-

2E54-153

Explanation: TCP Checksum Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E54
-

2E54-154

Explanation: UDP Checksum Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E54
-

2E54-155

Explanation: TSO Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E54
-

2E54-161

Explanation: Normal External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E54
-

2E54-162

Explanation: IP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E54
-

2E54-163

Explanation: TCP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E54
-

2E54-164

Explanation: UDP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E54
-

2E54-165

Explanation: TSO External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E54
-

2E54-605

Explanation: Ethernet hardware error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E54
-

2E54-606

Explanation: Ethernet configuration error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E54

2E54-607

Explanation: EEH error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E54

2E55-101

Explanation: Configuration Register Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E55
- FFC_221

2E55-140

Explanation: DMA Read Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E55

2E55-141

Explanation: DMA Write Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E55

2E55-142

Explanation: DMA Read and Write Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E55

2E55-151

Explanation: Normal Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E55

2E55-152

Explanation: IP Checksum Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E55

2E55-153

Explanation: TCP Checksum Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E55

2E55-154

Explanation: UDP Checksum Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E55

2E55-155

Explanation: TSO Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E55

2E55-161

Explanation: Normal External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E55
-

2E55-162

Explanation: IP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E55
-

2E55-163

Explanation: TCP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E55
-

2E55-164

Explanation: UDP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E55
-

2E55-165

Explanation: TSO External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E55
-

2E55-605

Explanation: Ethernet hardware error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E55
-

2E55-606

Explanation: Ethernet configuration error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E55
-

2E55-607

Explanation: EEH error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E55
-

2E56-101

Explanation: Configuration Register Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E56
 - FFC_221
-

2E56-140

Explanation: DMA Read Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E56
-

2E56-141

Explanation: DMA Write Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E56
-

2E56-142

Explanation: DMA Read and Write Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E56
-

2E56-151

Explanation: Normal Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E56
-

2E56-152

Explanation: IP Checksum Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E56
-

2E56-153

Explanation: TCP Checksum Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E56
-

2E56-154

Explanation: UDP Checksum Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E56
-

2E56-155

Explanation: TSO Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E56
-

2E56-161

Explanation: Normal External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E56
-

2E56-162

Explanation: IP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E56
-

2E56-163

Explanation: TCP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E56
-

2E56-164

Explanation: UDP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E56
-

2E56-165

Explanation: TSO External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E56
-

2E56-605

Explanation: Ethernet hardware error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E56
-

2E56-606

Explanation: Ethernet configuration error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E56
-

2E56-607

Explanation: EEH error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E56
-

2E57-101

Explanation: Configuration Register Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E57
 - FFC_221
-

2E57-140

Explanation: DMA Read Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E57
-

2E57-141

Explanation: DMA Write Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E57
-

2E57-142

Explanation: DMA Read and Write Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E57
-

2E57-151

Explanation: Normal Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E57
-

2E57-152

Explanation: IP Checksum Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E57
-

2E57-153

Explanation: TCP Checksum Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E57
-

2E57-154

Explanation: UDP Checksum Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E57
-

2E57-155

Explanation: TSO Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E57
-

2E57-161

Explanation: Normal External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E57
-

2E57-162

Explanation: IP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E57
-

2E57-163

Explanation: TCP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E57
-

2E57-164

Explanation: UDP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E57
-

2E57-165

Explanation: TSO External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E57
-

2E57-605

Explanation: Ethernet hardware error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E57
-

2E57-606

Explanation: Ethernet configuration error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E57
-

2E57-607

Explanation: EEH error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E57
-

2E58-101

Explanation: Configuration Register Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E58
 - FFC_221
-

2E58-140

Explanation: DMA Read Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E58
-

2E58-141

Explanation: DMA Write Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E58
-

2E58-142

Explanation: DMA Read and Write Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E58
-

2E58-151

Explanation: Normal Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E58
-

2E58-152

Explanation: IP Checksum Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E58
-

2E58-153

Explanation: TCP Checksum Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E58
-

2E58-154

Explanation: UDP Checksum Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E58
-

2E58-155

Explanation: TSO Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E58
-

2E58-161

Explanation: Normal External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E58
-

2E58-162

Explanation: IP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E58
-

2E58-163

Explanation: TCP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E58
-

2E58-164

Explanation: UDP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E58
-

2E58-165

Explanation: TSO External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E58
-

2E58-605

Explanation: Ethernet hardware error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E58
-

2E58-606

Explanation: Ethernet configuration error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E58
-

2E58-607

Explanation: EEH error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E58
-

2E59-101

Explanation: Configuration Register Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E59
 - FFC_221
-

2E59-161

Explanation: Normal External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E59
-

2E59-162

Explanation: IP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E59

2E59-163

Explanation: TCP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E59

2E59-164

Explanation: UDP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E59

2E59-165

Explanation: TSO External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E59

2E59-201

Explanation: Adapter configuration error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E59
- FFC_221

2E59-605

Explanation: Ethernet hardware error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E59

2E59-606

Explanation: Ethernet configuration error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E59

2E59-607

Explanation: EEH error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E59

2E5D-101

Explanation: Configuration Register Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E5D
- FFC_221

2E5D-161

Explanation: Normal External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E5D

2E5D-162

Explanation: IP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E5D

2E5D-163

Explanation: TCP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E5D

2E5D-164

Explanation: UDP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E5D
-

2E5D-165

Explanation: TSO External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E5D
-

2E5E-101

Explanation: Configuration Register Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E5E
 - FFC_221
-

2E5E-140

Explanation: DMA Read Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E5E
-

2E5E-141

Explanation: DMA Write Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E5E
-

2E5E-142

Explanation: DMA Read and Write Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E5E
-

2E5E-151

Explanation: Normal Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E5E
-

2E5E-152

Explanation: IP Checksum Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E5E
-

2E5E-153

Explanation: TCP Checksum Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E5E
-

2E5E-154

Explanation: UDP Checksum Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E5E
-

2E5E-155

Explanation: TSO Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E5E
-

2E5E-161

Explanation: Normal External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E5E
-

2E5E-162

Explanation: IP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E5E
-

2E5E-163

Explanation: TCP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E5E
-

2E5E-164

Explanation: UDP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E5E
-

2E5E-165

Explanation: TSO External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E5E
-

2E5E-605

Explanation: Ethernet hardware error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E5E
-

2E5E-606

Explanation: Ethernet configuration error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E5E
-

2E5E-607

Explanation: EEH error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E5E
-

2E60-101

Explanation: Configuration Register Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E60
 - FFC_221
-

2E60-161

Explanation: Normal External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E60
-

2E60-162

Explanation: IP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E60
-

2E60-163

Explanation: TCP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E60
-

2E60-164

Explanation: UDP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E60
-

2E60-165**Explanation:** TSO External Loopback Test error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E60
-

2E60-201**Explanation:** Adapter configuration error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E60
 - FFC_221
-

2E60-605**Explanation:** Ethernet hardware error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E60
-

2E60-606**Explanation:** Ethernet configuration error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E60
-

2E60-607**Explanation:** EEH error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E60
-

2E62-101**Explanation:** Configuration Register Test error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E62
 - FFC_221
-

2E62-161**Explanation:** Normal External Loopback Test error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E62
-

2E62-162**Explanation:** IP Checksum External Loopback Test error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E62
-

2E62-163**Explanation:** TCP Checksum External Loopback Test error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E62
-

2E62-164**Explanation:** UDP Checksum External Loopback Test error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E62
-

2E62-165**Explanation:** TSO External Loopback Test error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E62
-

2E63-101**Explanation:** Configuration Register Test error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E63
 - FFC_221
-

2E63-140

Explanation: DMA Read Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E63
-

2E63-141

Explanation: DMA Write Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E63
-

2E63-142

Explanation: DMA Read and Write Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E63
-

2E63-151

Explanation: Normal Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E63
-

2E63-152

Explanation: IP Checksum Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E63
-

2E63-153

Explanation: TCP Checksum Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E63
-

2E63-154

Explanation: UDP Checksum Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E63
-

2E63-155

Explanation: TSO Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E63
-

2E63-161

Explanation: Normal External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E63
-

2E63-162

Explanation: IP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E63
-

2E63-163

Explanation: TCP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E63
-

2E63-164

Explanation: UDP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E63

2E63-165**Explanation:** TSO External Loopback Test error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E63
-

2E63-605**Explanation:** Ethernet hardware error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E63
-

2E63-606**Explanation:** Ethernet configuration error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E63
-

2E63-607**Explanation:** EEH error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E63
-

2E70-201**Explanation:** Adapter configuration error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E70
 - FFC_221
-

2E72-201**Explanation:** Adapter configuration error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E72
 - FFC_221
-

2E80-101**Explanation:** Configuration Register Test error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E80
 - FFC_221
-

2E80-140**Explanation:** DMA Read Test error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E80
-

2E80-141**Explanation:** DMA Write Test error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E80
-

2E80-142**Explanation:** DMA Read and Write Test error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E80
-

2E80-151**Explanation:** Normal Internal Loopback Test error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E80
-

2E80-152**Explanation:** IP Checksum Internal Loopback Test error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E80
-

2E80-153

Explanation: TCP Checksum Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E80
-

2E80-154

Explanation: UDP Checksum Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E80
-

2E80-155

Explanation: TSO Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E80
-

2E80-161

Explanation: Normal External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E80
-

2E80-162

Explanation: IP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E80
-

2E80-163

Explanation: TCP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E80
-

2E80-164

Explanation: UDP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E80
-

2E80-165

Explanation: TSO External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E80
-

2E80-605

Explanation: Ethernet hardware error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E80
-

2E80-606

Explanation: Ethernet configuration error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E80
-

2E80-607

Explanation: EEH error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E80
-

2E81-101

Explanation: Configuration Register Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E81
 - FFC_221
-

2E81-161**Explanation:** Normal External Loopback Test error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E81
-

2E81-162**Explanation:** IP Checksum External Loopback Test error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E81
-

2E81-163**Explanation:** TCP Checksum External Loopback Test error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E81
-

2E81-164**Explanation:** UDP Checksum External Loopback Test error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E81
-

2E81-165**Explanation:** TSO External Loopback Test error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E81
-

2E82-101**Explanation:** Configuration Register Test error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E82
 - FFC_221
-

2E82-140**Explanation:** DMA Read Test error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E82
-

2E82-141**Explanation:** DMA Write Test error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E82
-

2E82-142**Explanation:** DMA Read and Write Test error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E82
-

2E82-151**Explanation:** Normal Internal Loopback Test error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E82
-

2E82-152**Explanation:** IP Checksum Internal Loopback Test error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E82
-

2E82-153**Explanation:** TCP Checksum Internal Loopback Test error**Response:** Use MAP0210 : General Problem Resolution**Failing Item:**

- FFC_2E82
-

2E82-154

Explanation: UDP Checksum Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E82
-

2E82-155

Explanation: TSO Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E82
-

2E82-161

Explanation: Normal External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E82
-

2E82-162

Explanation: IP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E82
-

2E82-163

Explanation: TCP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E82
-

2E82-164

Explanation: UDP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E82
-

2E82-165

Explanation: TSO External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E82
-

2E82-605

Explanation: Ethernet hardware error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E82
-

2E82-606

Explanation: Ethernet configuration error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E82
-

2E82-607

Explanation: EEH error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E82
-

2E83-101

Explanation: Configuration Register Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E83
 - FFC_221
-

2E83-161

Explanation: Normal External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E83
-

2E83-162

Explanation: IP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E83
-

2E83-163

Explanation: TCP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E83
-

2E83-164

Explanation: UDP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E83
-

2E83-165

Explanation: TSO External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E83
-

2E84-101

Explanation: Configuration Register Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E84
 - FFC_221
-

2E84-140

Explanation: DMA Read Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E84
-

2E84-141

Explanation: DMA Write Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E84
-

2E84-142

Explanation: DMA Read and Write Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E84
-

2E84-151

Explanation: Normal Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E84
-

2E84-152

Explanation: IP Checksum Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E84
-

2E84-153

Explanation: TCP Checksum Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E84
-

2E84-154

Explanation: UDP Checksum Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E84
-

2E84-155

Explanation: TSO Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E84

2E84-161

Explanation: Normal External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E84

2E84-162

Explanation: IP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E84

2E84-163

Explanation: TCP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E84

2E84-164

Explanation: UDP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E84

2E84-165

Explanation: TSO External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E84

2E84-605

Explanation: Ethernet hardware error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E84

2E84-606

Explanation: Ethernet configuration error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E84

2E84-607

Explanation: EEH error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E84

2E85-101

Explanation: Configuration Register Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E85
- FFC_221

2E85-161

Explanation: Normal External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E85

2E85-162

Explanation: IP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E85

2E85-163

Explanation: TCP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E85
-

2E85-164

Explanation: UDP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E85
-

2E85-165

Explanation: TSO External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E85
-

2E86-101

Explanation: Configuration Register Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E86
 - FFC_221
-

2E86-140

Explanation: DMA Read Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E86
-

2E86-141

Explanation: DMA Write Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E86
-

2E86-142

Explanation: DMA Read and Write Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E86
-

2E86-151

Explanation: Normal Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E86
-

2E86-152

Explanation: IP Checksum Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E86
-

2E86-153

Explanation: TCP Checksum Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E86
-

2E86-154

Explanation: UDP Checksum Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E86
-

2E86-155

Explanation: TSO Internal Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E86
-

2E86-161

Explanation: Normal External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E86

2E86-162

Explanation: IP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E86

2E86-163

Explanation: TCP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E86

2E86-164

Explanation: UDP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E86

2E86-165

Explanation: TSO External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E86

2E86-605

Explanation: Ethernet hardware error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E86

2E86-606

Explanation: Ethernet configuration error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E86

2E86-607

Explanation: EEH error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E86

2E87-101

Explanation: Configuration Register Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E87
- FFC_221

2E87-161

Explanation: Normal External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E87

2E87-162

Explanation: IP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E87

2E87-163

Explanation: TCP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E87
-

2E87-164

Explanation: UDP Checksum External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E87
-

2E87-165

Explanation: TSO External Loopback Test error

Response: Use MAP0210 : General Problem Resolution

Failing Item:

- FFC_2E87
-

300C0

Explanation: A disk drive module detected the loss of redundant power or cooling.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive.

301C0

Explanation: Multiple disk drive modules detected the loss of redundant power or cooling.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive.

303FE

Explanation: A disk drive Microcode Error was detected.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive and the User's Guide and Maintenance Information for the SSA adapter.

303FF

Explanation: An SCSI status that is not valid was received.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive and the User's Guide and Maintenance Information for the SSA adapter.

31000

Explanation: The disk drive was reset by the adapter. The disk drive might be going to fail.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive.

33PAA

Explanation: Excessive link reconfigurations were detected.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.
Note:

P denotes the adapter port number.

AA denotes the SSA address.

3000-1002

Explanation: There is not enough available spare space to re-establish full redundancy in a declustered array.

Response: Use MAP5001

40000

Explanation: The SSA adapter card failed.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

40004

Explanation: A module on the adapter card failed.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

40008

Explanation: A module on the adapter card failed.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

40016

Explanation: A module on the adapter card failed.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

40032

Explanation: A module on the adapter failed.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

40064

Explanation: A module on the adapter card failed.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

40128

Explanation: A module on the adapter card failed.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

41004

Explanation: A module on the adapter card failed.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

41008

Explanation: A module on the adapter card failed.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

41016

Explanation: A module on the adapter card failed.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

41032

Explanation: A module on the adapter failed.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

41064

Explanation: A module on the adapter card failed.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

41128

Explanation: A module on the adapter card failed.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

42000

Explanation: A module on the adapter card failed.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

42200

Explanation: Other adapters on the SSA loop are using levels of microcode that are not compatible.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

42500

Explanation: An SSA adapter detected a failure in its fast-write cache.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

42510

Explanation: Not enough DRAM available to run an SSA fast-write cache.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

42515

Explanation: An SSA adapter is attempting to use its fast-write cache, but a fast-write cache card is not installed.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

42520

Explanation: An SSA fast-write cache failure was detected.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

42521

Explanation: An SSA fast-write cache option card failure was detected.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

42522

Explanation: An SSA fast-write cache option card failure was detected.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

42523

Explanation: An incorrect version number was detected in the fast-write cache option card.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

42524

Explanation: A fast-write disk drive (or drives) contains unsynchronized data, but the fast-write cache option card cannot be detected.

Response: Refer to the SRN table in the User's Guide

and Maintenance Information for the SSA adapter.

42525

Explanation: A fast-write problem occurred.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

42526

Explanation: This adapter does not support the SSA Fast-Write Cache Option.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

42527

Explanation: A dormant SSA fast-write cache entry exists.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

42528

Explanation: A fast-write SSA disk drive has been detected that was previously unsynchronized, but has since been configured on a different adapter.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

42529

Explanation: The fast-write cache is disabled. The battery is charging.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

4252A

Explanation: The supply voltage to the fast-write cache option card is low. The card has switched to Self-Refresh mode.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

4252B

Explanation: The battery to the fast-write cache option card no longer has the power to maintain data.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

4252C

Explanation: The battery to the fast-write cache option card needs to be exchanged for a new one.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

42540

Explanation: Two-way fast-write cache is configured to operate only when both caches are available. One cache, however, is not available.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

43PAA

Explanation: An SSA device on the loop is preventing the completion of the loop configuration.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive or to the User's Guide and Maintenance Information for the SSA adapter. Note:

P denotes the adapter port number.

AA denotes the SSA address.

44PAA

Explanation: A disk drive module has a Failed status.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive or to the User's Guide and Maintenance Information for the SSA adapter. Note:

P denotes the adapter port number.

AA denotes the SSA address.

45PAA

Explanation: The SSA adapter has detected an open SSA loop.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive or to the User's Guide and Maintenance Information for the SSA adapter. Note:

P denotes the adapter port number.

AA denotes the SSA address.

46000

Explanation: A RAID array is in the Off-Line state because more than one disk drive is not available.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

46500

Explanation: A member disk drive is missing from a SSA array or the original SSA adapter is not available.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

47000

Explanation: An attempt was made to store in the SSA adapter the details of more than 32 RAID arrays.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

47500

Explanation: Part of the RAID array data might have been lost.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

48000

Explanation: The SSA adapter detected a link configuration that is not valid.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

48500

Explanation: The array filter detected a link configuration that is not valid.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

48600

Explanation: One member disk drive of an array is not on the SSA loop that contains the other member disk drives of the array.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

48700

Explanation: Two or more member disk drives of an SSA array are on different loops.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

48750

Explanation: An array is in the Off-Line state because the primary or secondary half of the array is not present.

Response: Refer to the SRN table in the User's Guide

and Maintenance Information for the SSA adapter.

48755

Explanation: The SSA adapter is unknown to the array.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

48760

Explanation: An array is in the Off-Line state because the split/join procedure was not performed correctly.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

48800

Explanation: The Invalid-Strip table is full.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

48900

Explanation: An SSA array is not available; a multiple-device error occurred.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

48950

Explanation: A disk drive caused an Array-Build operation to fail.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

49000

Explanation: A RAID array is in the Degraded state.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

49100

Explanation: A RAID array is in the Exposed state.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

49500

Explanation: No hot-spare disk drives are available for an array that is configured for hot-spare disk drives.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

49510

Explanation: Hot-spare configuration is not synchronized.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

49520

Explanation: Hot-spare tuning has been lost.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

49530

Explanation: The number of disk drives that remain in a hot-spare pool is less than the specified number.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

49540

Explanation: Adapters that do not support hot-spare pools were detected.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

49700

Explanation: The parity for the RAID array is not complete.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

49800

Explanation: A different adapter was detected on each loop.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

4A100

Explanation: The adapter cannot initialize an SSA disk drive.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

4BPAA

Explanation: An SSA disk drive at PAA cannot be configured, because its UID cannot be read.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.
Note:

P denotes the adapter port number.

AA denotes the SSA address.

50000

Explanation: The SSA adapter failed to respond to the device driver.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

50001

Explanation: A Data Parity error occurred.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

50002

Explanation: An SSA adapter DMA error occurred.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

50004

Explanation: A Channel Check occurred.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

50005

Explanation: A software error occurred.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

50006

Explanation: A Channel Check occurred.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

50007

Explanation: The IOCC detected an internal error.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

50008

Explanation: Unable to read or write the POS registers or PCI configuration space.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

50010

Explanation: An SSA adapter or device-driver protocol error occurred.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

50012

Explanation: The SSA adapter microcode hung.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

50013

Explanation: The SSA adapter card failed.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

50100

Explanation: An attempt was made to log an error against a pdisk that is not available to the using system.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

50200

Explanation: Duplicate SSA cluster number detected.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

50411

Explanation: SSA adapter detected a SS_SIC_CLASS1 error.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

50422

Explanation: SSA adapter detected a SS_TIMEOUT error.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

50425

Explanation: SSA adapter detected a SS_LINK_CONFIG_FAILED error.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

504XX

Explanation: The SSA adapter microcode hung.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

440-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_440
-

440-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_440
-

440-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_440
-

440-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_440
-

440-108

Explanation: The bus test failed.

Failing Item:

- FFC_440
-

440-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_440
-

440-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_440
-

440-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_440

440-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_440
-

440-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_440
-

440-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_440
 - FFC_B88
-

440-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_440
-

440-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_440
-

440-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_440
-

440-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_440
 - FFC_B88
-

440-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_440
 - SOFTWARE
-

440-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_440
 - SOFTWARE
-

440-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_440
-

440-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_440
-

440-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_440
-

440-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

440-135

Explanation: The device failed to configure.

Failing Item:

- FFC_440
 - FFC_B88
-

440-136 • 441-116

- SOFTWARE

440-136

Explanation: The certify operation failed.

Failing Item:

- FFC_440

440-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_440
- FFC_B88
- FFC_190

440-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_440

440-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_440

440-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

441-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_441

441-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_441

441-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_441

441-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_441

441-108

Explanation: The bus test failed.

Failing Item:

- FFC_441

441-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_441

441-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_441

441-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_441

441-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_441
-

441-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_441
-

441-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_441
 - FFC_B88
-

441-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_441
-

441-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_441
-

441-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_441
-

441-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_441
 - FFC_B88
-

441-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_441
 - SOFTWARE
-

441-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_441
 - SOFTWARE
-

441-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_441
-

441-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_441
-

441-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_441
-

441-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

441-135

Explanation: The device failed to configure.

Failing Item:

- FFC_441
 - FFC_B88
 - SOFTWARE
-

441-136

Explanation: The certify operation failed.

Failing Item:

- FFC_441
-

441-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_441
- FFC_B88
- FFC_190

441-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_441

441-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_441

441-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

442-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_442

442-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_442

442-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_442

442-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_442

442-108

Explanation: The bus test failed.

Failing Item:

- FFC_442

442-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_442

442-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_442

442-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_442

442-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_442

442-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_442

442-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_442
- FFC_B88

442-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_442
-

442-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_442
-

442-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_442
-

442-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_442
 - FFC_B88
-

442-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_442
 - SOFTWARE
-

442-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_442
 - SOFTWARE
-

442-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_442
-

442-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_442
-

442-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_442
-

442-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

442-135

Explanation: The device failed to configure.

Failing Item:

- FFC_442
 - FFC_B88
 - SOFTWARE
-

442-136

Explanation: The certify operation failed.

Failing Item:

- FFC_442
-

442-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_442
 - FFC_B88
 - FFC_190
-

442-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

442-140 • 443-124

- FFC_442

442-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_442

442-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

443-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_443

443-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_443

443-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_443

443-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_443

443-108

Explanation: The bus test failed.

Failing Item:

- FFC_443

443-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_443

443-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_443

443-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_443

443-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_443

443-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_443

443-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_443
- FFC_B88

443-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_443

443-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_443

443-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_443

443-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_443
 - FFC_B88
-

443-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_443
 - SOFTWARE
-

443-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_443
 - SOFTWARE
-

443-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_443
-

443-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_443
-

443-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_443
-

443-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

- SOFTWARE
-

443-135

Explanation: The device failed to configure.

Failing Item:

- FFC_443
 - FFC_B88
 - SOFTWARE
-

443-136

Explanation: The certify operation failed.

Failing Item:

- FFC_443
-

443-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_443
 - FFC_B88
 - FFC_190
-

443-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_443
-

443-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_443
-

443-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

444-101

Explanation: External wrap test failed on port 0.

Failing Item:

- FFC_2C3
- FFC_444

444-102

Explanation: External wrap test failed on port 1.

Failing Item:

- FFC_2C3
- FFC_444

444-103

Explanation: Enhanced error handling failure on bus.

Failing Item:

- FFC_227

444-104

Explanation: Enhanced error handling failure on Eads chip.

Failing Item:

- FFC_227

444-105

Explanation: Enhanced error handling failure on adapter.

Failing Item:

- FFC_444

444-106

Explanation: Enhanced error handling failure on bus.

Failing Item:

- FFC_776
- FFC_646

444-107

Explanation: EEH failure on Eads chip.

Failing Item:

- FFC_776
- FFC_646

444-108

Explanation: Enhanced error handling failure on adapter.

Failing Item:

- FFC_776
- FFC_646

444-201

Explanation: Internal adapter test failed.

Failing Item:

- FFC_444
- FFC_227

444-202

Explanation: External wrap test failed on port 0.

Failing Item:

- FFC_444
- FFC_227

444-203

Explanation: External wrap test failed on port 1.

Failing Item:

- FFC_444
- FFC_227

444-204

Explanation: External wrap test failed on port 0.

Failing Item:

- FFC_2C3
- FFC_444

444-205

Explanation: External wrap test failed on port 1.

Failing Item:

- FFC_2C3
- FFC_444

444-206

Explanation: External wrap test failed on port 0.

Failing Item:

- FFC_2C3
- FFC_444
- SOFTWARE

444-207

Explanation: External wrap test failed on port 1.

Failing Item:

- FFC_2C3
- FFC_444

- SOFTWARE

444-208

Explanation: Enhanced error handling failure opening the adapter.

Failing Item:

- FFC_444
- FFC_227

444-301

Explanation: Internal adapter test failed.

Failing Item:

- FFC_444
- FFC_227
- SOFTWARE

444-302

Explanation: External wrap test failed on port 0.

Failing Item:

- FFC_444
- FFC_227
- SOFTWARE

444-303

Explanation: External wrap test failed on port 1.

Failing Item:

- FFC_444
- FFC_227
- SOFTWARE

444-304

Explanation: External wrap test failed on port 0.

Failing Item:

- FFC_2C3
- FFC_444
- SOFTWARE

444-305

Explanation: External wrap test failed on port 1.

Failing Item:

- FFC_2C3
- FFC_444
- SOFTWARE

444-700

Explanation: Error log analysis indicates a hardware problem.

Failing Item:

- FFC_444
- SOFTWARE

444-701

Explanation: Error log analysis indicates that this adapter has failed to initialize due to enhanced error handling errors.

Failing Item:

- FFC_444
- FFC_227

446-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_446

446-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_446

446-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_446

446-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_446

446-108

Explanation: The bus test failed.

Failing Item:

- FFC_446

446-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_446

446-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_446
-

446-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_446
-

446-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_446
-

446-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_446
-

446-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_446
 - FFC_B88
-

446-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_446
-

446-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_446
-

446-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_446

446-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_446
 - FFC_B88
-

446-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_446
 - SOFTWARE
-

446-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_446
 - SOFTWARE
-

446-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_446
-

446-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_446
-

446-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_446
-

446-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88

- SOFTWARE

446-135

Explanation: The device failed to configure.

Failing Item:

- FFC_446
 - FFC_B88
 - SOFTWARE
-

446-136

Explanation: The certify operation failed.

Failing Item:

- FFC_446
-

446-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_446
 - FFC_B88
 - FFC_190
-

446-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_446
-

446-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_446
-

446-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

447-101

Explanation: The Fibre Channel Adapter configuration failed.

Failing Item:

- FFC_447
-

447-102

Explanation: The Reset test failed.

Failing Item:

- FFC_447
-

447-103

Explanation: The Register test failed.

Failing Item:

- FFC_447
-

447-104

Explanation: The SRAM test failed.

Failing Item:

- FFC_447
-

447-105

Explanation: The Internal Wrap test failed.

Failing Item:

- FFC_447
-

447-106

Explanation: Gigabaud Link Module (GLM) Wrap Test Failure.

Failing Item:

- FFC_447
-

447-107

Explanation: The External Wrap test failed.

Failing Item:

- FFC_447
-

447-109

Explanation: Enhanced Error Handling Failure on EADs chip.

Failing Item:

- FFC_221
-

447-110

Explanation: Enhanced Error Handling Failure on adapter.

Failing Item:

- FFC_447
-

447-201

Explanation: The Configuration Register test failed.

Failing Item:

- FFC_447
 - FFC_221
-

447-202

Explanation: The Interrupt test failed.

Failing Item:

- FFC_447
 - FFC_221
-

447-203

Explanation: The PCI Wrap test failed.

Failing Item:

- FFC_447
 - FFC_221
-

447-204

Explanation: The DMA test failed.

Failing Item:

- FFC_447
 - FFC_221
-

447-205

Explanation: I/O error on a read/write operation.

Failing Item:

- FFC_447
 - FFC_221
-

447-701

Explanation: Error log analysis indicates that an error has occurred with the adapter.

Failing Item:

- FFC_447
 - FFC_221
-

447-703

Explanation: Error log analysis indicates that an unknown adapter error has occurred.

Failing Item:

- FFC_447
-

447-704

Explanation: Error log analysis indicates that an adapter error has occurred.

Failing Item:

- FFC_447
-

447-705

Explanation: A parity error has been detected. The adapter must be replaced immediately. Failure to do so could result in data being read or written incorrectly.

Failing Item:

- FFC_447
-

447-706

Explanation: A fatal hardware error has occurred. This adapter was successfully taken offline. It will remain offline until reconfigured or the system is rebooted. This adapter must be replaced and not brought back online. Failure to adhere to this action could result in data being read or written incorrectly or in the loss of data.

Failing Item:

- FFC_447
-

451-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_451
-

451-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_451
-

451-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_451
-

451-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_451
-

451-108

Explanation: The bus test failed.

Failing Item:

- FFC_451
-

451-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_451
-

451-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_451
-

451-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_451
-

451-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_451
-

451-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_451
-

451-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_451
 - FFC_B88
-

451-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_451
-

451-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_451
-

451-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_451
-

451-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_451
 - FFC_B88
-

451-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_451
 - SOFTWARE
-

451-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_451
 - SOFTWARE
-

451-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_451

451-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_451
-

451-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_451
-

451-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

451-135

Explanation: The device failed to configure.

Failing Item:

- FFC_451
 - FFC_B88
 - SOFTWARE
-

451-136

Explanation: The certify operation failed.

Failing Item:

- FFC_451
-

451-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_451
 - FFC_B88
 - FFC_190
-

451-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_451
-

451-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_451
-

451-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

453-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_453
-

453-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_453
-

453-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_453
-

453-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_453
-

453-108

Explanation: The bus test failed.

Failing Item:

- FFC_453
-

453-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_453

453-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_453
-

453-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_453
-

453-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_453
-

453-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_453
-

453-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_453
 - FFC_B88
-

453-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_453
-

453-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_453
-

453-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_453
-

453-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_453
 - FFC_B88
-

453-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_453
 - SOFTWARE
-

453-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_453
 - SOFTWARE
-

453-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_453
-

453-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_453
-

453-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_453
-

453-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

- SOFTWARE

453-135

Explanation: The device failed to configure.

Failing Item:

- FFC_453
- FFC_B88
- SOFTWARE

453-136

Explanation: The certify operation failed.

Failing Item:

- FFC_453

453-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_453
- FFC_B88
- FFC_190

453-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_453

453-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_453

453-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

458-110

Explanation: The Reserve command failed.

Failing Item:

- FFC_458

458-120

Explanation: The Inquiry command failed.

Failing Item:

- FFC_458

458-130

Explanation: The Load command failed.

Failing Item:

- FFC_458
- MEDIA

458-135

Explanation: The Unload command failed.

Failing Item:

- FFC_458
- MEDIA

458-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_458

458-150

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_458
- MEDIA

458-160

Explanation: The Send Diagnostic command failed.

Failing Item:

- FFC_458
- MEDIA

458-169

Explanation: The Send Diagnostic command failed.

Failing Item:

- FFC_458
- MEDIA

458-170

Explanation: The Read, Write and Compare test failed.

Failing Item:

- FFC_458
 - FFC_B88
 - MEDIA
-

458-180

Explanation: The Load command failed.

Failing Item:

- FFC_458
 - MEDIA
-

458-185

Explanation: The Unload command failed.

Failing Item:

- FFC_458
 - MEDIA
-

458-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_458
-

458-200

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_458
 - MEDIA
-

458-210

Explanation: The device configuration failed.

Failing Item:

- FFC_458
 - FFC_B88
-

458-220

Explanation: The Release command failed.

Failing Item:

- FFC_458
-

458-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_458
-

458-240

Explanation: The Openx command failed.

Failing Item:

- FFC_458
-

458-300

Explanation: The device configuration failed.

Failing Item:

- FFC_458
 - SOFTWARE
-

458-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
 - FFC_458
 - SOFTWARE
-

458-320

Explanation: Error log analysis indicates a failure.

Failing Item:

- FFC_458
 - MEDIA
-

458-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_458
- FFC_B88
- SOFTWARE

458-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_458
- FFC_B88
- SOFTWARE

458-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_458
- FFC_B88
- SOFTWARE

458-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_458
- FFC_B88
- SOFTWARE

458-417

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_458
- FFC_B88
- SOFTWARE

458-418

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_458
- FFC_B88
- SOFTWARE

458-419

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_458
- FFC_B88
- SOFTWARE

458-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_458
- FFC_B88
- SOFTWARE

458-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_458
- FFC_B88
- SOFTWARE

458-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_458
- FFC_B88
- SOFTWARE

458-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_458
- FFC_B88
- SOFTWARE

458-511

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_458
 - FFC_B88
-

458-512

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_458
 - FFC_B88
-

458-513

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_458
 - FFC_B88
-

458-514

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_458
 - FFC_B88
-

458-515

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_458
 - FFC_B88
-

458-516

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_458
 - FFC_B88
-

458-517

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_458
 - FFC_B88
-

458-518

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_458
 - FFC_B88
-

458-519

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_458
 - FFC_B88
-

458-520

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_458
 - FFC_B88
-

458-521

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_458
 - FFC_B88
-

458-522

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_458
 - FFC_B88
-

458-523

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_458
 - FFC_B88
-

458-611

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-612

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_458
- FFC_B88
- SOFTWARE

458-613

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_458
- FFC_B88
- SOFTWARE

458-614

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_458
- FFC_B88
- SOFTWARE

458-615

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_458
- FFC_B88
- SOFTWARE

458-616

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_458
- FFC_B88
- SOFTWARE

458-617

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_458
- FFC_B88
- SOFTWARE

458-618

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_458
- FFC_B88
- SOFTWARE

458-619

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_458
- FFC_B88
- SOFTWARE

458-620

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_458
- FFC_B88
- SOFTWARE

458-621

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_458
- FFC_B88
- SOFTWARE

458-622

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_458
- FFC_B88
- SOFTWARE

458-623

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-711

Explanation: A device timeout error occurred.

Failing Item:

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-712

Explanation: A device timeout error occurred.

Failing Item:

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-713

Explanation: A device timeout error occurred.

Failing Item:

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-714

Explanation: A device timeout error occurred.

Failing Item:

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-715

Explanation: A device timeout error occurred.

Failing Item:

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-716

Explanation: A device timeout error occurred.

Failing Item:

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-717

Explanation: A device timeout error occurred.

Failing Item:

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-718

Explanation: A device timeout error occurred.

Failing Item:

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-719

Explanation: A device timeout error occurred.

Failing Item:

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-720

Explanation: A device timeout error occurred.

Failing Item:

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-721

Explanation: A device timeout error occurred.

Failing Item:

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-722

Explanation: A device timeout error occurred.

Failing Item:

- FFC_458
 - FFC_B88
 - SOFTWARE
-

458-723

Explanation: A device timeout error occurred.

Failing Item:

- FFC_458
- FFC_B88
- SOFTWARE

459-110

Explanation: The Reserve command failed.

Failing Item:

- FFC_459

459-120

Explanation: The Inquiry command failed.

Failing Item:

- FFC_459

459-130

Explanation: The Load command failed.

Failing Item:

- FFC_459
- MEDIA

459-135

Explanation: The Unload command failed.

Failing Item:

- FFC_459
- MEDIA

459-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_459

459-150

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_459
- MEDIA

459-160

Explanation: The Send Diagnostic command failed.

Failing Item:

- FFC_459

- MEDIA

459-169

Explanation: The Send Diagnostic command failed.

Failing Item:

- FFC_459
- MEDIA

459-170

Explanation: The Read, Write and Compare test failed.

Failing Item:

- FFC_459
- FFC_B88
- MEDIA

459-180

Explanation: The Load command failed.

Failing Item:

- FFC_459
- MEDIA

459-185

Explanation: The Unload command failed.

Failing Item:

- FFC_459
- MEDIA

459-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_459

459-200

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_459
- MEDIA

459-210

Explanation: The device configuration failed.

Failing Item:

- FFC_459
- FFC_B88

459-220

Explanation: The Release command failed.

Failing Item:

- FFC_459
-

459-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_459
-

459-240

Explanation: The Openx command failed.

Failing Item:

- FFC_459
-

459-300

Explanation: The device configuration failed.

Failing Item:

- FFC_459
 - SOFTWARE
-

459-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
 - FFC_459
 - SOFTWARE
-

459-320

Explanation: Error log analysis indicates a failure.

Failing Item:

- FFC_459
 - MEDIA
-

459-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-417

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-418

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_459
- FFC_B88
- SOFTWARE

459-419

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_459
- FFC_B88
- SOFTWARE

459-41A

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_459
- FFC_B88
- SOFTWARE

459-41B

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_459
- FFC_B88
- SOFTWARE

459-41C

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_459
- FFC_B88
- SOFTWARE

459-41D

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_459
- FFC_B88
- SOFTWARE

459-41E

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_459
- FFC_B88
- SOFTWARE

459-41F

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_459
- FFC_B88
- SOFTWARE

459-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_459
- FFC_B88
- SOFTWARE

459-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_459
- FFC_B88
- SOFTWARE

459-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_459
- FFC_B88
- SOFTWARE

459-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-511

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_459
 - FFC_B88
-

459-512

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_459
 - FFC_B88
-

459-513

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_459
 - FFC_B88
-

459-514

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_459
 - FFC_B88
-

459-515

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_459
 - FFC_B88
-

459-516

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_459
 - FFC_B88
-

459-517

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_459
 - FFC_B88
-

459-518

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_459
 - FFC_B88
-

459-519

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_459
 - FFC_B88
-

459-520

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_459
 - FFC_B88
-

459-521

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_459
 - FFC_B88
-

459-522

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_459
 - FFC_B88
-

459-523

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_459
 - FFC_B88
-

459-611

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_459
- FFC_B88
- SOFTWARE

459-612

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_459
- FFC_B88
- SOFTWARE

459-613

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_459
- FFC_B88
- SOFTWARE

459-614

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_459
- FFC_B88
- SOFTWARE

459-615

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_459
- FFC_B88
- SOFTWARE

459-616

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_459
- FFC_B88
- SOFTWARE

459-617

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_459
- FFC_B88
- SOFTWARE

459-618

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_459
- FFC_B88
- SOFTWARE

459-619

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_459
- FFC_B88
- SOFTWARE

459-620

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_459
- FFC_B88
- SOFTWARE

459-621

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_459
- FFC_B88
- SOFTWARE

459-622

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-623

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-711

Explanation: A device timeout error occurred.

Failing Item:

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-712

Explanation: A device timeout error occurred.

Failing Item:

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-713

Explanation: A device timeout error occurred.

Failing Item:

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-714

Explanation: A device timeout error occurred.

Failing Item:

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-715

Explanation: A device timeout error occurred.

Failing Item:

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-716

Explanation: A device timeout error occurred.

Failing Item:

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-717

Explanation: A device timeout error occurred.

Failing Item:

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-718

Explanation: A device timeout error occurred.

Failing Item:

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-719

Explanation: A device timeout error occurred.

Failing Item:

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-720

Explanation: A device timeout error occurred.

Failing Item:

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-721

Explanation: A device timeout error occurred.

Failing Item:

- FFC_459
 - FFC_B88
 - SOFTWARE
-

459-722

Explanation: A device timeout error occurred.

Failing Item:

- FFC_459
- FFC_B88
- SOFTWARE

459-723

Explanation: A device timeout error occurred.

Failing Item:

- FFC_459
- FFC_B88
- SOFTWARE

541-XXX

Explanation: A DLT tape device problem has occurred.

Response: Refer to the DLT tape device documentation.

Failing Item:

- FFC_541

542-XXX

Explanation: An 8mm 60GB tape device problem has occurred.

Response: Refer to the 8mm 60GB tape device documentation.

Failing Item:

- FFC_542

56B-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_56B

56B-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_56B

56B-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_56B

56B-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_56B

56B-108

Explanation: The bus test failed.

Failing Item:

- FFC_56B

56B-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_56B

56B-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_56B

56B-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_56B

56B-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_56B

56B-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_56B

56B-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_56B
- FFC_B88

56B-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_56B
-

56B-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_56B
-

56B-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_56B
-

56B-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_56B
 - FFC_B88
-

56B-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_56B
 - SOFTWARE
-

56B-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_56B
 - SOFTWARE
-

56B-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_56B
-

56B-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_56B
-

56B-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_56B
-

56B-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

56B-135

Explanation: The device failed to configure.

Failing Item:

- FFC_56B
 - FFC_B88
 - SOFTWARE
-

56B-136

Explanation: The certify operation failed.

Failing Item:

- FFC_56B
-

56B-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_56B
 - FFC_B88
 - FFC_190
-

56B-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

56B-140 • 56D-124

- FFC_56B

56B-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_56B

56B-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

56D-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_56D

56D-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_56D

56D-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_56D

56D-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_440

56D-108

Explanation: The bus test failed.

Failing Item:

- FFC_56D

56D-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_56D

56D-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_56D

56D-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_56D

56D-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_56D

56D-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_56D

56D-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_56D
- FFC_B88

56D-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_56D

56D-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_56D

56D-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_56D

56D-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_56D
 - FFC_B88
-

56D-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_56D
 - SOFTWARE
-

56D-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_56D
 - SOFTWARE
-

56D-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_56D
-

56D-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_56D
-

56D-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_56D
-

56D-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

- SOFTWARE
-

56D-135

Explanation: The device failed to configure.

Failing Item:

- FFC_56D
 - FFC_B88
 - SOFTWARE
-

56D-136

Explanation: The certify operation failed.

Failing Item:

- FFC_56D
-

56D-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_56D
 - FFC_B88
 - FFC_190
-

56D-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_56D
-

56D-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_56D
-

56D-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

57B-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_57B
-

57B-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_57B
-

57B-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_57B
-

57B-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_57B
-

57B-108

Explanation: The bus test failed.

Failing Item:

- FFC_57B
-

57B-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_57B
-

57B-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_57B
-

57B-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_57B
-

57B-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_57B
-

57B-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_57B
-

57B-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_57B
 - FFC_B88
-

57B-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_57B
-

57B-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_57B
-

57B-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_57B
-

57B-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_57B
 - FFC_B88
-

57B-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_57B
- SOFTWARE

57B-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_57B
 - SOFTWARE
-

57B-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_57B
-

57B-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_57B
-

57B-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_57B
-

57B-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

57B-135

Explanation: The device failed to configure.

Failing Item:

- FFC_57B
 - FFC_B88
 - SOFTWARE
-

57B-136

Explanation: The certify operation failed.

Failing Item:

- FFC_57B
-

57B-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_57B
 - FFC_B88
 - FFC_190
-

57B-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_57B
-

57B-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_57B
-

57B-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

57D-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_57D
-

57D-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_57D
-

57D-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_57D
-

57D-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_57D
-

57D-108

Explanation: The bus test failed.

Failing Item:

- FFC_57D
-

57D-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_57D
-

57D-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_57D
-

57D-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_57D
-

57D-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_57D
-

57D-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_57D
-

57D-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_57D
 - FFC_B88
-

57D-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_57D
-

57D-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_57D
-

57D-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_57D
-

57D-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_57D
 - FFC_B88
-

57D-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_57D
 - SOFTWARE
-

57D-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_57D
 - SOFTWARE
-

57D-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_57D
-

57D-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_57D
-

57D-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_57D
-

57D-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

57D-135

Explanation: The device failed to configure.

Failing Item:

- FFC_57D
 - FFC_B88
 - SOFTWARE
-

57D-136

Explanation: The certify operation failed.

Failing Item:

- FFC_57D
-

57D-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_57D
 - FFC_B88
 - FFC_190
-

57D-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_57D
-

57D-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_57D
-

57D-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

58B-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_58B
-

58B-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_58B
-

58B-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_58B
-

58B-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_58B
-

58B-108

Explanation: The bus test failed.

Failing Item:

- FFC_58B
-

58B-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_58B

58B-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_58B
-

58B-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_58B
-

58B-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_58B
-

58B-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_58B
-

58B-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_58B
 - FFC_B88
-

58B-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_58B
-

58B-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_58B
-

58B-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_58B

58B-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_58B
 - FFC_B88
-

58B-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_58B
 - SOFTWARE
-

58B-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_58B
 - SOFTWARE
-

58B-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_58B
-

58B-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_58B
-

58B-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_58B
-

58B-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88

- SOFTWARE

58B-135

Explanation: The device failed to configure.

Failing Item:

- FFC_58B
 - FFC_B88
 - SOFTWARE
-

58B-136

Explanation: The certify operation failed.

Failing Item:

- FFC_58B
-

58B-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_58B
 - FFC_B88
 - FFC_190
-

58B-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_58B
-

58B-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_58B
-

58B-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

58D-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_58D
-

58D-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_58D
-

58D-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_58D
-

58D-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_58D
-

58D-108

Explanation: The bus test failed.

Failing Item:

- FFC_58D
-

58D-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_58D
-

58D-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_58D
-

58D-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_58D
-

58D-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

58D-117 • 58D-136

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_58D
-

58D-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_58D
-

58D-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_58D
 - FFC_B88
-

58D-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_58D
-

58D-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_58D
-

58D-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_58D
-

58D-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_58D
 - FFC_B88
-

58D-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_58D
 - SOFTWARE
-

58D-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_58D
 - SOFTWARE
-

58D-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_58D
-

58D-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_58D
-

58D-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_58D
-

58D-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

58D-135

Explanation: The device failed to configure.

Failing Item:

- FFC_58D
 - FFC_B88
 - SOFTWARE
-

58D-136

Explanation: The certify operation failed.

Failing Item:

- FFC_58D
-

58D-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_58D
 - FFC_B88
 - FFC_190
-

58D-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_58D
-

58D-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_58D
-

58D-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

59B-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_59B
-

59B-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_59B
-

59B-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_59B

59B-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_59B
-

59B-108

Explanation: The bus test failed.

Failing Item:

- FFC_59B
-

59B-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_59B
-

59B-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_59B
-

59B-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_59B
-

59B-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_59B
-

59B-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_59B
-

59B-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_59B
- FFC_B88

59B-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_59B
-

59B-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_59B
-

59B-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_59B
-

59B-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_59B
 - FFC_B88
-

59B-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_59B
 - SOFTWARE
-

59B-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_59B
 - SOFTWARE
-

59B-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_59B

59B-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_59B
-

59B-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_59B
-

59B-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

59B-135

Explanation: The device failed to configure.

Failing Item:

- FFC_59B
 - FFC_B88
 - SOFTWARE
-

59B-136

Explanation: The certify operation failed.

Failing Item:

- FFC_59B
-

59B-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_59B
 - FFC_B88
 - FFC_190
-

59B-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_59B

59B-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_59B

59B-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

59D-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_59D

59D-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_59D

59D-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_59D

59D-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_59D

59D-108

Explanation: The bus test failed.

Failing Item:

- FFC_59D

59D-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_59D

59D-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_59D

59D-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_59D

59D-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_59D

59D-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_59D

59D-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_59D
- FFC_B88

59D-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_59D

59D-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_59D

59D-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_59D

59D-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_59D
- FFC_B88

59D-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_59D
- SOFTWARE

59D-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_59D
- SOFTWARE

59D-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_59D

59D-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_59D

59D-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_59D

59D-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88

- SOFTWARE

59D-135

Explanation: The device failed to configure.

Failing Item:

- FFC_59D
- FFC_B88
- SOFTWARE

59D-136

Explanation: The certify operation failed.

Failing Item:

- FFC_59D

59D-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_59D
- FFC_B88
- FFC_190

59D-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_59D

59D-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_59D

59D-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

60000

Explanation: The SSA adapter is missing from the expected configuration.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

60200

Explanation: The SSA unit cannot be turned on.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter or if the system service guide contains integrated SSA (without a distinct model type from the system unit itself), use the SRN table in the system unit's service guide to find this SRN and do the action indicated there.

60210

Explanation: A disk drive module has its Check light On.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter or if the system service guide contains integrated SSA (without a distinct model type from the system unit itself), use the SRN table in the system unit's service guide to find this SRN and do the action indicated there.

60220

Explanation: A fan-and-power-supply assembly has its Check light On.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter or if the system service guide contains integrated SSA (without a distinct model type from the system unit itself), use the SRN table in the system unit's service guide to find this SRN and do the action indicated there.

60230

Explanation: The SSA unit has an unexpected Check light On.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter or if the system service guide contains integrated SSA (without a distinct model type from the system unit itself), use the SRN table in the system unit's service guide to find this SRN and do the action indicated there.

60240

Explanation: An SSA configuration problem occurred.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter or if the system service guide contains integrated SSA (without a distinct model type from the system unit itself), use the SRN table in the system unit's service guide to find this SRN and do the action indicated there.

7XXXX

Explanation: An SSA disk drive is missing from the expected configuration of the SSA loop.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive and to the User's Guide and Maintenance Information for the SSA adapter. Note: In this SRN, an x represents a digit 0 through F.

601-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_601
-

601-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_601
-

601-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_601
-

601-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_601
-

601-108

Explanation: The bus test failed.

Failing Item:

- FFC_601
-

601-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_601
-

601-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_601
-

601-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_601
-

601-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_601
-

601-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_601
-

601-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_601
 - FFC_B88
-

601-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_601
-

601-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_601
-

601-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_601
-

601-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_601
 - FFC_B88
-

601-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_601
 - SOFTWARE
-

601-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_601
 - SOFTWARE
-

601-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_601
-

601-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_601
-

601-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_601
-

601-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

601-135

Explanation: The device failed to configure.

Failing Item:

- FFC_601
 - FFC_B88
 - SOFTWARE
-

601-136

Explanation: The certify operation failed.

Failing Item:

- FFC_601
-

601-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_601
 - FFC_B88
 - FFC_190
-

601-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_601
-

601-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_601
-

601-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

60B-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_60B
-

60B-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_60B
-

60B-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_60B
-

60B-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_60B
-

60B-108

Explanation: The bus test failed.

Failing Item:

- FFC_60B
-

60B-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_60B
-

60B-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_60B
-

60B-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_60B
-

60B-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_60B

60B-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_60B

60B-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_60B
- FFC_B88

60B-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_60B

60B-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_60B

60B-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_60B

60B-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_60B
- FFC_B88

60B-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_60B
- SOFTWARE

60B-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_60B
- SOFTWARE

60B-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_60B

60B-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_60B

60B-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_60B

60B-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

60B-135

Explanation: The device failed to configure.

Failing Item:

- FFC_60B
- FFC_B88

- SOFTWARE

60B-136

Explanation: The certify operation failed.

Failing Item:

- FFC_60B

60B-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_60B
- FFC_B88
- FFC_190

60B-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_60B

60B-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_60B

60B-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

613-XXX

Explanation: An 8-mm 80-GB VXA-2 tape device problem has occurred.

Failing Item:

- FFC_613

61B-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_61B

61B-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_61B

61B-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_61B

61B-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_61B

61B-108

Explanation: The bus test failed.

Failing Item:

- FFC_61B

61B-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_61B

61B-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_61B

61B-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_61B

61B-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

61B-117 • 61B-136

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_61B
-

61B-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_61B
-

61B-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_61B
 - FFC_B88
-

61B-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_61B
-

61B-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_61B
-

61B-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_61B
-

61B-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_61B
 - FFC_B88
-

61B-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_61B
 - SOFTWARE
-

61B-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_61B
 - SOFTWARE
-

61B-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_61B
-

61B-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_61B
-

61B-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_61B
-

61B-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

61B-135

Explanation: The device failed to configure.

Failing Item:

- FFC_61B
 - FFC_B88
 - SOFTWARE
-

61B-136

Explanation: The certify operation failed.

Failing Item:

- FFC_61B
-

61B-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_61B
 - FFC_B88
 - FFC_190
-

61B-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_61B
-

61B-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_61B
-

61B-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

61D-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_61D
-

61D-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_61D
-

61D-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_61D
-

61D-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_61D
-

61D-108

Explanation: The bus test failed.

Failing Item:

- FFC_61D
-

61D-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_61D
-

61D-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_61D
-

61D-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_61D
-

61D-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_61D
-

61D-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_61D
-

61D-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_61D
 - FFC_B88
-

61D-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_61D
-

61D-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_61D
-

61D-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_61D
-

61D-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_61D
 - FFC_B88
-

61D-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_61D
 - SOFTWARE
-

61D-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_61D
 - SOFTWARE
-

61D-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_61D
-

61D-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_61D
-

61D-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_61D
-

61D-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

61D-135

Explanation: The device failed to configure.

Failing Item:

- FFC_61D
 - FFC_B88
 - SOFTWARE
-

61D-136

Explanation: The certify operation failed.

Failing Item:

- FFC_61D
-

61D-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_61D
 - FFC_B88
 - FFC_190
-

61D-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_61D

61D-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_61D

61D-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

61E-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_61E

61E-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_61E

61E-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_61E

61E-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_61E

61E-108

Explanation: The bus test failed.

Failing Item:

- FFC_61E

61E-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_61E

61E-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_61E

61E-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_61E

61E-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_61E

61E-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_61E

61E-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_61E
- FFC_B88

61E-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_61E

61E-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_61E

61E-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_61E

61E-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_61E
- FFC_B88

61E-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_61E
- SOFTWARE

61E-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_61E
- SOFTWARE

61E-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_61E

61E-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_61E

61E-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_61E

61E-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88

- SOFTWARE

61E-135

Explanation: The device failed to configure.

Failing Item:

- FFC_61E
- FFC_B88
- SOFTWARE

61E-136

Explanation: The certify operation failed.

Failing Item:

- FFC_61E

61E-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_61E
- FFC_B88
- FFC_190

61E-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_61E

61E-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_61E

61E-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

621-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_621
-

621-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_621
-

621-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_621
-

621-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_621
-

621-108

Explanation: The bus test failed.

Failing Item:

- FFC_621
-

621-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_621
-

621-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_621
-

621-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_621
-

621-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_621
-

621-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_621
-

621-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_621
 - FFC_B88
-

621-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_621
-

621-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_621
-

621-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_621
-

621-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_621
 - FFC_B88
-

621-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_621
- SOFTWARE

621-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_621
 - SOFTWARE
-

621-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_621
-

621-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_621
-

621-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_621
-

621-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

621-135

Explanation: The device failed to configure.

Failing Item:

- FFC_621
 - FFC_B88
 - SOFTWARE
-

621-136

Explanation: The certify operation failed.

Failing Item:

- FFC_621
-

621-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_621
 - FFC_B88
 - FFC_190
-

621-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_621
-

621-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_621
-

621-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

623-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_623
-

623-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_623
-

623-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_623
-

623-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_623
-

623-108

Explanation: The bus test failed.

Failing Item:

- FFC_623
-

623-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_623
-

623-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_623
-

623-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_623
-

623-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_623
-

623-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_623
-

623-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_623
 - FFC_B88
-

623-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_623
-

623-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_623
-

623-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_623
-

623-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_623
 - FFC_B88
-

623-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_623
 - SOFTWARE
-

623-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_623
 - SOFTWARE
-

623-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_623
-

623-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_623
-

623-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_623
-

623-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

623-135

Explanation: The device failed to configure.

Failing Item:

- FFC_623
 - FFC_B88
 - SOFTWARE
-

623-136

Explanation: The certify operation failed.

Failing Item:

- FFC_623
-

623-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_623
 - FFC_B88
 - FFC_190
-

623-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_623
-

623-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_623
-

623-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

624-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_624
-

624-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_624
-

624-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_624
-

624-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_624
-

624-108

Explanation: The bus test failed.

Failing Item:

- FFC_624
-

624-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_624

624-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_624
-

624-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_624
-

624-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_624
-

624-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_624
-

624-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_624
 - FFC_B88
-

624-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_624
-

624-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_624
-

624-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_624
-

624-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_624
 - FFC_B88
-

624-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_624
 - SOFTWARE
-

624-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_624
 - SOFTWARE
-

624-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_624
-

624-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_624
-

624-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_624
-

624-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

- SOFTWARE

624-135

Explanation: The device failed to configure.

Failing Item:

- FFC_624
- FFC_B88
- SOFTWARE

624-136

Explanation: The certify operation failed.

Failing Item:

- FFC_624

624-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_624
- FFC_B88
- FFC_190

624-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_624

624-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_624

624-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

62D-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_62D

62D-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_62D

62D-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_62D

62D-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_62D

62D-108

Explanation: The bus test failed.

Failing Item:

- FFC_62D

62D-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_62D

62D-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_62D

62D-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_62D

62D-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_62D

62D-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_62D

62D-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_62D
- FFC_B88

62D-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_62D

62D-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_62D

62D-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_62D

62D-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_62D
- FFC_B88

62D-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_62D
- SOFTWARE

62D-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_62D
- SOFTWARE

62D-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_62D

62D-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_62D

62D-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_62D

62D-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

62D-135

Explanation: The device failed to configure.

Failing Item:

- FFC_62D
- FFC_B88
- SOFTWARE

62D-136

Explanation: The certify operation failed.

Failing Item:

- FFC_62D

62D-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_62D
- FFC_B88
- FFC_190

62D-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_62D

62D-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_62D

62D-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

62E-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_62E

62E-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_62E

62E-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_62E

62E-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_62E

62E-108

Explanation: The bus test failed.

Failing Item:

- FFC_62E

62E-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_62E

62E-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_62E

62E-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_62E

62E-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_62E

62E-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_62E

62E-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_62E
- FFC_B88

62E-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_62E
-

62E-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_62E
-

62E-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_62E
-

62E-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_62E
 - FFC_B88
-

62E-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_62E
 - SOFTWARE
-

62E-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_62E
 - SOFTWARE
-

62E-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_62E
-

62E-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_62E
-

62E-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_62E
-

62E-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

62E-135

Explanation: The device failed to configure.

Failing Item:

- FFC_62E
 - FFC_B88
 - SOFTWARE
-

62E-136

Explanation: The certify operation failed.

Failing Item:

- FFC_62E
-

62E-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_62E
 - FFC_B88
 - FFC_190
-

62E-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_62E

62E-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_62E

62E-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

636-101

Explanation: EPROM test failure.

Failing Item:

- FFC_636

636-102

Explanation: Adapter SDRAM failure.

Failing Item:

- FFC_636

636-103

Explanation: Adapter checksum failure.

Failing Item:

- FFC_636

636-104

Explanation: Adapter memory test failure.

Failing Item:

- FFC_636

636-105

Explanation: Adapter buffer test failure.

Failing Item:

- FFC_636

636-106

Explanation: Adapter cache test failure.

Failing Item:

- FFC_636

636-107

Explanation: Internal loop-back test failure.

Failing Item:

- FFC_636

636-108

Explanation: External wrap test failure.

Failing Item:

- FFC_636

636-109

Explanation: Enhanced error handling failure on the bus.

Failing Item:

- FFC_221

636-110

Explanation: Enhanced error handling failure on the Eads chip.

Failing Item:

- FFC_221

636-111

Explanation: Enhanced error handling failure on the adapter.

Failing Item:

- FFC_636

636-201

Explanation: Hardware failure opening adapter.

Failing Item:

- FFC_636
- FFC_221

636-202

Explanation: Interrupt test failure.

Failing Item:

- FFC_636
- FFC_221

636-203

Explanation: Adapter DMA test failure.

Failing Item:

- FFC_636
- FFC_221

636-204

Explanation: Enhanced error handling failure opening the adapter.

Failing Item:

- FFC_636
 - FFC_221
-

636-701

Explanation: ELA indicates an I/O failure on the adapter.

Failing Item:

- FFC_636
-

638-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_638
-

638-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_638
-

638-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_638
-

638-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_638
-

638-108

Explanation: The bus test failed.

Failing Item:

- FFC_638
-

638-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_638
-

638-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_638
-

638-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_638
-

638-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_638
-

638-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_638
-

638-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_638
 - FFC_B88
-

638-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_638
-

638-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_638
-

638-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_638
-

638-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_638
- FFC_B88

638-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_638
- SOFTWARE

638-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_638
- SOFTWARE

638-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_638

638-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_638

638-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_638

638-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88

- SOFTWARE

638-135

Explanation: The device failed to configure.

Failing Item:

- FFC_638
- FFC_B88
- SOFTWARE

638-136

Explanation: The certify operation failed.

Failing Item:

- FFC_638

638-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_638
- FFC_B88
- FFC_190

638-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_638

638-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_638

638-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

639-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_639
-

639-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_639
-

639-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_639
-

639-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_639
-

639-108

Explanation: The bus test failed.

Failing Item:

- FFC_639
-

639-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_639
-

639-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_639
-

639-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_639
-

639-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_639
-

639-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_639
-

639-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_639
 - FFC_B88
-

639-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_639
-

639-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_639
-

639-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_639
-

639-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_639
 - FFC_B88
-

639-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_639
- SOFTWARE

639-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_639
 - SOFTWARE
-

639-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_639
-

639-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_639
-

639-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_639
-

639-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

639-135

Explanation: The device failed to configure.

Failing Item:

- FFC_639
 - FFC_B88
 - SOFTWARE
-

639-136

Explanation: The certify operation failed.

Failing Item:

- FFC_639
-

639-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_639
 - FFC_B88
 - FFC_190
-

639-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_639
-

639-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_639
-

639-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

63A-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_63A
-

63A-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_63A
-

63A-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_63A
-

63A-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_63A
-

63A-108

Explanation: The bus test failed.

Failing Item:

- FFC_63A
-

63A-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_63A
-

63A-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_63A
-

63A-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_63A
-

63A-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_63A
-

63A-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_63A
-

63A-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_63A
 - FFC_B88
-

63A-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_63A
-

63A-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_63A
-

63A-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_63A
-

63A-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_63A
 - FFC_B88
-

63A-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_63A
 - SOFTWARE
-

63A-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_63A
 - SOFTWARE
-

63A-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_63A
-

63A-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_63A
-

63A-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_63A
-

63A-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

63A-135

Explanation: The device failed to configure.

Failing Item:

- FFC_63A
 - FFC_B88
 - SOFTWARE
-

63A-136

Explanation: The certify operation failed.

Failing Item:

- FFC_63A
-

63A-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_63A
 - FFC_B88
 - FFC_190
-

63A-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_63A
-

63A-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_63A
-

63A-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

63B-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_63B
-

63B-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_63B
-

63B-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_63B
-

63B-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_63B
-

63B-108

Explanation: The bus test failed.

Failing Item:

- FFC_63B
-

63B-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_63B

63B-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_63B
-

63B-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_63B
-

63B-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_63B
-

63B-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_63B
-

63B-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_63B
 - FFC_B88
-

63B-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_63B
-

63B-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_63B
-

63B-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_63B
-

63B-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_63B
 - FFC_B88
-

63B-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_63B
 - SOFTWARE
-

63B-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_63B
 - SOFTWARE
-

63B-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_63B
-

63B-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_63B
-

63B-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_63B
-

63B-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

- SOFTWARE

63B-135

Explanation: The device failed to configure.

Failing Item:

- FFC_63B
- FFC_B88
- SOFTWARE

63B-136

Explanation: The certify operation failed.

Failing Item:

- FFC_63B

63B-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_63B
- FFC_B88
- FFC_190

63B-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_63B

63B-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_63B

63B-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

63C-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_63C

63C-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_63C

63C-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_63C

63C-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_63C

63C-108

Explanation: The bus test failed.

Failing Item:

- FFC_63C

63C-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_63C

63C-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_63C

63C-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_63C

63C-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_63C

63C-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_63C

63C-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_63C
- FFC_B88

63C-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_63C

63C-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_63C

63C-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_63C

63C-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_63C
- FFC_B88

63C-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_63C
- SOFTWARE

63C-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_63C
- SOFTWARE

63C-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_63C

63C-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_63C

63C-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_63C

63C-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

63C-135

Explanation: The device failed to configure.

Failing Item:

- FFC_63C
- FFC_B88
- SOFTWARE

63C-136

Explanation: The certify operation failed.

Failing Item:

- FFC_63C

63C-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_63C
- FFC_B88
- FFC_190

63C-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_63C

63C-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_63C

63C-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

63D-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_63D

63D-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_63D

63D-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_63D

63D-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_63D

63D-108

Explanation: The bus test failed.

Failing Item:

- FFC_63D

63D-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_63D

63D-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_63D

63D-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_63D

63D-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_63D

63D-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_63D

63D-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_63D
- FFC_B88

63D-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_63D
-

63D-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_63D
-

63D-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_63D
-

63D-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_63D
 - FFC_B88
-

63D-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_63D
 - SOFTWARE
-

63D-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_63D
 - SOFTWARE
-

63D-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_63D
-

63D-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_63D
-

63D-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_63D
-

63D-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

63D-135

Explanation: The device failed to configure.

Failing Item:

- FFC_63D
 - FFC_B88
 - SOFTWARE
-

63D-136

Explanation: The certify operation failed.

Failing Item:

- FFC_63D
-

63D-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_63D
 - FFC_B88
 - FFC_190
-

63D-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

63D-140 • 63E-124

- FFC_63D

63D-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_63D

63D-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

63E-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_63E

63E-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_63E

63E-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_63E

63E-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_63E

63E-108

Explanation: The bus test failed.

Failing Item:

- FFC_63E

63E-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_63E

63E-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_63E

63E-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_63E

63E-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_63E

63E-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_63E

63E-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_63E
- FFC_B88

63E-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_63E

63E-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_63E

63E-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_63E

63E-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_63E
 - FFC_B88
-

63E-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_63E
 - SOFTWARE
-

63E-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_63E
 - SOFTWARE
-

63E-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_63E
-

63E-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_63E
-

63E-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_63E
-

63E-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

- SOFTWARE
-

63E-135

Explanation: The device failed to configure.

Failing Item:

- FFC_63E
 - FFC_B88
 - SOFTWARE
-

63E-136

Explanation: The certify operation failed.

Failing Item:

- FFC_63E
-

63E-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_63E
 - FFC_B88
 - FFC_190
-

63E-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_63E
-

63E-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_63E
-

63E-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

63F-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_63F
-

63F-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_63F
-

63F-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_63F
-

63F-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_63F
-

63F-108

Explanation: The bus test failed.

Failing Item:

- FFC_63F
-

63F-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_63F
-

63F-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_63F
-

63F-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_63F
-

63F-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_63F
-

63F-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_63F
-

63F-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_63F
 - FFC_B88
-

63F-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_63F
-

63F-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_63F
-

63F-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_63F
-

63F-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_63F
 - FFC_B88
-

63F-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_63F
- SOFTWARE

63F-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_63F
 - SOFTWARE
-

63F-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_63F
-

63F-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_63F
-

63F-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_63F
-

63F-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

63F-135

Explanation: The device failed to configure.

Failing Item:

- FFC_63F
 - FFC_B88
 - SOFTWARE
-

63F-136

Explanation: The certify operation failed.

Failing Item:

- FFC_63F
-

63F-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_63F
 - FFC_B88
 - FFC_190
-

63F-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_63F
-

63F-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_63F
-

63F-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

640-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_640
-

640-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_640
-

640-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_640
-

640-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_640
-

640-108

Explanation: The bus test failed.

Failing Item:

- FFC_640
-

640-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_640
-

640-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_640
-

640-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_640
-

640-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_640
-

640-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_640
-

640-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_640
 - FFC_B88
-

640-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_640
-

640-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_640
-

640-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_640
-

640-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_640
 - FFC_B88
-

640-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_640
 - SOFTWARE
-

640-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_640
 - SOFTWARE
-

640-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_640
-

640-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_640
-

640-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_640
-

640-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

640-135

Explanation: The device failed to configure.

Failing Item:

- FFC_640
 - FFC_B88
 - SOFTWARE
-

640-136

Explanation: The certify operation failed.

Failing Item:

- FFC_640
-

640-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_640
 - FFC_B88
 - FFC_190
-

640-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_640
-

640-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_640
-

640-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

643-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_643
-

643-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_643
-

643-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_643
-

643-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_643
-

643-108

Explanation: The bus test failed.

Failing Item:

- FFC_643
-

643-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_643

643-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_643
-

643-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_643
-

643-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_643
-

643-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_643
-

643-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_643
 - FFC_B88
-

643-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_643
-

643-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_643
-

643-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_643
-

643-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_643
 - FFC_B88
-

643-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_643
 - SOFTWARE
-

643-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_643
 - SOFTWARE
-

643-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_643
-

643-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_643
-

643-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_643
-

643-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

- SOFTWARE

643-135

Explanation: The device failed to configure.

Failing Item:

- FFC_643
 - FFC_B88
 - SOFTWARE
-

643-136

Explanation: The certify operation failed.

Failing Item:

- FFC_643
-

643-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_643
 - FFC_B88
 - FFC_190
-

643-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_643
-

643-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_643
-

643-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

644-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_644
-

644-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_644
-

644-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_644
-

644-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_644
-

644-108

Explanation: The bus test failed.

Failing Item:

- FFC_644
-

644-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_644
-

644-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_644
-

644-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_644
-

644-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

644-117 • 644-136

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_644
-

644-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_644
-

644-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_644
 - FFC_B88
-

644-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_644
-

644-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_644
-

644-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_644
-

644-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_644
 - FFC_B88
-

644-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_644
 - SOFTWARE
-

644-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_644
 - SOFTWARE
-

644-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_644
-

644-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_644
-

644-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_644
-

644-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

644-135

Explanation: The device failed to configure.

Failing Item:

- FFC_644
 - FFC_B88
 - SOFTWARE
-

644-136

Explanation: The certify operation failed.

Failing Item:

- FFC_644
-

644-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_644
 - FFC_B88
 - FFC_190
-

644-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_644
-

644-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_644
-

644-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

646-101

Explanation: External Test Failure.

Failing Item:

- FFC_D46
-

646-102

Explanation: External Test Failure.

Failing Item:

- FFC_240
-

646-103

Explanation: I/O Test Failure.

Failing Item:

- FFC_646

646-104

Explanation: Adapter On-card Test Failure.

Failing Item:

- FFC_646
 - FFC_221
-

646-105

Explanation: Wrap Test Failure.

Failing Item:

- FFC_646
-

646-106

Explanation: Enhanced Error Handling failure on bus.

Failing Item:

- FFC_646
-

646-107

Explanation: EEH failure on PCI-PCI bridge chip.

Failing Item:

- FFC_646
-

646-108

Explanation: Enhanced Error Handling failure on adapter.

Failing Item:

- FFC_646
-

646-201

Explanation: Configuration Register Test Failure.

Failing Item:

- FFC_646
 - FFC_221
-

646-202

Explanation: Wrap Test Failure.

Failing Item:

- FFC_646
 - FFC_221
-

646-204

Explanation: External Test Failure.

Failing Item:

- FFC_D46
- FFC_240

646-205

Explanation: External Test Failure.

Response: Run advanced diagnostics with wrap test for this resource to obtain a correct problem resolution.

Failing Item:

- FFC_D46
- FFC_646

646-206

Explanation: External Test Failure.

Response: Run advanced diagnostics with wrap test for this resource to obtain a correct problem resolution.

Failing Item:

- FFC_240
- FFC_646

646-302

Explanation: External Test Failure.

Response: Run advanced diagnostics with wrap test for this resource to obtain a correct problem resolution.

Failing Item:

- FFC_240
- FFC_D46
- FFC_221

646-303

Explanation: External Test Failure.

Response: Run advanced diagnostics with wrap test for this resource to obtain a correct problem resolution.

Failing Item:

- FFC_D46
- FFC_646
- FFC_221

646-401

Explanation: External Test Failure.

Response: Run advanced diagnostics with wrap test for this resource to obtain a correct problem resolution. Use MAP0210 : General problem resolution.

Failing Item:

- FFC_240
- FFC_D46
- FFC_646
- FFC_221

646-701

Explanation: Error log analysis indicates that an adapter error has occurred.

Failing Item:

- FFC_646

646-702

Explanation: Error log analysis indicates that an adapter check has occurred.

Failing Item:

- FFC_646

646-703

Explanation: Error log analysis indicates that a DMA failure has occurred.

Failing Item:

- FFC_646
- FFC_221

646-704

Explanation: Error log analysis indicates that a PCI Bus error has occurred.

Failing Item:

- FFC_646
- FFC_221

646-705

Explanation: Error log analysis indicates that a Programmed I/O error has occurred.

Failing Item:

- FFC_646
- FFC_221

646-706

Explanation: ELA indicates a command write failure occurred.

Failing Item:

- FFC_646

646-707

Explanation: ELA indicates an internal adapter error has occurred.

Failing Item:

- FFC_646
-

64A-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_64A
-

64A-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_64A
-

64A-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_64A
-

64A-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_64A
-

64A-108

Explanation: The bus test failed.

Failing Item:

- FFC_64A
-

64A-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_64A
-

64A-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_64A
-

64A-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_64A
-

64A-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_64A
-

64A-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_64A
-

64A-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_64A
 - FFC_B88
-

64A-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_64A
-

64A-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_64A
-

64A-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_64A
-

64A-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_64A
 - FFC_B88
-

64A-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_64A
- SOFTWARE

64A-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_64A
- SOFTWARE

64A-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_64A

64A-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_64A

64A-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_64A

64A-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

64A-135

Explanation: The device failed to configure.

Failing Item:

- FFC_64A
- FFC_B88
- SOFTWARE

64A-136

Explanation: The certify operation failed.

Failing Item:

- FFC_64A

64A-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_64A
- FFC_B88
- FFC_190

64A-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_64A

64A-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_64A

64A-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

64B-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_64B

64B-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_64B

64B-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_64B

64B-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_64B
-

64B-108

Explanation: The bus test failed.

Failing Item:

- FFC_64B
-

64B-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_64B
-

64B-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_64B
-

64B-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_64B
-

64B-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_64B
-

64B-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_64B
-

64B-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_64B
 - FFC_B88
-

64B-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_64B
-

64B-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_64B
-

64B-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_64B
-

64B-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_64B
 - FFC_B88
-

64B-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_64B
 - SOFTWARE
-

64B-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_64B
 - SOFTWARE
-

64B-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_64B
-

64B-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_64B
-

64B-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_64B
-

64B-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

64B-135

Explanation: The device failed to configure.

Failing Item:

- FFC_64B
 - FFC_B88
 - SOFTWARE
-

64B-136

Explanation: The certify operation failed.

Failing Item:

- FFC_64B
-

64B-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_64B
 - FFC_B88
 - FFC_190
-

64B-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_64B
-

64B-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_64B
-

64B-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

64C-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_64C
-

64C-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_64C
-

64C-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_64C
-

64C-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_64C
-

64C-108

Explanation: The bus test failed.

Failing Item:

- FFC_64C
-

64C-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_64C

64C-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_64C
-

64C-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_64C
-

64C-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_64C
-

64C-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_64C
-

64C-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_64C
 - FFC_B88
-

64C-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_64C
-

64C-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_64C
-

64C-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_64C
-

64C-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_64C
 - FFC_B88
-

64C-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_64C
 - SOFTWARE
-

64C-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_64C
 - SOFTWARE
-

64C-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_64C
-

64C-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_64C
-

64C-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_64C
-

64C-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

64C-135 • 64D-116

- SOFTWARE

64C-135

Explanation: The device failed to configure.

Failing Item:

- FFC_64C
- FFC_B88
- SOFTWARE

64C-136

Explanation: The certify operation failed.

Failing Item:

- FFC_64C

64C-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_64C
- FFC_B88
- FFC_190

64C-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_64C

64C-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_64C

64C-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

64D-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_64D

64D-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_64D

64D-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_64D

64D-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_64D

64D-108

Explanation: The bus test failed.

Failing Item:

- FFC_64D

64D-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_64D

64D-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_64D

64D-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_64D

64D-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_64D

64D-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_64D

64D-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_64D
- FFC_B88

64D-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_64D

64D-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_64D

64D-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_64D

64D-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_64D
- FFC_B88

64D-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_64D
- SOFTWARE

64D-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_64D
- SOFTWARE

64D-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_64D

64D-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_64D

64D-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_64D

64D-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

64D-135

Explanation: The device failed to configure.

Failing Item:

- FFC_64D
- FFC_B88
- SOFTWARE

64D-136

Explanation: The certify operation failed.

Failing Item:

- FFC_64D

64D-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_64D
- FFC_B88
- FFC_190

64D-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_64D

64D-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_64D

64D-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

64E-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_64E

64E-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_64E

64E-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_64E

64E-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_64E

64E-108

Explanation: The bus test failed.

Failing Item:

- FFC_64E

64E-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_64E

64E-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_64E

64E-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_64E

64E-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_64E

64E-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_64E

64E-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_64E
- FFC_B88

64E-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_64E
-

64E-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_64E
-

64E-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_64E
-

64E-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_64E
 - FFC_B88
-

64E-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_64E
 - SOFTWARE
-

64E-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_64E
 - SOFTWARE
-

64E-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_64E
-

64E-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_64E
-

64E-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_64E
-

64E-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

64E-135

Explanation: The device failed to configure.

Failing Item:

- FFC_64E
 - FFC_B88
 - SOFTWARE
-

64E-136

Explanation: The certify operation failed.

Failing Item:

- FFC_64E
-

64E-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_64E
 - FFC_B88
 - FFC_190
-

64E-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

64E-140 • 64F-124

- FFC_64E

64E-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_64E

64E-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

64F-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_64F

64F-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_64F

64F-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_64F

64F-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_64F

64F-108

Explanation: The bus test failed.

Failing Item:

- FFC_64F

64F-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_64F

64F-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_64F

64F-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_64F

64F-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_64F

64F-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_64F

64F-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_64F
- FFC_B88

64F-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_64F

64F-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_64F

64F-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_64F

64F-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_64F
 - FFC_B88
-

64F-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_64F
 - SOFTWARE
-

64F-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_64F
 - SOFTWARE
-

64F-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_64F
-

64F-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_64F
-

64F-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_64F
-

64F-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

- SOFTWARE
-

64F-135

Explanation: The device failed to configure.

Failing Item:

- FFC_64F
 - FFC_B88
 - SOFTWARE
-

64F-136

Explanation: The certify operation failed.

Failing Item:

- FFC_64F
-

64F-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_64F
 - FFC_B88
 - FFC_190
-

64F-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_64F
-

64F-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_64F
-

64F-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

650-XXX

Explanation: Disk drive configuration failed.

Failing Item:

- FFC_650
-

651-140

Explanation: Display character test failed.

Failing Item:

- FFC_165
 - FFC_221
-

651-199

Explanation: This is a test of the flow of a Serviceable Event from this system to the management console. This is not a real problem.

657-001

Explanation: Software error.

Failing Item:

- SOFTWARE
 - FFC_657
-

657-002

Explanation: Adapter failure.

Failing Item:

- FFC_657
 - SOFTWARE
-

657-003

Explanation: Adapter failure.

Failing Item:

- FFC_657
 - FFC_227
-

657-004

Explanation: Display failure.

Failing Item:

- FFC_657
 - MONITOR
 - CABLE
-

657-005

Explanation: Adapter failure.

Failing Item:

- FFC_657
-

- FFC_227
 - MONITOR
 - CABLE
-

65A-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_65A
-

65A-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_65A
-

65A-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_65A
-

65A-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_65A
-

65A-108

Explanation: The bus test failed.

Failing Item:

- FFC_65A
-

65A-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_65A
-

65A-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_65A
-

65A-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_65A
-

65A-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_65A
-

65A-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_65A
-

65A-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_65A
 - FFC_B88
-

65A-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_65A
-

65A-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_65A
-

65A-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_65A
-

65A-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_65A
 - FFC_B88
-

65A-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_65A
 - SOFTWARE
-

65A-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_65A
 - SOFTWARE
-

65A-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_65A
-

65A-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_65A
-

65A-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_65A
-

65A-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

65A-135

Explanation: The device failed to configure.

Failing Item:

- FFC_65A
 - FFC_B88
-

- SOFTWARE

65A-136

Explanation: The certify operation failed.

Failing Item:

- FFC_65A

65A-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_65A
- FFC_B88
- FFC_190

65A-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_65A

65A-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_65A

65A-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

65B-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_65B

65B-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_65B

65B-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_65B

65B-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_65B

65B-108

Explanation: The bus test failed.

Failing Item:

- FFC_65B

65B-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_65B

65B-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_65B

65B-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_65B

65B-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_65B
-

65B-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_65B
-

65B-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_65B
 - FFC_B88
-

65B-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_65B
-

65B-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_65B
-

65B-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_65B
-

65B-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_65B
 - FFC_B88
-

65B-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_65B
 - SOFTWARE
-

65B-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_65B
 - SOFTWARE
-

65B-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_65B
-

65B-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_65B
-

65B-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_65B
-

65B-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

65B-135

Explanation: The device failed to configure.

Failing Item:

- FFC_65B
 - FFC_B88
 - SOFTWARE
-

65B-136

Explanation: The certify operation failed.

Failing Item:

- FFC_65B
-

65B-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_65B
- FFC_B88
- FFC_190

65B-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_65B

65B-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_65B

65B-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

65C-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_65C

65C-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_65C

65C-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_65C

65C-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_65C

65C-108

Explanation: The bus test failed.

Failing Item:

- FFC_65C

65C-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_65C

65C-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_65C

65C-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_65C

65C-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_65C

65C-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_65C

65C-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_65C
- FFC_B88

65C-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_65C
-

65C-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_65C
-

65C-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_65C
-

65C-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_65C
 - FFC_B88
-

65C-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_65C
 - SOFTWARE
-

65C-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_65C
 - SOFTWARE
-

65C-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_65C
-

65C-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_65C
-

65C-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_65C
-

65C-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

65C-135

Explanation: The device failed to configure.

Failing Item:

- FFC_65C
 - FFC_B88
 - SOFTWARE
-

65C-136

Explanation: The certify operation failed.

Failing Item:

- FFC_65C
-

65C-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_65C
 - FFC_B88
 - FFC_190
-

65C-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

65C-140 • 65D-124

- FFC_65C

65C-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_65C

65C-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

65D-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_65D

65D-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_65D

65D-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_65D

65D-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_65D

65D-108

Explanation: The bus test failed.

Failing Item:

- FFC_65D

65D-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_65D

65D-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_65D

65D-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_65D

65D-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_65D

65D-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_65D

65D-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_65D
- FFC_B88

65D-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_65D

65D-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_65D

65D-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_65D

65D-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_65D
 - FFC_B88
-

65D-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_65D
 - SOFTWARE
-

65D-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_65D
 - SOFTWARE
-

65D-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_65D
-

65D-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_65D
-

65D-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_65D
-

65D-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

- SOFTWARE
-

65D-135

Explanation: The device failed to configure.

Failing Item:

- FFC_65D
 - FFC_B88
 - SOFTWARE
-

65D-136

Explanation: The certify operation failed.

Failing Item:

- FFC_65D
-

65D-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_65D
 - FFC_B88
 - FFC_190
-

65D-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_65D
-

65D-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_65D
-

65D-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

65E-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_65E
-

65E-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_65E
-

65E-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_65E
-

65E-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_65E
-

65E-108

Explanation: The bus test failed.

Failing Item:

- FFC_65E
-

65E-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_65E
-

65E-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_65E
-

65E-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_65E
-

65E-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_65E
-

65E-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_65E
-

65E-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_65E
 - FFC_B88
-

65E-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_65E
-

65E-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_65E
-

65E-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_65E
-

65E-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_65E
 - FFC_B88
-

65E-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_65E
- SOFTWARE

65E-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_65E
 - SOFTWARE
-

65E-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_65E
-

65E-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_65E
-

65E-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_65E
-

65E-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

65E-135

Explanation: The device failed to configure.

Failing Item:

- FFC_65E
 - FFC_B88
 - SOFTWARE
-

65E-136

Explanation: The certify operation failed.

Failing Item:

- FFC_65E
-

65E-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_65E
 - FFC_B88
 - FFC_190
-

65E-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_65E
-

65E-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_65E
-

65E-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

65F-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_65F
-

65F-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_65F
-

65F-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_65F
-

65F-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_65F
-

65F-108

Explanation: The bus test failed.

Failing Item:

- FFC_65F
-

65F-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_65F
-

65F-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_65F
-

65F-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_65F
-

65F-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_65F
-

65F-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_65F
-

65F-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_65F
 - FFC_B88
-

65F-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_65F
-

65F-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_65F
-

65F-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_65F
-

65F-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_65F
 - FFC_B88
-

65F-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_65F
 - SOFTWARE
-

65F-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_65F
 - SOFTWARE
-

65F-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_65F
-

65F-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_65F
-

65F-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_65F
-

65F-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

65F-135

Explanation: The device failed to configure.

Failing Item:

- FFC_65F
 - FFC_B88
 - SOFTWARE
-

65F-136

Explanation: The certify operation failed.

Failing Item:

- FFC_65F
-

65F-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_65F
 - FFC_B88
 - FFC_190
-

65F-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_65F
-

65F-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_65F
-

65F-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

662-101

Explanation: Enhanced error handling failure on the bus.

Failing Item:

- FFC_221
-

662-102

Explanation: Enhanced error handling failure on a PCI-PCI Bridge.

Failing Item:

- FFC_293
-

662-103

Explanation: Enhanced error handling failure on the adapter.

Failing Item:

- FFC_662
 - FFC_221
-

662-212

Explanation: FIFO empty bit set.

Failing Item:

- FFC_662
-

662-213

Explanation: FIFO empty bit clear.

Failing Item:

- FFC_662
-

662-214

Explanation: FIFO full bit set.

Failing Item:

- FFC_662
-

662-215

Explanation: FIFO full bit clear.

Failing Item:

- FFC_662
-

662-216

Explanation: FIFO data miscompare.

Failing Item:

- FFC_662
-

662-217

Explanation: SCSI FIFO data miscompare.

Failing Item:

- FFC_662
-

662-218

Explanation: SCSI FIFO underflow.

Failing Item:

- FFC_662
-

662-219

Explanation: SCSI parity error.

Response: Go to MAP0050 : SCSI Bus Problems.

662-220

Explanation: SCSI FIFO flags error.

Failing Item:

- FFC_662
-

662-221

Explanation: Miscompare during the write/read of the configuration register.

Failing Item:

- FFC_662
 - FFC_221
-

662-222

Explanation: Error during the write/read of the memory register.

Failing Item:

- FFC_662
-

662-223

Explanation: Miscompare during the write/read of the memory I/O register.

Response: Go to MAP0050 : SCSI Bus Problems.

Failing Item:

- FFC_662
-

662-224

Explanation: SCSI configuration register read or write error.

Failing Item:

- FFC_662
 - FFC_221
-

662-225

Explanation: Adapter POST failed.

Failing Item:

- FFC_662
-

662-226

Explanation: SCSI wrap or PTC failure.

Response: Go to MAP0050 : SCSI Bus Problems.

662-227

Explanation: SCSI adapter test failure.

Failing Item:

- FFC_662
 - FFC_221
-

662-230

Explanation: Arbitration test failed.

Response: Go to MAP0050 : SCSI Bus Problems.

662-231

Explanation: Function could not complete.

Response: Go to MAP0050 : SCSI Bus Problems.

662-232

Explanation: SCSI bus data miscompare.

Response: Go to MAP0050 : SCSI Bus Problems.

662-240

Explanation: No terminal power.

Response: Go to MAP0050 : SCSI Bus Problems.

662-242

Explanation: SCSI bus problem.

Response: Go to MAP0050 : SCSI Bus Problems.

662-301

Explanation: The parent device open failed.

Failing Item:

- FFC_662
 - FFC_221
-

662-701

Explanation: Error log analysis indicates a PCI SCSI adapter failure.

Failing Item:

- FFC_662
-

662-801

Explanation: Error log analysis indicates a terminator problem.

Response: Run the diagnostics on the adapter in system verification mode. If an SRN is reported, use the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in General SCSI configuration checks to resolve the problem.

662-802

Explanation: Error log analysis indicates that multiple attempts to reset the SCSI bus have timed out.

Response: Run the diagnostics on the adapter in system verification mode. If an SRN is reported, use the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in General SCSI configuration checks to resolve the problem.

662-803

Explanation: Error log analysis indicates that multiple SCSI bus errors have occurred.

Response: Run the diagnostics on the adapter in system verification mode. If an SRN is reported, use

the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in General SCSI configuration checks to resolve the problem.

663-101

Explanation: IBM ARTIC960RxD or RxF PCI Adapter Central Processing Unit test failure.

Failing Item:

- FFC_663
 - FFC_C94
 - FFC_C95
-

663-102

Explanation: IBM ARTIC960RxD or RxF PCI Adapter Timer test failure.

Failing Item:

- FFC_663
 - FFC_C94
 - FFC_C95
-

663-103

Explanation: IBM ARTIC960RxD or RxF PCI Adapter Bus Interface test failure.

Failing Item:

- FFC_663
 - FFC_C94
 - FFC_C95
-

663-104

Explanation: IBM ARTIC960RxD or RxF PCI Adapter Dynamic Random Access Memory test failure.

Failing Item:

- FFC_C94
 - FFC_663
 - FFC_C95
-

663-105

Explanation: IBM ARTIC960RxD or RxF PCI Adapter Memory Protection test failure.

Failing Item:

- FFC_663
 - FFC_C94
 - FFC_C95
-

663-106

Explanation: IBM ARTIC960RxD PCI Adapter Debug Port test failure.

Failing Item:

- FFC_663
- FFC_C94
- FFC_C95

663-107

Explanation: Interface board wrap test failure.

Failing Item:

- FFC_C95
- FFC_663
- FFC_C97

663-110

Explanation: IBM ARTIC960RxD or RxF PCI Adapter Download Diagnostics test failure.

Failing Item:

- FFC_C94
- FFC_663
- FFC_C95

663-123

Explanation: Interface board non-wrap test failure.

Failing Item:

- FFC_C95
- FFC_663
- FFC_C94

663-150

Explanation: Device configuration failure.

Failing Item:

- FFC_663
- SOFTWARE
- FFC_227

663-151

Explanation: Device driver indicates a hardware failure.

Failing Item:

- FFC_663
- SOFTWARE
- FFC_227

663-152

Explanation: Failure and error in determining which type of IBM ARTIC960RxD PCI Adapter.

Failing Item:

- FFC_663

663-153

Explanation: Error log analysis indicates a IBM ARTIC960RxD or RxF PCI Adapter failure. Action: Use the errpt command to check error log.

Failing Item:

- FFC_663
- FFC_227
- FFC_C94
- SOFTWARE

663-154

Explanation: IBM ARTIC960RxD or RxF PCI Adapter initialization failure.

Failing Item:

- FFC_C94
- FFC_663
- FFC_C95

663-155

Explanation: IBM ARTIC960RxD or RxF PCI Adapter initialization failure.

Failing Item:

- FFC_663
- FFC_C94
- FFC_C95

663-156

Explanation: IBM ARTIC960RxD or RxF PCI Adapter initialization failure.

Failing Item:

- FFC_C95
- FFC_663
- FFC_C94

663-157

Explanation: Cable wrap test failure.

Failing Item:

- FFC_C98
- FFC_C97
- FFC_C95

669-101

Explanation: Enhanced error handling failure on bus.

Failing Item:

- FFC_221
-

669-102

Explanation: Enhanced error handling failure on Eads chip.

Failing Item:

- FFC_221
-

669-103

Explanation: Enhanced error handling failure on adapter.

Failing Item:

- FFC_669
-

669-201

Explanation: Configuration register test failure.

Response: Before going to MAP0210 , look at the label on the adapter. If the label is A-A, use SRN 66C-201 instead.

Failing Item:

- FFC_669
 - FFC_221
-

669-202

Explanation: I/O register test failure.

Failing Item:

- FFC_669
-

669-203

Explanation: Adapter memory test failure.

Failing Item:

- FFC_669
-

669-204

Explanation: Adapter initialization test failure.

Failing Item:

- FFC_669
-

669-205

Explanation: Internal loopback test failure.

Failing Item:

- FFC_669
-

669-206

Explanation: External wrap test failure (1000 Mbps).

Failing Item:

- FFC_669
-

669-701

Explanation: Error Log Analysis indicates that this device failed to initialize because it is not the IBM version of this adapter. AIX operating system cannot configure this non-IBM version of the adapter.

Failing Item:

- FFC_669
-

669-702

Explanation: Error Log Analysis indicates that this device failed to initialize due to a problem with the EEPROM on the adapter.

Failing Item:

- FFC_669
-

669-703

Explanation: Error Log Analysis indicates that this device has failed to initialize due to a self-test failure.

Failing Item:

- FFC_669
-

669-704

Explanation: Error Log Analysis indicates that this device has failed to initialize due to firmware download error.

Failing Item:

- FFC_669
-

66A-101

Explanation: Diagnostics indicates adapter configuration failure.

66C-101

Explanation: Enhanced error handling failure on bus.

Failing Item:

- FFC_221
-

66C-102

Explanation: Enhanced error handling failure on Eads chip.

Failing Item:

- FFC_221
-

66C-103

Explanation: Enhanced error handling failure on adapter.

Failing Item:

- FFC_66C

66C-201

Explanation: Configuration register test failure.

Failing Item:

- FFC_66C
- FFC_221

66C-202

Explanation: I/O register test failure.

Failing Item:

- FFC_66C

66C-203

Explanation: Adapter memory test failure.

Failing Item:

- FFC_66C

66C-204

Explanation: Adapter initialization test failure.

Failing Item:

- FFC_66C

66C-205

Explanation: Internal loopback test failure.

Failing Item:

- FFC_66C

66C-206

Explanation: External wrap test failure (1000 Mbps).

Failing Item:

- FFC_66C

66C-207

Explanation: External wrap test failure (10 Mbps).

Failing Item:

- FFC_66C

66C-208

Explanation: External wrap test failure (100 Mbps).

Failing Item:

- FFC_66C

66C-702

Explanation: Error Log Analysis indicates that this device failed to initialize due to a problem with the EEPROM on the adapter.

Failing Item:

- FFC_66C

66C-703

Explanation: Error Log Analysis indicates that this device has failed to initialize due to a self-test failure.

Failing Item:

- FFC_66C

66C-704

Explanation: Error Log Analysis indicates that this device has failed to initialize due to firmware download error.

Failing Item:

- FFC_66C

66D-101

Explanation: The PCI wrap test failed.

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_66D
- FFC_227

66D-102

Explanation: The POST indicates an adapter failure.

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_66D
- FFC_E2A

66D-103

Explanation: The POST indicates an adapter channel failure.

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_66D

66D-104

Explanation: The POST indicates a defective cable.

Failing Item:

- FFC_190

66D-105

Explanation: The POST indicates a defective backplane or external enclosure.

Failing Item:

- FFC_B3A

66D-106

Explanation: The POST indicates the last disk drive reconnected caused a channel failure.

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_722

66D-108

Explanation: Enhanced error handling failure on bus.

Failing Item:

- FFC_221

66D-109

Explanation: The test indicates an adapter failure.

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_66D

66D-110

Explanation: The disk reported a Predictive Failure Analysis error (PFA).

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_722

66D-111

Explanation: The disk drive has been failed by the adapter.

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_722

66D-112

Explanation: ELA indicates that the disk reported a hard data error.

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_722

66D-113

Explanation: ELA indicates that the disk reported a hard equipment error.

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_722

66D-114

Explanation: ELA indicates a cache failure.

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_E2A

66D-115

Explanation: ELA indicates that the cache battery is either low on power or has failed.

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_E3A

66D-116

Explanation: Failed to disable data scrub.

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_66D

66D-117

Explanation: POST indicates cache failure.

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_E2A

66D-118

Explanation: Adapter test indicates a cache failure.

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_E2A

66D-119

Explanation: Adapter test indicates that write cache is missing.

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_E2A

66D-120

Explanation: Adapter test indicates that cache size is invalid.

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_E2A

66D-121

Explanation: Adapter test indicates that the cache battery is low on power.

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_E3A

66D-122

Explanation: Adapter test indicates cache battery failure.

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_E3A

66D-123

Explanation: ELA indicates an adapter failure.

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_66D

66D-124

Explanation: Enhanced error handling failure on PCI-PCI Bridge.

Failing Item:

- FFC_221

66D-125

Explanation: Enhanced error handling failure on adapter.

Failing Item:

- FFC_66D
- FFC_221

66D-400

Explanation: The POST test indicates a channel failure.

Response: Use MAP0270 : SCSI RAID problem resolution and verification.

Failing Item:

- FFC_66D
- FFC_190
- FFC_B3A
- FFC_722

66D-701

Explanation: Error Log Analysis indicates an enhanced error handling error.

Failing Item:

- FFC_66D
- FFC_221

66E-100

Explanation: Unable to configure the parent device.

Failing Item:

- FFC_66E
-

66E-102

Explanation: SCSI command Inquiry has failed. Unable to get Additional Vital Product Data.

Failing Item:

- FFC_66E
-

66E-103

Explanation: SCSI command Reserve has failed.

Failing Item:

- FFC_66E
-

66E-104

Explanation: SCSI command Mode Sense has failed.

Failing Item:

- FFC_66E
-

66E-105

Explanation: SCSI command Mode Select has failed.

Failing Item:

- FFC_66E
-

66E-106

Explanation: SCSI command Allow Media Removal has failed.

Failing Item:

- FFC_66E
-

66E-107

Explanation: SCSI command Prevent Media Removal has failed.

Failing Item:

- FFC_66E
-

66E-108

Explanation: SCSI command Start Stop Unit has failed.

Failing Item:

- FFC_66E
-

66E-109

Explanation: SCSI command Test Unit Ready has failed.

Failing Item:

- FFC_66E
-

66E-10A

Explanation: SCSI command Send Diagnostic has failed.

Failing Item:

- FFC_66E
-

66E-10B

Explanation: SCSI command Release has failed.

Failing Item:

- FFC_66E
-

66E-10F

Explanation: Undetermined hardware error has occurred.

Failing Item:

- FFC_66E
-

66E-200

Explanation: Unable to configure the device.

Failing Item:

- FFC_66E
 - FFC_B88
-

66E-201

Explanation: DVD-RAM drive is unable to eject the tray.

Response: Verify that no external object prevents the drive from ejecting the tray. Verify that no media is stuck inside the drive. Otherwise, use MAP0210 : General problem resolution.

Failing Item:

- MEDIA
 - FFC_66E
-

66E-202

Explanation: DVD-RAM drive is unable to load the tray.

Response: Verify that no external object prevents the drive from loading the tray. Verify that the test medium is inserted properly in the tray.

Failing Item:

- MEDIA
 - FFC_66E
-

66E-203

Explanation: DVD-RAM drive is unable to detect the test medium.

Response: Verify that the test medium is inserted properly. Clean the drive. Run the test with another test medium. Otherwise, use MAP0210 : General problem resolution.

Failing Item:

- MEDIA
- FFC_66E

66E-204

Explanation: A SCSI reservation conflict has occurred.

Failing Item:

- FFC_66E
- FFC_B88

66E-205

Explanation: The Random Write/Read/Compare Test has detected a medium error while testing the DVD-RAM test medium.

Response: Run Diagnostic on this drive with another DVD-RAM test medium. Use MAP0210 : General problem resolution.

Failing Item:

- MEDIA
- FFC_66E

66E-206

Explanation: The Random Write/Read/Compare Test has detected a hardware error while testing the DVD-RAM test medium.

Response: Run Diagnostic on this drive with another DVD-RAM test medium. Use MAP0210 : General problem resolution.

Failing Item:

- FFC_66E
- MEDIA

66E-207

Explanation: The Random Read Test has detected a medium error while testing the CD-ROM test medium.

Response: Run Diagnostic on this drive with another CD-ROM test medium. Use MAP0210 : General problem resolution.

Failing Item:

- MEDIA
- FFC_66E

66E-208

Explanation: The Random Read Test has detected a hardware error while testing the CD-ROM test medium.

Response: Run Diagnostic on this drive with another CD-ROM test medium. Use MAP0210 : General problem resolution.

Failing Item:

- FFC_66E
- MEDIA

66E-209

Explanation: DVD-RAM drive is unable to determine the media type.

Response: Verify that the proper test medium is inserted. Clean the drive. Run Diagnostic on this drive with another test medium. Use MAP0210 : General problem resolution.

Failing Item:

- MEDIA
- FFC_66E

66E-20A

Explanation: DVD-RAM drive has faulty write-protect-detection mechanism.

Response: Verify that the DVD-RAM test medium is not write-protected. Run Diagnostic on this drive with another DVD-RAM test medium. Use MAP0210 : General problem resolution.

Failing Item:

- MEDIA
- FFC_66E

66E-20B

Explanation: DVD-RAM drive has detected a media error.

Response: Verify that the DVD-RAM test medium is inserted properly. Run Diagnostic on this drive with another DVD-RAM test medium. If the test fails with the new test media, replace the defective DVD-ROM drive.

Failing Item:

- MEDIA
 - FFC_66E
-

66E-300

Explanation: SCSI command timeout has occurred.

Response: Replace the defective DVD-ROM drive.

Failing Item:

- FFC_66E
 - FFC_B88
 - FFC_190
-

66E-301

Explanation: Unit Attention has occurred.

Failing Item:

- FFC_B88
 - FFC_190
 - FFC_66E
-

66E-700

Explanation: ELA indicates an irrecoverable hardware error.

Failing Item:

- FFC_66E
-

66E-701

Explanation: ELA indicates an undetermined hardware error.

Failing Item:

- FFC_66E
-

670-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_670
-

670-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_670
-

670-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_670
-

670-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_670
-

670-108

Explanation: The bus test failed.

Failing Item:

- FFC_670
-

670-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_670
-

670-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_670
-

670-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_670
-

670-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_670
-

670-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_670
-

670-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_670
- FFC_B88

670-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_670
-

670-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_670
-

670-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_670
-

670-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_670
 - FFC_B88
-

670-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_670
 - SOFTWARE
-

670-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_670
 - SOFTWARE
-

670-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_670
-

670-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_670
-

670-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_670
-

670-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

670-135

Explanation: The device failed to configure.

Failing Item:

- FFC_670
 - FFC_B88
 - SOFTWARE
-

670-136

Explanation: The certify operation failed.

Failing Item:

- FFC_670
-

670-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_670
 - FFC_B88
 - FFC_190
-

670-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_670

670-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_670

670-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

671-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_671

671-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_671

671-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_671

671-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_671

671-108

Explanation: The bus test failed.

Failing Item:

- FFC_671

671-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_671

671-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_671

671-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_671

671-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_671

671-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_671

671-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_671
- FFC_B88

671-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_671

671-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_671

671-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_671

671-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_671
- FFC_B88

671-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_671
- SOFTWARE

671-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_671
- SOFTWARE

671-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_671

671-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_671

671-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_671

671-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88

- SOFTWARE

671-135

Explanation: The device failed to configure.

Failing Item:

- FFC_671
- FFC_B88
- SOFTWARE

671-136

Explanation: The certify operation failed.

Failing Item:

- FFC_671

671-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_671
- FFC_B88
- FFC_190

671-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_671

671-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_671

671-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

672-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_672
-

672-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_672
-

672-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_672
-

672-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_672
-

672-108

Explanation: The bus test failed.

Failing Item:

- FFC_672
-

672-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_672
-

672-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_672
-

672-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_672
-

672-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_672
-

672-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_672
-

672-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_672
 - FFC_B88
-

672-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_672
-

672-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_672
-

672-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_672
-

672-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_672
 - FFC_B88
-

672-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_672
- SOFTWARE

672-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_672
 - SOFTWARE
-

672-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_672
-

672-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_672
-

672-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_672
-

672-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

672-135

Explanation: The device failed to configure.

Failing Item:

- FFC_672
 - FFC_B88
 - SOFTWARE
-

672-136

Explanation: The certify operation failed.

Failing Item:

- FFC_672
-

672-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_672
 - FFC_B88
 - FFC_190
-

672-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_672
-

672-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_672
-

672-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

673-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_673
-

673-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_673
-

673-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_673
-

673-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_673
-

673-108

Explanation: The bus test failed.

Failing Item:

- FFC_673
-

673-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_673
-

673-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_673
-

673-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_673
-

673-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_673
-

673-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_673
-

673-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_673
 - FFC_B88
-

673-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_673
-

673-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_673
-

673-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_673
-

673-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_673
 - FFC_B88
-

673-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_673
 - SOFTWARE
-

673-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_673
 - SOFTWARE
-

673-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_673
-

673-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_673
-

673-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_673
-

673-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

673-135

Explanation: The device failed to configure.

Failing Item:

- FFC_673
 - FFC_B88
 - SOFTWARE
-

673-136

Explanation: The certify operation failed.

Failing Item:

- FFC_673
-

673-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_673
 - FFC_B88
 - FFC_190
-

673-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_673
-

673-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_673
-

673-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

674-101

Explanation: IBM ARTIC960Rx PCI Adapter Central Processing Unit (CPU) test failure.

Failing Item:

- FFC_674
 - FFC_C94
 - FFC_C95
-

674-102

Explanation: IBM ARTIC960Rx PCI Adapter Timer test failure.

Failing Item:

- FFC_674
 - FFC_C94
 - FFC_C95
-

674-103

Explanation: IBM ARTIC960Rx PCI Adapter Bus Interface test failure.

Failing Item:

- FFC_674
 - FFC_C94
 - FFC_C95
-

674-104

Explanation: IBM ARTIC960Rx PCI Adapter Dynamic Random Access Memory (DRAM) test failure.

Failing Item:

- FFC_C94
- FFC_674
- FFC_C95

674-105

Explanation: IBM ARTIC960Rx PCI Adapter Memory Protection test failure.

Failing Item:

- FFC_674
 - FFC_C94
 - FFC_C95
-

674-106

Explanation: IBM ARTIC960Rx PCI Adapter Debug Port test failure.

Failing Item:

- FFC_674
 - FFC_C94
 - FFC_C95
-

674-107

Explanation: Interface board wrap test failure.

Failing Item:

- FFC_C95
 - FFC_674
 - FFC_C97
-

674-110

Explanation: IBM ARTIC960Rx PCI Adapter Download Diagnostics test failure.

Failing Item:

- FFC_C94
 - FFC_674
 - FFC_C95
-

674-123

Explanation: Interface board non-wrap test failure.

Failing Item:

- FFC_C95
 - FFC_C97
-

674-150

Explanation: Device configuration failure.

Failing Item:

- FFC_674
 - SOFTWARE
 - FFC_227
-

674-151

Explanation: Device driver indicates a hardware failure.

Failing Item:

- FFC_674
 - SOFTWARE
 - FFC_227
-

674-152

Explanation: Failure and error in determining which type of IBM ARTIC960Rx PCI Adapter.

Failing Item:

- FFC_674
-

674-153

Explanation: Error log analysis indicates a IBM ARTIC960Rx PCI Adapter failure. Action: Use the erprt command to check error log.

Failing Item:

- FFC_674
 - FFC_227
 - FFC_C94
 - SOFTWARE
-

674-154

Explanation: IBM ARTIC960Rx PCI Adapter initialization failure.

Failing Item:

- FFC_C94
 - FFC_674
 - FFC_C95
-

674-155

Explanation: IBM ARTIC960Rx PCI Adapter initialization failure.

Failing Item:

- FFC_674
 - FFC_C94
 - FFC_C95
-

674-156

Explanation: IBM ARTIC960Rx PCI Adapter initialization failure.

Failing Item:

- FFC_C95
 - FFC_674
 - FFC_C94
-

674-157

Explanation: Cable wrap test failure.

Failing Item:

- FFC_C97
- FFC_C95

675-101

Explanation: IBM ARTIC960Hx Adapter Central Processing Unit (CPU) test failure.

Failing Item:

- FFC_675
- FFC_C94
- FFC_C95

675-102

Explanation: IBM ARTIC960Hx Adapter Timer test failure.

Failing Item:

- FFC_675
- FFC_C94
- FFC_C95

675-103

Explanation: IBM ARTIC960Hx Adapter Bus Interface test failure.

Failing Item:

- FFC_675
- FFC_C94
- FFC_C95

675-104

Explanation: IBM ARTIC960Hx Adapter Dynamic Random Access Memory (DRAM) test failure.

Failing Item:

- FFC_C94
- FFC_675
- FFC_C95

675-105

Explanation: IBM ARTIC960Hx Adapter Memory Protection test failure.

Failing Item:

- FFC_675
- FFC_C94
- FFC_C95

675-106

Explanation: IBM ARTIC960Hx Adapter Debug Port test failure.

Failing Item:

- FFC_675
- FFC_C94
- FFC_C95

675-107

Explanation: Interface board wrap test failure.

Failing Item:

- FFC_C95
- FFC_675
- FFC_C97

675-110

Explanation: IBM ARTIC960Hx Adapter Download Diagnostics test failure.

Failing Item:

- FFC_C94
- FFC_675
- FFC_C95

675-123

Explanation: Interface board non-wrap test failure.

Failing Item:

- FFC_C95
- FFC_675
- FFC_C94

675-150

Explanation: Device configuration failure.

Failing Item:

- FFC_675
- SOFTWARE
- FFC_227

675-151

Explanation: Device driver indicates a hardware failure.

Failing Item:

- FFC_675
- SOFTWARE
- FFC_227

675-152

Explanation: Failure and error in determining which type of IBM ARTIC960Hx Adapter.

Failing Item:

- FFC_675
-

675-153

Explanation: Error log analysis indicates a IBM ARTIC960Hx Adapter failure.

Response: Use the errprt command to check error log.

Failing Item:

- FFC_675
 - FFC_227
 - FFC_C94
 - SOFTWARE
-

675-154

Explanation: IBM ARTIC960Hx Adapter initialization failure.

Failing Item:

- FFC_C94
 - FFC_675
 - FFC_C95
-

675-155

Explanation: IBM ARTIC960Hx Adapter initialization failure.

Failing Item:

- FFC_675
 - FFC_C94
 - FFC_C95
-

675-156

Explanation: IBM ARTIC960Hx Adapter initialization failure.

Failing Item:

- FFC_C95
 - FFC_675
 - FFC_C94
-

675-157

Explanation: Cable wrap test failure.

Response: Use the MAP0210 : General problem resolution.

Failing Item:

- FFC_C98
-

- FFC_C97

- FFC_C95
-

677-101

Explanation: The Fibre Channel Adapter configuration failed.

Failing Item:

- FFC_677
-

677-102

Explanation: The Reset test failed.

Response: Use the MAP0210 : General problem resolution.

Failing Item:

- FFC_677
-

677-103

Explanation: The Register test failed.

Response: Use the MAP0210 : General problem resolution.

Failing Item:

- FFC_677
-

677-104

Explanation: The SRAM test failed.

Response: Use the MAP0210 : General problem resolution.

Failing Item:

- FFC_677
-

677-105

Explanation: The Internal Wrap test failed.

Response: Use the MAP0210 : General problem resolution.

Failing Item:

- FFC_677
-

677-106

Explanation: The Gigabaud Link Module (GLM) Wrap Test Failure.

Failing Item:

- FFC_677
-

677-107

Explanation: The External Wrap test failed.

Response: Use the MAP0210 : General problem resolution.

Failing Item:

- FFC_677
-

677-109

Explanation: Enhanced Error Handling Failure on EADs chip.

Failing Item:

- FFC_221
-

677-110

Explanation: Enhanced Error Handling Failure on adapter.

Failing Item:

- FFC_677
-

677-201

Explanation: The Configuration Register test failed.

Failing Item:

- FFC_677
 - FFC_221
-

677-202

Explanation: The Interrupt test failed.

Response: Use the MAP0210 : General problem resolution.

Failing Item:

- FFC_677
 - FFC_221
-

677-203

Explanation: The PCI Wrap test failed.

Response: Use the MAP0210 : General problem resolution.

Failing Item:

- FFC_677
 - FFC_221
-

677-204

Explanation: The DMA test failed.

Response: Use the MAP0210 : General problem resolution.

Failing Item:

- FFC_677
 - FFC_221
-

677-205

Explanation: I/O error on a read/write operation.

Failing Item:

- FFC_677
 - FFC_221
-

677-701

Explanation: Error log analysis indicates that an error has occurred with the adapter.

Failing Item:

- FFC_677
 - FFC_221
-

677-703

Explanation: Error log analysis indicates that an unknown adapter error has occurred.

Failing Item:

- FFC_677
-

677-704

Explanation: Error log analysis indicates that an adapter error has occurred.

Failing Item:

- FFC_677
-

677-705

Explanation: A parity error has been detected. The adapter must be replaced immediately. Failure to do so could result in data being read or written incorrectly.

Failing Item:

- FFC_677
-

677-706

Explanation: A fatal hardware error has occurred. This adapter was successfully taken offline. It will remain offline until reconfigured or the system is rebooted. This adapter must be replaced and not brought back online. Failure to adhere to this action could result in data being read or written incorrectly or in the loss of data.

Failing Item:

- FFC_677
-

678-098

Explanation: Tape drive indicates an error.

Failing Item:

- FFC_678
-

678-099

Explanation: Tape drive not found.

Failing Item:

- FFC_678
 - FFC_B88
-

678-101

Explanation: Timeout while attempting to communicate with SCSI device.

Failing Item:

- FFC_678
-

678-102

Explanation: The SCSI device indicates busy.

Failing Item:

- FFC_678
-

678-103

Explanation: The SCSI device indicates a reservation conflict.

Failing Item:

- FFC_678
-

678-104

Explanation: The SCSI device indicates a check condition.

Failing Item:

- FFC_678
-

678-105

Explanation: An error is detected in request sense data.

Failing Item:

- FFC_678
-

678-107

Explanation: Sense data from the SCSI drive has unexpected data.

Failing Item:

- FFC_678
-

678-110

Explanation: The Reserve command failed.

Failing Item:

- FFC_678
-

678-111

Explanation: Invalid condition from the drive after a reserve.

Failing Item:

- FFC_678
-

678-112

Explanation: The write-protect sensor test failed.

Failing Item:

- FFC_678
-

678-113

Explanation: Invalid condition from drive after a request sense.

Failing Item:

- FFC_678
-

678-114

Explanation: Timeout while attempting to communicate with the SCSI device.

Failing Item:

- FFC_678
-

678-120

Explanation: The Inquiry command failed.

Failing Item:

- FFC_678
-

678-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_678
 - MEDIA
-

678-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_678

678-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

678-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_678
- MEDIA

678-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_678

678-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_678

678-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_678
- MEDIA

678-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_678

678-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_678
- MEDIA

678-161

Explanation: Invalid condition from the drive after a reserve.

Failing Item:

- FFC_678
- FFC_B88

678-163

Explanation: Invalid condition from the drive after a request sense.

Failing Item:

- FFC_678
 - FFC_B88
-

678-164

Explanation: Timeout while attempting to communicate with the SCSI device.

Failing Item:

- FFC_678
 - FFC_B88
-

678-165

Explanation: Write, Read and Compare Test failed.

Failing Item:

- FFC_678
 - FFC_B88
 - FFC_276
-

678-166

Explanation: Unable to configure the device.

Failing Item:

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-167

Explanation: An unexpected SCSI error occurred.

Failing Item:

- FFC_678
 - FFC_B88
-

678-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_678
-

678-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_678
-

- MEDIA
-

678-16L

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_678
-

678-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_678
 - FFC_B88
 - MEDIA
-

678-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_678
 - FFC_B88
-

678-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_678
 - MEDIA
-

678-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_678

678-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_678
- MEDIA

678-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_678

678-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_678

678-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_678
- MEDIA

678-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_678

678-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_678
- MEDIA

678-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_678

678-261

Explanation: The device open failed.

Failing Item:

- FFC_678

678-300

Explanation: The device configuration failed.

Failing Item:

- FFC_678
- SOFTWARE

678-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
 - FFC_678
 - SOFTWARE
-

678-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_678
 - MEDIA
-

678-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_678
-

678-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-417

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-418

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-419

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-41A

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-41B

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-41C

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-41D

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-41E

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-41F

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-511

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_678
 - FFC_B88
-

678-512

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_678
 - FFC_B88
-

678-513

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_678
 - FFC_B88
-

678-514

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_678
 - FFC_B88
-

678-515

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_678
 - FFC_B88
-

678-516

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_678
 - FFC_B88
-

678-517

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_678
 - FFC_B88
-

678-518

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_678
 - FFC_B88
-

678-519

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_678
 - FFC_B88
-

678-51A

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_678
 - FFC_B88
-

678-51B

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_678
 - FFC_B88
-

678-51C

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_678
 - FFC_B88
-

678-51D

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_678
 - FFC_B88
-

678-51E

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_678
 - FFC_B88
-

678-51F

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_678
- FFC_B88

678-520

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_678
- FFC_B88

678-521

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_678
- FFC_B88

678-522

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_678
- FFC_B88

678-523

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_678
- FFC_B88

678-611

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-612

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_678

- FFC_B88
- SOFTWARE

678-613

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-614

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-615

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-616

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-617

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-618

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-619

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-61A

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-61B

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-61C

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-61D

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-61E

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-61F

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-620

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-621

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-622

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-623

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-711

Explanation: A device timeout error occurred.

Failing Item:

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-712

Explanation: A device timeout error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-713

Explanation: A device timeout error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-714

Explanation: A device timeout error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-715

Explanation: A device timeout error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-716

Explanation: A device timeout error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-717

Explanation: A device timeout error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-718

Explanation: A device timeout error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-719

Explanation: A device timeout error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-71A

Explanation: A device timeout error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-71B

Explanation: A device timeout error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-71C

Explanation: A device timeout error occurred.

Failing Item:

- FFC_678
- FFC_B88
- SOFTWARE

678-71D

Explanation: A device timeout error occurred.

Failing Item:

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-71E

Explanation: A device timeout error occurred.

Failing Item:

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-71F

Explanation: A device timeout error occurred.

Failing Item:

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-720

Explanation: A device timeout error occurred.

Failing Item:

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-721

Explanation: A device timeout error occurred.

Failing Item:

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-722

Explanation: A device timeout error occurred.

Failing Item:

- FFC_678
 - FFC_B88
 - SOFTWARE
-

678-723

Explanation: A device timeout error occurred.

Failing Item:

- FFC_678
 - FFC_B88
 - SOFTWARE
-

679-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_679
-

679-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_679
-

679-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_679
-

679-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_679
-

679-108

Explanation: The bus test failed.

Failing Item:

- FFC_679
-

679-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_679
-

679-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_679
-

679-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_679
-

679-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

679-117 • 679-136

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_679
-

679-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_679
-

679-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_679
 - FFC_B88
-

679-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_679
-

679-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_679
-

679-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_679
-

679-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_679
 - FFC_B88
-

679-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_679
 - SOFTWARE
-

679-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_679
 - SOFTWARE
-

679-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_679
-

679-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_679
-

679-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_679
-

679-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

679-135

Explanation: The device failed to configure.

Failing Item:

- FFC_679
 - FFC_B88
 - SOFTWARE
-

679-136

Explanation: The certify operation failed.

Failing Item:

- FFC_679
-

679-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_679
 - FFC_B88
 - FFC_190
-

679-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_679
-

679-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_679
-

679-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

67B-100

Explanation: POST failed: Catastrophic error detected.

Failing Item:

- FFC_67B
-

67B-601

Explanation: ELA indicates a low battery warning.

Failing Item:

- FFC_11A
-

67B-602

Explanation: ELA indicates a mesh violation - tamper.

Failing Item:

- FFC_67B
-

67B-603

Explanation: ELA indicates the coprocessor is held in a reset condition.

Failing Item:

- FFC_67B
-

67B-604

Explanation: ELA indicates a +3, +5, or +12 V over-voltage condition.

Failing Item:

- FFC_67B
-

67B-605

Explanation: ELA indicates an out-of-temperature specification.

Failing Item:

- FFC_67B
-

67B-606

Explanation: ELA indicates a X-ray or dead battery condition.

Failing Item:

- FFC_67B
-

67B-607

Explanation: ELA indicates: Intrusion latch.

Failing Item:

- FFC_67B
-

67E-001

Explanation: Adapter problem.

Failing Item:

- FFC_67E
 - FFC_221
 - MONITOR
 - CABLE
-

67E-002

Explanation: Display problem.

Failing Item:

- FFC_67E
 - MONITOR
 - CABLE
-

67E-003

Explanation: Software error.

Failing Item:

- SOFTWARE
- FFC_67E

67E-004

Explanation: The monitor test failed.

Failing Item:

- FFC_67E
- MONITOR
- CABLE

681-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_681

681-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_681

681-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_681

681-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_681

681-108

Explanation: The bus test failed.

Failing Item:

- FFC_681

681-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_681

681-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_681

681-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_681

681-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_681

681-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_681

681-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_681
- FFC_B88

681-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_681

681-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_681

681-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_681

681-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_681
 - FFC_B88
-

681-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_681
 - SOFTWARE
-

681-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_681
 - SOFTWARE
-

681-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_681
-

681-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_681
-

681-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_681
-

681-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

- SOFTWARE
-

681-135

Explanation: The device failed to configure.

Failing Item:

- FFC_681
 - FFC_B88
 - SOFTWARE
-

681-136

Explanation: The certify operation failed.

Failing Item:

- FFC_681
-

681-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_681
 - FFC_B88
 - FFC_190
-

681-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_681
-

681-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_681
-

681-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

683-128

Explanation: Error Log Analysis Indicates hardware failure VSS2105 Model B09.

Failing Item:

- FFC_683
-

686-114

Explanation: The register verification test failed.

Failing Item:

- FFC_686
-

686-124

Explanation: The adapter RAM verification test failed.

Failing Item:

- FFC_686
-

686-152

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_686
 - FFC_D57
-

686-153

Explanation: The modem control line test failed.

Failing Item:

- FFC_686
-

686-252

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_686
-

686-253

Explanation: The modem control line test failed.

Failing Item:

- FFC_686
-

686-501

Explanation: Adapter Reset failed

Failing Item:

- FFC_686
-

686-511

Explanation: Adapter to host memory test failed (byte tag test).

Failing Item:

- FFC_686
-

686-512

Explanation: Adapter to host memory test failed (word tag test).

Failing Item:

- FFC_686
-

686-513

Explanation: Adapter to host memory test failed (byte pattern test).

Failing Item:

- FFC_686
-

686-514

Explanation: Adapter to host memory test failed (word pattern test).

Failing Item:

- FFC_686
-

686-521

Explanation: Adapter BIOS POST CPU failed.

Failing Item:

- FFC_686
-

686-522

Explanation: Adapter BIOS POST Checksum failed.

Failing Item:

- FFC_686
-

686-523

Explanation: Adapter BIOS POST Timer failed.

Failing Item:

- FFC_686
-

686-524

Explanation: Adapter BIOS POST RAM failed.

Failing Item:

- FFC_686
-

686-526

Explanation: Adapter BIOS POST Async Ports failed.

Failing Item:

- FFC_686
-

686-527

Explanation: Adapter BIOS test failed.

Failing Item:

- FFC_686
-

686-528

Explanation: Adapter BIOS Reset failed.

Failing Item:

- FFC_686
-

686-529

Explanation: Adapter BIOS Download failed.

Failing Item:

- FFC_686
-

686-531

Explanation: Adapter BIOS Command failed.

Failing Item:

- FFC_686
-

686-533

Explanation: Adapter BIOS Timer test failed.

Failing Item:

- FFC_686
-

686-534

Explanation: Adapter BIOS RAM test failed.

Failing Item:

- FFC_686
-

686-541

Explanation: Port async internal loopback test failed (general).

Failing Item:

- FFC_686
-

686-542

Explanation: Port async internal loopback test failed (no response from the port).

Failing Item:

- FFC_686
-

686-551

Explanation: Port async external loopback test failed (general).

Failing Item:

- FFC_686
-

686-552

Explanation: Port async external loopback test failed (data signals).

Failing Item:

- FFC_686
-

686-553

Explanation: Port async external loopback test failed (control signals).

Failing Item:

- FFC_686
-

686-554

Explanation: Port async external loopback test failed (modem signals).

Failing Item:

- FFC_686
-

686-555

Explanation: Port async external loopback test failed (no response from port).

Failing Item:

- FFC_686
-

686-901

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_686
-

686-902

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_686

686-903

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_686

686-904

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_686

686-905

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_686

686-906

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_686

686-907

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_686

686-908

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_686

686-909

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_686
-

686-910

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_686

686-911

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_686

686-912

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_686

686-913

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_686

686-914

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_686

686-915

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_686

686-916

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_686

686-917

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_686
-

686-918

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_686
-

686-919

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_686
-

686-920

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 with a FFC of 686; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_686
-

686-921

Explanation: The adapter failed to configure.

Failing Item:

- FFC_686
 - SOFTWARE
-

686-922

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a

network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_686
-

686-923

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_686
-

686-924

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_686
-

686-925

Explanation: The adapter failed to configure software

Failing Item:

- FFC_686
-

686-926

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_686
-

686-927

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_686
-

686-928

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_686
-

686-929

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_686
-

686-930

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_686
-

686-931

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_686
-

686-932

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_686
-

686-933

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_686
-

686-934

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_686
-

686-935

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_686

686-936

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_686

686-937

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_686

686-938

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_686

686-939

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_686

686-940

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_686

686-941

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_686

686-942

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_686
-

686-943

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_686

686-944

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_686

686-945

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_686

686-946

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_686

686-947

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_686

686-948

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_686

686-949

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_686

686-950

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_686
-

687-111

Explanation: The controller register test failed.

Failing Item:

- FFC_687
-

687-114

Explanation: The register verification test failed.

Failing Item:

- FFC_687
-

687-124

Explanation: The adapter RAM verification test failed.

Failing Item:

- FFC_687
-

687-144

Explanation: The sync line test failed.

Failing Item:

- FFC_687
-

687-152

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_837
 - FFC_684
 - FFC_687
 - FFC_152
-

687-153

Explanation: The modem control line test failed.

Failing Item:

- FFC_687
-

687-244

Explanation: The sync line test failed.

Failing Item:

- FFC_687
-

687-252

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_687
-

687-253

Explanation: The modem control line test failed.

Failing Item:

- FFC_687
-

687-501

Explanation: Adapter Reset failed.

Failing Item:

- FFC_687
-

687-502

Explanation: Adapter Fuse failed.

Failing Item:

- FFC_687
-

687-511

Explanation: Adapter to host memory test failed (byte tag test).

Failing Item:

- FFC_687
-

687-512

Explanation: Adapter to host memory test failed (word tag test).

Failing Item:

- FFC_687
-

687-513

Explanation: Adapter to host memory test failed (byte pattern test).

Failing Item:

- FFC_687
-

687-514

Explanation: Adapter to host memory test failed (word pattern test).

Failing Item:

- FFC_687
-

687-521

Explanation: Adapter BIOS POST CPU failed.

Failing Item:

- FFC_687
-

687-522**Explanation:** Adapter BIOS POST Checksum failed.**Failing Item:**

- FFC_687
-

687-523**Explanation:** Adapter BIOS POST Timer failed.**Failing Item:**

- FFC_687
-

687-524**Explanation:** Adapter BIOS POST RAM failed.**Failing Item:**

- FFC_687
-

687-525**Explanation:** Adapter BIOS POST Sync Line failed.**Failing Item:**

- FFC_687
-

687-527**Explanation:** Adapter BIOS test failed.**Failing Item:**

- FFC_687
-

687-528**Explanation:** Adapter BIOS Reset failed.**Failing Item:**

- FFC_687
-

687-529**Explanation:** Adapter BIOS Download failed.**Failing Item:**

- FFC_687
-

687-531**Explanation:** Adapter BIOS Command failed.**Failing Item:**

- FFC_687
-

687-533**Explanation:** Adapter BIOS Timer test failed.**Failing Item:**

- FFC_687

687-534**Explanation:** Adapter BIOS RAM test failed.**Failing Item:**

- FFC_687
-

687-541**Explanation:** Port sync internal loopback test failed.**Failing Item:**

- FFC_687
-

687-551**Explanation:** Port sync external loopback test failed.**Failing Item:**

- FFC_687
-

687-600**Explanation:** 232RAN status test failed.**Failing Item:**

- FFC_837
-

687-700**Explanation:** 422RAN status test failed.**Failing Item:**

- FFC_684
-

687-901**Explanation:** An unexpected error occurred that can be attributed to software or hardware.**Response:** Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.**Failing Item:**

- SOFTWARE
 - FFC_687
-

687-902**Explanation:** An unexpected error occurred that can be attributed to software or hardware.**Response:** Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.**Failing Item:**

- SOFTWARE
- FFC_687

687-903

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_687

687-904

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_687

687-905

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_687

687-906

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_687

687-907

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_687

687-908

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_687

687-909

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_687

687-910

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_687

687-911

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_687
-

687-912

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_687
-

687-913

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_687
-

687-914

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_687
-

687-915

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_687
-

687-916

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_687
-

687-917

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_687
-

687-918

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_687
-

687-919

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_687
-

687-920

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_687
-

687-921

Explanation: The adapter failed to configure.

Failing Item:

- SOFTWARE
 - FFC_687
-

687-922

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_687
-

687-923

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a

network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_687
-

687-924

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_687
-

687-925

Explanation: The adapter failed to configure.

Failing Item:

- FFC_687
 - SOFTWARE
-

687-926

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_687
-

687-927

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
 - FFC_687
-

687-928

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_687
-

687-929

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_687
-

687-930

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_687
-

687-931

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE

- FFC_687
-

687-932

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_687
-

687-933

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_687
-

687-934

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_687
-

687-935

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_687

687-936

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_687

687-937

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_687

687-938

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_687

687-939

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_687

687-940

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_687

687-941

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_687

687-942

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_687

687-943

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General

problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_687

687-944

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_687

687-945

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_687

687-946

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_687

687-947

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or

if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_687

687-948

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_687

687-949

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_687

687-950

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 687; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_687

689-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_689

689-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_689

689-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_689

689-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_689

689-108

Explanation: The bus test failed.

Failing Item:

- FFC_689

689-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_689

689-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_689

689-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_689

689-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_689

689-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_689

689-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_689
- FFC_B88

689-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_689

689-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_689

689-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_689

689-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_689
- FFC_B88

689-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_689
- SOFTWARE

689-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_689
 - SOFTWARE
-

689-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_689
-

689-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_689
-

689-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_689
-

689-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

689-135

Explanation: The device failed to configure.

Failing Item:

- FFC_689
 - FFC_B88
 - SOFTWARE
-

689-136

Explanation: The certify operation failed.

Failing Item:

- FFC_689
-

689-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_689
 - FFC_B88
 - FFC_190
-

689-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_689
-

689-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_689
-

689-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

68C-101

Explanation: Timeout while attempting to communicate with SCSI device.

Failing Item:

- FFC_68C
-

68C-102

Explanation: The SCSI device indicates busy.

Failing Item:

- FFC_68C
-

68C-103

Explanation: The SCSI device indicates a reservation conflict.

Failing Item:

- FFC_68C
-

68C-104

Explanation: The SCSI device indicates a check condition.

Failing Item:

- FFC_68C
-

68C-105

Explanation: An error is detected in request sense data.

Failing Item:

- FFC_68C
-

68C-107

Explanation: Sense data from the SCSI drive has unexpected data.

Failing Item:

- FFC_68C
-

68C-110

Explanation: The Reserve command failed.

Failing Item:

- FFC_68C
-

68C-111

Explanation: Invalid condition from the drive after a reserve.

Failing Item:

- FFC_68C
-

68C-112

Explanation: The write-protect sensor test failed.

Failing Item:

- FFC_68C
-

68C-113

Explanation: Invalid condition from drive after a request sense.

Failing Item:

- FFC_68C
-

68C-114

Explanation: Timeout while attempting to communicate with the SCSI device.

Failing Item:

- FFC_68C
-

68C-120

Explanation: The Inquiry command failed.

Failing Item:

- FFC_68C
-

68C-130

Explanation: The Load command failed.

Failing Item:

- FFC_68C
 - MEDIA
-

68C-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

68C-135

Explanation: The Unload command failed.

Failing Item:

- FFC_68C
 - MEDIA
-

68C-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_68C
-

68C-150

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_68C
 - MEDIA
-

68C-160

Explanation: The Send Diagnostic command failed.

Failing Item:

- FFC_68C
 - MEDIA
-

68C-161

Explanation: Invalid condition from the drive after a reserve.

Failing Item:

- FFC_68C
 - FFC_B88
-

68C-163

Explanation: Invalid condition from the drive after a request sense.

Failing Item:

- FFC_68C
 - FFC_B88
-

68C-164

Explanation: Timeout while attempting to communicate with the SCSI device.

Failing Item:

- FFC_68C
 - FFC_B88
-

68C-165

Explanation: Write, Read and Compare Test failed.

Failing Item:

- FFC_68C
 - FFC_B88
 - FFC_276
-

68C-166

Explanation: Unable to configure the device.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_68C
 - FFC_B88
 - SOFTWARE
-

68C-167

Explanation: An unexpected SCSI error occurred.

Failing Item:

- FFC_68C
 - FFC_B88
-

68C-168

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

68C-169

Explanation: The Send Diagnostic command failed.

Failing Item:

- FFC_68C
 - MEDIA
-

68C-170

Explanation: The Read, Write and Compare test failed.

Failing Item:

- FFC_68C
 - FFC_B88
 - MEDIA
-

68C-180

Explanation: The Load command failed.

Failing Item:

- FFC_68C
 - MEDIA
-

68C-185

Explanation: The Unload command failed.

Failing Item:

- FFC_68C
 - MEDIA
-

68C-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_68C
-

68C-200

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_68C
 - MEDIA
-

68C-201

Explanation: Error diagnosed from error log analysis.

Failing Item:

- FFC_68C
- FFC_B88

68C-210

Explanation: The device configuration failed.

Failing Item:

- FFC_68C
- FFC_B88

68C-211

Explanation: The device open failed.

Failing Item:

- FFC_68C
- FFC_B88

68C-220

Explanation: The Release command failed.

Failing Item:

- FFC_68C

68C-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_68C

68C-240

Explanation: The Openx command failed.

Failing Item:

- FFC_68C

68C-260

Explanation: The device configuration failed.

Failing Item:

- FFC_68C

68C-261

Explanation: The device open failed.

Failing Item:

- FFC_68C

68C-300

Explanation: The device configuration failed.

Failing Item:

- FFC_68C
- SOFTWARE

68C-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
- FFC_68C
- SOFTWARE

68C-320

Explanation: Error log analysis indicates a failure.

Failing Item:

- FFC_68C
- MEDIA

68C-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_68C
- FFC_B88

- SOFTWARE

68C-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-417

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-418

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-419

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-511

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_68C
- FFC_B88

68C-512

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_68C
- FFC_B88

68C-513

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_68C
 - FFC_B88
-

68C-514

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_68C
- FFC_B88

68C-515

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_68C
- FFC_B88

68C-516

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_68C
- FFC_B88

68C-517

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_68C
- FFC_B88

68C-518

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_68C
- FFC_B88

68C-519

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_68C
- FFC_B88

68C-520

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_68C
- FFC_B88

68C-521

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_68C
- FFC_B88

68C-522

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_68C
- FFC_B88

68C-523

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_68C
- FFC_B88

68C-611

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-612

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-613

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-614

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_68C
 - FFC_B88
 - SOFTWARE
-

68C-615

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_68C
 - FFC_B88
 - SOFTWARE
-

68C-616

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_68C
 - FFC_B88
 - SOFTWARE
-

68C-617

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_68C
 - FFC_B88
 - SOFTWARE
-

68C-618

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_68C
 - FFC_B88
 - SOFTWARE
-

68C-619

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_68C
 - FFC_B88
 - SOFTWARE
-

68C-620

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_68C
 - FFC_B88
 - SOFTWARE
-

68C-621

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_68C
 - FFC_B88
 - SOFTWARE
-

68C-622

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_68C
 - FFC_B88
 - SOFTWARE
-

68C-623

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_68C
 - FFC_B88
 - SOFTWARE
-

68C-711

Explanation: A device timeout error occurred.

Failing Item:

- FFC_68C
 - FFC_B88
 - SOFTWARE
-

68C-712

Explanation: A device timeout error occurred.

Failing Item:

- FFC_68C
 - FFC_B88
 - SOFTWARE
-

68C-713

Explanation: A device timeout error occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-714

Explanation: A device timeout error occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-715

Explanation: A device timeout error occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-716

Explanation: A device timeout error occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-717

Explanation: A device timeout error occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-718

Explanation: A device timeout error occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-719

Explanation: A device timeout error occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-720

Explanation: A device timeout error occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-721

Explanation: A device timeout error occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-722

Explanation: A device timeout error occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68C-723

Explanation: A device timeout error occurred.

Failing Item:

- FFC_68C
- FFC_B88
- SOFTWARE

68E-001

Explanation: Software error.

Failing Item:

- SOFTWARE
- FFC_68E

68E-002

Explanation: Adapter failure.

Failing Item:

- FFC_68E

- SOFTWARE

68E-003

Explanation: Adapter failure.

Failing Item:

- FFC_68E
- FFC_227

68E-004

Explanation: Display failure.

Failing Item:

- FFC_68E
- MONITOR
- CABLE

68E-005

Explanation: Adapter failure.

Failing Item:

- FFC_68E
- FFC_227
- MONITOR
- CABLE

690-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_690

690-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_690

690-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_690

690-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_690

690-108

Explanation: The bus test failed.

Failing Item:

- FFC_690

690-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_690

690-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_690

690-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_690

690-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_690

690-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_690

690-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_690
- FFC_B88

690-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_690

690-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_690
-

690-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_690
-

690-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_690
 - FFC_B88
-

690-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_690
 - SOFTWARE
-

690-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_690
 - SOFTWARE
-

690-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_690
-

690-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_690
-

690-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_690
-

690-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

690-135

Explanation: The device failed to configure.

Failing Item:

- FFC_690
 - FFC_B88
 - SOFTWARE
-

690-136

Explanation: The certify operation failed.

Failing Item:

- FFC_690
-

690-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_690
 - FFC_B88
 - FFC_190
-

690-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_690
-

690-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_690
-

690-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

692-110

Explanation: The Reserve command failed.

Failing Item:

- FFC_692
-

692-120

Explanation: The Inquiry command failed.

Failing Item:

- FFC_692
-

692-130

Explanation: The Load command failed.

Failing Item:

- FFC_692
 - MEDIA
-

692-135

Explanation: The Unload command failed.

Failing Item:

- FFC_692
 - MEDIA
-

692-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_692
-

692-150

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_692
 - MEDIA
-

692-160

Explanation: The Send Diagnostic command failed.

Failing Item:

- FFC_692
 - MEDIA
-

692-169

Explanation: The Send Diagnostic command failed.

Failing Item:

- FFC_692
 - MEDIA
-

692-170

Explanation: The Read, Write and Compare test failed.

Failing Item:

- FFC_692
 - FFC_B88
 - MEDIA
-

692-180

Explanation: The Load command failed.

Failing Item:

- FFC_692
 - MEDIA
-

692-185

Explanation: The Unload command failed.

Failing Item:

- FFC_692
 - MEDIA
-

692-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_692
-

692-200

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_692
 - MEDIA
-

692-210

Explanation: The device configuration failed.

Failing Item:

- FFC_692
- FFC_B88

692-220

Explanation: The Release command failed.

Failing Item:

- FFC_692

692-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_692

692-240

Explanation: The Openx command failed.

Failing Item:

- FFC_692

692-300

Explanation: The device configuration failed.

Failing Item:

- FFC_692
- SOFTWARE

692-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
- FFC_692
- SOFTWARE

692-320

Explanation: Error log analysis indicates a failure.

Failing Item:

- FFC_692
- MEDIA

692-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_692

- FFC_B88
- SOFTWARE

692-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

692-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

692-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

692-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

692-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

692-417

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_692
 - FFC_B88
 - SOFTWARE
-

692-418

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_692
 - FFC_B88
 - SOFTWARE
-

692-419

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_692
 - FFC_B88
 - SOFTWARE
-

692-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_692
 - FFC_B88
 - SOFTWARE
-

692-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_692
 - FFC_B88
 - SOFTWARE
-

692-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_692
 - FFC_B88
 - SOFTWARE
-

692-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_692
 - FFC_B88
 - SOFTWARE
-

692-511

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_692
 - FFC_B88
-

692-512

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_692
 - FFC_B88
-

692-513

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_692
 - FFC_B88
-

692-514

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_692
 - FFC_B88
-

692-515

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_692
 - FFC_B88
-

692-516

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_692
 - FFC_B88
-

692-517

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

692-518 • 692-616

- FFC_692
- FFC_B88

692-518

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_692
- FFC_B88

692-519

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_692
- FFC_B88

692-520

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_692
- FFC_B88

692-521

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_692
- FFC_B88

692-522

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_692
- FFC_B88

692-523

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_692
- FFC_B88

692-611

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

692-612

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

692-613

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

692-614

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

692-615

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

692-616

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_692
 - FFC_B88
 - SOFTWARE
-

692-617

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_692
 - FFC_B88
 - SOFTWARE
-

692-618

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_692
 - FFC_B88
 - SOFTWARE
-

692-619

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_692
 - FFC_B88
 - SOFTWARE
-

692-620

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_692
 - FFC_B88
 - SOFTWARE
-

692-621

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_692
 - FFC_B88
 - SOFTWARE
-

692-622

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_692
 - FFC_B88
 - SOFTWARE
-

692-623

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_692
 - FFC_B88
 - SOFTWARE
-

692-711

Explanation: A device timeout error occurred.

Failing Item:

- FFC_692
 - FFC_B88
 - SOFTWARE
-

692-712

Explanation: A device timeout error occurred.

Failing Item:

- FFC_692
 - FFC_B88
 - SOFTWARE
-

692-713

Explanation: A device timeout error occurred.

Failing Item:

- FFC_692
 - FFC_B88
 - SOFTWARE
-

692-714

Explanation: A device timeout error occurred.

Failing Item:

- FFC_692
 - FFC_B88
 - SOFTWARE
-

692-715

Explanation: A device timeout error occurred.

Failing Item:

- FFC_692
 - FFC_B88
 - SOFTWARE
-

692-716

Explanation: A device timeout error occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

692-717

Explanation: A device timeout error occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

692-718

Explanation: A device timeout error occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

692-719

Explanation: A device timeout error occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

692-720

Explanation: A device timeout error occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

692-721

Explanation: A device timeout error occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

692-722

Explanation: A device timeout error occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

692-723

Explanation: A device timeout error occurred.

Failing Item:

- FFC_692
- FFC_B88
- SOFTWARE

693-100

Explanation: Adapter open failed.

Failing Item:

- FFC_693
- FFC_227

693-101

Explanation: Adapter config register test failed.

Failing Item:

- FFC_693
- FFC_227

693-102

Explanation: Adapter reset failed.

Failing Item:

- FFC_693
- FFC_227

693-103

Explanation: Adapter I/O register test failed.

Failing Item:

- FFC_693
- FFC_227

693-104

Explanation: Adapter microcode download test failed.

Failing Item:

- FFC_693
 - FFC_227
-

693-105**Explanation:** Adapter internal wrap test failed.**Failing Item:**

- FFC_693
 - FFC_227
-

693-106**Explanation:** Adapter close failed.**Failing Item:**

- FFC_693
 - FFC_227
-

697-100**Explanation:** Charm memory write failure.**Failing Item:**

- FFC_697
 - SOFTWARE
 - FFC_227
-

697-101**Explanation:** Charm memory read failure.**Failing Item:**

- FFC_697
 - SOFTWARE
 - FFC_227
-

697-102**Explanation:** PCI configuration register write failure.**Failing Item:**

- FFC_697
 - SOFTWARE
 - FFC_227
-

697-103**Explanation:** Charm software reset failure.**Failing Item:**

- FFC_697
 - SOFTWARE
 - FFC_227
-

697-104**Explanation:** Packet memory error.**Failing Item:**

- FFC_697
 - SOFTWARE
-

- FFC_227
-

697-105**Explanation:** Control memory failure.**Failing Item:**

- FFC_697
 - SOFTWARE
 - FFC_227
-

697-106**Explanation:** Link-R detected bad parity.**Failing Item:**

- FFC_697
-

697-107**Explanation:** Suni detected bad parity.**Failing Item:**

- FFC_697
-

697-108**Explanation:** Suni initialization failure.**Failing Item:**

- FFC_697
-

697-109**Explanation:** Loss of light detected in Link test.
Action: Check wrap plug installation.**Failing Item:**

- WRAP_PLUG
 - FFC_697
-

697-10B**Explanation:** External Loopback failed Action: Check wrap plug installation.**Failing Item:**

- WRAP_PLUG
 - FFC_697
-

697-10C**Explanation:** Internal Loopback failed.**Failing Item:**

- FFC_697
 - SOFTWARE
 - FFC_227
-

697-10D

Explanation: DMS failed.

Failing Item:

- FFC_697
- FFC_227
- SOFTWARE

697-121

Explanation: Adapter memory test failure.

Failing Item:

- FFC_697

697-122

Explanation: Adapter checksum failure.

Failing Item:

- FFC_697

697-123

Explanation: Internal wrap test failure

Failing Item:

- FFC_697

697-124

Explanation: External wrap test failure

Failing Item:

- FFC_697

697-125

Explanation: Enhanced Error Handling failure on bus

Failing Item:

- FFC_221

697-126

Explanation: Enhanced Error Handling failure on EADS chip

Failing Item:

- FFC_221

697-127

Explanation: Enhanced Error Handling failure on adapter

Failing Item:

- FFC_697

697-1FF

Explanation: EPROM checksum failed

Failing Item:

- FFC_697
- SOFTWARE
- FFC_227

697-200

Explanation: Klog error

Failing Item:

- SOFTWARE
- FFC_697
- FFC_227

697-201

Explanation: ASL error

Response: Use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_697
- FFC_227

697-202

Explanation: ODM Initialization error

Failing Item:

- SOFTWARE
- FFC_697
- FFC_227

697-203

Explanation: Diagnostic configuration failure.

Failing Item:

- SOFTWARE
- FFC_697
- FFC_227

697-205

Explanation: Error in diag open.

Failing Item:

- SOFTWARE
- FFC_697
- FFC_227

697-206

Explanation: Error in releasing adapter

Failing Item:

- SOFTWARE
 - FFC_697
 - FFC_227
-

697-221

Explanation: Hardware failure opening the adapter

Failing Item:

- FFC_697
 - FFC_221
-

697-222

Explanation: Enhanced Error Handling failure opening the adapter

Failing Item:

- FFC_697
 - FFC_221
-

697-223

Explanation: Interrupt test failure

Failing Item:

- FFC_697
 - FFC_221
-

697-224

Explanation: Adapter DMA test failure

Failing Item:

- FFC_697
 - FFC_221
-

697-701

Explanation: Error Log Analysis indicates an I/O failure on the adapter.

Failing Item:

- FFC_697
 - FFC_221
-

697-702

Explanation: Error Log Analysis indicates an unrecovered interrupt error.

Failing Item:

- FFC_697

698-100

Explanation: Charm memory write failure.

Failing Item:

- FFC_698
 - SOFTWARE
 - FFC_227
-

698-101

Explanation: Charm memory read failure.

Failing Item:

- FFC_698
 - SOFTWARE
 - FFC_227
-

698-102

Explanation: PCI configuration register write failure.

Failing Item:

- FFC_698
 - SOFTWARE
 - FFC_227
-

698-103

Explanation: Charm software reset failure.

Failing Item:

- FFC_698
 - SOFTWARE
 - FFC_227
-

698-104

Explanation: Packet memory error

Failing Item:

- FFC_698
 - SOFTWARE
 - FFC_227
-

698-105

Explanation: Control memory failure.

Failing Item:

- FFC_698
 - SOFTWARE
 - FFC_227
-

698-106

Explanation: Link-R detected bad parity.

Failing Item:

- FFC_698
-

698-107

Explanation: Suni detected bad parity.

Failing Item:

- FFC_698
-

698-108

Explanation: Suni initialization failure.

Failing Item:

- FFC_698
-

698-109

Explanation: Loss of light detected in Link test.
Action: Check wrap plug installation.

Failing Item:

- WRAP_PLUG
 - FFC_698
-

698-10B

Explanation: External Loopback failed Action: Check wrap plug installation.

Failing Item:

- WRAP_PLUG
 - FFC_698
-

698-10C

Explanation: Internal Loopback failed.

Failing Item:

- FFC_698
 - SOFTWARE
 - FFC_227
-

698-10D

Explanation: DMS failed.

Failing Item:

- FFC_698
 - FFC_227
 - SOFTWARE
-

698-121

Explanation: Adapter memory test failure.

Failing Item:

- FFC_698
-

698-122

Explanation: Adapter checksum failure.

Failing Item:

- FFC_698
-

698-123

Explanation: Internal wrap test failure.

Failing Item:

- FFC_698
-

698-124

Explanation: External wrap test failure.

Failing Item:

- FFC_698
-

698-125

Explanation: Enhanced Error Handling failure on bus.

Failing Item:

- FFC_221
-

698-126

Explanation: Enhanced Error Handling failure on EADS chip.

Failing Item:

- FFC_221
-

698-127

Explanation: Enhanced Error Handling failure on adapter.

Failing Item:

- FFC_698
-

698-1FF

Explanation: EPROM checksum failed.

Failing Item:

- FFC_698
 - SOFTWARE
 - FFC_227
-

698-200

Explanation: Klog error.

Failing Item:

- SOFTWARE
 - FFC_698
 - FFC_227
-

698-201

Explanation: ASL error.

Failing Item:

- SOFTWARE
 - FFC_698
 - FFC_227
-

698-202

Explanation: ODM Initialization error.

Failing Item:

- SOFTWARE
 - FFC_698
 - FFC_227
-

698-203

Explanation: Diagnostic configuration failure.

Failing Item:

- SOFTWARE
 - FFC_698
 - FFC_227
-

698-205

Explanation: Error in diag open.

Failing Item:

- SOFTWARE
 - FFC_698
 - FFC_227
-

698-206

Explanation: Error in releasing adapter.

Failing Item:

- SOFTWARE
 - FFC_698
 - FFC_227
-

698-221

Explanation: Hardware failure opening the adapter.

Failing Item:

- FFC_698
 - FFC_221
-

698-222

Explanation: Enhanced Error Handling failure opening the adapter.

Failing Item:

- FFC_698
 - FFC_221
-

698-223

Explanation: Interrupt test failure.

Failing Item:

- FFC_698
 - FFC_221
-

698-224

Explanation: Adapter DMA test failure.

Failing Item:

- FFC_698
 - FFC_221
-

698-701

Explanation: Error Log Analysis indicates an I/O failure on the adapter.

Failing Item:

- FFC_698
 - FFC_221
-

698-702

Explanation: Error Log Analysis indicates an unrecovered interrupt error.

Failing Item:

- FFC_698
-

69B-101

Explanation: EPROM test failure.

Failing Item:

- FFC_69B
-

69B-102

Explanation: Adapter SDRAM failure.

Failing Item:

- FFC_69B
-

69B-103

Explanation: Adapter checksum failure.

Failing Item:

- FFC_69B
-

69B-104

Explanation: Adapter memory test failure.

Failing Item:

- FFC_69B
-

69B-105

Explanation: Adapter buffer test failure.

Failing Item:

- FFC_69B
-

69B-106

Explanation: Adapter cache test failure.

Failing Item:

- FFC_69B
-

69B-107

Explanation: Internal loopback test failure.

Failing Item:

- FFC_69B
-

69B-108

Explanation: External wrap test failure.

Failing Item:

- FFC_69B
-

69B-109

Explanation: Enhanced Error Handling failure on bus.

Failing Item:

- FFC_221
-

69B-110

Explanation: Enhanced Error Handling failure on Eads chip.

Failing Item:

- FFC_221
-

69B-111

Explanation: Enhanced Error Handling failure on adapter.

Failing Item:

- FFC_69B
-

69B-201

Explanation: Hardware failure opening adapter.

Failing Item:

- FFC_69B
 - FFC_221
-

69B-202

Explanation: Interrupt test failure.

Failing Item:

- FFC_69B
 - FFC_221
-

69B-203

Explanation: Adapter DMA test failure.

Failing Item:

- FFC_69B
 - FFC_221
-

69B-204

Explanation: Enhanced error handling failure opening the adapter.

Failing Item:

- FFC_69B
 - FFC_221
-

69B-701

Explanation: Error Log Analysis indicates an I/O failure on the adapter.

Failing Item:

- FFC_69B
-

69D-101

Explanation: EPROM test failure.

Failing Item:

- FFC_69D
-

69D-102**Explanation:** Adapter SDRAM failure.**Failing Item:**

- FFC_69D
-

69D-103**Explanation:** Adapter checksum failure.**Failing Item:**

- FFC_69D
-

69D-104**Explanation:** Adapter memory test failure.**Failing Item:**

- FFC_69D
-

69D-105**Explanation:** Adapter buffer test failure.**Failing Item:**

- FFC_69D
-

69D-106**Explanation:** Adapter cache test failure.**Failing Item:**

- FFC_69D
-

69D-107**Explanation:** Internal loopback test failure.**Failing Item:**

- FFC_69D
-

69D-108**Explanation:** External wrap test failure.**Failing Item:**

- FFC_69D
-

69D-109**Explanation:** Enhanced Error Handling failure on bus.**Failing Item:**

- FFC_221
-

69D-110**Explanation:** Enhanced Error Handling failure on Eads chip.**Failing Item:**

- FFC_221
-

69D-111**Explanation:** Enhanced Error Handling failure on adapter.**Failing Item:**

- FFC_69D
-

69D-201**Explanation:** Hardware failure opening adapter.**Failing Item:**

- FFC_69D
 - FFC_221
-

69D-202**Explanation:** Interrupt test failure.**Failing Item:**

- FFC_69D
 - FFC_221
-

69D-203**Explanation:** Adapter DMA test failure.**Failing Item:**

- FFC_69D
 - FFC_221
-

69D-204**Explanation:** Enhanced error handling failure opening the adapter.**Failing Item:**

- FFC_69D
 - FFC_221
-

69D-701**Explanation:** Error Log Analysis indicates an I/O failure on the adapter.**Failing Item:**

- FFC_69D
-

700-102**Explanation:** An unrecoverable media error occurred.**Failing Item:**

- FFC_700
-

700-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_700
-

700-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_700
-

700-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_700
-

700-108

Explanation: The bus test failed.

Failing Item:

- FFC_700
-

700-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_700
-

700-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_700
-

700-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_700
-

700-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_700
-

700-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_700
-

700-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_700
 - FFC_B88
-

700-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_700
-

700-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_700
-

700-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_700
-

700-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_700
 - FFC_B88
-

700-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_700
 - SOFTWARE
-

700-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_700
 - SOFTWARE
-

700-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_700
-

700-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_700
-

700-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

700-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

700-135

Explanation: The device failed to configure.

Failing Item:

- FFC_700
 - FFC_B88
 - SOFTWARE
-

700-136

Explanation: The certify operation failed.

Failing Item:

- FFC_700
-

700-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_700
 - FFC_B88
 - FFC_190
-

700-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_700
-

700-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_700
-

700-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

701-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_701
-

701-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_701
-

701-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_701
-

701-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_701
-

701-108

Explanation: The bus test failed.

Failing Item:

- FFC_701
-

701-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_701
-

701-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_701
-

701-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_701
-

701-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_701
-

701-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_701
-

701-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_701
 - FFC_B88
-

701-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_701
-

701-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_701
-

701-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_701
-

701-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_701
 - FFC_B88
-

701-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_701
 - SOFTWARE
-

701-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_701
 - SOFTWARE
-

701-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_701
-

701-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_701
-

701-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

701-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

701-135

Explanation: The device failed to configure.

Failing Item:

- FFC_701
 - FFC_B88
 - SOFTWARE
-

701-136

Explanation: The certify operation failed.

Failing Item:

- FFC_701
-

701-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_701
 - FFC_B88
 - FFC_190
-

701-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_701
-

701-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_701
-

701-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

702-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_702
-

702-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_702
-

702-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_702
-

702-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_702
-

702-108

Explanation: The bus test failed.

Failing Item:

- FFC_702
-

702-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_702

702-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_702
-

702-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_702
-

702-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_702
-

702-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_702
-

702-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_702
 - FFC_B88
-

702-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_702
-

702-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_702
-

702-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_702

702-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_702
 - FFC_B88
-

702-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_702
 - SOFTWARE
-

702-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_702
 - SOFTWARE
-

702-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_702
-

702-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_702
-

702-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

702-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88

- SOFTWARE

702-135

Explanation: The device failed to configure.

Failing Item:

- FFC_702
 - FFC_B88
 - SOFTWARE
-

702-136

Explanation: The certify operation failed.

Failing Item:

- FFC_702
-

702-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_702
 - FFC_B88
 - FFC_190
-

702-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_702
-

702-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_702
-

702-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

703-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_703
-

703-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_703
-

703-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_703
-

703-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_703
-

703-108

Explanation: The bus test failed.

Failing Item:

- FFC_703
-

703-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_703
-

703-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_703
-

703-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_703
-

703-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

703-117 • 703-136

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_703
-

703-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_703
-

703-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_703
 - FFC_B88
-

703-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_703
-

703-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_703
-

703-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_703
-

703-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_703
 - FFC_B88
-

703-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_703
 - SOFTWARE
-

703-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_703
 - SOFTWARE
-

703-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_703
-

703-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_703
-

703-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

703-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

703-135

Explanation: The device failed to configure.

Failing Item:

- FFC_703
 - FFC_B88
 - SOFTWARE
-

703-136

Explanation: The certify operation failed.

Failing Item:

- FFC_703
-

703-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_703
 - FFC_B88
 - FFC_190
-

703-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_703
-

703-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_703
-

703-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

704-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_704
-

704-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_704
-

704-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_704
-

704-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_704
-

704-108

Explanation: The bus test failed.

Failing Item:

- FFC_704
-

704-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_704
-

704-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_704
-

704-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_704
-

704-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_704
-

704-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_704
-

704-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_704
 - FFC_B88
-

704-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_704
-

704-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_704
-

704-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_704
-

704-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_704
 - FFC_B88
-

704-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_704
 - SOFTWARE
-

704-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_704
 - SOFTWARE
-

704-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_704

704-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_704
-

704-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

704-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

704-135

Explanation: The device failed to configure.

Failing Item:

- FFC_704
 - FFC_B88
 - SOFTWARE
-

704-136

Explanation: The certify operation failed.

Failing Item:

- FFC_704
-

704-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_704
 - FFC_B88
 - FFC_190
-

704-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_704

704-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_704
-

704-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

705-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_705
-

705-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_705
-

705-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_705
-

705-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_705
-

705-108

Explanation: The bus test failed.

Failing Item:

- FFC_705
-

705-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_705

705-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_705
-

705-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_705
-

705-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_705
-

705-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_705
-

705-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_705
 - FFC_B88
-

705-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_705
-

705-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_705
-

705-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_705

705-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_705
- FFC_B88

705-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_705
- SOFTWARE

705-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_705
- SOFTWARE

705-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_705

705-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_705

705-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

705-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88

- SOFTWARE

705-135

Explanation: The device failed to configure.

Failing Item:

- FFC_705
- FFC_B88
- SOFTWARE

705-136

Explanation: The certify operation failed.

Failing Item:

- FFC_705

705-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_705
- FFC_B88
- FFC_190

705-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_705

705-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_705

705-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

706-102**Explanation:** An unrecoverable media error occurred.**Failing Item:**

- FFC_706
-

706-104**Explanation:** The motor failed to restart.**Failing Item:**

- FFC_706
-

706-105**Explanation:** The drive did not become ready.**Failing Item:**

- FFC_706
-

706-106**Explanation:** The electronics card test failed.**Failing Item:**

- FFC_706
-

706-108**Explanation:** The bus test failed.**Failing Item:**

- FFC_706
-

706-110**Explanation:** The media format is corrupted.**Failing Item:**

- FFC_706
-

706-112**Explanation:** The diagnostic test failed.**Failing Item:**

- FFC_706
-

706-114**Explanation:** An unrecoverable hardware error.**Failing Item:**

- FFC_706
-

706-116**Explanation:** A protocol error.**Response:** Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_706
-

706-117**Explanation:** A write-protect error occurred.**Failing Item:**

- FFC_706
-

706-118**Explanation:** A SCSI command time-out occurred.**Failing Item:**

- FFC_706
 - FFC_B88
-

706-120**Explanation:** A SCSI busy or command error.**Failing Item:**

- FFC_706
-

706-122**Explanation:** A SCSI reservation conflict error.**Failing Item:**

- FFC_706
-

706-124**Explanation:** A SCSI check condition error occurred.**Failing Item:**

- FFC_706
-

706-126**Explanation:** A software error was caused by a hardware failure.**Failing Item:**

- FFC_706
 - FFC_B88
-

706-128**Explanation:** The error log analysis indicates a hardware failure.**Failing Item:**

- FFC_190
- FFC_B88
- FFC_706
- SOFTWARE

706-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_706
- SOFTWARE

706-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_706

706-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_706

706-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

706-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

706-135

Explanation: The device failed to configure.

Failing Item:

- FFC_706
- FFC_B88
- SOFTWARE

706-136

Explanation: The certify operation failed.

Failing Item:

- FFC_706

706-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_706
- FFC_B88
- FFC_190

706-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_706

706-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_706

706-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

707-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_707

707-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_707

707-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_707

707-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_707
-

707-108

Explanation: The bus test failed.

Failing Item:

- FFC_707
-

707-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_707
-

707-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_707
-

707-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_707
-

707-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_707
-

707-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_707
-

707-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_707
 - FFC_B88
-

707-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_707
-

707-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_707
-

707-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_707
-

707-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_707
 - FFC_B88
-

707-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_707
 - SOFTWARE
-

707-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_707
 - SOFTWARE
-

707-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_707
-

707-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_707
-

707-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

707-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

707-135

Explanation: The device failed to configure.

Failing Item:

- FFC_707
 - FFC_B88
 - SOFTWARE
-

707-136

Explanation: The certify operation failed.

Failing Item:

- FFC_707
-

707-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_707
 - FFC_B88
 - FFC_190
-

707-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_707
-

707-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_707
-

707-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

721-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_721
-

721-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_721
-

721-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_721
-

721-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_721
-

721-108

Explanation: The bus test failed.

Failing Item:

- FFC_721
-

721-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_721

721-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_721
-

721-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_721
-

721-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_721
-

721-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_721
-

721-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_721
 - FFC_B88
-

721-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_721
-

721-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_721
-

721-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_721
-

721-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_721
 - FFC_B88
-

721-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_721
 - SOFTWARE
-

721-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_721
 - SOFTWARE
-

721-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_721
-

721-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_721
-

721-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

721-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

721-135 • 733-114

- SOFTWARE

721-135

Explanation: The device failed to configure.

Failing Item:

- FFC_721
- FFC_B88
- SOFTWARE

721-136

Explanation: The certify operation failed.

Failing Item:

- FFC_721

721-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_721
- FFC_B88
- FFC_190

721-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_721

721-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_721

721-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

722-XXX

Explanation: Unknown disk drive type is failing.

Failing Item:

- FFC_722

723-XXX

Explanation: Unknown CD-ROM type is failing.

Failing Item:

- FFC_723

724-XXX

Explanation: Unknown tape drive failure.

Failing Item:

- FFC_724

733-110

Explanation: The Reserve command failed, or the Inquiry command failed.

Failing Item:

- FFC_733

733-111

Explanation: The Reserve command failed, or the Inquiry command failed.

Failing Item:

- FFC_733

733-112

Explanation: The Reserve command failed, or the Inquiry command failed.

Failing Item:

- FFC_733

733-113

Explanation: The Reserve command failed, or the Inquiry command failed.

Failing Item:

- FFC_733

733-114

Explanation: The Reserve command failed, or the Inquiry command failed.

Failing Item:

- FFC_733
-

733-115

Explanation: The Reserve command failed, or the Inquiry command failed.

Failing Item:

- FFC_733
-

733-116

Explanation: The Reserve command failed, or the Inquiry command failed.

Failing Item:

- FFC_733
-

733-117

Explanation: The Reserve command failed, or the Inquiry command failed.

Failing Item:

- FFC_733
-

733-118

Explanation: The Reserve command failed, or the Inquiry command failed.

Failing Item:

- FFC_733
-

733-119

Explanation: The Reserve command failed, or the Inquiry command failed.

Failing Item:

- FFC_733
-

733-120

Explanation: The Reserve command failed, or the Inquiry command failed.

Failing Item:

- FFC_733
-

733-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_733
- MEDIA

733-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_733
-

733-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_733
 - MEDIA
-

733-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_733
-

733-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_733
-

733-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_733
- MEDIA

733-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_733

733-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_733
- MEDIA

733-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_733

733-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_733
- MEDIA

733-16L

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_733

733-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_733
- FFC_B88
- MEDIA

733-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_733
- FFC_B88

733-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_733
- MEDIA

733-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_733

733-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_733
- MEDIA

733-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_733

733-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_733

733-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_733
- MEDIA

733-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_733

733-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_733
- MEDIA

733-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_733

733-220

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733

733-221

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733

733-222

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733

733-223

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733

733-224 • 733-300

733-224

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733
-

733-225

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733
-

733-226

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733
-

733-227

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733
-

733-228

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733
-

733-229

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733
-

733-230

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733
-

733-231

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733
-

733-232

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733
-

733-233

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733
-

733-234

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733
-

733-235

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733
-

733-236

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733
-

733-237

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733
-

733-238

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733
-

733-239

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733
-

733-240

Explanation: 140 GB 8 mm tape drive failed.

Failing Item:

- FFC_733
-

733-300

Explanation: The device configuration failed.

Failing Item:

- FFC_733
-

- SOFTWARE

733-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
- FFC_733
- SOFTWARE

733-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_733
- MEDIA

733-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_733

733-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-417

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-418

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-419

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-511

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_733
- FFC_B88

733-512

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_733
- FFC_B88

733-513

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_733
- FFC_B88

733-514

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_733
- FFC_B88

733-515

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_733
- FFC_B88

733-516

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_733
- FFC_B88

733-517

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_733
- FFC_B88

733-518

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_733
- FFC_B88

733-519

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_733
- FFC_B88

733-520

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_733
- FFC_B88

733-521

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_733
- FFC_B88

733-522

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_733
- FFC_B88

733-523

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_733
- FFC_B88

733-611

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-612

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-613

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-614

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-615

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-616

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-617

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88

733-618 • 733-629

- SOFTWARE
-

733-618

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-619

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-620

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-621

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-622

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-623

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733

- FFC_B88
 - SOFTWARE
-

733-624

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-625

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-626

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-627

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-628

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-629

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-630

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-631

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-632

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-633

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-634

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-635

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-636

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-637

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-638

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-639

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-640

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88

733-641 • 733-652

- SOFTWARE
-

733-641

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-642

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-643

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-644

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-645

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-646

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733

- FFC_B88
 - SOFTWARE
-

733-647

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-648

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-649

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-650

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-651

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-652

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-653

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-654

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-655

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-656

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-657

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-658

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-659

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-660

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-661

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-662

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-663

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88

733-664 • 733-675

- SOFTWARE
-

733-664

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-665

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-666

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-667

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-668

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-669

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733

- FFC_B88
 - SOFTWARE
-

733-670

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-671

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-672

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-673

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-674

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-675

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-676

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-677

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-678

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-679

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-680

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-681

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-682

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-683

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-684

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-685

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-686

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88

733-687 • 733-698

- SOFTWARE
-

733-687

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-688

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-689

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-690

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-691

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-692

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
-

- FFC_B88
 - SOFTWARE
-

733-693

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-694

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-695

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-696

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-697

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-698

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-699

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-700

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-701

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-702

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-703

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-704

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-705

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-706

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-707

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-708

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-709

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88

733-710 • 733-721

- SOFTWARE
-

733-710

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-711

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-712

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-713

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-714

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-715

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733

- FFC_B88
 - SOFTWARE
-

733-716

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-717

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-718

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-719

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-720

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
 - FFC_B88
 - SOFTWARE
-

733-721

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-722

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

733-723

Explanation: An adapter, device, or bus I/O error occurred.

Failing Item:

- FFC_733
- FFC_B88
- SOFTWARE

736-101

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821

736-102

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_736
- FFC_821

736-103

Explanation: The keyboard reset failed.

Failing Item:

- FFC_736
- FFC_821

736-104

Explanation: Unknown keyboard.

Failing Item:

- FFC_736

736-105

Explanation: The keyboard light-on test failed.

Failing Item:

- FFC_736
- FFC_821

736-106

Explanation: The keyboard light-off test failed.

Failing Item:

- FFC_736
- FFC_821

736-201

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821

736-202

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_736
- FFC_821

736-203

Explanation: The read keyboard ID test failed.

Failing Item:

- FFC_736
- FFC_821

736-204

Explanation: The keyboard layout ID test failed.

Failing Item:

- FFC_736

736-205

Explanation: The keyboard echo test failed.

Failing Item:

- FFC_736
 - FFC_821
-

736-206

Explanation: The select scan code set test failed.

Failing Item:

- FFC_736
 - FFC_821
-

736-301

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821
-

736-302

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_736
 - FFC_821
-

736-303

Explanation: An error occurred in turning on the lamps.

Failing Item:

- FFC_736
-

736-304

Explanation: An error occurred in turning off the lamps.

Failing Item:

- FFC_736
-

736-401

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821
-

736-402

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_736
 - FFC_821
-

736-403

Explanation: Unable to recognize the keyboard.

Failing Item:

- FFC_736
-

736-404

Explanation: The keyboard is failing.

Failing Item:

- FFC_736
 - FFC_821
-

736-701

Explanation: Error configuring the device.

Failing Item:

- FFC_736
 - FFC_821
-

736-901

Explanation: The error log analysis indicates an adapter failure.

Failing Item:

- FFC_821
-

736-902

Explanation: The error log analysis indicates a device failure.

Failing Item:

- FFC_736
 - FFC_821
-

736-903

Explanation: The error log analysis indicates an unknown failure.

Failing Item:

- FFC_736
 - FFC_821
-

741-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_741
-

741-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_741
-

741-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_741
-

741-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_741
-

741-108

Explanation: The bus test failed.

Failing Item:

- FFC_741
-

741-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_741
-

741-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_741
-

741-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_741
-

741-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_741
-

741-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_741
-

741-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_741
 - FFC_B88
-

741-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_741
-

741-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_741
-

741-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_741
-

741-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_741
 - FFC_B88
-

741-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_741
 - SOFTWARE
-

741-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_741
- SOFTWARE

741-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_741

741-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_741

741-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

741-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

741-135

Explanation: The device failed to configure.

Failing Item:

- FFC_741
- FFC_B88
- SOFTWARE

741-136

Explanation: The certify operation failed.

Failing Item:

- FFC_741

741-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_741
- FFC_B88
- FFC_190

741-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_741

741-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_741

741-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

745-100

Explanation: Recovered error.

Response: No action required.

Failing Item:

- MEDIA
- FFC_745

745-200

Explanation: Drive Not Ready.

Response: Install media, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-300

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
 - FFC_745
-

745-301

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
 - FFC_745
-

745-302

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
 - FFC_745
-

745-303

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
 - FFC_745
-

745-304

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
 - FFC_745
-

745-305

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
 - FFC_745
-

745-306

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
 - FFC_745
-

745-307

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
 - FFC_745
-

745-308

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
 - FFC_745
-

745-309

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
 - FFC_745
-

745-310

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
 - FFC_745
-

745-311

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-312

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-313

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-314

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-315

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-316

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-317

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-318

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-319

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-320

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-321

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
 - FFC_745
-

745-322

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
 - FFC_745
-

745-323

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
 - FFC_745
-

745-324

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
 - FFC_745
-

745-325

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
 - FFC_745
-

745-326

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
 - FFC_745
-

745-327

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
 - FFC_745
-

745-328

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
 - FFC_745
-

745-329

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
 - FFC_745
-

745-330

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
 - FFC_745
-

745-331

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
 - FFC_745
-

745-332

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
 - FFC_745
-

745-333

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-334

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-335

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-336

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-337

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-338

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-339

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-340

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-341

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-342

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
- FFC_745

745-343

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
 - FFC_745
-

745-344

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
 - FFC_745
-

745-345

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
 - FFC_745
-

745-346

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
 - FFC_745
-

745-347

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
 - FFC_745
-

745-348

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
 - FFC_745
-

745-349

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
 - FFC_745
-

745-350

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- MEDIA
 - FFC_745
-

745-400

Explanation: General Hardware Failure.

Response: Replace media, clean drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
 - MAGAZINE
 - MEDIA
-

745-410

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
 - MEDIA
-

745-411

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
 - MEDIA
-

745-412

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
 - MEDIA
-

745-413

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-414

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-415

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-416

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-417

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-418

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-419

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-420

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-421

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-422

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-423

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-424

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
 - MEDIA
-

745-425

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
 - MEDIA
-

745-426

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
 - MEDIA
-

745-427

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
 - MEDIA
-

745-428

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
 - MEDIA
-

745-429

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
 - MEDIA
-

745-430

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
 - MEDIA
-

745-431

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
 - MEDIA
-

745-432

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
 - MEDIA
-

745-433

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
 - MEDIA
-

745-434

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
 - MEDIA
-

745-435

Explanation: Internal Hardware Failure

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-440

Explanation: SCSI Hardware Failure.

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- SCSI_ADAPTER

745-441

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-442

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-443

Explanation: 4-mm Tape Auto Loader problem.

Response: Replace drive, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-444

Explanation: Humidity too High

Response: Lower humidity, replace media, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- ENVIRONMENT
- MEDIA

745-445

Explanation: Drive Requires Cleaning

Response: Clean drive, replace media, refer to the tape autoloader service information.

Failing Item:

- CLEAN_MEDIA_DRIVE

745-460

Explanation: Magazine Movement Failure

Response: Check magazine and media, clean rollers, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MAGAZINE
- MEDIA

745-461

Explanation: Magazine Movement Failure

Response: Check magazine and media, clean rollers, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MAGAZINE
- MEDIA

745-462

Explanation: Magazine Movement Failure

Response: Check magazine and media, clean rollers, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MAGAZINE
- MEDIA

745-463

Explanation: Magazine Movement Failure

Response: Check magazine and media, clean rollers, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MAGAZINE
- MEDIA

745-464

Explanation: Magazine Movement Failure

Response: Check magazine and media, clean rollers, refer to the tape autoloader service information.

Failing Item:

- FFC_745
 - MAGAZINE
 - MEDIA
-

745-465

Explanation: Magazine Movement Failure

Response: Check magazine and media, clean rollers, refer to the tape autoloader service information.

Failing Item:

- FFC_745
 - MAGAZINE
 - MEDIA
-

745-470

Explanation: Media Insert/Eject Failure

Response: Check clean magazine and media, clean rollers, refer to the tape autoloader service information.

Failing Item:

- FFC_745
 - MAGAZINE
 - MEDIA
-

745-471

Explanation: Media Insert/Eject Failure

Response: Check clean magazine and media, clean rollers, refer to the tape autoloader service information.

Failing Item:

- FFC_745
 - MAGAZINE
 - MEDIA
-

745-472

Explanation: Media Insert/Eject Failure

Response: Check clean magazine and media, clean rollers, refer to the tape autoloader service information.

Failing Item:

- FFC_745
 - MAGAZINE
 - MEDIA
-

745-473

Explanation: Media Insert/Eject Failure

Response: Check clean magazine and media, clean rollers, refer to the tape autoloader service information.

Failing Item:

- FFC_745
 - MAGAZINE
 - MEDIA
-

745-474

Explanation: Media Insert/Eject Failure

Response: Check clean magazine and media, clean rollers, refer to the tape autoloader service information.

Failing Item:

- FFC_745
 - MAGAZINE
 - MEDIA
-

745-475

Explanation: Media Insert/Eject Failure

Response: Check clean magazine and media, clean rollers, refer to the tape autoloader service information.

Failing Item:

- FFC_745
 - MAGAZINE
 - MEDIA
-

745-480

Explanation: Drawer Open/Close Failure

Response: Check magazine and media, refer to the tape autoloader service information.

Failing Item:

- FFC_745
 - MAGAZINE
 - MEDIA
-

745-481

Explanation: Drawer Open/Close Failure

Response: Check magazine and media, refer to the tape autoloader service information.

Failing Item:

- FFC_745
 - MAGAZINE
 - MEDIA
-

745-482

Explanation: Drawer Open/Close Failure

Response: Check magazine and media, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MAGAZINE
- MEDIA

745-483

Explanation: Drawer Open/Close Failure

Response: Check magazine and media, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MAGAZINE
- MEDIA

745-484

Explanation: Drawer Open/Close Failure

Response: Check magazine and media, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MAGAZINE
- MEDIA

745-485

Explanation: Drawer Open/Close Failure

Response: Check magazine and media, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MAGAZINE
- MEDIA

745-500

Explanation: Illegal request to drive

Response: Software conflict, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- SYSTEM

745-600

Explanation: Unit Attention

Response: Software conflict, media changed, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- SYSTEM

745-700

Explanation: Not Writeable

Response: Check media for write-protect, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-800

Explanation: Blank Media

Response: Check media, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

745-B00

Explanation: SCSI Interface Failure

Response: Check SCSI interface, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- SCSI_ADAPTER

745-D00

Explanation: Tape Full

Response: Check replace media, refer to the tape autoloader service information.

Failing Item:

- FFC_745
- MEDIA

746-101

Explanation: Enhanced error handling failure on the bus.

Failing Item:

- FFC_221

746-102

Explanation: Enhanced error handling failure on a PCI-PCI Bridge.

Failing Item:

- FFC_293
-

746-103

Explanation: Enhanced error handling failure on the adapter.

Failing Item:

- FFC_746
 - FFC_221
-

746-212

Explanation: FIFO empty bit set.

Failing Item:

- FFC_746
-

746-213

Explanation: FIFO empty bit clear.

Failing Item:

- FFC_746
-

746-214

Explanation: FIFO full bit set.

Failing Item:

- FFC_746
-

746-215

Explanation: FIFO full bit clear.

Failing Item:

- FFC_746
-

746-216

Explanation: FIFO data miscompare.

Failing Item:

- FFC_746
-

746-217

Explanation: SCSI FIFO data miscompare.

Failing Item:

- FFC_746
-

746-218

Explanation: SCSI FIFO underflow.

Failing Item:

- FFC_746
-

746-219

Explanation: SCSI parity error.

Response: Use MAP0050 : SCSI Bus Problems

746-220

Explanation: SCSI FIFO flags error.

Failing Item:

- FFC_746
-

746-221

Explanation: Miscompare during the write/read of the configuration register.

Failing Item:

- FFC_746
 - FFC_221
-

746-222

Explanation: Error during the write/read of the memory register.

Failing Item:

- FFC_746
-

746-223

Explanation: Miscompare during the write/read of the memory I/O register.

Response: Use MAP0050 : SCSI Bus Problems.

Failing Item:

- FFC_746
-

746-224

Explanation: SCSI configuration register read or write error.

Failing Item:

- FFC_746
 - FFC_221
-

746-225

Explanation: Adapter POST failed.

Failing Item:

- FFC_746
-

746-226

Explanation: SCSI wrap or PTC failure.

Response: Use MAP0050 : SCSI Bus Problems.

746-227

Explanation: SCSI adapter test failure.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_746
 - FFC_221
-

746-230

Explanation: Arbitration test failed.

Response: Use MAP0050 : SCSI Bus Problems.

746-231

Explanation: Function could not complete.

Response: Use MAP0050 : SCSI Bus Problems.

746-232

Explanation: SCSI bus data mismatch.

Response: Use MAP0050 : SCSI Bus Problems.

746-240

Explanation: No terminal power.

Response: Use MAP0050 : SCSI Bus Problems.

746-242

Explanation: SCSI bus error.

Response: Use MAP0050 : SCSI Bus Problems.

746-301

Explanation: The parent device open failed.

Failing Item:

- FFC_746
 - FFC_221
-

746-701

Explanation: Error log analysis indicates a PCI SCSI adapter failure.

Failing Item:

- FFC_746
-

746-801

Explanation: Error log analysis indicates a terminator problem.

Response: Run the diagnostics on the adapter in system verification mode. If an SRN is reported, use the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in General SCSI configuration checks to resolve the problem.

746-802

Explanation: Error log analysis indicates that multiple attempts to reset the SCSI bus have timed out.

Response: Run the diagnostics on the adapter in System Verification mode. If an SRN is reported, use the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in General SCSI configuration checks to resolve the problem.

746-803

Explanation: Error log analysis indicates that multiple SCSI bus errors have occurred.

Response: Run the diagnostics on the adapter in system verification mode. If an SRN is reported, use the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in General SCSI configuration checks to resolve the problem.

747-101

Explanation: Enhanced error handling failure on the bus.

Failing Item:

- FFC_221
-

747-102

Explanation: Enhanced error handling failure on a PCI-PCI Bridge.

Failing Item:

- FFC_293
-

747-103

Explanation: Enhanced error handling failure on the adapter.

Failing Item:

- FFC_747
 - FFC_221
-

747-212

Explanation: FIFO empty bit set.

Failing Item:

- FFC_747
-

747-213

Explanation: FIFO empty bit clear.

Failing Item:

- FFC_747
-

747-214

Explanation: FIFO full bit set.

Failing Item:

- FFC_747
-

747-215

Explanation: FIFO full bit clear.

Failing Item:

- FFC_747
-

747-216

Explanation: FIFO data miscompare.

Failing Item:

- FFC_747
-

747-217

Explanation: SCSI FIFO data miscompare.

Failing Item:

- FFC_747
-

747-218

Explanation: SCSI FIFO underflow.

Failing Item:

- FFC_747
-

747-219

Explanation: SCSI parity error.

Response: Use MAP0050 : SCSI Bus Problems

747-220

Explanation: SCSI FIFO flags error.

Failing Item:

- FFC_747
-

747-221

Explanation: Miscompare during the write/read of the configuration register.

Failing Item:

- FFC_747
 - FFC_221
-

747-222

Explanation: Error during the write/read of the memory register.

Failing Item:

- FFC_747
-

747-223

Explanation: Miscompare during the write/read of the memory I/O register.

Response: Use MAP0050 : SCSI Bus Problems.

Failing Item:

- FFC_747
-

747-224

Explanation: SCSI configuration register read or write error.

Failing Item:

- FFC_747
 - FFC_221
-

747-225

Explanation: Adapter POST failed.

Failing Item:

- FFC_747
-

747-226

Explanation: SCSI wrap or PTC failure.

Response: Use MAP0050 : SCSI Bus Problems.

747-227

Explanation: SCSI adapter test failure.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_747
 - FFC_221
-

747-230

Explanation: Arbitration test failed.

Response: Use MAP0050 : SCSI Bus Problems.

747-231

Explanation: Function could not complete.

Response: Use MAP0050 : SCSI Bus Problems.

747-232

Explanation: SCSI bus data miscompare.

Response: Use MAP0050 : SCSI Bus Problems.

747-240

Explanation: No terminal power.

Response: Use MAP0050 : SCSI Bus Problems.

747-242

Explanation: SCSI bus error.

Response: Use MAP0050 : SCSI Bus Problems.

747-301

Explanation: The parent device open failed.

Failing Item:

- FFC_747
 - FFC_221
-

747-701

Explanation: Error log analysis indicates a PCI SCSI adapter failure.

Failing Item:

- FFC_747
-

747-801

Explanation: Error log analysis indicates a terminator problem.

Response: Run the diagnostics on the adapter in system verification mode. If an SRN is reported, use the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in General SCSI configuration checks to resolve the problem.

747-802

Explanation: Error log analysis indicates that multiple attempts to reset the SCSI bus have timed out.

Response: Run the diagnostics on the adapter in system verification mode. If an SRN is reported, use

the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in General SCSI configuration checks to resolve the problem.

747-803

Explanation: Error log analysis indicates that multiple SCSI bus errors have occurred.

Response: Run the diagnostics on the adapter in system verification mode. If an SRN is reported, use the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in General SCSI configuration checks to resolve the problem.

749-XXX

Explanation: 7331 Model 205 Tape Library. Refer to service documentation for this device.

Failing Item:

- FFC_749
-

757-110

Explanation: The Reserve command failed.

Failing Item:

- FFC_757
-

757-120

Explanation: The Inquiry command failed.

Failing Item:

- FFC_757
-

757-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_757
 - MEDIA
-

757-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA

- FFC_757

757-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_757
- MEDIA

757-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_757

757-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_757

757-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_757
- MEDIA

757-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA

- FFC_757

757-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_757
- MEDIA

757-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_757

757-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_757
- MEDIA

757-16L

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_757

757-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_757
- FFC_B88
- MEDIA

757-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_757
- FFC_B88

757-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_757
- MEDIA

757-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_757

757-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_757
- MEDIA

757-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_757

757-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_757

757-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_757
- MEDIA

757-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_757

757-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_757
 - MEDIA
-

757-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_757
-

757-220

Explanation: The Release command failed.

Failing Item:

- FFC_757
-

757-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_757
-

757-240

Explanation: The Openx command failed.

Failing Item:

- FFC_757
-

757-300

Explanation: The device configuration failed.

Failing Item:

- FFC_757
 - SOFTWARE
-

757-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
 - FFC_757
 - SOFTWARE
-

757-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_757
 - MEDIA
-

757-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_757
-

757-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_757
 - FFC_B88
 - SOFTWARE
-

757-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_757
 - FFC_B88
 - SOFTWARE
-

757-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-417

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-418

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-419

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-511

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_757
 - FFC_B88
-

757-512

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_757
 - FFC_B88
-

757-513

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_757
 - FFC_B88
-

757-514

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_757
 - FFC_B88
-

757-515

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_757
 - FFC_B88
-

757-516

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_757
 - FFC_B88
-

757-517

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_757
 - FFC_B88
-

757-518

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_757
 - FFC_B88
-

757-519

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_757
 - FFC_B88
-

757-520

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_757
 - FFC_B88
-

757-521

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_757
 - FFC_B88
-

757-522

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_757
 - FFC_B88
-

757-523

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_757
 - FFC_B88
-

757-611

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_757
 - FFC_B88
 - SOFTWARE
-

757-612

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-613

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-614

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-615

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-616

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-617

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-618

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-619

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-620

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-621

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-622

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

757-623

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_757
 - FFC_B88
 - SOFTWARE
-

757-711

Explanation: A device timeout error occurred.

Failing Item:

- FFC_757
 - FFC_B88
 - SOFTWARE
-

757-712

Explanation: A device timeout error occurred.

Failing Item:

- FFC_757
 - FFC_B88
 - SOFTWARE
-

757-713

Explanation: A device timeout error occurred.

Failing Item:

- FFC_757
 - FFC_B88
 - SOFTWARE
-

757-714

Explanation: A device timeout error occurred.

Failing Item:

- FFC_757
 - FFC_B88
 - SOFTWARE
-

757-715

Explanation: A device timeout error occurred.

Failing Item:

- FFC_757
 - FFC_B88
 - SOFTWARE
-

757-716

Explanation: A device timeout error occurred.

Failing Item:

- FFC_757
 - FFC_B88
 - SOFTWARE
-

757-717

Explanation: A device timeout error occurred.

Failing Item:

- FFC_757
 - FFC_B88
 - SOFTWARE
-

757-718

Explanation: A device timeout error occurred.

Failing Item:

- FFC_757
 - FFC_B88
 - SOFTWARE
-

757-719

Explanation: A device timeout error occurred.

Failing Item:

- FFC_757
 - FFC_B88
 - SOFTWARE
-

757-720

Explanation: A device timeout error occurred.

Failing Item:

- FFC_757
 - FFC_B88
 - SOFTWARE
-

757-721

Explanation: A device timeout error occurred.

Failing Item:

- FFC_757
 - FFC_B88
 - SOFTWARE
-

757-722

Explanation: A device timeout error occurred.

Failing Item:

- FFC_757
 - FFC_B88
 - SOFTWARE
-

757-723

Explanation: A device timeout error occurred.

Failing Item:

- FFC_757
- FFC_B88
- SOFTWARE

759-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_759

759-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_759

759-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_759

759-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_759

759-108

Explanation: The bus test failed.

Failing Item:

- FFC_759

759-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_759

759-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_759

759-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_759

759-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_759

759-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_759

759-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_759
- FFC_B88

759-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_759

759-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_759

759-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_759

759-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_759

- FFC_B88

759-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_759
- SOFTWARE

759-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_759
- SOFTWARE

759-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_759

759-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_759

759-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

759-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

759-135

Explanation: The device failed to configure.

Failing Item:

- FFC_759
- FFC_B88
- SOFTWARE

759-136

Explanation: The certify operation failed.

Failing Item:

- FFC_759

759-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_759
- FFC_B88
- FFC_190

759-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_759

759-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_759

759-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

763-1XX

Explanation: Problem detected with a device or device data corrupted

Response: Note: You may need to reinstall ssp.css software.

Failing Item:

- FFC_763
- SOFTWARE
- FFC_221

763-200

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-201

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-202

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-203

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-204

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-205

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-206

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-207

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-208

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-209

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-210

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-211

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-212

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-213

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-214

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-215

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-216

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-217

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-218

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-219

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-220

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-221

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-222

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-223

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-224

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-225

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-226

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-227

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-228

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-229

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-230

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-231

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-232

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-233

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-234

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-235

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-236

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-237

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-238

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-239

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-240

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-241

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-242

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-243

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-244

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-245

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-246

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-247

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-248

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-249

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-250

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-251

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-252

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-253

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-254

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-255

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-256

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-257

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-258

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-259

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-260

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-261

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-262

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-263

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-264

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-265

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-266

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-267

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-268

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-269

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-270

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-271

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-272

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-273

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-274

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-275

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-276

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-277

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-278

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-279

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-280

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-281

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-282

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-283

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-284

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-285

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-286

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-287

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-288

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-289

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-290

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-291

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-292

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-293

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-294

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_763
 - WRAP_PLUG
-

763-295

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-296

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-297

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-298

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-299

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_763
- WRAP_PLUG

763-2A1

Explanation: Problem detected with the internal clock.

Failing Item:

- FFC_763

763-2A2

Explanation: Problem detected with the internalclock.

Failing Item:

- FFC_763

763-2A3

Explanation: Problem detected with the internalclock.

Failing Item:

- FFC_763

763-2A4

Explanation: Problem detected with the internalclock.

Failing Item:

- FFC_763

763-2A5

Explanation: Problem detected with the internalclock.

Failing Item:

- FFC_763

763-2A6

Explanation: Problem detected with the internalclock.

Failing Item:

- FFC_763
-

763-2A7**Explanation:** Problem detected with the internalclock.**Failing Item:**

- FFC_763
-

763-2A8**Explanation:** Problem detected with the internalclock.**Failing Item:**

- FFC_763
-

763-2A9**Explanation:** Problem detected with the internalclock.**Failing Item:**

- FFC_763
-

763-3XX**Explanation:** Problem detected with the POS registers.**Failing Item:**

- FFC_763
 - FFC_221
-

763-4XX**Explanation:** TBIC test failed.**Failing Item:**

- FFC_763
 - SOFTWARE
-

763-5XX**Explanation:** SRAM test failed.**Failing Item:**

- FFC_763
-

763-6XX**Explanation:** Microprocessor test failed.**Failing Item:**

- FFC_763
-

763-7XX**Explanation:** Interrupt test failed.**Failing Item:**

- FFC_763
-

763-8XX**Explanation:** FIFO test failed.**Failing Item:**

- FFC_763
-

763-9XX**Explanation:** DMA engine test failed.**Response:** Note: Refer to your SP Maintenance Information for the switch cable FRU part number.**Failing Item:**

- FFC_763
 - FFC_221
 - SWITCH_CABLE
-

763-AX3**Explanation:** Card wrap test failed.**Response:** Note: The terminator FRU part number is listed under the 763 FFC. Use MAP0210 : General problem resolution.**Failing Item:**

- FFC_763
 - TERMINATOR
-

763-AX4**Explanation:** Card wrap test failed.**Response:** Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.**Failing Item:**

- SWITCH_CABLE
 - WRAP_PLUG
-

763-XX2**Explanation:** Bad adapter card. (except for SRN 763-282)**Response:** Replace the SP Switch MX Adapter.**Failing Item:**

- FFC_763
-

764-1XX**Explanation:** Problem detected with a device or device data corrupted.**Response:** Note: You may need to reinstall ssp.css software.**Failing Item:**

764-200 • 764-207

- FFC_764
- SOFTWARE
- FFC_221

764-200

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-201

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-202

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-203

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK

- FFC_764
- WRAP_PLUG

764-204

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-205

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-206

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-207

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764

- WRAP_PLUG

764-208

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-209

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-210

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-211

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-212

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-213

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-214

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-215

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-216

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-217

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-218

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-219

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-220

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-221

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-222

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-223

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-224

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-225

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-226

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-227

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-228

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-229

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-230

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-231

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-232

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-233

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-234

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-235

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-236

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-237

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-238

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-239

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-240

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-241

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-242

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-243

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-244

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-245

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-246

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-247

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-248

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-249

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-250

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-251

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-252

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-253

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-254

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-255

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-256

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-257

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-258

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-259

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-260

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-261

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-262

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-263

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-264

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-265

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-266

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-267

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-268

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-269

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-270

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-271

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-272

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-273

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-274

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-275

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-276

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-277

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-278

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-279

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-280

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-281

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-282

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-283

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-284

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-285

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-286

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
- FFC_764
- WRAP_PLUG

764-287

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-288

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-289

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-290

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-291

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-292

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-293

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-294

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-295

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-296

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-297

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-298

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-299

Explanation: Problem detected with the external clock (SP switch).

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- EXTERNAL_CLOCK
 - FFC_764
 - WRAP_PLUG
-

764-3XX

Explanation: Problem detected with the POS registers.

Failing Item:

- FFC_764
 - FFC_221
-

764-4XX

Explanation: TBIC test failed.

Failing Item:

- FFC_764
 - SOFTWARE
-

764-5XX

Explanation: SRAM test failed.

Failing Item:

- FFC_764
-

764-6XX

Explanation: Microprocessor test failed.

Failing Item:

- FFC_764
-

764-7XX

Explanation: Interrupt test failed.

Failing Item:

- FFC_764
-

764-8XX

Explanation: FIFO test failed.

Failing Item:

- FFC_764
-

764-9XX

Explanation: DMA engine test failed.

Response: Note: Refer to your SP Maintenance Information for the switch cable FRU part number.

Failing Item:

- FFC_764
 - FFC_221
 - SWITCH_CABLE
-

764-AX3

Explanation: Card wrap test failed.

Response: Note: The terminator FRU part number is listed under the 763 FFC.

Failing Item:

- FFC_764
 - TERMINATOR
-

764-AX4

Explanation: Card wrap test failed.

Response: Note: Refer to your SP Maintenance Information for the external clock FRU part number. The wrap plug FRU part number is listed under the 763 FFC.

Failing Item:

- SWITCH_CABLE
 - WRAP_PLUG
-

764-XX2

Explanation: Bad adapter card. (except for SRN 764-282)

Response: Replace the SP Switch MX Adapter.

Failing Item:

- FFC_764
-

772-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_772
-

772-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_772
-

772-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_772
-

772-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_772
-

772-108

Explanation: The bus test failed.

Failing Item:

- FFC_772
-

772-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_772
-

772-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_772
-

772-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_772
-

772-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_772
-

772-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_772
-

772-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_772
 - FFC_B88
-

772-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_772
-

772-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_772
-

772-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_772
-

772-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_772
 - FFC_B88
-

772-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_772
 - SOFTWARE
-

772-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_772
 - SOFTWARE
-

772-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_772
-

772-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_772
-

772-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

772-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

772-135

Explanation: The device failed to configure.

Failing Item:

- FFC_772
 - FFC_B88
 - SOFTWARE
-

772-136

Explanation: The certify operation failed.

Failing Item:

- FFC_772
-

772-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_772
 - FFC_B88
 - FFC_190
-

772-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_772
-

772-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_772
-

772-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

773-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_773
-

773-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_773
-

773-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_773
-

773-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_773
-

773-108

Explanation: The bus test failed.

Failing Item:

- FFC_773
-

773-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_773
-

773-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_773
-

773-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_773
-

773-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_773
-

773-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_773
-

773-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_773
 - FFC_B88
-

773-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_773
-

773-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_773
-

773-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_773
-

773-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_773
- FFC_B88

773-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_773
- SOFTWARE

773-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_773
- SOFTWARE

773-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_773

773-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_773

773-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

773-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88

- SOFTWARE

773-135

Explanation: The device failed to configure.

Failing Item:

- FFC_773
- FFC_B88
- SOFTWARE

773-136

Explanation: The certify operation failed.

Failing Item:

- FFC_773

773-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_773
- FFC_B88
- FFC_190

773-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_773

773-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_773

773-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

774-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_774
-

774-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_774
-

774-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_774
-

774-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_774
-

774-108

Explanation: The bus test failed.

Failing Item:

- FFC_774
-

774-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_774
-

774-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_774
-

774-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_774
-

774-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_774
-

774-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_774
-

774-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_774
 - FFC_B88
-

774-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_774
-

774-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_774
-

774-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_774
-

774-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_774
 - FFC_B88
-

774-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_774
- SOFTWARE

774-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_774
 - SOFTWARE
-

774-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_774
-

774-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_774
-

774-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

774-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

774-135

Explanation: The device failed to configure.

Failing Item:

- FFC_774
 - FFC_B88
 - SOFTWARE
-

774-136

Explanation: The certify operation failed.

Failing Item:

- FFC_774
-

774-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_774
 - FFC_B88
 - FFC_190
-

774-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_774
-

774-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_774
-

774-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

776-101

Explanation: External Test Failure.

Failing Item:

- FFC_D46
-

776-102

Explanation: External Test Failure.

Failing Item:

- FFC_240
-

776-103

Explanation: I/O Test Failure.

Failing Item:

- FFC_776
-

776-104**Explanation:** Adapter On-card Test Failure.**Failing Item:**

- FFC_776
 - FFC_221
-

776-105**Explanation:** Wrap Test Failure.**Failing Item:**

- FFC_776
-

776-106**Explanation:** Enhanced error handling failure on bus.**Failing Item:**

- FFC_776
-

776-107**Explanation:** Enhanced error handling failure on Eads chip.**Failing Item:**

- FFC_776
-

776-108**Explanation:** Enhanced error handling failure on adapter.**Failing Item:**

- FFC_776
-

776-201**Explanation:** Configuration Register Test Failure.**Failing Item:**

- FFC_776
 - FFC_221
-

776-202**Explanation:** Wrap Test Failure.**Failing Item:**

- FFC_776
 - FFC_221
-

776-203**Explanation:** Wrap Test Failure.**Failing Item:**

- FFC_D46
 - FFC_776
-

776-204**Explanation:** Connect Test Failure.**Failing Item:**

- FFC_776
 - FFC_221
-

776-205**Explanation:** External Test Failure.**Response:** Run advanced diagnostics with wrap test for this resource to obtain correct problem isolation. Use MAP0210 : General problem resolution.**Failing Item:**

- FFC_D46
 - FFC_776
-

776-206**Explanation:** Wrap Test Failure.**Failing Item:**

- FFC_776
 - FFC_221
-

776-301**Explanation:** External Test Failure.**Failing Item:**

- FFC_D46
 - FFC_240
 - FFC_776
-

776-302**Explanation:** External Test Failure.**Response:** Run advanced diagnostics with wrap test for this resource to obtain correct problem isolation.**Failing Item:**

- FFC_D46
 - FFC_776
 - FFC_221
-

776-303**Explanation:** External Test Failure.**Response:** Run advanced diagnostics with wrap test for this resource to obtain correct problem isolation.**Failing Item:**

- FFC_240
 - FFC_D46
 - FFC_776
-

776-304

Explanation: Connect Wrap Test Failure.

Failing Item:

- FFC_D46
- FFC_776
- FFC_221

776-305

Explanation: Wrap Test Failure.

Failing Item:

- FFC_D46
- FFC_776
- FFC_221

776-306

Explanation: Wrap Test Failure.

Failing Item:

- FFC_D46
- FFC_776
- FFC_221

776-401

Explanation: External Test Failure.

Response: Run advanced diagnostics with wrap test for this resource to obtain correct problem isolation.

Failing Item:

- FFC_240
- FFC_D46
- FFC_776
- FFC_221

776-404

Explanation: Connect Test Failure.

Failing Item:

- FFC_240
- FFC_D46
- FFC_776
- FFC_221

776-405

Explanation: Wrap Test Failure.

Failing Item:

- FFC_240
- FFC_D46
- FFC_776

- FFC_221

776-406

Explanation: Wrap Test Failure.

Failing Item:

- FFC_240
- FFC_D46
- FFC_776
- FFC_221

776-414

Explanation: Connect Test Failure. This failure occurs if not connected to a functional Token-Ring network.

Response: Run advanced diagnostics for this resource to obtain correct problem isolation.

Failing Item:

- FFC_240
- FFC_D46
- FFC_776
- FFC_221

776-415

Explanation: Wrap Test Failure. This failure occurs if not connected to a functional Token-Ring network.

Response: Run advanced diagnostics for this resource to obtain correct problem isolation.

Failing Item:

- FFC_240
- FFC_D46
- FFC_776
- FFC_221

776-416

Explanation: Wrap Test Failure. This failure occurs if not connected to a functional Token-Ring network.

Response: Run advanced diagnostics for this resource to obtain correct problem isolation.

Failing Item:

- FFC_240
- FFC_D46
- FFC_776
- FFC_221

776-701

Explanation: ELA indicates an adapter error occurred.

Failing Item:

- FFC_776

776-702

Explanation: ELA indicates an adapter check occurred.

Failing Item:

- FFC_776
 - FFC_221
-

776-703

Explanation: ELA indicates a DMA failure occurred.

Failing Item:

- FFC_776
 - FFC_221
-

776-704

Explanation: ELA indicates a PCI bus failure occurred.

Failing Item:

- FFC_776
 - FFC_221
-

776-705

Explanation: ELA indicates a Programmed I/O failure occurred.

Failing Item:

- FFC_776
 - FFC_221
-

776-706

Explanation: ELA indicates a command write failure occurred.

Failing Item:

- FFC_776
-

776-707

Explanation: ELA indicates an internal adapter error has occurred.

Failing Item:

- FFC_776
-

778-002

Explanation: Software error.

Failing Item:

- SOFTWARE
 - FFC_778
-

778-301

Explanation: Adapter failure.

Failing Item:

- FFC_778
 - FFC_221
-

778-E01

Explanation: Software error.

Failing Item:

- SOFTWARE
 - FFC_778
-

778-E02

Explanation: Adapter failure.

Failing Item:

- FFC_778
 - FFC_221
-

77C-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_77C
-

77C-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_77C
-

77C-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_77C
-

77C-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_77C
-

77C-108

Explanation: The bus test failed.

Failing Item:

- FFC_77C
-

77C-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_77C
-

77C-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_77C
-

77C-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_77C
-

77C-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_77C
-

77C-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_77C
-

77C-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_77C
 - FFC_B88
-

77C-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_77C
-

77C-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_77C
-

77C-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_77C
-

77C-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_77C
 - FFC_B88
-

77C-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_77C
 - SOFTWARE
-

77C-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_77C
 - SOFTWARE
-

77C-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_77C
-

77C-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_77C
-

77C-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

77C-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

77C-135

Explanation: The device failed to configure.

Failing Item:

- FFC_77C
 - FFC_B88
 - SOFTWARE
-

77C-136

Explanation: The certify operation failed.

Failing Item:

- FFC_77C
-

77C-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_77C
 - FFC_B88
 - FFC_190
-

77C-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_77C
-

77C-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_77C
-

77C-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

780-101

Explanation: Adapter logic test failure.

Failing Item:

- FFC_780
 - FFC_227
-

780-102

Explanation: Adapter logic test failure.

Failing Item:

- FFC_780
-

780-109

Explanation: Adapter channel Input/Output test failure.

Failing Item:

- FFC_780
-

780-113

Explanation: Adapter Serial Communication Controller (SCC) test failure.

Failing Item:

- FFC_780
-

780-114

Explanation: Adapter logic test failure.

Failing Item:

- FFC_780
 - FFC_227
-

780-120

Explanation: Adapter could not be detected or configured.

Failing Item:

- FFC_780
 - FFC_227
 - SOFTWARE
-

780-140

Explanation: An error was found with the X.21 interface adapter cable.

Failing Item:

- FFC_271
 - FFC_780
-

780-150

Explanation: An error was found with the X.24 interface adapter cable.

Failing Item:

- FFC_272
 - FFC_780
-

780-160

Explanation: An error was found with the X.35 interface adapter cable.

Failing Item:

- FFC_273
 - FFC_780
-

780-170

Explanation: The adapter hardware failed.

Failing Item:

- FFC_780
-

780-180

Explanation: The adapter hardware failed.

Failing Item:

- FFC_780
-

780-190

Explanation: The adapter hardware failed.

Failing Item:

- FFC_780
-

780-210

Explanation: An error was found on the adapter.

Failing Item:

- FFC_780
 - FFC_185
-

780-211

Explanation: The adapter card POST test failed.

Failing Item:

- FFC_780
 - FFC_227
-

780-230

Explanation: The adapter card hardware failed.

Failing Item:

- FFC_780
-

780-232

Explanation: The adapter card hardware failed.

Failing Item:

- FFC_780
 - FFC_227
-

780-240

Explanation: The adapter card hardware failed.

Failing Item:

- FFC_780
-

780-250

Explanation: An error was found on the adapter.

Failing Item:

- FFC_185
 - FFC_780
-

780-260

Explanation: The adapter card hardware failed.

Failing Item:

- FFC_780
-

780-270

Explanation: The adapter card hardware failed.

Failing Item:

- FFC_780
-

780-280

Explanation: The adapter card hardware failed.

Failing Item:

- FFC_780
-

780-290

Explanation: The adapter card hardware failed.

Failing Item:

- FFC_780
-

780-300

Explanation: An adapter error was found during error log analysis.

Failing Item:

- FFC_780
-

780-310

Explanation: An adapter error was found during error log analysis.

Failing Item:

- FFC_780
 - FFC_185
-

780-320

Explanation: An adapter error was found during error log analysis.

Failing Item:

- FFC_780
 - FFC_227
-

780-330

Explanation: Error log analysis indicates a hardware problem.

Failing Item:

- FFC_780
 - FFC_227
-

780-400

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_780
 - FFC_227
-

780-700

Explanation: The adapter failed to configure.

Failing Item:

- FFC_780
 - FFC_227
 - SOFTWARE
-

780-720

Explanation: Cable wrap test failed.

Failing Item:

- FFC_780
-

780-721

Explanation: Port wrap test failed.

Failing Item:

- FFC_780
-

780-722

Explanation: Cable wrap test failed.

Failing Item:

- FFC_780
-

781-101

Explanation: ROS POST adapter software initialization error.

Failing Item:

- FFC_781
 - FFC_227
-

781-102

Explanation: Extended DRAM SIP test failed.

Failing Item:

- FFC_781
-

781-103

Explanation: ROS checksum test failed.

Failing Item:

- FFC_781
-

781-104

Explanation: Adapter download diagnostics failed

Failing Item:

- FFC_781
 - FFC_227
-

781-105

Explanation: Memory size test failed.

Failing Item:

- FFC_781
 - FFC_227
-

781-106

Explanation: Interface ID test failed.

Failing Item:

- FFC_781
- FFC_227

781-107

Explanation: EIB ID test failed.

Failing Item:

- FFC_781
- FFC_227

781-108

Explanation: ROS version test failed.

Failing Item:

- FFC_781
- FFC_227

781-109

Explanation: DUSCC register test failed.

Failing Item:

- FFC_781

781-111

Explanation: DMA register test failed.

Failing Item:

- FFC_781

781-112

Explanation: X.21 PAL test failed.

Failing Item:

- FFC_781

781-113

Explanation: External wrap test failed.

Failing Item:

- FFC_781

781-114

Explanation: Twin tail logic test failed.

Failing Item:

- FFC_781
- FFC_227

781-116

Explanation: The RS232 cable wrap test failed.

Failing Item:

- FFC_254

781-117

Explanation: The RS422A cable wrap test failed.

Failing Item:

- FFC_253

781-118

Explanation: The V.35 cable wrap test failed.

Failing Item:

- FFC_257

781-119

Explanation: The X.21 cable wrap test failed.

Failing Item:

- FFC_260

781-120

Explanation: The adapter was not detected or could not be configured. test failed.

Failing Item:

- FFC_781
- FFC_227
- SOFTWARE

781-121

Explanation: The 4-port jumper cable assembly wrap test failed.

Failing Item:

- FFC_781
- FFC_227
- SOFTWARE

781-200

Explanation: The error log analysis indicates the adapter failed.

Failing Item:

- FFC_781
-

781-221

Explanation: The error log analysis indicates the adapter hardware failed.

Failing Item:

- FFC_781
 - FFC_227
-

781-231

Explanation: No interface card detected.

Failing Item:

- FFC_227
-

781-501

Explanation: The power-on self-test (POST) failed.

Failing Item:

- FFC_B77
 - FFC_B69
 - FFC_227
-

781-502

Explanation: The memory module failed.

Failing Item:

- FFC_B77
-

781-503

Explanation: Adapter hardware failure.

Failing Item:

- FFC_781
 - FFC_227
-

781-504

Explanation: Adapter hardware failure.

Failing Item:

- FFC_B69
-

781-505

Explanation: Adapter hardware failure.

Failing Item:

- FFC_B71
 - FFC_B69
-

781-506

Explanation: Adapter hardware failure.

Failing Item:

- FFC_B72
 - FFC_B69
-

781-507

Explanation: Adapter hardware failure.

Failing Item:

- FFC_B73
 - FFC_B69
-

781-508

Explanation: Adapter hardware failure.

Failing Item:

- FFC_B74
 - FFC_B69
-

781-516

Explanation: Adapter Test Failure.

Failing Item:

- FFC_B77
 - FFC_B69
-

781-517

Explanation: Adapter Test Failure.

Failing Item:

- FFC_B69
 - FFC_B77
-

781-720

Explanation: 4-port multiprotocol cable

Failing Item:

- FFC_258
 - FFC_781
-

783-110

Explanation: The Reserve command failed.

Failing Item:

- FFC_783
-

783-120

Explanation: The Inquiry command failed.

Failing Item:

- FFC_783

783-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_783
- MEDIA

783-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_783

783-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_783
- MEDIA

783-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_783

783-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_783

783-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_783
- MEDIA

783-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_783

783-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_783
- MEDIA

783-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_783

783-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_783
 - MEDIA
-

783-16L

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_783
-

783-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_783
 - FFC_B88
 - MEDIA
-

783-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_783
 - FFC_B88
-

783-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_783
 - MEDIA
-

783-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_783
-

783-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_783
 - MEDIA
-

783-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_783
-

783-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_783
-

783-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_783
- MEDIA

783-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_783

783-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_783
- MEDIA

783-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_783

783-220

Explanation: The Release command failed.

Failing Item:

- FFC_783

783-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_783

783-240

Explanation: The Openx command failed.

Failing Item:

- FFC_783

783-300

Explanation: The device configuration failed.

Failing Item:

- FFC_783
- SOFTWARE

783-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
- FFC_783
- SOFTWARE

783-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_783
- MEDIA

783-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_783
-

783-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-417

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-418

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-419

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_783
- FFC_B88
- SOFTWARE

783-511

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_783
- FFC_B88

783-512

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_783
- FFC_B88

783-513

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_783
- FFC_B88

783-514

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_783
- FFC_B88

783-515

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_783
- FFC_B88

783-516

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_783
- FFC_B88

783-517

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_783
- FFC_B88

783-518

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_783
- FFC_B88

783-519

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_783
- FFC_B88

783-520

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_783
- FFC_B88

783-521

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_783
- FFC_B88

783-522

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_783
- FFC_B88

783-523

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_783
 - FFC_B88
-

783-611

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-612

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-613

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-614

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-615

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-616

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-617

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-618

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-619

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-620

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-621

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-622

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_783
- FFC_B88
- SOFTWARE

783-623

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_783
- FFC_B88
- SOFTWARE

783-711

Explanation: A device timeout error occurred.

Failing Item:

- FFC_783
- FFC_B88
- SOFTWARE

783-712

Explanation: A device timeout error occurred.

Failing Item:

- FFC_783
- FFC_B88
- SOFTWARE

783-713

Explanation: A device timeout error occurred.

Failing Item:

- FFC_783
- FFC_B88
- SOFTWARE

783-714

Explanation: A device timeout error occurred.

Failing Item:

- FFC_783
- FFC_B88
- SOFTWARE

783-715

Explanation: A device timeout error occurred.

Failing Item:

- FFC_783
- FFC_B88
- SOFTWARE

783-716

Explanation: A device timeout error occurred.

Failing Item:

- FFC_783
- FFC_B88
- SOFTWARE

783-717

Explanation: A device timeout error occurred.

Failing Item:

- FFC_783
- FFC_B88
- SOFTWARE

783-718

Explanation: A device timeout error occurred.

Failing Item:

- FFC_783
- FFC_B88
- SOFTWARE

783-719

Explanation: A device timeout error occurred.

Failing Item:

- FFC_783
- FFC_B88
- SOFTWARE

783-720

Explanation: A device timeout error occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-721

Explanation: A device timeout error occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-722

Explanation: A device timeout error occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

783-723

Explanation: A device timeout error occurred.

Failing Item:

- FFC_783
 - FFC_B88
 - SOFTWARE
-

784-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_784
-

784-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_784
-

784-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_784
-

784-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_784
-

784-108

Explanation: The bus test failed.

Failing Item:

- FFC_784
-

784-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_784
-

784-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_784
-

784-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_784
-

784-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_784
-

784-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_784
-

784-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_784
 - FFC_B88
-

784-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_784
-

784-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_784
-

784-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_784
-

784-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_784
 - FFC_B88
-

784-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_784
 - SOFTWARE
-

784-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_784
 - SOFTWARE
-

784-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_784
-

784-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_784
-

784-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

784-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

784-135

Explanation: The device failed to configure.

Failing Item:

- FFC_784
 - FFC_B88
 - SOFTWARE
-

784-136

Explanation: The certify operation failed.

Failing Item:

- FFC_784
-

784-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_784
 - FFC_B88
 - FFC_190
-

784-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_784
-

784-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_784
-

784-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

785-111

Explanation: Could not do the test because the device driver detected a hardware error.

Failing Item:

- FFC_785
 - FFC_227
-

785-114

Explanation: The register verification test failed.

Failing Item:

- FFC_785
-

785-121

Explanation: Could not do the test because the device driver detected a hardware error.

Failing Item:

- FFC_785
 - FFC_227
-

785-122

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_785
 - FFC_227
-

785-123

Explanation: The modem control line test failed.

Failing Item:

- FFC_785
 - FFC_227
-

785-124

Explanation: The memory test failed.

Failing Item:

- FFC_785
-

785-151

Explanation: Could not do the test because the device driver detected a hardware error.

Failing Item:

- FFC_785
 - FFC_D57
-

785-152

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_785
 - FFC_D57
-

785-153

Explanation: The modem control line test failed.

Failing Item:

- FFC_785
 - FFC_D57
-

785-171

Explanation: Could not do the test because the device driver detected a hardware error.

Failing Item:

- FFC_259
-

785-172

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_259
-

785-173

Explanation: The modem control line test failed.

Failing Item:

- FFC_259
-

785-181

Explanation: Could not do the test because the device driver detected a hardware error.

Failing Item:

- FFC_261
-

785-182

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_261
-

785-183

Explanation: The modem control line test failed.

Failing Item:

- FFC_261
-

785-251

Explanation: Could not perform because the device driver detected a hardware error.

Failing Item:

- FFC_785
 - FFC_D57
-

785-252

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_785
 - FFC_D57
-

785-253

Explanation: The modem control line test failed.

Failing Item:

- FFC_785
 - FFC_D57
-

785-271

Explanation: Could not perform because the device driver detected a hardware error.

Failing Item:

- FFC_785
 - FFC_D57
-

785-272

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_785
 - FFC_D57
-

785-273

Explanation: The modem control line test failed.

Failing Item:

- FFC_785
 - FFC_D57
-

785-281

Explanation: Could not perform because the device driver detected a hardware error.

Failing Item:

- FFC_785
 - FFC_D57
-

785-282

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_785
 - FFC_D57
-

785-283

Explanation: The modem control line test failed.

Failing Item:

- FFC_785
 - FFC_D57
-

785-481

Explanation: Could not do the test because the device driver detected a hardware error.

Failing Item:

- FFC_D57
-

785-482

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_D57
-

785-483

Explanation: The modem control line test failed.

Failing Item:

- FFC_D57
-

785-901

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_785
-

785-902

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_785
-

785-903

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_785
-

785-904

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or

if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_785
-

785-905

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_785
-

785-906

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_785
-

785-907

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_785
-

785-908

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_785
-

785-909

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_785
-

785-910

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_785
-

785-911

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE

- FFC_785
-

785-912

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_785
-

785-913

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_785
-

785-914

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_785
-

785-915

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-916

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-917

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-918

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-919

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-920

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-921

Explanation: The adapter failed to configure.

Failing Item:

- FFC_785
- SOFTWARE

785-922

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-923

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-924

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-925

Explanation: The adapter failed to configure.

Failing Item:

- FFC_785
- SOFTWARE

785-926

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-927

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-928

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than

from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-929

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-930

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-931

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-932

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_785
-

785-933

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_785
-

785-934

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_785
-

785-935

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE

- FFC_785
-

785-936

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_785
-

785-937

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_785
-

785-938

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_785
-

785-939

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

785-940 • 786-710

- SOFTWARE
- FFC_785

785-940

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-941

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-942

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

785-943

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 785; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_785

786-200

Explanation: Initiation failed.

Response: Note: You must determine which of the first two FFCs is installed in the system unit. Use MAP0210 : General problem resolution.

Failing Item:

- FFC_786
- FFC_D96
- FFC_227

786-210

Explanation: The adapter test failed.

Failing Item:

- FFC_786
- FFC_227

786-211

Explanation: The adapter test failed.

Failing Item:

- FFC_D96
- FFC_227

786-220

Explanation: The display test failed.

Failing Item:

- FFC_786
- CABLE
- MONITOR

786-221

Explanation: The display test failed.

Failing Item:

- FFC_D96
- CABLE
- MONITOR

786-710

Explanation: The ELA indicates HW failure.

Failing Item:

- FFC_786
- FFC_227

786-711

Explanation: The ELA indicates HW failure.

Failing Item:

- FFC_D96
 - FFC_227
-

787-100

Explanation: GXT500P Graphics Adapter.

Failing Item:

- FFC_787
-

787-101

Explanation: GXT500P Graphics Adapter.

Failing Item:

- FFC_787
 - FFC_227
-

787-1AA

Explanation: GXT500P Graphics Adapter.

Failing Item:

- FFC_787
 - RGB
 - CABLE
 - DISPLAY
-

787-1XX

Explanation: GXT500P Graphics Adapter.

Failing Item:

- FFC_787
-

787-200

Explanation: GXT550P Graphics Adapter.

Failing Item:

- FFC_D95
-

787-201

Explanation: GXT550P Graphics Adapter.

Failing Item:

- FFC_D95
 - FFC_227
-

787-2AA

Explanation: GXT550P Graphics Adapter.

Failing Item:

- FFC_D95
 - RGB
 - CABLE
 - DISPLAY
-

787-2XX

Explanation: GXT550P Graphics Adapter.

Failing Item:

- FFC_D95
-

788-001

Explanation: Adapter Error.

Failing Item:

- FFC_788
 - FFC_227
-

788-002

Explanation: System Error.

Failing Item:

- SOFTWARE
 - FFC_788
-

788-003

Explanation: System Error.

Failing Item:

- SOFTWARE
 - FFC_788
-

788-004

Explanation: System Error.

Failing Item:

- FFC_788
 - SOFTWARE
-

789-101

Explanation: Failed to release the device.

Failing Item:

- FFC_789
-

789-102

Explanation: Failed to reserve the device.

Failing Item:

- FFC_789
-

789-103

Explanation: The device motor failed to start.

Failing Item:

- FFC_789
-

789-104

Explanation: Failed to make the device ready.

Failing Item:

- FFC_789
-

789-105

Explanation: Failed to get the inquiry data.

Failing Item:

- FFC_789
-

789-106

Explanation: The Prevent Media Removal command failed.

Failing Item:

- FFC_789
-

789-107

Explanation: The Allow Media Removal command failed.

Failing Item:

- FFC_789
-

789-200

Explanation: The optical disk failed to load.

Response: Change the media. Run diagnostics on the changed media in system verification mode. If the error reoccurs use MAP0210 : General problem resolution; otherwise, replace the media.

Failing Item:

- FFC_789
 - OPTICAL_DISK
-

789-201

Explanation: Failed to unload the optical disk.

Response: Change the media. Run diagnostics on the changed media in system verification mode. If the errors reoccur use MAP0210 : General problem resolution; otherwise, replace the media.

Failing Item:

- FFC_789
 - OPTICAL_DISK
-

789-202

Explanation: The diagnostic test failed.

Response: Change the media. Run diagnostics on the changed media in system verification mode. If errors do not reoccur, replace the media; otherwise, run the drive cleaning procedures if applicable and rerun the diagnostics. If errors reoccur, or the drive does not support the cleaning procedures use MAP0210 : General problem resolution.

Failing Item:

- FFC_789
 - OPTICAL_DISK
-

789-204

Explanation: The device failed to configure.

Failing Item:

- FFC_789
 - FFC_B88
-

789-205

Explanation: The Test Unit Ready command failed.

Response: Change the media. Run diagnostics on the changed media in system verification mode. If the error reoccurs, use MAP0210 : General problem resolution; otherwise, replace the media.

Failing Item:

- FFC_789
 - OPTICAL_DISK
-

789-206

Explanation: The random write, read and compare test failed.

Response: Change the media. Run diagnostics on the changed media in system verification mode. If the errors do not reoccur, replace the media; otherwise, run the drive cleaning procedures if applicable, and rerun diagnostics. If the errors reoccur, or the drive does not support cleaning procedures, use general problem resolution.

Failing Item:

- FFC_789
- OPTICAL_DISK

789-207

Explanation: A hardware error occurred.

Response: Change the media. Run diagnostics on the changed media in system verification mode. If the errors do not reoccur, replace the media; otherwise, run the drive cleaning procedures if applicable, and rerun diagnostics. If the errors reoccur, or the drive does not support cleaning procedures, use MAP0210 : General problem resolution.

Failing Item:

- FFC_789
- OPTICAL_DISK

789-208

Explanation: The Mode Sense command failed.

Response: Change the media. Run diagnostics on the changed media in system verification mode. If the errors do not reoccur, replace the media; otherwise, run the drive cleaning procedures if applicable, and rerun diagnostics. If the errors reoccur, or the drive does not support cleaning procedures, use general problem resolution.

Failing Item:

- FFC_789
- OPTICAL_DISK

789-209

Explanation: The Mode Select command failed.

Response: Change the media. Run diagnostics on the changed media in system verification mode. If the errors do not reoccur, replace the media; otherwise, run the drive cleaning procedures if applicable, and rerun diagnostics. If the errors reoccur, or the drive does not support cleaning procedures, use general problem resolution.

Failing Item:

- FFC_789
- OPTICAL_DISK

789-300

Explanation: A SCSI reservation conflict has occurred.

Failing Item:

- FFC_789
- FFC_B88
- SOFTWARE

789-400

Explanation: A SCSI command time out has occurred.

Failing Item:

- FFC_789
- FFC_B88
- CABLES
- SOFTWARE

789-401

Explanation: An unknown error has occurred.

Failing Item:

- OPTICAL_DISK
- FFC_190
- FFC_B88
- SOFTWARE

789-402

Explanation: Unit attention condition has occurred.

Failing Item:

- OPTICAL_DISK
- FFC_190
- FFC_B88
- SOFTWARE

789-600

Explanation: ELA indicates that the spare sectors on the disk are exhausted.

Response: Backup the media and replace it. Note: Use the time when the error occurred and the "Spare Sector Availability" service aid to identify the disk that has the error.

Failing Item:

- OPTICAL_DISK

789-700

Explanation: The ELA indicates an equipment error.

Response: Run diagnostics in system verification mode to isolate the problem. If errors are reported, use MAP0210 : General problem resolution; otherwise, the error is due to faulty media. Backup the media and then replace it. Note: Use the time when the error occurred to identify the faulty media.

Failing Item:

- FFC_789
- OPTICAL_DISK

789-701

Explanation: ELA indicates an irrecoverable data error.

Response: Run diagnostics in system verification mode to isolate the problem. If errors are reported, use MAP0210 : General problem resolution; otherwise, the error is due to faulty media. Backup the media and then replace it. Note: Use the time when the error occurred to identify the faulty media.

Failing Item:

- OPTICAL_DISK
- FFC_789

789-702

Explanation: ELA indicates that the adapter detected an error.

Response: Use the 7209 Installation and Service information. If the unit checks out to be good, use MAP0210 : General problem resolution.

Failing Item:

- FFC_789
- FFC_B88
- CABLES

78B-001

Explanation: Software error.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- SOFTWARE
- FFC_78B

78B-002

Explanation: Adapter failure.

Failing Item:

- FFC_78B
- SOFTWARE

78B-003

Explanation: Adapter failure.

Failing Item:

- FFC_78B
- FFC_227

78B-004

Explanation: Adapter or display failure.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_78B
- MONITOR_OR_CABLE

78B-005

Explanation: Adapter failure.

Failing Item:

- FFC_78B
- FFC_227
- MONITOR_OR_CABLE

78D-001

Explanation: Software error.

Failing Item:

- SOFTWARE
- FFC_78D

78D-002

Explanation: Adapter failure.

Failing Item:

- FFC_78D
- SOFTWARE

78D-003

Explanation: Adapter failure.

Failing Item:

- FFC_78D
- FFC_227

78D-004

Explanation: Display failure.

Failing Item:

- FFC_78D
- MONITOR_OR_CABLE

78D-005

Explanation: Adapter failure.

Failing Item:

- FFC_78D
- FFC_227
- MONITOR_OR_CABLE

790-101

Explanation: Configuration Register Test failure.

Failing Item:

- FFC_790

790-102**Explanation:** I/O test failure.**Failing Item:**

- FFC_790
-

790-103**Explanation:** Adapter initialization test failure.**Failing Item:**

- FFC_790
-

790-104**Explanation:** Internal wrap test failure.**Failing Item:**

- FFC_790
-

790-105**Explanation:** Internal wrap test failure.**Failing Item:**

- FFC_790
-

790-106**Explanation:** External wrap (10 Mbps) test failure.**Failing Item:**

- FFC_790
-

790-107**Explanation:** Internal wrap test failure.**Failing Item:**

- FFC_790
-

790-108**Explanation:** External wrap (100 Mbps) test failure.**Failing Item:**

- FFC_790
-

790-109**Explanation:** External wrap (10 Mbps) test failure.**Failing Item:**

- FFC_790
-

790-121**Explanation:** Configuration register test failure.**Failing Item:**

- FFC_790

790-122**Explanation:** I/O register test failure.**Failing Item:**

- FFC_790
-

790-124**Explanation:** Internal loopback test failure.**Failing Item:**

- FFC_790
-

790-125**Explanation:** Internal loopback test failure.**Failing Item:**

- FFC_790
-

790-126**Explanation:** External loopback test failure.**Failing Item:**

- FFC_790
-

790-150**Explanation:** 10Base-T transceiver test failure.**Failing Item:**

- FFC_B08
-

790-151**Explanation:** 10Base-2 transceiver test failure.**Failing Item:**

- FFC_B09
-

790-223**Explanation:** Device configuration failure.**Failing Item:**

- FFC_790
 - SOFTWARE
-

790-224**Explanation:** 10 Base-T transceiver test failure.**Failing Item:**

- FFC_B08
 - FFC_790
-

790-225

Explanation: 10 Base-2 transceiver test failure.

Failing Item:

- FFC_B09
- FFC_790

790-250

Explanation: 10 Base-T transceiver test failure.

Failing Item:

- FFC_B08
- FFC_790

790-251

Explanation: 10 Base-2 transceiver test failure.

Failing Item:

- FFC_B09
- FFC_790

790-701

Explanation: Error Log Analysis indicates that the adapter is not responding to initialization commands.

Failing Item:

- FFC_790

790-702

Explanation: Error Log Analysis indicates that the device driver has detected a PIO error which it was unable to correct.

Failing Item:

- FFC_790

790-703

Explanation: Error Log Analysis indicates that the adapter has been shutdown due to an unrecoverable error.

Failing Item:

- FFC_790

790-704

Explanation: Error Log Analysis indicates a problem with EEPROM on the adapter.

Failing Item:

- FFC_790

790-720

Explanation: Error log analysis indicates a hardware problem.

Failing Item:

- FFC_790
- SOFTWARE

791-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_791

791-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_791

791-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_791

791-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_791

791-108

Explanation: The bus test failed.

Failing Item:

- FFC_791

791-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_791

791-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_791
-

791-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_791
-

791-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_791
-

791-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_791
-

791-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_791
 - FFC_B88
-

791-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_791
-

791-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_791
-

791-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_791
-

791-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_791

- FFC_B88
-

791-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_791
 - SOFTWARE
-

791-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_791
 - SOFTWARE
-

791-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_791
-

791-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_791
-

791-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

791-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

791-135

Explanation: The device failed to configure.

Failing Item:

- FFC_791
 - FFC_B88
 - SOFTWARE
-

791-136

Explanation: The certify operation failed.

Failing Item:

- FFC_791
-

791-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_791
 - FFC_B88
 - FFC_190
-

791-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_791
-

791-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_791
-

791-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

792-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_792
-

792-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_792
-

792-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_792
-

792-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_792
-

792-108

Explanation: The bus test failed.

Failing Item:

- FFC_792
-

792-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_792
-

792-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_792
-

792-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_792
-

792-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_792

792-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_792

792-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_792
- FFC_B88

792-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_792

792-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_792

792-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_792

792-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_792
- FFC_B88

792-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_792
- SOFTWARE

792-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_792
- SOFTWARE

792-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_792

792-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_792

792-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS

792-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

792-135

Explanation: The device failed to configure.

Failing Item:

- FFC_792
- FFC_B88
- SOFTWARE

792-136

Explanation: The certify operation failed.

Failing Item:

- FFC_792

792-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_792
- FFC_B88
- FFC_190

792-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_792

792-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_792

792-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

793-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_793

793-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_793

793-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_793

793-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_793

793-108

Explanation: The bus test failed.

Failing Item:

- FFC_793

793-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_793

793-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_793

793-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_793

793-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_793

793-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_793

793-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_793
- FFC_B88

793-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_793
-

793-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_793
-

793-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_793
-

793-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_793
 - FFC_B88
-

793-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_793
 - SOFTWARE
-

793-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_793
 - SOFTWARE
-

793-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_793
-

793-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_793
-

793-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

793-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

793-135

Explanation: The device failed to configure.

Failing Item:

- FFC_793
 - FFC_B88
 - SOFTWARE
-

793-136

Explanation: The certify operation failed.

Failing Item:

- FFC_793
-

793-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_793
 - FFC_B88
 - FFC_190
-

793-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_793

793-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_793

793-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

799-101

Explanation: External wrap test failed on port 0.

Failing Item:

- FFC_2C3
- FFC_799

799-102

Explanation: External wrap test failed on port 1.

Failing Item:

- FFC_2C3
- FFC_799

799-201

Explanation: Internal adapter test failed.

Failing Item:

- FFC_799
- FFC_227

799-202

Explanation: External wrap test failed on port 0.

Failing Item:

- FFC_799
- FFC_227

799-203

Explanation: External wrap test failed on port 1.

Failing Item:

- FFC_799
- FFC_227

799-204

Explanation: External wrap test failed on port 0.

Failing Item:

- FFC_2C3
- FFC_799

799-205

Explanation: External wrap test failed on port 1.

Failing Item:

- FFC_2C3
- FFC_799

799-206

Explanation: External wrap test failed on port 0.

Failing Item:

- FFC_2C3
- FFC_799
- SOFTWARE

799-207

Explanation: External wrap test failed on port 1.

Failing Item:

- FFC_2C3
- FFC_799
- SOFTWARE

799-301

Explanation: Internal adapter test failed.

Failing Item:

- FFC_799
- FFC_227
- SOFTWARE

799-302

Explanation: External wrap test failed on port 0.

Failing Item:

- FFC_799
- FFC_227
- SOFTWARE

799-303

Explanation: External wrap test failed on port 1.

Failing Item:

- FFC_799
- FFC_227

- SOFTWARE

799-304

Explanation: External wrap test failed on port 0.

Failing Item:

- FFC_2C3
 - FFC_799
 - SOFTWARE
-

799-305

Explanation: External wrap test failed on port 1.

Failing Item:

- FFC_2C3
 - FFC_799
 - SOFTWARE
-

799-700

Explanation: Error log analysis indicates a hardware problem.

Failing Item:

- FFC_799
 - SOFTWARE
-

778-1402

Explanation: Software error.

Failing Item:

- SOFTWARE
 - FFC_778
-

778-1403

Explanation: Adapter failure.

Failing Item:

- FFC_778
 - FFC_221
-

778-1404

Explanation: Adapter failure.

Failing Item:

- FFC_778
 - FFC_221
-

778-1405

Explanation: Adapter failure.

Failing Item:

- FFC_778

- FFC_221

778-1500

Explanation: Adapter failure.

Failing Item:

- FFC_778
 - SOFTWARE
-

778-1600

Explanation: Adapter failure.

Failing Item:

- FFC_778
 - FFC_902
-

778-1601

Explanation: Adapter failure.

Failing Item:

- FFC_778
 - FFC_902
-

778-1602

Explanation: Adapter failure.

Failing Item:

- FFC_778
 - FFC_902
-

778-1603

Explanation: Adapter failure.

Failing Item:

- FFC_778
 - FFC_902
-

778-1604

Explanation: Adapter failure.

Failing Item:

- FFC_778
 - FFC_902
-

778-2501

Explanation: Adapter error.

Failing Item:

- FFC_778
 - FFC_221
-

778-2502

Explanation: Adapter error.

Failing Item:

- FFC_778
- FFC_221

778-2503

Explanation: Adapter error.

Failing Item:

- FFC_778
- FFC_221

778-2504

Explanation: Adapter error.

Failing Item:

- FFC_778
- FFC_221

778-2505

Explanation: Adapter error.

Failing Item:

- FFC_778
- FFC_221

778-2506

Explanation: Adapter error.

Failing Item:

- FFC_778
- FFC_221

778-2507

Explanation: Adapter error.

Failing Item:

- FFC_778
- FFC_221

778-2508

Explanation: Adapter error.

Failing Item:

- FFC_778
- FFC_221

778-2509

Explanation: Software error.

Failing Item:

- SOFTWARE
- FFC_778

778-2510

Explanation: Software error.

Failing Item:

- SOFTWARE
- FFC_778

778-2511

Explanation: Software error.

Failing Item:

- SOFTWARE
- FFC_778

778-2601

Explanation: Adapter error.

Failing Item:

- FFC_778
- FFC_221

778-2602

Explanation: Adapter error.

Failing Item:

- FFC_778
- FFC_221

778-2603

Explanation: Software error.

Failing Item:

- SOFTWARE
- FFC_778

8XXXX

Explanation: A Configuration Error occurred.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive. Note: In this SRN, an x represents a digit 0 through F.

802-655

Explanation: A resource was not detected that was previously installed.

Failing Item:

- FFC_655
-

802-657

Explanation: A resource was not detected that was previously installed.

Failing Item:

- FFC_657
-

802-67E

Explanation: A resource was not detected that was previously installed.

Failing Item:

- FFC_67E
-

802-684

Explanation: A potential problem with the RS422 concentrator exists.

Failing Item:

- FFC_684
 - FFC_687
-

802-787

Explanation: The diagnostics did not detect an installed resource.

Failing Item:

- FFC_787
 - FFC_D95
-

802-78D

Explanation: A resource was not detected that was previously installed.

Failing Item:

- FFC_78D
-

802-80C

Explanation: A potential problem with a SSA adapter exists. If the system has external SSA drives refer to the SSA Adapters User's Guide and Maintenance Information or the service information for your disk subsystem. If the system has internal SSA drives, go to the SSA MAP in either the system unit's service guide or user's guide.

Response:

Failing Item:

- FFC_80C
-

802-837

Explanation: A potential problem with the Enhanced Remote Async Node exists.

Failing Item:

- FFC_837
 - FFC_687
 - FFC_E10
 - FFC_227
-

807-102

Explanation: A critical failure has occurred on an undefined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807
-

807-103

Explanation: Non-critical failure has occurred on an undefined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807
-

807-104

Explanation: An unrecoverable failure has occurred on an undefined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807
-

807-122

Explanation: A critical power supply failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_152
-

807-123

Explanation: A non-critical power supply failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_152
-

807-124

Explanation: An unrecoverable power supply failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_152
-

807-132

Explanation: A critical fan failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_166
 - FFC_807
-

807-133

Explanation: A non-critical fan failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_166
 - FFC_807
-

807-134

Explanation: An unrecoverable fan failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_166
 - FFC_807
-

807-148

Explanation: The enclosure indicates a temperature threshold warning.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_166
 - FFC_807
-

807-149

Explanation: The enclosure indicates a temperature threshold failure.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_166
 - FFC_807
-

807-152

Explanation: A critical repeater card failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807
-

807-153

Explanation: A non-critical repeater card failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807
-

807-154

Explanation: An unrecoverable repeater card failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807
-

807-162

Explanation: A critical VPD module failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807
-

807-163

Explanation: A non-critical VPD module failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807
-

807-164

Explanation: An unrecoverable VPD module failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807
-

807-172

Explanation: A critical enclosure services failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807
-

807-173

Explanation: A non-critical enclosure services failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807
-

807-174

Explanation: An unrecoverable enclosure services failure has occurred.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807
-

807-182

Explanation: A critical failure has occurred on a user defined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807
-

807-183

Explanation: A non-critical failure has occurred on a user defined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807
-

807-184

Explanation: An unrecoverable failure has occurred on a user defined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807
-

807-192

Explanation: A critical failure has occurred on a user defined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807
-

807-193

Explanation: A non-critical failure has occurred on a user defined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807
-

807-194

Explanation: An unrecoverable failure has occurred on a user defined element.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807
-

807-201

Explanation: Device configuration error.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

807-202 • 815-201

- FFC_807
- FFC_891

807-202

Explanation: The enclosure failed to open.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807
- FFC_891

807-203

Explanation: The enclosure failed to return inquiry data.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_807
- FFC_891

807-204

Explanation: There is a critical power supply or fan failure.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_152
- FFC_166

807-205

Explanation: There is a redundant power supply or fan failure.

Response: Go to MAP2010 : 7031-D24 or 7031-T24 START.

Failing Item:

- FFC_152
- FFC_166

80C-XXX

Explanation: A potential problem with an SSA device exists.

Response: The SSA service aid might be of some help, it provides tools for diagnosing and resolving problems on SSA-attached devices. Also refer to the SSA Adapters User's Guide and Maintenance Information .

Failing Item:

- FFC_80C

814-112

Explanation: The NVRAM test failed.

Failing Item:

- FFC_814

814-113

Explanation: The VPD test failed.

Failing Item:

- FFC_221

814-114

Explanation: I/O Card NVRAM test failed.

Failing Item:

- FFC_814

815-100

Explanation: The floating-point processor test failed.

Failing Item:

- FFC_815

815-101

Explanation: Floating point processor failed.

Failing Item:

- FFC_815

815-102

Explanation: Floating point processor failed.

Failing Item:

- FFC_815

815-200

Explanation: Power-on self-test indicates a processor failure.

Failing Item:

- FFC_815
- FFC_7C0

815-201

Explanation: Processor has a status of failed. Processors with a failed status are deconfigured and therefore cannot be tested or used by the system.

Failing Item:

- FFC_815

816-140

Explanation: The four-digit display test failed.

Failing Item:

- FFC_165
 - FFC_816
-

817-123

Explanation: The I/O planar time-of-day clock test failed.

Failing Item:

- FFC_817
-

817-124

Explanation: Time of day RAM test failed.

Failing Item:

- FFC_817
-

817-210

Explanation: The time-of-day clock is at POR.

Failing Item:

- FFC_817
-

817-211

Explanation: Time of day POR test failed.

Failing Item:

- FFC_817
 - FFC_169
-

817-212

Explanation: The battery is low.

Failing Item:

- FFC_151
 - FFC_816
-

817-213

Explanation: The real-time clock is not running.

Failing Item:

- FFC_817
-

817-215

Explanation: Time of day clock not running test failed.

Failing Item:

- FFC_817
-

817-217

Explanation: Time of day clock not running.

Failing Item:

- FFC_817
 - FFC_169
-

821-111

Explanation: Unexpected results from the test.

Failing Item:

- FFC_821
 - FFC_B31
-

821-332

Explanation: Cannot open device.

Failing Item:

- FFC_821
 - SOFTWARE
-

823-111

Explanation: Standard Mouse adapter failed.

Failing Item:

- FFC_823
-

823-134

Explanation: Cannot open device.

Failing Item:

- FFC_823
 - SOFTWARE
-

823-211

Explanation: Standard mouse adapter failed.

Failing Item:

- FFC_925
 - FFC_823
-

824-220

Explanation: The tablet adapter fuse failed.

Failing Item:

- FFC_B10
 - FFC_824
-

824-331

Explanation: An unexpected error occurred.

Failing Item:

- FFC_824
- FFC_227

824-332

Explanation: The enable/disable device test failed.

Response: Note: Ensure that the wrap plug was not attached when the test was run. If the wrap plug was attached, remove it, and rerun the test. Use MAP0210 : General problem resolution.

Failing Item:

- FFC_824
- FFC_227

824-333

Explanation: The internal wrap test failed.

Failing Item:

- FFC_824

824-334

Explanation: The tablet adapter fuse failed.

Failing Item:

- FFC_B10
- FFC_824

824-441

Explanation: An unexpected error occurred.

Failing Item:

- FFC_824

824-442

Explanation: The wrap test failed.

Failing Item:

- FFC_824

824-450

Explanation: Software error caused by hardware failure.

Failing Item:

- FFC_227

824-461

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_227

824-511

Explanation: An unexpected error occurred.

Failing Item:

- FFC_824

824-512

Explanation: Tablet adapter reset test failed.

Failing Item:

- FFC_824

824-522

Explanation: Adapter fuse failure.

Failing Item:

- FFC_B10
- FFC_824

824-523

Explanation: Device cannot be configured.

Failing Item:

- FFC_824

824-524

Explanation: Cannot open device.

Failing Item:

- FFC_824
- SOFTWARE

826-111

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_221

826-112

Explanation: Unable to determine the type of adapter from the VPD.

Failing Item:

- FFC_221

826-113

Explanation: The VPD verification test failed.

Failing Item:

- FFC_826
-

826-114

Explanation: The register verification test failed.

Failing Item:

- FFC_826
-

826-121

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_221
-

826-122

Explanation: The data-wrap communications test failed.

Failing Item:

- FFC_221
-

826-123

Explanation: The modem control line test failed.

Failing Item:

- FFC_221
-

826-131

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_221
-

826-132

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_221
-

826-133

Explanation: The modem control line test failed.

Failing Item:

- FFC_221
-

826-161

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_252
-

826-162

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_252
-

826-163

Explanation: The modem control line test failed.

Failing Item:

- FFC_252
-

826-171

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_259
-

826-172

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_259
-

826-173

Explanation: The modem control line test failed.

Failing Item:

- FFC_259
-

826-181

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_261
-

826-182

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_261
-

826-183

Explanation: The modem control line test failed.

Failing Item:

- FFC_261
-

826-271

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_826
 - FFC_259
-

826-272

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_826
 - FFC_259
-

826-273

Explanation: The modem control line test failed.

Failing Item:

- FFC_826
 - FFC_259
-

826-281

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_826
 - FFC_259
-

826-282

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_826
 - FFC_259
-

826-283

Explanation: The modem control line test failed.

Failing Item:

- FFC_826
 - FFC_259
-

826-321

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_826
-

826-322

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_826
-

826-323

Explanation: The modem control line test failed.

Failing Item:

- FFC_826
-

826-331

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_826
-

826-332

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_826
-

826-333

Explanation: The modem control line test failed.

Failing Item:

- FFC_826
-

826-371

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_826
-

826-372

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_826
-

826-373

Explanation: The modem control line test failed.

Failing Item:

- FFC_826
-

826-381

Explanation: Could not do the test because the device driver detected a hardware error.

Failing Item:

- FFC_826
-

826-382

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_826
-

826-383

Explanation: The modem control line test failed.

Failing Item:

- FFC_826
-

826-481

Explanation: Could not do the test because the device driver detected a hardware error.

Failing Item:

- FFC_D56
-

826-482

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_D56
-

826-483

Explanation: The modem control line test failed.

Failing Item:

- FFC_D56
-

826-581

Explanation: Could not do the test because the device driver detected a hardware error.

Failing Item:

- FFC_826
- FFC_D56

826-582

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_826
 - FFC_D56
-

826-583

Explanation: The modem control line test failed.

Failing Item:

- FFC_826
 - FFC_D56
-

826-901

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution. with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_826
-

826-902

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_826
-

826-903

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

826-904 • 826-90B

- SOFTWARE
- FFC_826

826-904

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-905

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-906

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-907

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-908

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-909

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-90A

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-90B

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-90C

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-90D

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-90E

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-90F

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem

resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-910

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-911

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-912

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-913

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or

826-914 • 826-91A

if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_826
-

826-914

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_826
-

826-915

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_826
-

826-916

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_826
-

826-917

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_826
-

826-918

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_826
-

826-919

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_826
-

826-91A

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE

- FFC_826

826-91B

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-91C

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-91D

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-91E

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-91F

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-920

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-921

Explanation: The adapter failed to configure.

Failing Item:

- FFC_826
- SOFTWARE

826-922

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-923

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_826
-

826-924

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_826
-

826-925

Explanation: The adapter failed to configure.

Failing Item:

- FFC_826
 - SOFTWARE
-

826-926

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_826
-

826-927

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than

from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_826
-

826-928

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_826
-

826-929

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_826
-

826-92A

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_826
-

826-92B

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_826
-

826-92C

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_826
-

826-92D

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_826
-

826-92E

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE

- FFC_826
-

826-92F

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_826
-

826-930

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_826
-

826-931

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_826
-

826-932

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

826-933 • 826-93A

- SOFTWARE
- FFC_826

826-933

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-934

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-935

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-936

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-937

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-938

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-939

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-93A

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem

resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-93B

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-93C

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-93D

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-93E

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or

if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-93F

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-940

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-941

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-942

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

826-943

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 826; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_826

827-112

Explanation: The parallel port data register write/read test failed.

Failing Item:

- FFC_221

827-121

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_827

827-122

Explanation: The parallel port data register write/read test failed.

Failing Item:

- FFC_827

827-123

Explanation: The parallel port control register write/read test failed.

Failing Item:

- FFC_827

827-124

Explanation: The parallel port data register read test failed.

Failing Item:

- FFC_827

827-125

Explanation: The parallel port control register read test failed.

Failing Item:

- FFC_827

827-126

Explanation: The parallel port control register read test failed.

Failing Item:

- FFC_827

827-131

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_827

827-132

Explanation: The control port register direction bit (write) test with BIDI enabled failed.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_827

827-133

Explanation: The control port register direction bit (read) test with BIDI enabled failed.

Failing Item:

- FFC_827

827-141

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_827

827-142

Explanation: The parallel port control register write/read test with BIDI enabled failed.

Failing Item:

- FFC_827
-

827-151

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_221
-

827-152

Explanation: The parallel port status register read test failed.

Failing Item:

- FFC_827
-

827-161

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_827
-

827-162

Explanation: The parallel port interrupt test failed.

Failing Item:

- FFC_221
-

827-163

Explanation: The parallel port interrupt test failed.

Failing Item:

- FFC_221
-

827-201

Explanation: The extend control register of the parallel port failed a read/write test.

Failing Item:

- FFC_827
-

827-202

Explanation: Input/output to the FIFO (without interrupts) failed.

Failing Item:

- FFC_827
-

827-203

Explanation: Input/output to the FIFO (with interrupts) failed.

Failing Item:

- FFC_827
-

827-204

Explanation: Direct memory access to the FIFO failed.

Failing Item:

- FFC_827
-

828-501

Explanation: The diskette adapter test failed.

Failing Item:

- FFC_828
-

82C-102

Explanation: Adapter test failed.

Failing Item:

- FFC_82C
-

82C-104

Explanation: Display test failed.

Failing Item:

- FFC_82C
 - FFC_725
-

831-111

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_221
-

831-112

Explanation: Unable to determine the type of adapter from the VPD.

Failing Item:

- FFC_221
-

831-113

Explanation: The VPD verification test failed.

Failing Item:

- FFC_831
-

831-114

Explanation: The register verification test failed.

Failing Item:

- FFC_831
-

831-121

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_221
-

831-122

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_221
-

831-123

Explanation: The modem control line test failed.

Failing Item:

- FFC_221
-

831-131

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_221
-

831-132

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_221
-

831-133

Explanation: The modem control line test failed.

Failing Item:

- FFC_221
-

831-161

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_252
-

831-162

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_252
-

831-163

Explanation: The modem control line test failed.

Failing Item:

- FFC_252
-

831-164

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_221
 - FFC_252
-

831-165

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_221
 - FFC_252
-

831-166

Explanation: The modem control line test failed.

Failing Item:

- FFC_221
 - FFC_252
-

831-171

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_259
-

831-172

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_259
-

831-173

Explanation: The modem control line test failed.

Failing Item:

- FFC_259
-

831-181

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_261
-

831-182

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_261
-

831-183

Explanation: The modem control line test failed.

Failing Item:

- FFC_261
-

831-271

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_831
 - FFC_259
-

831-272

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_831
 - FFC_259
-

831-273

Explanation: The modem control line test failed.

Failing Item:

- FFC_831
 - FFC_259
-

831-281

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_831
 - FFC_259
-

831-282

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_831
 - FFC_259
-

831-283

Explanation: The modem control line test failed.

Failing Item:

- FFC_831
 - FFC_259
-

831-321

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_831
-

831-322

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_831
-

831-323

Explanation: The modem control line test failed.

Failing Item:

- FFC_831
-

831-331

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_831
-

831-332

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_831
-

831-333

Explanation: The modem control line test failed.

Failing Item:

- FFC_831
-

831-371

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_831
-

831-372

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_831
-

831-373

Explanation: The modem control line test failed.

Failing Item:

- FFC_831
-

831-381

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_831
-

831-382

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_831
-

831-383

Explanation: The modem control line test failed.

Failing Item:

- FFC_831
-

831-481

Explanation: Could not do the test because the device driver detected a hardware error.

Failing Item:

- FFC_D56
-

831-482

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_D56
-

831-483

Explanation: The modem control line test failed.

Failing Item:

- FFC_D56
-

831-581

Explanation: Could not do the test because the device driver detected a hardware error.

Failing Item:

- FFC_831
 - FFC_D56
-

831-582

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_831
 - FFC_D56
-

831-583

Explanation: The modem control line test failed.

Failing Item:

- FFC_831
 - FFC_D56
-

831-901

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-902

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-903

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-904

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-905

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-906

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-907

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-908

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-909

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem

831-90A • 831-910

resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_831
-

831-90A

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_831
-

831-90B

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_831
-

831-90C

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_831
-

831-90D

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or

if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_831
-

831-90E

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_831
-

831-90F

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_831
-

831-910

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_831
-

831-911

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_831
-

831-912

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_831
-

831-913

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_831
-

831-914

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE

- FFC_831
-

831-915

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_831
-

831-916

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_831
-

831-917

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_831
-

831-918

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

831-919 • 831-920

- SOFTWARE
- FFC_831

831-919

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-91A

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-91B

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-91C

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-91D

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-91E

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-91F

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-920

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem

resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-921

Explanation: The adapter failed to configure.

Failing Item:

- FFC_831
- SOFTWARE

831-922

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-923

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-924

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-925

Explanation: The adapter failed to configure.

Failing Item:

- FFC_831
- SOFTWARE

831-926

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-927

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-928

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-929

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than

from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_831
-

831-92A

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_831
-

831-92B

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_831
-

831-92C

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_831
-

831-92D

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_831
-

831-92E

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_831
-

831-92F

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_831
-

831-930

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE

- FFC_831

831-931

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-932

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-933

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-934

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-935

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-936

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-937

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-938

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-939

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-93A

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-93B

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-93C

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem

resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-93D

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-93E

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-93F

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-940

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or

if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-941

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-942

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

831-943

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 831; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_831

836-101

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_836

836-111

Explanation: Cannot run test because the device driver detected a hardware error.

Failing Item:

- FFC_836
- FFC_227

836-112

Explanation: Unable to determine the type of adapter from the VPD.

Failing Item:

- FFC_836
- FFC_227

836-113

Explanation: The VPD verification test failed.

Failing Item:

- FFC_836

836-114

Explanation: The register verification test failed.

Failing Item:

- FFC_836

836-115

Explanation: The VPD verification test failed.

Failing Item:

- FFC_836

836-116

Explanation: The 128-port controller line test failed.

Failing Item:

- FFC_B54
- FFC_836

836-117

Explanation: Remote Async Node test failed.

Failing Item:

- FFC_684

836-118

Explanation: Remote async node test failed.

Failing Item:

- FFC_837
-

836-119

Explanation: Sync line termination test failed.

Failing Item:

- FFC_836
-

836-151

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_837
-

836-152

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_837
-

836-153

Explanation: The modem control line test failed.

Failing Item:

- FFC_837
-

836-154

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_684
 - FFC_836
-

836-155

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_684
 - FFC_836
 - FFC_152
-

836-161

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_C22
-

836-162

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_C22
-

836-163

Explanation: The modem control line test failed.

Failing Item:

- FFC_C22
-

836-164

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_D06
-

836-171

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_259
-

836-172

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_259
-

836-173

Explanation: The modem control line test failed.

Failing Item:

- FFC_259
-

836-174

Explanation: Cannot run the test because the device driver detected a hardware error while running the Printer/Terminal cable wrap test.

Failing Item:

- FFC_263

836-175

Explanation: The data wrap communications test failed while running the Printer/Terminal cable wrap test.

Failing Item:

- FFC_263
-

836-181

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_261
-

836-182

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_261
-

836-183

Explanation: The modem control line test failed.

Failing Item:

- FFC_261
-

836-251

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_836
 - FFC_837
-

836-252

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_836
 - FFC_837
-

836-253

Explanation: The modem control line test failed.

Failing Item:

- FFC_836
 - FFC_837
-

836-254

Explanation: Cannot run the test because the device driver detected a hardware error while running the Remote Async Node wrap test.

Failing Item:

- FFC_836
 - FFC_837
-

836-255

Explanation: The data wrap communications test failed while running the Remote Async Node wrap test.

Response: Use MAP0210 : General problem resolution.

Failing Item:

- FFC_836
 - FFC_684
-

836-271

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_836
 - FFC_837
-

836-272

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_836
 - FFC_837
-

836-273

Explanation: The modem control line test failed.

Failing Item:

- FFC_836
 - FFC_837
-

836-274

Explanation: Cannot run the test because the device driver detected a hardware error while running the Printer/Terminal cable wrap test.

Failing Item:

- FFC_836
 - FFC_684
-

836-275

Explanation: The data wrap communications test failed while running the Printer/Terminal cable wrap test.

Failing Item:

- FFC_836
 - FFC_684
-

836-281

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_836
 - FFC_837
-

836-282

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_836
 - FFC_837
-

836-283

Explanation: The modem control line test failed.

Failing Item:

- FFC_836
 - FFC_837
-

836-481

Explanation: Could not do the test because the device driver detected a hardware error.

Failing Item:

- FFC_D56
-

836-482

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_D56
-

836-483

Explanation: The modem control line test failed.

Failing Item:

- FFC_D56

836-901

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_836
-

836-902

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_836
-

836-903

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_836
-

836-904

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE

- FFC_836

836-905

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-906

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-907

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-908

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-909

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-90A

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-90B

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-90C

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-90D

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-90E

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-90F

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-910

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem

resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-911

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-912

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-913

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-914

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or

if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-915

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-916

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-917

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-918

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-919

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-91A

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-91B

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE

- FFC_836

836-91C

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-91D

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-91E

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-91F

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-920

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-921

Explanation: The adapter failed to configure.

Failing Item:

- FFC_836
- SOFTWARE

836-922

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-923

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-924

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_836
-

836-925

Explanation: The adapter failed to configure.

Failing Item:

- FFC_836
 - SOFTWARE
-

836-926

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_836
-

836-927

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_836
-

836-928

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than

from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_836
-

836-929

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_836
-

836-92A

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_836
-

836-92B

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_836
-

836-92C

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_836
-

836-92D

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_836
-

836-92E

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_836
-

836-92F

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE

- FFC_836
-

836-930

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_836
-

836-931

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_836
-

836-932

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_836
-

836-933

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-934

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-935

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-936

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-937

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-938

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-939

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-93A

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_836

836-93B

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem

836-93C • 836-942

resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_836
-

836-93C

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_836
-

836-93D

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_836
-

836-93E

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_836
-

836-93F

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or

if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_836
-

836-940

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_836
-

836-941

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_836
-

836-942

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_836
-

836-943

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use general problem resolution with a FRU of 836; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_836
-

840-101

Explanation: Enhanced error handling failure on the bus.

Failing Item:

- FFC_221
-

840-102

Explanation: Enhanced error handling failure on a PCI-PCI Bridge.

Failing Item:

- FFC_293
-

840-103

Explanation: Enhanced error handling failure on the adapter.

Failing Item:

- FFC_840
 - FFC_221
-

840-212

Explanation: FIFO empty bit set.

Failing Item:

- FFC_840
-

840-213

Explanation: FIFO empty bit clear.

Failing Item:

- FFC_840
-

840-214

Explanation: FIFO full bit set.

Failing Item:

- FFC_840
-

840-215

Explanation: FIFO full bit clear.

Failing Item:

- FFC_840
-

840-216

Explanation: FIFO data miscompare.

Failing Item:

- FFC_840
-

840-217

Explanation: SCSI FIFO data miscompare.

Failing Item:

- FFC_840
-

840-218

Explanation: SCSI FIFO underflow.

Failing Item:

- FFC_840
-

840-219

Explanation: SCSI parity error.

Response: Use MAP0050 : SCSI Bus Problems

840-220

Explanation: SCSI FIFO flags error.

Failing Item:

- FFC_840
-

840-221

Explanation: Miscompare during the write/read of the configuration register.

Failing Item:

- FFC_840
 - FFC_221
-

840-222

Explanation: Error during the write/read of the memory register.

Failing Item:

- FFC_840
-

840-223

Explanation: Mismatch during the write/read of the memory I/O register.

Response: Use MAP0050 : SCSI Bus Problems.

Failing Item:

- FFC_840

840-224

Explanation: SCSI configuration register read or write error.

Failing Item:

- FFC_840
- FFC_221

840-225

Explanation: Adapter POST failed.

Failing Item:

- FFC_840

840-226

Explanation: SCSI wrap or PTC failure.

Response: Go to MAP0050 : SCSI Bus Problems.

840-227

Explanation: SCSI adapter test failure.

Failing Item:

- FFC_840
- FFC_221

840-230

Explanation: Arbitration test failed.

Response: Go to MAP0050 : SCSI Bus Problems.

840-231

Explanation: Function could not complete.

Response: Go to MAP0050 : SCSI Bus Problems.

840-232

Explanation: SCSI bus data mismatch.

Response: Go to MAP0050 : SCSI Bus Problems.

840-240

Explanation: No terminal power.

Response: Go to MAP0050 : SCSI Bus Problems.

840-242

Explanation: SCSI bus error.

Response: Go to MAP0050 : SCSI Bus Problems.

840-301

Explanation: The parent device open failed.

Failing Item:

- FFC_840
- FFC_221

840-701

Explanation: Error log analysis indicates a PCI SCSI adapter failure.

Failing Item:

- FFC_840

840-801

Explanation: Error log analysis indicates a terminator problem.

Response: Run the diagnostics on the adapter in System Verification mode. If an SRN is reported, use the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in General SCSI configuration checks to resolve the problem.

840-802

Explanation: Error log analysis indicates that multiple attempts to reset the SCSI bus have timed out.

Response: Run the diagnostics on the adapter in System Verification mode. If an SRN is reported, use the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in General SCSI configuration checks to resolve the problem.

840-803

Explanation: Error log analysis indicates that multiple SCSI bus errors have occurred.

Response: Run the diagnostics on the adapter in System Verification mode. If an SRN is reported, use the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in General SCSI configuration checks to resolve the problem.

844-XXX

Explanation: A 7135 controller problem is indicated.

Response: Use 7135 documentation.

Failing Item:

- FFC_844
-

845-XXX

Explanation: A 7135 DASD drawer problem is indicated.

Response: Use 7135 documentation.

Failing Item:

- FFC_845
-

846-XXX

Explanation: A 7135 DASD drawer problem is indicated.

Response: Use 7135 documentation.

Failing Item:

- FFC_846
-

868-101

Explanation: Enhanced error handling failure on the bus.

Failing Item:

- FFC_221
-

868-102

Explanation: Enhanced error handling failure on a PCI-PCI Bridge.

Failing Item:

- FFC_293
-

868-103

Explanation: Enhanced error handling failure on the adapter.

Failing Item:

- FFC_868
 - FFC_221
-

868-110

Explanation: The adapter diagnostic subcommand test failed.

Failing Item:

- FFC_221
-

868-130

Explanation: The adapter fuse test failed.

Failing Item:

- FFC_279
-

868-140

Explanation: The wrap test failed.

Failing Item:

- FFC_868
-

868-150

Explanation: The BCR registers write/read test failed.

Failing Item:

- FFC_868
-

868-160

Explanation: The POS registers write/read test failed.

Failing Item:

- FFC_868
-

868-170

Explanation: The internal/external reset test failed.

Failing Item:

- FFC_868
-

868-180

Explanation: The adapter command timed out.

Response: Note: Check the fuse before replacing.

Failing Item:

- FFC_279
 - FFC_868
-

868-190

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_221
-

868-191

Explanation: Analysis of the error log indicates a problem with the hardware.

Failing Item:

- FFC_868
-

868-192

Explanation: Analysis of the error log indicates a problem with the hardware.

Failing Item:

- FFC_221

868-193

Explanation: Analysis of the error log indicates a problem with the hardware.

Failing Item:

- FFC_279

868-194

Explanation: Analysis of the error log indicates a problem with the hardware.

Failing Item:

- FFC_868

868-200

Explanation: ROM CRC error.

Failing Item:

- FFC_868

868-201

Explanation: Adapter RAM error.

Failing Item:

- FFC_868

868-202

Explanation: The control logic failed.

Failing Item:

- FFC_868

868-203

Explanation: The control logic failed.

Failing Item:

- FFC_868

868-204

Explanation: The control logic failed.

Failing Item:

- FFC_868

868-205

Explanation: The control logic failed.

Failing Item:

- FFC_868

868-206

Explanation: Diagnostics completed with a previous error.

Failing Item:

- FFC_868

868-211

Explanation: The device failed to configure.

Failing Item:

- FFC_279
- FFC_868
- SOFTWARE

868-212

Explanation: FIFO empty bit set.

Failing Item:

- FFC_868

868-213

Explanation: FIFO empty bit clear.

Failing Item:

- FFC_868

868-214

Explanation: FIFO full bit set.

Failing Item:

- FFC_868

868-215

Explanation: FIFO full bit clear.

Failing Item:

- FFC_868

868-216

Explanation: FIFO data miscompare.

Failing Item:

- FFC_868
-

868-217

Explanation: SCSI FIFO data miscompare.

Failing Item:

- FFC_868
-

868-218

Explanation: SCSI FIFO underflow.

Failing Item:

- FFC_868
-

868-219

Explanation: SCSI parity error.

Response: Go to MAP0050 : SCSI Bus Problems.

868-220

Explanation: SCSI FIFO flags error.

Failing Item:

- FFC_868
-

868-221

Explanation: Miscompare during the write/read of the configuration register.

Failing Item:

- FFC_868
 - FFC_221
-

868-222

Explanation: Error during the write/read of the memory register.

Failing Item:

- FFC_868
-

868-223

Explanation: Miscompare during the write/read of the memory I/O register.

Failing Item:

- FFC_868
-

868-224

Explanation: SCSI configuration register read or write error.

Failing Item:

- FFC_868
 - FFC_221
-

868-225

Explanation: Adapter POST failed.

Failing Item:

- FFC_868
-

868-226

Explanation: SCSI wrap or PTC failure.

Response: Go to MAP0050 : SCSI Bus Problems.

868-227

Explanation: SCSI adapter test failure.

Failing Item:

- FFC_868
 - FFC_221
-

868-230

Explanation: Arbitration test failed.

Response: Go to MAP0050 : SCSI Bus Problems.

868-231

Explanation: Function could not complete.

Response: Go to MAP0050 : SCSI Bus Problems.

868-232

Explanation: SCSI bus data miscompare.

Response: Go to MAP0050 : SCSI Bus Problems.

868-240

Explanation: No terminal power.

Response: Go to MAP0050 : SCSI Bus Problems.

868-242

Explanation: SCSI bus error.

Response: Go to MAP0050 : SCSI Bus Problems.

868-301

Explanation: Configuration open failed for parent bus.

Failing Item:

- FFC_868
 - FFC_221
-

868-701

Explanation: Error log analysis indicates a PCI SCSI adapter failure.

Failing Item:

- FFC_868
-

868-801

Explanation: Error log analysis indicates a terminator problem.

Response: Run the diagnostics on the adapter in System Verification mode. If an SRN is reported, use the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in General SCSI configuration checks to resolve the problem.

868-802

Explanation: Error log analysis indicates that multiple attempts to reset the SCSI bus have timed out.

Response: Run the diagnostics on the adapter in System Verification mode. If an SRN is reported, use the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in General SCSI configuration checks to resolve the problem.

868-803

Explanation: Error log analysis indicates that multiple SCSI bus errors have occurred.

Response: Run the diagnostics on the adapter in System Verification mode. If an SRN is reported, use the SRN to resolve the problem. If an SRN is not reported, use the SCSI service hints in General SCSI configuration checks to resolve the problem.

887-101

Explanation: POS register test failed.

Failing Item:

- FFC_887
-

887-102

Explanation: I/O register test failed.

Failing Item:

- FFC_887
-

887-103

Explanation: Local RAM test failed.

Failing Item:

- FFC_887
-

887-104

Explanation: Vital Product Data (VPD) test failed.

Failing Item:

- FFC_887
-

887-105

Explanation: LAN coprocessor internal tests failed.

Failing Item:

- FFC_887
-

887-106

Explanation: Internal loopback test failed.

Failing Item:

- FFC_887
-

887-107

Explanation: External loopback test failed.

Failing Item:

- FFC_887
-

887-108

Explanation: External loopback test failed.

Failing Item:

- FFC_887
-

887-109

Explanation: External loopback parity tests failed.

Failing Item:

- FFC_887
-

887-110

Explanation: External loopback fairness test failed.

Failing Item:

- FFC_887
-

887-111

Explanation: External loopback fairness and parity tests failed.

Failing Item:

- FFC_887
-

887-112

Explanation: External loopback (twisted pair) test failed.

Failing Item:

- FFC_887
-

887-113

Explanation: External loopback (twisted pair) parity test failed.

Failing Item:

- FFC_887
-

887-114

Explanation: Ethernet loopback (twisted pair) fairness test failed.

Failing Item:

- FFC_887
-

887-115

Explanation: External loopback (twisted pair) fairness and parity tests failed.

Failing Item:

- FFC_887
-

887-116

Explanation: Twisted pair wrap data failed.

Failing Item:

- FFC_887
-

887-117

Explanation: Device configuration fails.

Failing Item:

- FFC_887
 - SOFTWARE
-

887-118

Explanation: Device driver indicates a hardware problem.

Failing Item:

- FFC_887
-

887-120

Explanation: Device driver indicates a hardware problem.

Failing Item:

- FFC_887
-

887-121

Explanation: Ethernet transceiver test failed.

Failing Item:

- FFC_B08
-

887-122

Explanation: Ethernet 10 Base-2 transceiver test failed.

Failing Item:

- FFC_B09
-

887-123

Explanation: Internal loopback test failed.

Failing Item:

- FFC_887
-

887-124

Explanation: Error log indicates a hardware problem.

Failing Item:

- FFC_887
 - SOFTWARE
-

887-125

Explanation: Fuse test failed.

Failing Item:

- FFC_887
-

887-202

Explanation: Vital product data test failed.

Failing Item:

- FFC_887
-

887-203

Explanation: Vital product data test failed.

Failing Item:

- FFC_887
-

887-209

Explanation: RJ-45 converter test failed.

Failing Item:

- FFC_887
-

887-304

Explanation: Coprocessor internal test failed.

Failing Item:

- FFC_887
-

887-305

Explanation: Internal loopback test failed.

Failing Item:

- FFC_887
-

887-306

Explanation: Internal loopback test failed.

Failing Item:

- FFC_887
-

887-307

Explanation: External loopback test failed.

Failing Item:

- FFC_887
-

887-319

Explanation: Device driver indicates a hardware failure.

Failing Item:

- FFC_887
 - SOFTWARE
-

887-400

Explanation: Fuse test failed.

Failing Item:

- FFC_887
-

887-401

Explanation: Circuit breaker for Ethernet test failed.

Failing Item:

- FFC_887
-

887-402

Explanation: Ethernet 10 Base-2 transceiver test failed.

Failing Item:

- FFC_B09
 - FFC_887
-

887-403

Explanation: Ethernet 10 Base-T transceiver test failed.

Failing Item:

- FFC_B08
 - FFC_887
-

887-405

Explanation: Rerun diagnostics in advanced mode for accurate problem determination.

Failing Item:

- ETHERNET_NETWORK
 - FFC_887
-

891-102

Explanation: A critical failure has occurred on an undefined element.

Failing Item:

- FFC_891
-

891-103

Explanation: Non-critical failure has occurred on an undefined element.

Failing Item:

- FFC_891
-

891-104

Explanation: An unrecoverable failure has occurred on an undefined element.

Failing Item:

- FFC_891
-

891-122

Explanation: A critical power supply failure has occurred.

Failing Item:

- FFC_152
-

891-123

Explanation: A non-critical power supply failure has occurred.

Failing Item:

- FFC_152
-

891-124

Explanation: An unrecoverable power supply failure has occurred.

Failing Item:

- FFC_152
-

891-132

Explanation: A critical fan failure has occurred.

Failing Item:

- FFC_166
-

891-133

Explanation: A non-critical fan failure has occurred.

Failing Item:

- FFC_166
-

891-134

Explanation: An unrecoverable fan failure has occurred.

Failing Item:

- FFC_166
 - FFC_891
-

891-148

Explanation: The enclosure indicates a temperature threshold warning.

Failing Item:

- FFC_166
 - FFC_891
-

891-149

Explanation: The enclosure indicates a temperature threshold failure.

Failing Item:

- FFC_166
 - FFC_891
-

891-152

Explanation: A critical repeater card failure has occurred.

Failing Item:

- FFC_891
-

891-153

Explanation: A non-critical repeater card failure has occurred.

Failing Item:

- FFC_891
-

891-154

Explanation: An unrecoverable repeater card failure has occurred.

Failing Item:

- FFC_891
-

891-162

Explanation: A critical VPD module failure has occurred.

Response: Go to MAP0210 : General problem resolution.

Failing Item:

- FFC_891
-

891-163

Explanation: A non-critical VPD module failure has occurred.

Failing Item:

- FFC_891
-

891-164

Explanation: An unrecoverable VPD module failure has occurred.

Failing Item:

- FFC_891
-

891-172

Explanation: A critical enclosure services failure has occurred.

Failing Item:

- FFC_891
-

891-173

Explanation: A non-critical enclosure services failure has occurred.

Failing Item:

- FFC_891
-

891-174

Explanation: An unrecoverable enclosure services failure has occurred.

Failing Item:

- FFC_891
-

891-182

Explanation: A critical failure has occurred on a user defined element.

Failing Item:

- FFC_891
-

891-183

Explanation: A non-critical failure has occurred on a user defined element.

Failing Item:

- FFC_891
-

891-184

Explanation: An unrecoverable failure has occurred on a user defined element.

Failing Item:

- FFC_891
-

891-192

Explanation: A critical failure has occurred on a user defined element.

Failing Item:

- FFC_891
-

891-193

Explanation: A non-critical failure has occurred on a user defined element.

Failing Item:

- FFC_891
-

891-194

Explanation: An unrecoverable failure has occurred on a user defined element.

Failing Item:

- FFC_891
-

891-201

Explanation: Device configuration error.

Failing Item:

- FFC_891
-

888 Service request numbers

891-202

Explanation: The enclosure failed to open.

Failing Item:

- FFC_891
-

891-203

Explanation: The enclosure failed to return inquiry data.

Response: Go to MAP0210 : General problem resolution.

Failing Item:

- FFC_891
-

891-204

Explanation: There is a critical power supply or fan failure.

Failing Item:

- FFC_152
 - FFC_166
-

891-205

Explanation: There is a redundant power supply or fan failure.

Failing Item:

- FFC_152
 - FFC_166
-

899-XXX

Explanation: 3490 or 3590 attached tape drive being identified or configured.

Response: Go to the service documentation for the tape drive attached to your system.

Failing Item:

- FFC_899
-

901-XXX

Explanation: Vendor SCSI device problem. Refer to the service documentation for this device.

902-XXX

Explanation: Vendor display problem. Refer to the service documentation for this display.

903-XXX

Explanation: Vendor Async device problem. Refer to the service documentation for this device.

904-XXX

Explanation: Vendor Parallel device problem. Refer to the service documentation for this device.

905-XXX

Explanation: Vendor device problem. Refer to the service documentation for this device.

912-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_912

912-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_912

912-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_912

912-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_912

912-108

Explanation: The bus test failed.

Failing Item:

- FFC_912

912-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_912

912-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_912

912-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_912

912-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_912

912-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_912

912-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_912
- FFC_B88

912-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_912

912-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_912

912-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_912

912-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_912
- FFC_B88

912-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_912
- SOFTWARE

912-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_912
- SOFTWARE

912-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_912

912-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_912

912-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_912

912-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88

- SOFTWARE

912-135

Explanation: The device failed to configure.

Failing Item:

- FFC_912
- FFC_B88
- SOFTWARE

912-136

Explanation: The certify operation failed.

Failing Item:

- FFC_912

912-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_912
- FFC_B88
- FFC_190

912-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General Problem Resolution.

Failing Item:

- FFC_912

912-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_912

912-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

913-102**Explanation:** An unrecoverable media error occurred.**Failing Item:**

- FFC_913
-

913-104**Explanation:** The motor failed to restart.**Failing Item:**

- FFC_913
-

913-105**Explanation:** The drive did not become ready.**Failing Item:**

- FFC_913
-

913-106**Explanation:** The electronics card test failed.**Failing Item:**

- FFC_913
-

913-108**Explanation:** The bus test failed.**Failing Item:**

- FFC_913
-

913-110**Explanation:** The media format is corrupted.**Failing Item:**

- FFC_913
-

913-112**Explanation:** The diagnostic test failed.**Failing Item:**

- FFC_913
-

913-114**Explanation:** An unrecoverable hardware error.**Failing Item:**

- FFC_913
-

913-116**Explanation:** A protocol error.**Response:** Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_913
-

913-117**Explanation:** A write-protect error occurred.**Failing Item:**

- FFC_913
-

913-118**Explanation:** A SCSI command time-out occurred.**Failing Item:**

- FFC_913
 - FFC_B88
-

913-120**Explanation:** A SCSI busy or command error.**Failing Item:**

- FFC_913
-

913-122**Explanation:** A SCSI reservation conflict error.**Failing Item:**

- FFC_913
-

913-124**Explanation:** A SCSI check condition error occurred.**Failing Item:**

- FFC_913
-

913-126**Explanation:** A software error was caused by a hardware failure.**Failing Item:**

- FFC_913
 - FFC_B88
-

913-128**Explanation:** The error log analysis indicates a hardware failure.**Failing Item:**

- FFC_190
- FFC_B88
- FFC_913
- SOFTWARE

913-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_913
 - SOFTWARE
-

913-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_913
-

913-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_913
-

913-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

913-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

913-135

Explanation: The device failed to configure.

Failing Item:

- FFC_913
 - FFC_B88
 - SOFTWARE
-

913-136

Explanation: The certify operation failed.

Failing Item:

- FFC_913
-

913-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_913
 - FFC_B88
 - FFC_190
-

913-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General Problem Resolution.

Failing Item:

- FFC_913
-

913-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_913
-

913-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

914-110

Explanation: The Reserve command failed.

Failing Item:

- FFC_914
-

914-120

Explanation: The Inquiry command failed.

Failing Item:

- FFC_914
-

914-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_914
- MEDIA

914-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_914

914-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_914
- MEDIA

914-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_914

914-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_914

914-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the

instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_914
- MEDIA

914-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_914

914-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_914
- MEDIA

914-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_914

914-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_914

- MEDIA

914-16L

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_914

914-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_914
- FFC_B88
- MEDIA

914-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_914
- FFC_B88

914-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_914
- MEDIA

914-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_914

914-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_914
- MEDIA

914-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_914

914-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_914

914-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_914
- MEDIA

914-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_914
-

914-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_914
 - MEDIA
-

914-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_914
-

914-220

Explanation: The Release command failed.

Failing Item:

- FFC_914
-

914-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_914
-

914-240

Explanation: The Openx command failed.

Failing Item:

- FFC_914
-

914-300

Explanation: The device configuration failed.

Failing Item:

- FFC_914
 - SOFTWARE
-

914-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
 - FFC_914
 - SOFTWARE
-

914-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_914
 - MEDIA
-

914-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_914
-

914-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_914
-

914-413 • 914-41E

- FFC_B88
- SOFTWARE

914-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-417

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-418

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-419

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-41A

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-41B

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-41C

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-41D

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-41E

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-41F

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-511

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_914
 - FFC_B88
-

914-512

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_914
 - FFC_B88
-

914-513

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_914
 - FFC_B88
-

914-514

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_914
 - FFC_B88
-

914-515

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_914
 - FFC_B88
-

914-516

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_914
 - FFC_B88
-

914-517

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_914
 - FFC_B88
-

914-518

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

914-519 • 914-612

- FFC_914
- FFC_B88

914-519

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_914
- FFC_B88

914-51A

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_914
- FFC_B88

914-51B

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_914
- FFC_B88

914-51C

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_914
- FFC_B88

914-51D

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_914
- FFC_B88

914-51E

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_914
- FFC_B88

914-51F

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_914
- FFC_B88

914-520

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_914
- FFC_B88

914-521

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_914
- FFC_B88

914-522

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_914
- FFC_B88

914-523

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_914
- FFC_B88

914-611

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-612

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_914

- FFC_B88
- SOFTWARE

914-613

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-614

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-615

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-616

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-617

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-618

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-619

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-61A

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-61B

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-61C

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-61D

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-61E

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-61F

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-620

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-621

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-622

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-623

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-711

Explanation: A device timeout error occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-712

Explanation: A device timeout error occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-713

Explanation: A device timeout error occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-714

Explanation: A device timeout error occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-715

Explanation: A device timeout error occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-716

Explanation: A device timeout error occurred.

Failing Item:

- FFC_914
- FFC_B88
- SOFTWARE

914-717

Explanation: A device timeout error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-718

Explanation: A device timeout error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-719

Explanation: A device timeout error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-71A

Explanation: A device timeout error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-71B

Explanation: A device timeout error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-71C

Explanation: A device timeout error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-71D

Explanation: A device timeout error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-71E

Explanation: A device timeout error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-71F

Explanation: A device timeout error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-720

Explanation: A device timeout error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-721

Explanation: A device timeout error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-722

Explanation: A device timeout error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

914-723

Explanation: A device timeout error occurred.

Failing Item:

- FFC_914
 - FFC_B88
 - SOFTWARE
-

915-110

Explanation: The Reserve command is corrupted.

Failing Item:

- FFC_915
-

915-120

Explanation: The Inquiry command failed.

Failing Item:

- FFC_915
-

915-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_915
 - MEDIA
-

915-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_915
-

915-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_915
 - MEDIA
-

915-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_915
-

915-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_915
-

915-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_915
 - MEDIA
-

915-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_915
-

915-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_915
 - MEDIA
-

915-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the

instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_915

915-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_915
- MEDIA

915-16L

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_915

915-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_915
- FFC_B88
- MEDIA

915-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_915
- FFC_B88

915-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_915
- MEDIA

915-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_915

915-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_915
- MEDIA

915-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_915

915-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_915
-

915-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_915
 - MEDIA
-

915-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_915
-

915-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_915
 - MEDIA
-

915-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_915
-

915-220

Explanation: The Replace command failed.

Failing Item:

- FFC_915
-

915-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_915
-

915-240

Explanation: The Openx command failed.

Failing Item:

- FFC_915
-

915-300

Explanation: The device configuration failed.

Failing Item:

- FFC_915
 - SOFTWARE
-

915-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
 - FFC_915
 - SOFTWARE
-

915-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_915
 - MEDIA
-

915-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_915

915-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-417

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-418

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-419

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-511

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_915
- FFC_B88

915-512

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_915
- FFC_B88

915-513

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_915
- FFC_B88

915-514

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_915
- FFC_B88

915-515

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_915
- FFC_B88

915-516

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_915
- FFC_B88

915-517

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_915
- FFC_B88

915-518

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_915
- FFC_B88

915-519

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_915
- FFC_B88

915-520

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_915
- FFC_B88

915-521

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_915
- FFC_B88

915-522

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_915
- FFC_B88

915-523

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_915
 - FFC_B88
-

915-611

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_915
 - FFC_B88
 - SOFTWARE
-

915-612

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_915
 - FFC_B88
 - SOFTWARE
-

915-613

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_915
 - FFC_B88
 - SOFTWARE
-

915-614

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_915
 - FFC_B88
 - SOFTWARE
-

915-615

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_915
 - FFC_B88
 - SOFTWARE
-

915-616

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_915
 - FFC_B88
 - SOFTWARE
-

915-617

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_915
 - FFC_B88
 - SOFTWARE
-

915-618

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_915
 - FFC_B88
 - SOFTWARE
-

915-619

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_915
 - FFC_B88
 - SOFTWARE
-

915-620

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_915
 - FFC_B88
 - SOFTWARE
-

915-621

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_915
 - FFC_B88
 - SOFTWARE
-

915-622

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-623

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-711

Explanation: A device timeout error occurred.

Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-712

Explanation: A device timeout error occurred.

Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-713

Explanation: A device timeout error occurred.

Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-714

Explanation: A device timeout error occurred.

Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-715

Explanation: A device timeout error occurred.

Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-716

Explanation: A device timeout error occurred.

Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-717

Explanation: A device timeout error occurred.

Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-718

Explanation: A device timeout error occurred.

Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-719

Explanation: A device timeout error occurred.

Failing Item:

- FFC_915
- FFC_B88
- SOFTWARE

915-720

Explanation: A device timeout error occurred.

Failing Item:

- FFC_915
 - FFC_B88
 - SOFTWARE
-

915-721

Explanation: A device timeout error occurred.

Failing Item:

- FFC_915
 - FFC_B88
 - SOFTWARE
-

915-722

Explanation: A device timeout error occurred.

Failing Item:

- FFC_915
 - FFC_B88
 - SOFTWARE
-

915-723

Explanation: A device timeout error occurred.

Failing Item:

- FFC_915
 - FFC_B88
 - SOFTWARE
-

917-102

Explanation: An unrecoverable media error.

Failing Item:

- FFC_917
 - FFC_B88
-

917-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_917
-

917-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_917
-

917-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_917
-

917-108

Explanation: The bus test failed.

Failing Item:

- FFC_917
-

917-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_917
-

917-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_917
-

917-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_917
-

917-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to ensure they are all compatible. If you do not find a problem, call your support person.

917-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_917
-

917-118

Explanation: A SCSI command timeout.

Failing Item:

- FFC_917
 - FFC_B88
-

917-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_917
-

917-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_917
-

917-124

Explanation: A SCSI check condition error.

Failing Item:

- FFC_917
-

917-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_917
 - FFC_B88
-

917-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_917
-

917-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_917
-

917-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_917
 - FFC_B88
-

917-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_917
-

917-133

Explanation: Use the subsystem guide to complete diagnostics.

Failing Item:

- FFC_917
-

917-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

917-135

Explanation: The device failed to configure.

Failing Item:

- FFC_917
 - FFC_B88
 - SOFTWARE
-

917-136

Explanation: The certify operation failed.

Failing Item:

- FFC_917
-

917-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_917
 - FFC_B88
 - FFC_190
-

917-138

Explanation: Error log indicates that the disk is operating at higher than recommended temperatures.

Failing Item:

- FFC_190
-

917-139

Explanation: Error configuring or opening device.

Failing Item:

- FFC_917
-

917-640

Explanation: Error Log Analysis indicates a path error.

Failing Item:

- FFC_640
-

918-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_918
-

918-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_918
-

918-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_918
-

918-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_918
-

918-108

Explanation: The bus test failed.

Failing Item:

- FFC_918
-

918-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_918
-

918-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_918
-

918-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_918
-

918-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_918
-

918-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_918
-

918-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_918
 - FFC_B88
-

918-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_918
-

918-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_918
-

918-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_918
-

918-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_918
 - FFC_B88
-

918-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_918
- SOFTWARE

918-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_918
- SOFTWARE

918-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_918

918-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_918

918-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_918

918-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

918-135

Explanation: The device failed to configure.

Failing Item:

- FFC_918
- FFC_B88
- SOFTWARE

918-136

Explanation: The certify operation failed.

Failing Item:

- FFC_918

918-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_918
- FFC_B88
- FFC_190

918-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_918

918-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_918

918-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

921-101

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821

921-102

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_921
 - FFC_821
-

921-103

Explanation: The keyboard reset failed.

Failing Item:

- FFC_921
 - FFC_821
-

921-104

Explanation: Unknown keyboard.

Failing Item:

- FFC_921
-

921-105

Explanation: The keyboard light-on test failed.

Failing Item:

- FFC_921
 - FFC_821
-

921-106

Explanation: The keyboard light-off test failed.

Failing Item:

- FFC_921
 - FFC_821
-

921-201

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821
-

921-202

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_921
 - FFC_821
-

921-203

Explanation: The read keyboard ID test failed.

Failing Item:

- FFC_921
 - FFC_821
-

921-204

Explanation: The keyboard layout ID test failed.

Failing Item:

- FFC_921
-

921-205

Explanation: The keyboard echo test failed.

Failing Item:

- FFC_921
 - FFC_821
-

921-206

Explanation: The select scan code set test failed.

Failing Item:

- FFC_921
 - FFC_821
-

921-301

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821
-

921-302

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_921
 - FFC_821
-

921-303

Explanation: An error occurred in turning on the lamps.

Failing Item:

- FFC_921
-

921-304

Explanation: An error occurred in turning off the lamps.

Failing Item:

- FFC_921
-

921-401

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821

921-402

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_921
 - FFC_821
-

921-403

Explanation: Unable to recognize the keyboard.

Failing Item:

- FFC_921
-

921-404

Explanation: The keyboard is failing.

Failing Item:

- FFC_921
 - FFC_821
-

921-501

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821
-

921-502

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_921
 - FFC_821
-

921-503

Explanation: The auto-click cannot be disabled.

Failing Item:

- FFC_921
-

921-504

Explanation: The auto-click cannot be enabled.

Failing Item:

- FFC_921
-

921-505

Explanation: Unable to recognize the keyboard.

Failing Item:

- FFC_921

921-601

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821
-

921-602

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_921
 - FFC_821
-

921-603

Explanation: The speaker test failed.

Failing Item:

- FFC_921
-

921-701

Explanation: Error configuring the device.

Failing Item:

- FFC_921
 - FFC_821
-

921-901

Explanation: The error log analysis indicates an adapter failure.

Failing Item:

- FFC_821
-

921-902

Explanation: The error log analysis indicates a device failure.

Failing Item:

- FFC_921
 - FFC_821
-

921-903

Explanation: The error log analysis indicates an unknown failure.

Failing Item:

- FFC_921
 - FFC_821
-

922-101

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821
-

922-102

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_922
 - FFC_821
-

922-103

Explanation: The keyboard reset failed.

Failing Item:

- FFC_922
 - FFC_821
-

922-104

Explanation: Unknown keyboard.

Failing Item:

- FFC_922
-

922-105

Explanation: The keyboard light-on test failed.

Failing Item:

- FFC_922
 - FFC_821
-

922-106

Explanation: The keyboard light-off test failed.

Failing Item:

- FFC_922
 - FFC_821
-

922-201

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821
-

922-202

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_922
-

- FFC_821
-

922-203

Explanation: The read keyboard id test failed.

Failing Item:

- FFC_922
 - FFC_821
-

922-204

Explanation: The keyboard layout id test failed.

Failing Item:

- FFC_922
-

922-205

Explanation: The keyboard echo test failed.

Failing Item:

- FFC_922
 - FFC_821
-

922-206

Explanation: The select scan code set test failed.

Failing Item:

- FFC_922
 - FFC_821
-

922-301

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821
-

922-302

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_922
 - FFC_821
-

922-303

Explanation: An error occurred in turning on the lamps.

Failing Item:

- FFC_922
-

922-304

Explanation: An error occurred in turning off the lamps.

Failing Item:

- FFC_922
-

922-401

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821
-

922-402

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_922
 - FFC_821
-

922-403

Explanation: The keyboard is failing.

Failing Item:

- FFC_922
-

922-404

Explanation: Unable to recognize the keyboard.

Failing Item:

- FFC_922
 - FFC_821
-

922-501

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821
-

922-502

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_922
 - FFC_821
-

922-503

Explanation: The auto-click cannot be disabled.

Failing Item:

- FFC_921
-

922-504

Explanation: The auto-click cannot be enabled.

Failing Item:

- FFC_922
-

922-505

Explanation: Unable to recognize the keyboard.

Failing Item:

- FFC_922
-

922-601

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821
-

922-602

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_922
 - FFC_821
-

922-603

Explanation: The speaker test failed.

Failing Item:

- FFC_922
-

922-701

Explanation: Error configuring the device.

Failing Item:

- FFC_923
 - FFC_821
-

922-901

Explanation: The error log indicates an adapter failed.

Failing Item:

- FFC_821
-

922-902

Explanation: The error log indicates a device failed.

Failing Item:

- FFC_922
 - FFC_821
-

922-903

Explanation: The error log analysis indicates an unknown failure.

Failing Item:

- FFC_922
 - FFC_821
-

923-101

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821
-

923-102

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_923
 - FFC_821
-

923-103

Explanation: The keyboard reset failed.

Failing Item:

- FFC_923
 - FFC_821
-

923-104

Explanation: Unknown keyboard.

Failing Item:

- FFC_923
-

923-105

Explanation: The keyboard light-on test failed.

Failing Item:

- FFC_923
 - FFC_821
-

923-106

Explanation: The keyboard light-off test failed.

Failing Item:

- FFC_923
 - FFC_821
-

923-201

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821
-

923-202

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_923
 - FFC_821
-

923-203

Explanation: The read keyboard id test failed.

Failing Item:

- FFC_923
 - FFC_821
-

923-204

Explanation: The keyboard layout id test failed.

Failing Item:

- FFC_923
-

923-205

Explanation: The keyboard echo test failed.

Failing Item:

- FFC_923
 - FFC_821
-

923-206

Explanation: The select scan code set test failed.

Failing Item:

- FFC_923
 - FFC_821
-

923-301

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821
-

923-302

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_923
-

- FFC_821

923-303

Explanation: An error occurred in turning on the lamps.

Failing Item:

- FFC_923

923-304

Explanation: An error occurred in turning off the lamps.

Failing Item:

- FFC_923

923-401

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821

923-402

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_923
- FFC_821

923-403

Explanation: The keyboard is failing.

Failing Item:

- FFC_923

923-404

Explanation: Unable to recognize the keyboard.

Failing Item:

- FFC_923
- FFC_821

923-501

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821

923-502

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_923
- FFC_821

923-503

Explanation: The auto-click cannot be disabled.

Failing Item:

- FFC_923

923-504

Explanation: The auto-click cannot be enabled.

Failing Item:

- FFC_923

923-505

Explanation: Unable to recognize the keyboard.

Failing Item:

- FFC_923

923-601

Explanation: An unexpected adapter error occurred.

Failing Item:

- FFC_821

923-602

Explanation: An unexpected device or adapter error occurred.

Failing Item:

- FFC_923
- FFC_821

923-603

Explanation: The speaker test failed.

Failing Item:

- FFC_923

923-901

Explanation: The error log indicates an adapter failed.

Failing Item:

- FFC_821

923-902

Explanation: The error log analysis indicates a device failure.

Failing Item:

- FFC_923
 - FFC_821
-

923-903

Explanation: The error log analysis indicates an unknown failure.

Failing Item:

- FFC_923
 - FFC_821
-

925-111

Explanation: An unexpected device error occurred.

Failing Item:

- FFC_925
 - FFC_823
-

925-112

Explanation: The device disable test failed.

Failing Item:

- FFC_925
 - FFC_823
-

925-113

Explanation: Could not reset the device.

Failing Item:

- FFC_925
-

925-114

Explanation: The Read Status command failed.

Failing Item:

- FFC_925
 - FFC_823
-

925-115

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-116

Explanation: Unknown Mouse type.

Failing Item:

- FFC_925
-

925-117

Explanation: Mouse wrap mode failed.

Failing Item:

- FFC_925
 - FFC_823
-

925-118

Explanation: Error setting mouse parameters.

Failing Item:

- FFC_925
 - FFC_823
-

925-121

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-122

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-123

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-124

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-125

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-126

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-127

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-128

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-129

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-130

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-131

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-132

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-133

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-134

Explanation: The device test failed.

Failing Item:

- FFC_925

925-135

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-136

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-137

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-138

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-139

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-140

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-141

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-142

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-143

Explanation: The device test failed.

Failing Item:

- FFC_925

925-144

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-145

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-146

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-147

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-148

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-149

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-150

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-151

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-152

Explanation: The device test failed.

Failing Item:

- FFC_925

925-153

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-154

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-155

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-156

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-157

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-158

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-159

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-160

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-161

Explanation: The device test failed.

Failing Item:

- FFC_925

925-162

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-163

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-164

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-165

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-166

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-167

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-168

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-169

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-170

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-171

Explanation: The device test failed.

Failing Item:

- FFC_925
-

925-200

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_925
 - FFC_823
-

925-300

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_925
-

925-301

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_925
 - FFC_823
-

926-104

Explanation: Input device cable is not attached.

Failing Item:

- FFC_926
 - FFC_159
-

926-111

Explanation: Adapter error.

Failing Item:

- FFC_824
-

926-112

Explanation: Device, adapter or tablet reset failed.

Failing Item:

- FFC_926
 - FFC_824
-

926-113

Explanation: Device, adapter or tablet reset failed.

Failing Item:

- FFC_926
 - FFC_824
-

926-114

Explanation: Device, adapter or tablet reset failed.

Failing Item:

- FFC_926
 - FFC_824
-

926-115

Explanation: Device, adapter or tablet reset failed.

Failing Item:

- FFC_926
 - FFC_824
-

926-116

Explanation: The input device cable is not attached.

Failing Item:

- FFC_159
-

926-119

Explanation: The input device cable is not attached.

Failing Item:

- FFC_188
-

926-121

Explanation: Adapter error.

Failing Item:

- FFC_824
-

926-131

Explanation: Adapter error.

Failing Item:

- FFC_824
 - FFC_926
-

926-132

Explanation: Device or adapter error.

Failing Item:

- FFC_926

926-133

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-134

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-135

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-141

Explanation: Adapter error.

Failing Item:

- FFC_824
 - FFC_926
-

926-142

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-143

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-144

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-145

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-146

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-147

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-148

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-149

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-150

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-151

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-152

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-153

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-154

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-155

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-156

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-157

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-158

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-159

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-160

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-161

Explanation: Device or adapter error.

Failing Item:

- FFC_926
-

926-162

Explanation: Device or adapter error.

Failing Item:

- FFC_159
 - FFC_926
-

926-163**Explanation:** Error in turning off input device LED.**Failing Item:**

- FFC_159
 - FFC_926
-

926-164**Explanation:** Error in turning off input device LED.**Failing Item:**

- FFC_159
 - FFC_926
-

926-165**Explanation:** The input device cable is not attached.**Failing Item:**

- FFC_159
-

926-166**Explanation:** Device or adapter error.**Failing Item:**

- FFC_188
 - FFC_926
-

926-167**Explanation:** Error in turning off input device LED.**Failing Item:**

- FFC_188
 - FFC_926
-

926-168**Explanation:** Error in turning on input device LED.**Failing Item:**

- FFC_188
 - FFC_926
-

926-169**Explanation:** The input device cable is not attached.**Failing Item:**

- FFC_188
-

926-172**Explanation:** Device or adapter error.**Failing Item:**

- FFC_159
-

- FFC_926
-

926-173**Explanation:** Error in turning off input device switch.**Failing Item:**

- FFC_159
 - FFC_926
-

926-174**Explanation:** Error in turning on input device switch.**Failing Item:**

- FFC_159
 - FFC_926
-

926-175**Explanation:** The input device cable is not attached.**Failing Item:**

- FFC_159
-

926-176**Explanation:** Device or adapter error.**Failing Item:**

- FFC_188
 - FFC_926
-

926-177**Explanation:** Error in turning off input device switch.**Failing Item:**

- FFC_188
 - FFC_926
-

926-178**Explanation:** Error in turning on input device switch.**Failing Item:**

- FFC_188
 - FFC_926
-

926-179**Explanation:** The input device cable is not attached.**Failing Item:**

- FFC_188
-

926-181

Explanation: Adapter error.

Failing Item:

- FFC_824
- FFC_926

926-182

Explanation: Device or adapter error.

Failing Item:

- FFC_159
- FFC_926

926-183

Explanation: Error in incremental data mode test.

Failing Item:

- FFC_159
- FFC_926

926-184

Explanation: The input device cable is not attached.

Failing Item:

- FFC_159

926-186

Explanation: Device or adapter error.

Failing Item:

- FFC_188
- FFC_926

926-187

Explanation: The incremental data mode test failed.

Failing Item:

- FFC_188
- FFC_926

926-188

Explanation: The input device cable is not attached.

Failing Item:

- FFC_188

926-203

Explanation: Error in disabling tablet.

Failing Item:

- FFC_926

- FFC_824

926-204

Explanation: Error in enabling tablet.

Failing Item:

- FFC_926
- FFC_824

926-207

Explanation: Enabled/disabled test failed.

Failing Item:

- FFC_926
- FFC_824

926-208

Explanation: Enabled/disabled test failed.

Failing Item:

- FFC_926
- FFC_824

926-221

Explanation: Adapter error.

Failing Item:

- FFC_824

926-222

Explanation: Device or adapter error.

Failing Item:

- FFC_926
- FFC_824

926-225

Explanation: The input device cable is not attached.

Failing Item:

- FFC_159

926-229

Explanation: The input device cable is not attached.

Failing Item:

- FFC_188

926-271

Explanation: Adapter error.

Failing Item:

- FFC_926

926-272

Explanation: Device or adapter error.

Failing Item:

- FFC_159
 - FFC_926
-

926-273

Explanation: Error in input device switch test.

Failing Item:

- FFC_159
-

926-274

Explanation: The input device cable is not attached.

Failing Item:

- FFC_159
-

926-276

Explanation: Device or adapter error.

Failing Item:

- FFC_188
 - FFC_926
-

926-277

Explanation: Error in input device switch test.

Failing Item:

- FFC_188
 - FFC_926
-

926-278

Explanation: Input device cable is not attached.

Failing Item:

- FFC_188
-

926-281

Explanation: Adapter error.

Failing Item:

- FFC_824
 - FFC_926
-

926-282

Explanation: Device or adapter error.

Failing Item:

- FFC_159
- FFC_926

926-283

Explanation: Error in incremental data mode test.

Failing Item:

- FFC_159
 - FFC_926
-

926-284

Explanation: The input device cable is not attached.

Failing Item:

- FFC_159
-

926-286

Explanation: Device or adapter error.

Failing Item:

- FFC_188
 - FFC_926
-

926-287

Explanation: Error in incremental data mode test.

Failing Item:

- FFC_188
 - FFC_926
-

926-288

Explanation: The input device cable is not attached.

Failing Item:

- FFC_188
-

927-104

Explanation: The input device cable is not attached.

Failing Item:

- FFC_927
 - FFC_159
-

927-111

Explanation: Adapter error.

Failing Item:

- FFC_824
-

927-112

Explanation: Device or adapter error.

Failing Item:

- FFC_927
- FFC_824

927-113

Explanation: Tablet reset failed.

Failing Item:

- FFC_927
 - FFC_824
-

927-114

Explanation: The read configuration test failed.

Failing Item:

- FFC_927
 - FFC_824
-

927-115

Explanation: The read status test failed.

Failing Item:

- FFC_927
 - FFC_824
-

927-116

Explanation: The input device cable is not attached.

Failing Item:

- FFC_159
-

927-119

Explanation: The input device cable is not attached.

Failing Item:

- FFC_188
-

927-121

Explanation: Adapter error.

Failing Item:

- FFC_824
-

927-122

Explanation: Device or adapter error.

Failing Item:

- FFC_927
 - FFC_824
-

927-125

Explanation: The input device cable is not attached.

Failing Item:

- FFC_927
- FFC_824

927-131

Explanation: Adapter error.

Failing Item:

- FFC_824
 - FFC_927
-

927-132

Explanation: Device or adapter error.

Failing Item:

- FFC_927
-

927-133

Explanation: The set conversion mode test failed.

Failing Item:

- FFC_927
-

927-134

Explanation: The set resolution test failed.

Failing Item:

- FFC_927
-

927-135

Explanation: The read status test failed.

Failing Item:

- FFC_927
-

927-141

Explanation: Adapter error.

Failing Item:

- FFC_824
 - FFC_927
-

927-142

Explanation: Device or adapter error.

Failing Item:

- FFC_927
-

927-143

Explanation: Error in tablet indicator.

Failing Item:

- FFC_927
-

927-161**Explanation:** Adapter error.**Failing Item:**

- FFC_927
-

927-162**Explanation:** Device or adapter error.**Failing Item:**

- FFC_159
 - FFC_927
-

927-163**Explanation:** Error in turning off input device LED.**Failing Item:**

- FFC_159
 - FFC_927
-

927-164**Explanation:** Error in turning on input device LED.**Failing Item:**

- FFC_159
 - FFC_927
-

927-165**Explanation:** The input device cable is not attached.**Failing Item:**

- FFC_159
-

927-166**Explanation:** Device or adapter error.**Failing Item:**

- FFC_188
 - FFC_927
-

927-167**Explanation:** Error in turning off input device LED.**Failing Item:**

- FFC_188
 - FFC_927
-

927-168**Explanation:** Error in turning on input device LED.**Failing Item:**

- FFC_188

- FFC_927
-

927-169**Explanation:** The input device cable is not attached.**Failing Item:**

- FFC_188
-

927-171**Explanation:** Adapter error.**Failing Item:**

- FFC_927
-

927-172**Explanation:** Device or adapter error.**Failing Item:**

- FFC_159
 - FFC_927
-

927-173**Explanation:** Error in turning off input device switch.**Failing Item:**

- FFC_159
 - FFC_927
-

927-174**Explanation:** Error in turning on input device switch.**Failing Item:**

- FFC_159
 - FFC_927
-

927-175**Explanation:** The input device cable is not attached.**Failing Item:**

- FFC_159
-

927-176**Explanation:** Device or adapter error.**Failing Item:**

- FFC_188
 - FFC_927
-

927-177**Explanation:** Error in turning off input device switch.**Failing Item:**

- FFC_188

- FFC_927

927-178

Explanation: Error in turning on input device switch.

Failing Item:

- FFC_188
- FFC_927

927-179

Explanation: The input device cable is not attached.

Failing Item:

- FFC_188

927-181

Explanation: Adapter error.

Failing Item:

- FFC_824
- FFC_927

927-182

Explanation: Device or adapter error.

Failing Item:

- FFC_159
- FFC_927

927-183

Explanation: Error in incremental data mode test.

Failing Item:

- FFC_159
- FFC_927

927-184

Explanation: The input device cable is not attached.

Failing Item:

- FFC_159

927-186

Explanation: Device or adapter error.

Failing Item:

- FFC_188
- FFC_927

927-187

Explanation: Error in incremental data mode test.

Failing Item:

- FFC_188
- FFC_927

927-188

Explanation: The input device cable is not attached.

Failing Item:

- FFC_188

927-203

Explanation: Error in disabling tablet.

Failing Item:

- FFC_927
- FFC_824

927-204

Explanation: Error in enabling tablet.

Failing Item:

- FFC_927
- FFC_824

927-221

Explanation: Adapter error.

Failing Item:

- FFC_824

927-222

Explanation: Device or adapter error.

Failing Item:

- FFC_927
- FFC_824

927-225

Explanation: The input device cable is not attached.

Failing Item:

- FFC_159

927-229

Explanation: The input device cable is not attached.

Failing Item:

- FFC_188

927-271

Explanation: Adapter error.

Failing Item:

- FFC_927
-

927-272

Explanation: Device or adapter error.

Failing Item:

- FFC_159
 - FFC_927
-

927-273

Explanation: Error in input device switch test.

Failing Item:

- FFC_159
 - FFC_927
-

927-274

Explanation: The input device cable is not attached.

Failing Item:

- FFC_159
-

927-276

Explanation: Device or adapter error.

Failing Item:

- FFC_188
 - FFC_927
-

927-277

Explanation: Error in input device switch test.

Failing Item:

- FFC_188
 - FFC_927
-

927-278

Explanation: The input device cable is not attached.

Failing Item:

- FFC_188
-

927-281

Explanation: Adapter error.

Failing Item:

- FFC_824
 - FFC_927
-

927-282

Explanation: Device or adapter error.

Failing Item:

- FFC_159
 - FFC_927
-

927-283

Explanation: Error in incremental data mode test.

Failing Item:

- FFC_159
 - FFC_927
-

927-284

Explanation: The input device cable is not attached.

Failing Item:

- FFC_159
-

927-286

Explanation: Device or adapter error.

Failing Item:

- FFC_188
 - FFC_927
-

927-287

Explanation: Error in incremental data mode test.

Failing Item:

- FFC_188
 - FFC_927
-

927-288

Explanation: The input device cable is not attached.

Failing Item:

- FFC_188
-

929-201

Explanation: Failed to register input ring.

Failing Item:

- FFC_929
-

929-202

Explanation: Unable to read event from the device.

Failing Item:

- FFC_929
-

929-203

Explanation: Unable to communicate with the device.

Failing Item:

- FFC_929
-

929-204

Explanation: Cannot set the device granularity.

Failing Item:

- FFC_929
-

929-210

Explanation: Device or adapter failure.

Failing Item:

- FFC_929
-

929-212

Explanation: Cannot set the device to HIGH granularity.

Failing Item:

- FFC_929
-

929-213

Explanation: Cannot set the device to LOW granularity.

Failing Item:

- FFC_929
-

929-299

Explanation: Error unconfiguring the device.

Failing Item:

- SOFTWARE
 - FFC_929
-

929-301

Explanation: Error configuring the device.

Failing Item:

- SOFTWARE
 - FFC_929
-

930-201

Explanation: Device or adapter failure.

Failing Item:

- FFC_930
-

930-210

Explanation: Unable to turn the lights on.

Failing Item:

- FFC_930
-

930-220

Explanation: Unable to turn the lights off hardware failure.

Failing Item:

- FFC_930
-

930-230

Explanation: Unable to turn the lights off.

Failing Item:

- FFC_930
-

930-241

Explanation: Unable to turn a single light-on.

Failing Item:

- FFC_930
-

930-242

Explanation: Device or adapter failure.

Failing Item:

- FFC_930
-

930-243

Explanation: Device or adapter failure.

Failing Item:

- FFC_930
-

930-261

Explanation: Cable test failed.

Failing Item:

- FFC_930
-

930-262

Explanation: Cable test failed.

Failing Item:

- FFC_930
-

930-299

Explanation: Error unconfiguring the device.

Failing Item:

- SOFTWARE
 - FFC_930
-

930-301

Explanation: Error configuring the device.

Failing Item:

- SOFTWARE
 - FFC_930
-

935-101

Explanation: The diskette-drive select or deselect test failed.

Failing Item:

- FFC_935
 - FFC_828
-

935-102

Explanation: The diskette-drive select or deselect test failed.

Failing Item:

- FFC_935
 - FFC_828
-

935-103

Explanation: The diskette failed.

Failing Item:

- FFC_935
 - FFC_828
-

935-104

Explanation: The diskette failed.

Failing Item:

- FFC_935
 - FFC_828
-

935-105

Explanation: The diskette failed.

Failing Item:

- FFC_935
 - FFC_828
-

935-106

Explanation: The diskette failed.

Failing Item:

- FFC_935
 - FFC_828
-

935-107

Explanation: The diskette failed.

Failing Item:

- FFC_935
 - FFC_828
-

935-108

Explanation: The diskette read test failed.

Failing Item:

- FFC_935
-

935-109

Explanation: The read/write on the diskette drive failed.

Failing Item:

- FFC_935
 - FFC_828
-

935-110

Explanation: The read/write on the diskette drive failed.

Failing Item:

- FFC_935
 - FFC_828
-

935-111

Explanation: A diskette drive test failed.

Failing Item:

- FFC_935
-

935-112

Explanation: A diskette drive test failed.

Failing Item:

- FFC_935
-

935-113

Explanation: A diskette drive test failed.

Failing Item:

- FFC_935
-

935-114

Explanation: A diskette drive test failed.

Failing Item:

- FFC_935
-

935-115

Explanation: The diskette drive test failed.

Failing Item:

- FFC_935
 - FFC_828
-

935-116

Explanation: The diskette drive test failed.

Failing Item:

- FFC_935
 - FFC_828
-

935-117

Explanation: The diskette drive test failed.

Failing Item:

- FFC_935
 - FFC_828
-

935-118

Explanation: The diskette drive test failed.

Failing Item:

- FFC_935
 - FFC_828
-

935-119

Explanation: The diskette drive test failed.

Failing Item:

- FFC_935
 - FFC_828
-

935-120

Explanation: The diskette drive test failed.

Failing Item:

- FFC_935
 - FFC_828
-

935-121

Explanation: The diskette drive test failed.

Failing Item:

- FFC_935
 - FFC_828
-

935-122

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_935
 - FFC_828
-

935-123

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_935
-

935-124

Explanation: Unable to configure the device.

Failing Item:

- FFC_935
 - SOFTWARE
-

938-101

Explanation: HIPPI Adapter test failed.

Failing Item:

- FFC_938
 - FFC_227
-

938-104

Explanation: HIPPI Adapter test failed.

Failing Item:

- FFC_938
 - FFC_227
-

938-105

Explanation: HIPPI Adapter test failed.

Failing Item:

- FFC_938
 - FFC_227
-

938-108

Explanation: HIPPI Adapter test failed.

Failing Item:

- FFC_938
 - FFC_227
-

938-109

Explanation: HIPPI Adapter test failed.

Failing Item:

- FFC_938
 - FFC_227
-

938-10A

Explanation: HIPPI Adapter test failed.

Failing Item:

- FFC_938
 - FFC_227
-

938-10B

Explanation: HIPPI Adapter test failed.

Failing Item:

- FFC_938
 - FFC_227
-

938-10C

Explanation: HIPPI Adapter test failed.

Failing Item:

- WRAP_PLUG
 - FFC_938
-

938-124

Explanation: HIPPI Adapter test failed.

Failing Item:

- FFC_938
 - FFC_227
-

938-600

Explanation: HIPPI Adapter test failed.

Failing Item:

- FFC_938
 - FFC_227
 - SOFTWARE
-

938-800

Explanation: HIPPI Adapter test failed.

Failing Item:

- FFC_938
 - FFC_227
-

945-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_945
-

945-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_945
-

945-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_945
-

945-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_945
-

945-108

Explanation: The bus test failed.

Failing Item:

- FFC_945
-

945-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_945
-

945-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_945
-

945-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_945
-

945-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_945
-

945-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_945
-

945-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_945
 - FFC_B88
-

945-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_945
-

945-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_945
-

945-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_945
-

945-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_945
-

- FFC_B88
-

945-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_945
 - SOFTWARE
-

945-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_945
 - SOFTWARE
-

945-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_945
-

945-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_945
-

945-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

945-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

945-135

Explanation: The device failed to configure.

Failing Item:

- FFC_945
 - FFC_B88
 - SOFTWARE
-

945-136

Explanation: The certify operation failed.

Failing Item:

- FFC_945
-

945-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_945
 - FFC_B88
 - FFC_190
-

945-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_945
-

945-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_945
-

945-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

946-111

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_946
 - FFC_227
-

946-114

Explanation: The register verification test failed.

Failing Item:

- FFC_946
-

946-121

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_946
 - FFC_227
-

946-122

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_946
 - FFC_227
-

946-123

Explanation: The modem control line test failed.

Failing Item:

- FFC_946
 - FFC_227
-

946-131

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_946
-

946-132

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_946
 - FFC_227
-

946-133

Explanation: The modem control line test failed.

Failing Item:

- FFC_946
-

946-161

Explanation: Could not do the test because the device driver detected a hardware error.

Failing Item:

- FFC_252
-

946-162

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_252
-

946-163

Explanation: The modem control line test failed.

Failing Item:

- FFC_252
-

946-171

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_259
-

946-172

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_259
-

946-173

Explanation: The modem control line test failed.

Failing Item:

- FFC_259
-

946-181

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_261
-

946-182

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_261
-

946-183

Explanation: The modem control line test failed.

Failing Item:

- FFC_261
-

946-271

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_946
 - FFC_259
-

946-272

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_946
 - FFC_259
-

946-273

Explanation: The modem control line test failed.

Failing Item:

- FFC_946
 - FFC_259
-

946-281

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_946
 - FFC_261
-

946-282

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_946
 - FFC_261
-

946-283

Explanation: The modem control line test failed.

Failing Item:

- FFC_946
 - FFC_261
-

946-321

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_946
-

946-322

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_946
-

946-323

Explanation: The modem control line test failed.

Failing Item:

- FFC_946
-

946-331

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_946
-

946-332

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_946
-

946-333

Explanation: The modem control line test failed.

Failing Item:

- FFC_946
-

946-371

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_946
-

946-372

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_946
-

946-373

Explanation: The modem control line test failed.

Failing Item:

- FFC_946
-

946-381

Explanation: Cannot run the test because the device driver detected a hardware error.

Failing Item:

- FFC_946
-

946-382

Explanation: The data wrap communications test failed.

Failing Item:

- FFC_946
-

946-383

Explanation: The modem control line test failed.

Failing Item:

- FFC_946
-

946-481

Explanation: Could not do the test because the device driver detected a hardware error.

Failing Item:

- FFC_D56
-

946-482

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_D56
-

946-483

Explanation: The modem control line test failed.

Failing Item:

- FFC_D56
-

946-581

Explanation: Could not do the test because the device driver detected a hardware error.

Failing Item:

- FFC_946
 - FFC_D56
-

946-582

Explanation: The data wrap communication test failed.

Failing Item:

- FFC_946
 - FFC_D56
-

946-583

Explanation: The modem control line test failed.

Failing Item:

- FFC_946
 - FFC_D56
-

946-901

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_946
-

946-902

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_946
-

946-903

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_946
-

946-904

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_946
-

946-905

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_946
-

946-906

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE

- FFC_946

946-907

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-908

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-909

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-910

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-911

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-912

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-913

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-914

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-915

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-916

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-917

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-918

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General

problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-919

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-920

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-921

Explanation: The adapter failed to configure.

Failing Item:

- FFC_946
- SOFTWARE

946-922

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-923

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_946
-

946-924

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_946
-

946-925

Explanation: The adapter failed to configure.

Failing Item:

- FFC_946
 - SOFTWARE
-

946-926

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_946
-

946-927

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than

from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_946
-

946-928

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_946
-

946-929

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_946
-

946-930

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_946
-

946-931

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_946
-

946-932

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_946
-

946-933

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_946
-

946-934

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE

- FFC_946
-

946-935

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_946
-

946-936

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_946
-

946-937

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
 - FFC_946
-

946-938

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-939

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-940

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-941

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-942

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

946-943

Explanation: An unexpected error occurred that can be attributed to software or hardware.

Response: Run diagnostics from a source other than from the disk or a network. If the same error occurs or if the original SRN was not obtained from disk or a network based diagnostics, use MAP0210 : General problem resolution with a FFC of 946; otherwise, suspect a software problem.

Failing Item:

- SOFTWARE
- FFC_946

950-100

Explanation: Power supply problem.

Response: Use the service documentation for the portable disk.

Failing Item:

- FFC_192

950-101

Explanation: PCI bus was not found.

Response: Rerun diagnostics in Advanced Mode for additional problem isolation.

Failing Item:

- FFC_2C9
- FFC_153

950-102

Explanation: PCI bus was not found.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_2C9

950-103

Explanation: Multiple adapters on bus were not found.

Failing Item:

- FFC_2C9

950-105

Explanation: PCI bus was not found.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_2C9
- FFC_221

950-106

Explanation: PCI bus was not found.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_2C9

950-107

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_153
- FFC_165

950-108

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_190
- FFC_199
- FFC_153
- FFC_165

950-200

Explanation: Power supply problem.

Response: Use the service documentation for the external device.

Failing Item:

- FFC_152

950-201

Explanation: SCSI bus problem.

Response: Refer to MAP2010 in the 7134 High Density SCSI Disk Subsystem Installation and Service Guide

Failing Item:

- SCSI_BUS

950-400

Explanation: Power supply problem.

Response: Use the service documentation for the drawer/tower containing the failing power supply. If the drawer/deskside unit service documentation does not isolate the problem, go to Power problem isolation for your system.

Failing Item:

- FFC_153

950-440

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_440
- FFC_B88
- FFC_190
- FFC_199
- FFC_152

950-441

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_441
- FFC_B88
- FFC_190
- FFC_199
- FFC_152

950-442

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_442
- FFC_B88
- FFC_190
- FFC_199
- FFC_152

950-443

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_443
 - FFC_B88
 - FFC_190
 - FFC_199
 - FFC_152
-

950-451

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_451
 - FFC_B88
 - FFC_190
 - FFC_199
 - FFC_152
-

950-500

Explanation: Power supply problem.

Response: Use the service documentation for the system unit, rack, or drawer that contains the missing device.

Failing Item:

- FFC_152
-

950-56D

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_56D
 - FFC_B88
 - FFC_190
 - FFC_152
-

950-58D

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_58D
-

- FFC_B88
 - FFC_190
 - FFC_152
-

950-61D

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_61D
 - FFC_B88
 - FFC_190
 - FFC_152
-

950-638

Explanation: The SCSI device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_638
 - FFC_B88
 - FFC_277
 - FFC_190
 - FFC_152
-

950-639

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_639
 - FFC_B88
 - FFC_190
 - FFC_152
-

950-63A

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_63A
 - FFC_B88
 - FFC_190
 - FFC_152
-

950-63B

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_63B
- FFC_B88
- FFC_190
- FFC_152

950-63C

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_63C
- FFC_B88
- FFC_190
- FFC_152

950-63D

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_63D
- FFC_B88
- FFC_190
- FFC_152

950-63E

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_63E
- FFC_B88
- FFC_277
- FFC_190
- FFC_152

950-63F

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_63F
- FFC_B88
- FFC_190
- FFC_152

950-640

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_640
- FFC_B88
- FFC_190
- FFC_152

950-664

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_664
- FFC_B88
- FFC_190
- FFC_152

950-678

Explanation: The SCSI Tape Drive is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_678
- FFC_B88
- FFC_190
- FFC_152

950-679

Explanation: The SCSI Disk Drive is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_679
- FFC_B88
- FFC_190
- FFC_152

950-681

Explanation: The SCSI Disk Drive is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_681
 - FFC_2E7
 - FFC_190
 - FFC_152
-

950-700

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_700
 - FFC_B88
 - FFC_190
 - FFC_152
-

950-701

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_701
 - FFC_B88
 - FFC_190
 - FFC_152
-

950-702

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_702
 - FFC_B88
 - FFC_190
 - FFC_152
-

950-703

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_703

- FFC_B88
 - FFC_190
 - FFC_152
-

950-704

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_704
 - FFC_B88
 - FFC_190
 - FFC_152
-

950-705

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_705
 - FFC_B88
 - FFC_190
 - FFC_152
-

950-706

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_706
 - FFC_B88
 - FFC_190
 - FFC_152
-

950-707

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_707
 - FFC_B88
 - FFC_190
 - FFC_152
-

950-721

Explanation: An unknown drive type is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_721
- FFC_B88
- FFC_190
- FFC_152

950-722

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_722
- FFC_B88
- FFC_190
- FFC_152

950-723

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_723
- FFC_B88
- FFC_190
- FFC_152

950-724

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_724
- FFC_B88
- FFC_190
- FFC_152

950-734

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_734
- FFC_B88
- FFC_190
- FFC_152

950-741

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_741
- FFC_B88
- FFC_190
- FFC_152

950-772

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_772
- FFC_B88
- FFC_190
- FFC_152

950-773

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_773
- FFC_B88
- FFC_190
- FFC_152

950-789

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_789
- FFC_B88
- FFC_190
- FFC_152

950-792

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_792
 - FFC_B88
 - FFC_190
 - FFC_152
-

950-793

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_793
 - FFC_B88
 - FFC_190
 - FFC_152
-

950-804

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_807
 - FFC_B88
 - FFC_190
 - FFC_152
-

950-807

Explanation: The device is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_804
 - FFC_B88
 - FFC_190
 - FFC_152
-

950-912

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_912

- FFC_B88
 - FFC_190
 - FFC_152
-

950-914

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_914
 - FFC_B88
 - FFC_190
 - FFC_152
-

950-915

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_915
 - FFC_B88
 - FFC_190
 - FFC_152
-

950-917

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_917
 - FFC_B88
 - FFC_190
 - FFC_152
-

950-918

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_918
 - FFC_B88
 - FFC_190
 - FFC_152
-

950-935

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_935
- FFC_B88
- FFC_190
- FFC_152

950-951

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_951
- FFC_B88
- FFC_190
- FFC_152

950-952

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_952
- FFC_B88
- FFC_190
- FFC_152

950-953

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_953
- FFC_B88
- FFC_190
- FFC_152

950-954

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_954

- FFC_B88
- FFC_190
- FFC_152

950-955

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_955
- FFC_B88
- FFC_141
- FFC_190
- FFC_152

950-956

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_956
- FFC_B88
- FFC_190
- FFC_152

950-959

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_959
- FFC_B88
- FFC_190
- FFC_152

950-960

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_960
 - FFC_B88
 - FFC_190
 - FFC_152
-

950-964

Explanation: The SCSI Tape Drive is not responding.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_964
 - FFC_B88
 - FFC_190
 - FFC_152
-

950-968

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_968
 - FFC_B88
 - FFC_190
 - FFC_152
-

950-970

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_970
 - FFC_B88
 - FFC_190
 - FFC_152
-

950-971

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_971
 - FFC_B88
 - FFC_190
 - FFC_152
-

950-972

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_972

- FFC_B88
 - FFC_190
 - FFC_152
-

950-974

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_974
 - FFC_B88
 - FFC_190
 - FFC_152
-

950-981

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_981
 - FFC_B88
 - FFC_190
 - FFC_152
-

950-984

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_984
 - FFC_B88
 - FFC_190
 - FFC_152
-

950-986

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_986
 - FFC_B88
 - FFC_190
 - FFC_152
-

950-987

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_987
- FFC_B88
- FFC_190
- FFC_152

950-989

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_989
- FFC_B88
- FFC_190
- FFC_152

950-990

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_990
- FFC_B88
- FFC_190
- FFC_152

950-991

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_991
- FFC_B88
- FFC_190
- FFC_152

950-994

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_994

954 Service request numbers

- FFC_B88
- FFC_190
- FFC_152

950-995

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_995
- FFC_B88
- FFC_190
- FFC_152

950-998

Explanation: Device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_998
- FFC_B88
- FFC_190
- FFC_152

951-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_951

951-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_951

951-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_951

951-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_951
-

951-108

Explanation: The bus test failed.

Failing Item:

- FFC_951
-

951-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_951
-

951-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_951
-

951-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_951
-

951-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_951
-

951-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_951
-

951-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_951
 - FFC_B88
-

951-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_951
-

951-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_951
-

951-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_951
-

951-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_951
 - FFC_B88
-

951-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_951
 - SOFTWARE
-

951-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_951
 - SOFTWARE
-

951-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_951
-

951-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_951
-

951-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

951-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

951-135

Explanation: The device failed to configure.

Failing Item:

- FFC_951
 - FFC_B88
 - SOFTWARE
-

951-136

Explanation: The certify operation failed.

Failing Item:

- FFC_951
-

951-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_951
 - FFC_B88
 - FFC_190
-

951-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_951
-

951-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_951
-

951-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

952-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_952
-

952-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_952
-

952-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_952
-

952-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_952
-

952-108

Explanation: The bus test failed.

Failing Item:

- FFC_952
-

952-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_952
-

952-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_952
-

952-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_952
-

952-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_952
-

952-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_952
-

952-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_952
 - FFC_B88
-

952-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_952
-

952-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_952
-

952-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_952
-

952-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_952
 - FFC_B88
-

952-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_952
 - SOFTWARE
-

952-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_952
 - SOFTWARE
-

952-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_952
-

952-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_952
-

952-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_952
-

952-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

- SOFTWARE

952-135

Explanation: The device failed to configure.

Failing Item:

- FFC_952
- FFC_B88
- SOFTWARE

952-136

Explanation: The certify operation failed.

Failing Item:

- FFC_952

952-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_952
- FFC_B88
- FFC_190

952-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_952

952-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_952

952-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

953-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_953

953-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_953

953-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_953

953-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_953

953-108

Explanation: The bus test failed.

Failing Item:

- FFC_953

953-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_953

953-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_953

953-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_953

953-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_953

953-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_953

953-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_953
- FFC_B88

953-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_953

953-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_953

953-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_953

953-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_953
- FFC_B88

953-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_953
- SOFTWARE

953-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_953
- SOFTWARE

953-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_953

953-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_953

953-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_953

953-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

953-135

Explanation: The device failed to configure.

Failing Item:

- FFC_953
- FFC_B88
- SOFTWARE

953-136

Explanation: The certify operation failed.

Failing Item:

- FFC_953

953-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_953
- FFC_B88
- FFC_190

953-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_953

953-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_953

953-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

954-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_954

954-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_954

954-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_954

954-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_954

954-108

Explanation: The bus test failed.

Failing Item:

- FFC_954

954-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_954

954-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_954

954-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_954

954-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_954

954-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_954

954-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_954
- FFC_B88

954-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_954
-

954-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_954
-

954-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_954
-

954-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_954
 - FFC_B88
-

954-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_954
 - SOFTWARE
-

954-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_954
 - SOFTWARE
-

954-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_954
-

954-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_954
-

954-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

954-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

954-135

Explanation: The device failed to configure.

Failing Item:

- FFC_954
 - FFC_B88
 - SOFTWARE
-

954-136

Explanation: The certify operation failed.

Failing Item:

- FFC_954
-

954-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_954
 - FFC_B88
 - FFC_190
-

954-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_954

954-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_954

954-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

955-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_955

955-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_955

955-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_955

955-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_955

955-108

Explanation: The bus test failed.

Failing Item:

- FFC_955

955-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_955

955-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_955

955-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_955

955-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_955

955-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_955

955-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_955
- FFC_B88

955-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_955

955-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_955

955-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_955

955-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_955
 - FFC_B88
-

955-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_955
 - SOFTWARE
-

955-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_955
 - SOFTWARE
-

955-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_955
-

955-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_955
-

955-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_955
-

955-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
-

- SOFTWARE
-

955-135

Explanation: The device failed to configure.

Failing Item:

- FFC_955
 - FFC_B88
 - SOFTWARE
-

955-136

Explanation: The certify operation failed.

Failing Item:

- FFC_955
-

955-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_955
 - FFC_B88
 - FFC_190
-

955-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_955
-

955-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_955
-

955-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

956-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_956
-

956-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_956
-

956-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_956
-

956-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_956
-

956-108

Explanation: The bus test failed.

Failing Item:

- FFC_956
-

956-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_956
-

956-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_956
-

956-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_956
-

956-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_956
-

956-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_956
-

956-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_956
 - FFC_B88
-

956-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_956
-

956-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_956
-

956-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_956
-

956-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_956
 - FFC_B88
-

956-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_956
- SOFTWARE

956-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_956
 - SOFTWARE
-

956-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_956
-

956-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_956
-

956-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- SSSS
-

956-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

956-135

Explanation: The device failed to configure.

Failing Item:

- FFC_956
 - FFC_B88
 - SOFTWARE
-

956-136

Explanation: The certify operation failed.

Failing Item:

- FFC_956
-

956-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_956
 - FFC_B88
 - FFC_190
-

956-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_956
-

956-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_956
-

956-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

957-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_957
-

957-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_957
-

957-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_957
-

957-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_957
-

957-108

Explanation: The bus test failed.

Failing Item:

- FFC_957
-

957-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_957
-

957-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_957
-

957-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_957
-

957-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_957
-

957-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_957
-

957-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_957
 - FFC_B88
-

957-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_957
-

957-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_957
-

957-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_957
-

957-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_957
 - FFC_B88
-

957-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_957
 - SOFTWARE
-

957-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_957
 - SOFTWARE
-

957-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_957
-

957-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_957
-

957-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_957
-

957-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

957-135

Explanation: The device failed to configure.

Failing Item:

- FFC_957
 - FFC_B88
 - SOFTWARE
-

957-136

Explanation: The certify operation failed.

Failing Item:

- FFC_957
-

957-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_957
 - FFC_B88
 - FFC_190
-

957-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_957
-

957-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_957
-

957-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

959-102

Explanation: Non-recoverable medium error.

Failing Item:

- FFC_959
-

959-104

Explanation: Motor failed to restart.

Failing Item:

- FFC_959
-

959-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_959
-

959-106

Explanation: Electronics card failure.

Failing Item:

- FFC_959
-

959-108

Explanation: Bus failure.

Failing Item:

- FFC_959
-

959-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_959

959-112

Explanation: Diagnostic failure.

Failing Item:

- FFC_959
-

959-114

Explanation: Non-recoverable hardware error.

Failing Item:

- FFC_959
-

959-116

Explanation: A protocol error was detected.

Response: Check the levels of the device, adapter, diagnostic and application software, and ensure they are all compatible. If you do not find a problem, call your support person.

959-117

Explanation: write-protect error.

Failing Item:

- FFC_959
-

959-118

Explanation: SCSI command timeout.

Failing Item:

- FFC_959
 - FFC_B88
-

959-120

Explanation: SCSI busy/command error.

Failing Item:

- FFC_959
-

959-122

Explanation: SCSI reservation conflict error.

Failing Item:

- FFC_959
-

959-124

Explanation: SCSI check condition error.

Failing Item:

- FFC_959
-

959-126

Explanation: Software error caused by hardware failure.

Failing Item:

- FFC_959
 - FFC_B88
-

959-128

Explanation: Error log analysis indicates hardware failure.

Failing Item:

- FFC_959
-

959-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_959
 - FFC_B88
 - SOFTWARE
-

959-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_959
-

959-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

959-135

Explanation: The device failed to configure.

Failing Item:

- FFC_959
 - FFC_B88
 - SOFTWARE
-

959-136

Explanation: The certify operation failed.

Failing Item:

- FFC_959
-

959-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_959
 - FFC_B88
 - FFC_190
-

960-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_960
-

960-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_960
-

960-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_960
-

960-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_960
-

960-108

Explanation: The bus test failed.

Failing Item:

- FFC_960
-

960-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_960
-

960-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_960
-

960-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_960
-

960-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_960
-

960-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_960
-

960-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_960
 - FFC_B88
-

960-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_960
-

960-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_960
-

960-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_960
-

960-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_960
-

- FFC_B88

960-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_960
- SOFTWARE

960-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_960
- SOFTWARE

960-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_960

960-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_960

960-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_960

960-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

960-135

Explanation: The device failed to configure.

Failing Item:

- FFC_960
- FFC_B88
- SOFTWARE

960-136

Explanation: The certify operation failed.

Failing Item:

- FFC_960

960-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_960
- FFC_B88
- FFC_190

960-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_960

960-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_960

960-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

964-101

Explanation: Timeout while attempting to communicate with SCSI device.

Failing Item:

- FFC_964
-

964-102

Explanation: The SCSI device indicates busy.

Failing Item:

- FFC_964
-

964-103

Explanation: The SCSI device indicates a reservation conflict.

Failing Item:

- FFC_964
-

964-104

Explanation: The SCSI device indicates a check condition.

Failing Item:

- FFC_964
-

964-105

Explanation: An error is detected in request sense data.

Failing Item:

- FFC_964
-

964-107

Explanation: Sense data from the SCSI drive has unexpected data.

Failing Item:

- FFC_964
-

964-110

Explanation: The Reserve command failed.

Failing Item:

- FFC_964
-

964-111

Explanation: Invalid condition from the drive after a reserve.

Failing Item:

- FFC_964
-

964-112

Explanation: The write-protect sensor test failed.

Failing Item:

- FFC_964
-

964-113

Explanation: Invalid condition from drive after a request sense.

Failing Item:

- FFC_964
-

964-114

Explanation: Timeout while attempting to communicate with the SCSI device.

Failing Item:

- FFC_964
-

964-120

Explanation: The Inquiry command failed.

Failing Item:

- FFC_964
-

964-130

Explanation: The Load command failed.

Failing Item:

- FFC_964
 - MEDIA
-

964-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

964-135

Explanation: The Unload command failed.

Failing Item:

- FFC_964
 - MEDIA
-

964-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_964
-

964-150

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_964
- MEDIA

964-160

Explanation: The Send Diagnostic command failed.

Failing Item:

- FFC_964
- MEDIA

964-161

Explanation: Invalid condition from the drive after a reserve.

Failing Item:

- FFC_964
- FFC_B88

964-163

Explanation: Invalid condition from the drive after a request sense.

Failing Item:

- FFC_964
- FFC_B88

964-164

Explanation: Timeout while attempting to communicate with the SCSI device.

Failing Item:

- FFC_964
- FFC_B88

964-165

Explanation: Write, Read and Compare Test failed.

Failing Item:

- FFC_964
- FFC_B88
- FFC_276

964-166

Explanation: Unable to configure the device.

Failing Item:

- FFC_964
- FFC_B88

- SOFTWARE

964-167

Explanation: An unexpected SCSI error occurred.

Failing Item:

- FFC_964
- FFC_B88

964-168

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

964-169

Explanation: The Send Diagnostic command failed.

Failing Item:

- FFC_964
- MEDIA

964-170

Explanation: The Read, Write and Compare test failed.

Failing Item:

- FFC_964
- FFC_B88
- MEDIA

964-180

Explanation: The Load command failed.

Failing Item:

- FFC_964
- MEDIA

964-185

Explanation: The Unload command failed.

Failing Item:

- FFC_964
- MEDIA

964-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_964

964-200

Explanation: The Test Unit Ready command failed.

Failing Item:

- FFC_964
 - MEDIA
-

964-201

Explanation: Error diagnosed from error log analysis.

Failing Item:

- FFC_964
 - FFC_B88
-

964-210

Explanation: The device configuration failed.

Failing Item:

- FFC_964
 - FFC_B88
-

964-211

Explanation: The device open failed.

Failing Item:

- FFC_964
 - FFC_B88
-

964-220

Explanation: The Release command failed.

Failing Item:

- FFC_964
-

964-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_964
-

964-240

Explanation: The Openx command failed.

Failing Item:

- FFC_964
-

964-260

Explanation: The device configuration failed.

Failing Item:

- FFC_964

964-261

Explanation: The device open failed.

Failing Item:

- FFC_964
-

964-300

Explanation: The device configuration failed.

Failing Item:

- FFC_964
 - SOFTWARE
-

964-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
 - FFC_964
 - SOFTWARE
-

964-320

Explanation: Error log analysis indicates a failure.

Failing Item:

- FFC_964
 - MEDIA
-

964-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_964
 - FFC_B88
 - SOFTWARE
-

964-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_964
 - FFC_B88
 - SOFTWARE
-

964-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-417

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-418

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-419

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-511

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_964
- FFC_B88

964-512

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_964
 - FFC_B88
-

964-513

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_964
 - FFC_B88
-

964-514

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_964
 - FFC_B88
-

964-515

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_964
 - FFC_B88
-

964-516

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_964
 - FFC_B88
-

964-517

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_964
 - FFC_B88
-

964-518

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_964
 - FFC_B88
-

964-519

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_964
 - FFC_B88
-

964-520

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_964
 - FFC_B88
-

964-521

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_964
 - FFC_B88
-

964-522

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_964
 - FFC_B88
-

964-523

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_964
 - FFC_B88
-

964-611

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_964
 - FFC_B88
 - SOFTWARE
-

964-612

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_964
 - FFC_B88
 - SOFTWARE
-

964-613

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-614

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-615

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-616

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-617

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-618

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-619

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-620

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-621

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-622

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-623

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_964
- FFC_B88
- SOFTWARE

964-711

Explanation: A device timeout error occurred.

Failing Item:

- FFC_964
 - FFC_B88
 - SOFTWARE
-

964-712

Explanation: A device timeout error occurred.

Failing Item:

- FFC_964
 - FFC_B88
 - SOFTWARE
-

964-713

Explanation: A device timeout error occurred.

Failing Item:

- FFC_964
 - FFC_B88
 - SOFTWARE
-

964-714

Explanation: A device timeout error occurred.

Failing Item:

- FFC_964
 - FFC_B88
 - SOFTWARE
-

964-715

Explanation: A device timeout error occurred.

Failing Item:

- FFC_964
 - FFC_B88
 - SOFTWARE
-

964-716

Explanation: A device timeout error occurred.

Failing Item:

- FFC_964
 - FFC_B88
 - SOFTWARE
-

964-717

Explanation: A device timeout error occurred.

Failing Item:

- FFC_964
 - FFC_B88
 - SOFTWARE
-

964-718

Explanation: A device timeout error occurred.

Failing Item:

- FFC_964
 - FFC_B88
 - SOFTWARE
-

964-719

Explanation: A device timeout error occurred.

Failing Item:

- FFC_964
 - FFC_B88
 - SOFTWARE
-

964-720

Explanation: A device timeout error occurred.

Failing Item:

- FFC_964
 - FFC_B88
 - SOFTWARE
-

964-721

Explanation: A device timeout error occurred.

Failing Item:

- FFC_964
 - FFC_B88
 - SOFTWARE
-

964-722

Explanation: A device timeout error occurred.

Failing Item:

- FFC_964
 - FFC_B88
 - SOFTWARE
-

964-723

Explanation: A device timeout error occurred.

Failing Item:

- FFC_964
 - FFC_B88
 - SOFTWARE
-

966-101

Explanation: Error in non-interactive tests.

Failing Item:

- FFC_966
-

966-103

Explanation: The test pattern failed.

Failing Item:

- FFC_966
-

966-201

Explanation: Error in non-interactive tests on card.

Failing Item:

- FFC_966
 - FFC_190
-

966-203

Explanation: The test pattern failed.

Failing Item:

- FFC_966
 - FFC_190
-

966-205

Explanation: Test pattern failed.

Failing Item:

- FFC_966
 - FFC_190
-

966-207

Explanation: Test pattern failed.

Failing Item:

- FFC_966
 - FFC_190
-

966-208

Explanation: Error in non-interactive test on card.

Failing Item:

- FFC_190
-

966-209

Explanation: Test pattern failed.

Failing Item:

- FFC_190
-

966-211

Explanation: Test pattern failed.

Failing Item:

- FFC_190
-

966-213

Explanation: Test pattern failed.

Failing Item:

- FFC_190
-

966-304

Explanation: Video error in interactive test.

Failing Item:

- FFC_E22
 - FFC_725
 - FFC_966
-

966-306

Explanation: Audio error in interactive test.

Failing Item:

- FFC_E23
 - FFC_725
 - FFC_966
-

966-310

Explanation: Video error in interactive test.

Failing Item:

- FFC_E22
 - FFC_725
-

966-312

Explanation: Audio error in interactive test.

Failing Item:

- FFC_E22
 - FFC_725
-

966-400

Explanation: Error in non-interactive tests.

Failing Item:

- FFC_152
 - FFC_190
 - FFC_E24
 - FFC_166
-

966-402**Explanation:** Test pattern failed.**Failing Item:**

- FFC_190
 - FFC_E23
 - FFC_E22
-

968-102**Explanation:** An unrecoverable media error occurred.**Failing Item:**

- FFC_968
-

968-104**Explanation:** The motor failed to restart.**Failing Item:**

- FFC_968
-

968-105**Explanation:** The drive did not become ready.**Failing Item:**

- FFC_968
-

968-106**Explanation:** The electronics card test failed.**Failing Item:**

- FFC_968
-

968-108**Explanation:** The bus test failed.**Failing Item:**

- FFC_968
-

968-110**Explanation:** The media format is corrupted.**Failing Item:**

- FFC_968
-

968-112**Explanation:** The diagnostic test failed.**Failing Item:**

- FFC_968
-

968-114**Explanation:** An unrecoverable hardware error.**Failing Item:**

- FFC_968
-

968-116**Explanation:** A protocol error.**Response:** Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.**Failing Item:**

- FFC_968
-

968-117**Explanation:** A write-protect error occurred.**Failing Item:**

- FFC_968
-

968-118**Explanation:** A SCSI command time-out occurred.**Failing Item:**

- FFC_968
 - FFC_B88
-

968-120**Explanation:** A SCSI busy or command error.**Failing Item:**

- FFC_968
-

968-122**Explanation:** A SCSI reservation conflict error.**Failing Item:**

- FFC_968
-

968-124**Explanation:** A SCSI check condition error occurred.**Failing Item:**

- FFC_968
-

968-126**Explanation:** A software error was caused by a hardware failure.**Failing Item:**

- FFC_968
-

- FFC_B88

968-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_968
- SOFTWARE

968-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_968
- SOFTWARE

968-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_968

968-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_968

968-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_968

968-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

968-135

Explanation: The device failed to configure.

Failing Item:

- FFC_968
- FFC_B88
- SOFTWARE

968-136

Explanation: The certify operation failed.

Failing Item:

- FFC_968

968-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_968
- FFC_B88
- FFC_190

968-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_968

968-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_968

968-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

970-110

Explanation: The Reserve command failed.

Failing Item:

- FFC_970
-

970-120

Explanation: The Inquiry command failed.

Failing Item:

- FFC_970
-

970-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_970
 - MEDIA
-

970-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_970
-

970-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_970
 - MEDIA
-

970-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_970
-

970-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_970
-

970-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_970
 - MEDIA
-

970-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_970
-

970-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_970
 - MEDIA
-

970-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the

instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_970

970-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_970
- MEDIA

970-16L

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_970

970-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_970
- FFC_B88
- MEDIA

970-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_970
- FFC_B88

970-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_970
- MEDIA

970-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_970

970-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_970
- MEDIA

970-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_970

970-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_970
-

970-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_970
 - MEDIA
-

970-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_970
-

970-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_970
 - MEDIA
-

970-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_970
-

970-220

Explanation: The Release command failed.

Failing Item:

- FFC_970
-

970-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_970
-

970-240

Explanation: The Openx command failed.

Failing Item:

- FFC_970
-

970-300

Explanation: The device configuration failed.

Failing Item:

- FFC_970
 - SOFTWARE
-

970-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
 - FFC_970
 - SOFTWARE
-

970-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_970
 - MEDIA
-

970-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

970-411 • 970-41C

Failing Item:

- MEDIA
 - FFC_970
-

970-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-417

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-418

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-419

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-41A

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-41B

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-41C

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-41D

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-41E

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-41F

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-511

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_970
 - FFC_B88
-

970-512

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_970
 - FFC_B88
-

970-513

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_970
 - FFC_B88
-

970-514

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_970
 - FFC_B88
-

970-515

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_970
 - FFC_B88
-

970-516

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

970-517 • 970-523

- FFC_970
- FFC_B88

970-517

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_970
- FFC_B88

970-518

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_970
- FFC_B88

970-519

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_970
- FFC_B88

970-51A

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_970
- FFC_B88

970-51B

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_970
- FFC_B88

970-51C

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_970
- FFC_B88

970-51D

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_970
- FFC_B88

970-51E

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_970
- FFC_B88

970-51F

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_970
- FFC_B88

970-520

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_970
- FFC_B88

970-521

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_970
- FFC_B88

970-522

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_970
- FFC_B88

970-523

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_970
- FFC_B88

970-611**Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_970
- FFC_B88
- SOFTWARE

970-612**Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_970
- FFC_B88
- SOFTWARE

970-613**Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_970
- FFC_B88
- SOFTWARE

970-614**Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_970
- FFC_B88
- SOFTWARE

970-615**Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_970
- FFC_B88
- SOFTWARE

970-616**Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_970
- FFC_B88
- SOFTWARE

970-617**Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_970
- FFC_B88
- SOFTWARE

970-618**Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_970
- FFC_B88
- SOFTWARE

970-619**Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_970
- FFC_B88
- SOFTWARE

970-61A**Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_970
- FFC_B88
- SOFTWARE

970-61B**Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_970
- FFC_B88
- SOFTWARE

970-61C**Explanation:** An adapter or bus I/O error occurred.**Failing Item:**

- FFC_970
- FFC_B88
- SOFTWARE

970-61D

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-61E

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-61F

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-620

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-621

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-622

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-623

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-711

Explanation: A device timeout error occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-712

Explanation: A device timeout error occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-713

Explanation: A device timeout error occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-714

Explanation: A device timeout error occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-715

Explanation: A device timeout error occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-716

Explanation: A device timeout error occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-717

Explanation: A device timeout error occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-718

Explanation: A device timeout error occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-719

Explanation: A device timeout error occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-71A

Explanation: A device timeout error occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-71B

Explanation: A device timeout error occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-71C

Explanation: A device timeout error occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-71D

Explanation: A device timeout error occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-71E

Explanation: A device timeout error occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-71F

Explanation: A device timeout error occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-720

Explanation: A device timeout error occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-721

Explanation: A device timeout error occurred.

Failing Item:

- FFC_970
 - FFC_B88
 - SOFTWARE
-

970-722

Explanation: A device timeout error occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

970-723

Explanation: A device timeout error occurred.

Failing Item:

- FFC_970
- FFC_B88
- SOFTWARE

971-110

Explanation: The Reserve command failed.

Failing Item:

- FFC_971

971-120

Explanation: The Inquiry command failed.

Failing Item:

- FFC_971

971-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_971
- MEDIA

971-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_971

971-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_971
- MEDIA

971-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_971

971-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_971

971-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_971
- MEDIA

971-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_971

971-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_971
 - MEDIA
-

971-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_971
-

971-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_971
 - MEDIA
-

971-16L

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_971
-

971-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_971
 - FFC_B88
 - MEDIA
-

971-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_971
 - FFC_B88
-

971-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_971
 - MEDIA
-

971-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_971
-

971-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

971-186 • 971-320

- FFC_971
- MEDIA

971-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_971

971-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_971

971-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_971
- MEDIA

971-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_971

971-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_971
- MEDIA

971-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_971

971-220

Explanation: The Release command failed.

Failing Item:

- FFC_971

971-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_971

971-240

Explanation: The Openx command failed.

Failing Item:

- FFC_971

971-300

Explanation: The device configuration failed.

Failing Item:

- FFC_971
- SOFTWARE

971-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
- FFC_971
- SOFTWARE

971-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the

instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_971
- MEDIA

971-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_971

971-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-417

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-418

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-419

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-41A

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-41B

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-41C

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-41D

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-41E

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-41F

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-511

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_971
- FFC_B88

971-512

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_971
- FFC_B88

971-513

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_971
 - FFC_B88
-

971-514

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_971
 - FFC_B88
-

971-515

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_971
 - FFC_B88
-

971-516

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_971
 - FFC_B88
-

971-517

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_971
 - FFC_B88
-

971-518

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_971
 - FFC_B88
-

971-519

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_971
 - FFC_B88
-

971-51A

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_971
 - FFC_B88
-

971-51B

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_971
 - FFC_B88
-

971-51C

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_971
 - FFC_B88
-

971-51D

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_971
 - FFC_B88
-

971-51E

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_971
 - FFC_B88
-

971-51F

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_971
 - FFC_B88
-

971-520

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_971
 - FFC_B88
-

971-521

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_971
- FFC_B88

971-522

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_971
- FFC_B88

971-523

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_971
- FFC_B88

971-611

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-612

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-613

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-614

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-615

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-616

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-617

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-618

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-619

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-61A

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-61B

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-61C

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-61D

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-61E

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-61F

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-620

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-621

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-622

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-623

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-711

Explanation: A device timeout error occurred.

Failing Item:

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-712

Explanation: A device timeout error occurred.

Failing Item:

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-713

Explanation: A device timeout error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-714

Explanation: A device timeout error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-715

Explanation: A device timeout error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-716

Explanation: A device timeout error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-717

Explanation: A device timeout error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-718

Explanation: A device timeout error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-719

Explanation: A device timeout error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-71A

Explanation: A device timeout error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-71B

Explanation: A device timeout error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-71C

Explanation: A device timeout error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-71D

Explanation: A device timeout error occurred.

Failing Item:

- FFC_971
- FFC_B88
- SOFTWARE

971-71E

Explanation: A device timeout error occurred.

Failing Item:

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-71F

Explanation: A device timeout error occurred.

Failing Item:

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-720

Explanation: A device timeout error occurred.

Failing Item:

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-721

Explanation: A device timeout error occurred.

Failing Item:

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-722

Explanation: A device timeout error occurred.

Failing Item:

- FFC_971
 - FFC_B88
 - SOFTWARE
-

971-723

Explanation: A device timeout error occurred.

Failing Item:

- FFC_971
 - FFC_B88
 - SOFTWARE
-

972-110

Explanation: The Reserve command failed.

Failing Item:

- FFC_972
-

972-120

Explanation: The Inquiry command failed.

Failing Item:

- FFC_972

972-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_972
 - MEDIA
-

972-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_972
-

972-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_972
 - MEDIA
-

972-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_972
-

972-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_972

972-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_972
- MEDIA

972-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_972

972-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_972
- MEDIA

972-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_972

972-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_972
- MEDIA

972-16L

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_972

972-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_972
- FFC_B88
- MEDIA

972-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_972
- FFC_B88

972-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_972
- MEDIA

972-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_972

972-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_972
- MEDIA

972-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_972

972-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_972

972-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_972
- MEDIA

972-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_972

972-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_972
- MEDIA

972-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_972

972-220

Explanation: The Release command failed.

Failing Item:

- FFC_972

972-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_972

972-240

Explanation: The Openx command failed.

Failing Item:

- FFC_972
-

972-300

Explanation: The device configuration failed.

Failing Item:

- FFC_972
 - SOFTWARE
-

972-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
 - FFC_972
 - SOFTWARE
-

972-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_972
 - MEDIA
-

972-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_972
-

972-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-417

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-418

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-419

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-41A

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-41B

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-41C

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-41D

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-41E

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-41F

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-511

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_972
- FFC_B88

972-512

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_972
- FFC_B88

972-513

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_972
- FFC_B88

972-514

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_972
- FFC_B88

972-515

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_972
- FFC_B88

972-516

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_972
- FFC_B88

972-517

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_972
- FFC_B88

972-518

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_972
- FFC_B88

972-519

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_972
- FFC_B88

972-51A

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_972
- FFC_B88

972-51B

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_972
- FFC_B88

972-51C

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_972
- FFC_B88

972-51D

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_972
 - FFC_B88
-

972-51E

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_972
 - FFC_B88
-

972-51F

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_972
 - FFC_B88
-

972-520

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_972
 - FFC_B88
-

972-521

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_972
 - FFC_B88
-

972-522

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_972
 - FFC_B88
-

972-523

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_972
 - FFC_B88
-

972-611

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_972
-

- FFC_B88
 - SOFTWARE
-

972-612

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-613

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-614

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-615

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-616

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-617

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-618

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-619

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-61A

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-61B

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-61C

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-61D

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-61E

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-61F

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-620

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-621

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-622

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-623

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-711

Explanation: A device timeout error occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-712

Explanation: A device timeout error occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-713

Explanation: A device timeout error occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-714

Explanation: A device timeout error occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-715

Explanation: A device timeout error occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-716

Explanation: A device timeout error occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-717

Explanation: A device timeout error occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-718

Explanation: A device timeout error occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-719

Explanation: A device timeout error occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-71A

Explanation: A device timeout error occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-71B

Explanation: A device timeout error occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-71C

Explanation: A device timeout error occurred.

Failing Item:

- FFC_972
 - FFC_B88
 - SOFTWARE
-

972-71D

Explanation: A device timeout error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-71E

Explanation: A device timeout error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-71F

Explanation: A device timeout error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-720

Explanation: A device timeout error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-721

Explanation: A device timeout error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-722

Explanation: A device timeout error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

972-723

Explanation: A device timeout error occurred.

Failing Item:

- FFC_972
- FFC_B88
- SOFTWARE

973-110

Explanation: The Reserve command failed.

Failing Item:

- FFC_973

973-120

Explanation: The Inquiry command failed.

Failing Item:

- FFC_973

973-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_973
- MEDIA

973-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_973

973-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_973
- MEDIA

973-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_973

973-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_973

973-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_973
- MEDIA

973-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_973

973-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_973
- MEDIA

973-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_973

973-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_973
- MEDIA

973-16L

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_973

973-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_973
- FFC_B88
- MEDIA

973-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_973
 - FFC_B88
-

973-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_973
 - MEDIA
-

973-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_973
-

973-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_973
 - MEDIA
-

973-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_973
-

973-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_973
-

973-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_973
 - MEDIA
-

973-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_973
-

973-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_973
- MEDIA

973-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_973
-

973-220

Explanation: The Release command failed.

Failing Item:

- FFC_973
-

973-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_973
-

973-240

Explanation: The Openx command failed.

Failing Item:

- FFC_973
-

973-300

Explanation: The device configuration failed.

Failing Item:

- FFC_973
 - SOFTWARE
-

973-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
 - FFC_973
 - SOFTWARE
-

973-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_973
 - MEDIA
-

973-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_973
-

973-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-417

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-418

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-419

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-41A

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-41B

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-41C

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-41D

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-41E

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-41F

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-511

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_973
 - FFC_B88
-

973-512

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_973
 - FFC_B88
-

973-513

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_973
 - FFC_B88
-

973-514

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_973
 - FFC_B88
-

973-515

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_973
 - FFC_B88
-

973-516

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_973
 - FFC_B88
-

973-517

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_973
 - FFC_B88
-

973-518

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_973
 - FFC_B88
-

973-519

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_973
 - FFC_B88
-

973-51A

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

973-51B • 973-613

- FFC_973
- FFC_B88

973-51B

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_973
- FFC_B88

973-51C

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_973
- FFC_B88

973-51D

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_973
- FFC_B88

973-51E

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_973
- FFC_B88

973-51F

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_973
- FFC_B88

973-520

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_973
- FFC_B88

973-521

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_973
- FFC_B88

973-522

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_973
- FFC_B88

973-523

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_973
- FFC_B88

973-611

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-612

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-613

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-614

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-615

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-616

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-617

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-618

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-619

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-61A

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-61B

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-61C

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-61D

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-61E

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-61F

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-620

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-621

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-622

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-623

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-711

Explanation: A device timeout error occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-712

Explanation: A device timeout error occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-713

Explanation: A device timeout error occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-714

Explanation: A device timeout error occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-715

Explanation: A device timeout error occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-716

Explanation: A device timeout error occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-717

Explanation: A device timeout error occurred.

Failing Item:

- FFC_973
- FFC_B88
- SOFTWARE

973-718

Explanation: A device timeout error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-719

Explanation: A device timeout error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-71A

Explanation: A device timeout error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-71B

Explanation: A device timeout error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-71C

Explanation: A device timeout error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-71D

Explanation: A device timeout error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-71E

Explanation: A device timeout error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-71F

Explanation: A device timeout error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-720

Explanation: A device timeout error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-721

Explanation: A device timeout error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-722

Explanation: A device timeout error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

973-723

Explanation: A device timeout error occurred.

Failing Item:

- FFC_973
 - FFC_B88
 - SOFTWARE
-

974-111

Explanation: Unable to reserve device.

Failing Item:

- FFC_974
 - FFC_B88
-

974-112

Explanation: Unable to do configuration.

Failing Item:

- FFC_974
-

974-113 • 974-173

- FFC_B88

974-113

Explanation: Unable to open the device driver.

Failing Item:

- FFC_974
- FFC_B88

974-121

Explanation: The CD-ROM drive indicates an error.

Failing Item:

- FFC_974

974-122

Explanation: The CD-ROM drive indicates an error.

Failing Item:

- FFC_974

974-123

Explanation: The CD-ROM drive indicates an error.

Failing Item:

- FFC_974

974-125

Explanation: The CD-ROM drive indicates an error.

Failing Item:

- FFC_974
- FFC_B88

974-126

Explanation: The CD-ROM drive indicates an error.

Failing Item:

- FFC_974

974-127

Explanation: The CD-ROM drive indicates an error.

Failing Item:

- FFC_974

974-128

Explanation: The CD-ROM drive indicates an error.

Failing Item:

- FFC_974

974-129

Explanation: The CD-ROM drive indicates an error.

Failing Item:

- FFC_974

974-150

Explanation: A media error was detected.

Failing Item:

- TEST_DISC
- FFC_974

974-151

Explanation: A command timeout was detected.

Failing Item:

- FFC_974
- FFC_D88

974-152

Explanation: A command reservation conflict was detected.

Failing Item:

- FFC_974

974-162

Explanation: The CD-ROM drive indicates an error.

Failing Item:

- FFC_974

974-171

Explanation: Unable to reserve device.

Failing Item:

- FFC_974

974-172

Explanation: Unable to do configuration.

Failing Item:

- FFC_974

974-173

Explanation: Unable to open device driver.

Failing Item:

- FFC_974
-

974-175

Explanation: The CD-ROM drive indicates an error.

Failing Item:

- FFC_974
-

974-198

Explanation: Undefined error detected.

Failing Item:

- FFC_974
 - FFC_B88
-

974-199

Explanation: Undefined error detected.

Failing Item:

- FFC_974
-

974-211

Explanation: The LED test failed.

Failing Item:

- FFC_974
-

974-281

Explanation: No tone during audio test.

Failing Item:

- FFC_974
-

974-301

Explanation: Errors found during ELA.

Failing Item:

- FFC_974
-

974-302

Explanation: Errors log analysis indicates hardware failure.

Failing Item:

- FFC_974
 - FFC_B88
-

980-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_980
-

980-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_980
-

980-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_980
-

980-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_980
-

980-108

Explanation: The bus test failed.

Failing Item:

- FFC_980
-

980-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_980
-

980-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_980
-

980-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_980
-

980-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_980
-

980-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_980
-

980-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_980
 - FFC_B88
-

980-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_980
-

980-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_980
-

980-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_980
-

980-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_980
 - FFC_B88
-

980-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_980
 - SOFTWARE
-

980-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_980
 - SOFTWARE
-

980-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_980
-

980-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_980
-

980-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_980
-

980-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
 - SOFTWARE
-

980-135

Explanation: The device failed to configure.

Failing Item:

- FFC_980
 - FFC_B88
 - SOFTWARE
-

980-136

Explanation: The certify operation failed.

Failing Item:

- FFC_980
-

980-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_980
 - FFC_B88
 - FFC_190
-

980-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_980
-

980-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
 - FFC_B88
 - FFC_980
-

980-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

981-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_981
-

981-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_981
-

981-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_981
-

981-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_981
-

981-108

Explanation: The bus test failed.

Failing Item:

- FFC_981
-

981-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_981
-

981-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_981
-

981-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_981
-

981-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_981
-

981-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_981
-

981-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_981
 - FFC_B88
-

981-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_981

981-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_981

981-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_981

981-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_981
- FFC_B88

981-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_981
- SOFTWARE

981-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_981
- SOFTWARE

981-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_981

981-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_981

981-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_981

981-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

981-135

Explanation: The device failed to configure.

Failing Item:

- FFC_981
- FFC_B88
- SOFTWARE

981-136

Explanation: The certify operation failed.

Failing Item:

- FFC_981

981-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_981
- FFC_B88
- FFC_190

981-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_981

981-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_981

981-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

984-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_984

984-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_984

984-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_984

984-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_984

984-108

Explanation: The bus test failed.

Failing Item:

- FFC_984

984-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_912

984-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_984

984-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_984

984-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_984

984-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_984

984-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_984
- FFC_B88

984-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_984

984-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_984

984-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_984

984-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_984
- FFC_B88

984-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_984
- SOFTWARE

984-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_984
- SOFTWARE

984-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_984

984-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_984

984-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_984

984-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88

- SOFTWARE

984-135

Explanation: The device failed to configure.

Failing Item:

- FFC_984
- FFC_B88
- SOFTWARE

984-136

Explanation: The certify operation failed.

Failing Item:

- FFC_984

984-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_984
- FFC_B88
- FFC_190

984-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_984

984-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_984

984-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

986-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_986
-

986-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_986
-

986-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_986
-

986-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_986
-

986-108

Explanation: The bus test failed.

Failing Item:

- FFC_986
-

986-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_986
-

986-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_986
-

986-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_986
-

986-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure

they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_986
-

986-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_986
-

986-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_986
 - FFC_B88
-

986-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_986
-

986-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_986
-

986-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_986
-

986-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_986
 - FFC_B88
-

986-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
- FFC_B88
- FFC_986
- SOFTWARE

986-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
- FFC_B88
- FFC_986
- SOFTWARE

986-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_986

986-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_986

986-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_986

986-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

986-135

Explanation: The device failed to configure.

Failing Item:

- FFC_986
- FFC_B88
- SOFTWARE

986-136

Explanation: The certify operation failed.

Failing Item:

- FFC_986

986-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_986
- FFC_B88
- FFC_190

986-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_986

986-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_986

986-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

989-102

Explanation: An unrecoverable media error occurred.

Failing Item:

- FFC_989

989-104

Explanation: The motor failed to restart.

Failing Item:

- FFC_989

989-105

Explanation: The drive did not become ready.

Failing Item:

- FFC_989

989-106

Explanation: The electronics card test failed.

Failing Item:

- FFC_989
-

989-108

Explanation: The bus test failed.

Failing Item:

- FFC_989
-

989-110

Explanation: The media format is corrupted.

Failing Item:

- FFC_989
-

989-112

Explanation: The diagnostic test failed.

Failing Item:

- FFC_989
-

989-114

Explanation: An unrecoverable hardware error.

Failing Item:

- FFC_989
-

989-116

Explanation: A protocol error.

Response: Check the levels of the device, adapter, diagnostic software, and application software to be sure they are all compatible. If you do not find a problem, call your support person.

Failing Item:

- FFC_989
-

989-117

Explanation: A write-protect error occurred.

Failing Item:

- FFC_989
-

989-118

Explanation: A SCSI command time-out occurred.

Failing Item:

- FFC_989
 - FFC_B88
-

989-120

Explanation: A SCSI busy or command error.

Failing Item:

- FFC_989
-

989-122

Explanation: A SCSI reservation conflict error.

Failing Item:

- FFC_989
-

989-124

Explanation: A SCSI check condition error occurred.

Failing Item:

- FFC_989
-

989-126

Explanation: A software error was caused by a hardware failure.

Failing Item:

- FFC_989
 - FFC_B88
-

989-128

Explanation: The error log analysis indicates a hardware failure.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_989
 - SOFTWARE
-

989-129

Explanation: Error log analysis indicates a SCSI bus problem.

Failing Item:

- FFC_190
 - FFC_B88
 - FFC_989
 - SOFTWARE
-

989-130

Explanation: Error log analysis indicates a problem reported by the disk drive's self-monitoring function.

Failing Item:

- FFC_989
-

989-132

Explanation: A disk drive hardware error occurred.

Failing Item:

- FFC_989

989-133

Explanation: Use the Subsystem Service Guide to complete diagnosis.

Failing Item:

- FFC_989

989-134

Explanation: The adapter failed to configure.

Failing Item:

- FFC_B88
- SOFTWARE

989-135

Explanation: The device failed to configure.

Failing Item:

- FFC_989
- FFC_B88
- SOFTWARE

989-136

Explanation: The certify operation failed.

Failing Item:

- FFC_989

989-137

Explanation: Unit attention condition has occurred on the Send Diagnostic command.

Failing Item:

- FFC_989
- FFC_B88
- FFC_190

989-138

Explanation: Error log analysis indicates that the disk drive is operating at a higher than recommended temperature.

Response: Check to be sure none of the air passages in the system covers are blocked, that no other system environmental warnings are occurring. Otherwise, go to MAP0210 : General problem resolution.

Failing Item:

- FFC_989

989-140

Explanation: Error log analysis indicates poor signal quality.

Failing Item:

- FFC_199
- FFC_B88
- FFC_989

989-640

Explanation: Error log analysis indicates a path error.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

991-110

Explanation: The Reserve command failed.

Failing Item:

- FFC_991

991-120

Explanation: The Inquiry command failed.

Failing Item:

- FFC_991

991-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_991
- MEDIA

991-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_991

991-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_991
 - MEDIA
-

991-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_991
-

991-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_991
-

991-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_991
 - MEDIA
-

991-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_991
-

991-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_991
 - MEDIA
-

991-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_991
-

991-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_991
 - MEDIA
-

991-16L

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_991
-

991-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_991
- FFC_B88
- MEDIA

991-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_991
- FFC_B88

991-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_991
- MEDIA

991-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_991

991-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_991
- MEDIA

991-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_991

991-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_991

991-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_991
- MEDIA

991-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_991

991-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_991
- MEDIA

991-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_991

991-220

Explanation: The Release command failed.

Failing Item:

- FFC_991

991-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_991

991-240

Explanation: The Openx command failed.

Failing Item:

- FFC_991

991-300

Explanation: The device configuration failed.

Failing Item:

- FFC_991
- SOFTWARE

991-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
- FFC_991
- SOFTWARE

991-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the

instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_991
- MEDIA

991-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_991

991-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-417

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-418

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-419

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-41A

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-41B

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-41C

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-41D

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-41E

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-41F

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-511

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_991
 - FFC_B88
-

991-512

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_991
 - FFC_B88
-

991-513

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_991
 - FFC_B88
-

991-514

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_991
 - FFC_B88
-

991-515

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_991
 - FFC_B88
-

991-516

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_991
 - FFC_B88
-

991-517

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_991
 - FFC_B88
-

991-518

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_991
 - FFC_B88
-

991-519

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_991
 - FFC_B88
-

991-51A

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

991-51B • 991-613

- FFC_991
- FFC_B88

991-51B

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_991
- FFC_B88

991-51C

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_991
- FFC_B88

991-51D

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_991
- FFC_B88

991-51E

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_991
- FFC_B88

991-51F

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_991
- FFC_B88

991-520

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_991
- FFC_B88

991-521

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_991
- FFC_B88

991-522

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_991
- FFC_B88

991-523

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_991
- FFC_B88

991-611

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-612

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-613

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-614

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-615

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-616

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-617

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-618

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-619

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-61A

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-61B

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-61C

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-61D

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-61E

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-61F

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-620

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-621

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-622

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-623

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-711

Explanation: A device timeout error occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-712

Explanation: A device timeout error occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-713

Explanation: A device timeout error occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-714

Explanation: A device timeout error occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-715

Explanation: A device timeout error occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-716

Explanation: A device timeout error occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-717

Explanation: A device timeout error occurred.

Failing Item:

- FFC_991
- FFC_B88
- SOFTWARE

991-718

Explanation: A device timeout error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-719

Explanation: A device timeout error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-71A

Explanation: A device timeout error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-71B

Explanation: A device timeout error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-71C

Explanation: A device timeout error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-71D

Explanation: A device timeout error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-71E

Explanation: A device timeout error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-71F

Explanation: A device timeout error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-720

Explanation: A device timeout error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-721

Explanation: A device timeout error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-722

Explanation: A device timeout error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

991-723

Explanation: A device timeout error occurred.

Failing Item:

- FFC_991
 - FFC_B88
 - SOFTWARE
-

994-110

Explanation: The Reserve command failed.

Failing Item:

- FFC_994
-

994-120

Explanation: The Inquiry command failed.

Failing Item:

- FFC_994
-

994-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_994
- MEDIA

994-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_994

994-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_994
- MEDIA

994-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_994

994-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_994

994-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_994
- MEDIA

994-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_994

994-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_994
- MEDIA

994-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_994

994-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_994
- MEDIA

994-16L

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_994

994-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_994
- FFC_B88
- MEDIA

994-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_994
- FFC_B88

994-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_994
- MEDIA

994-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_994

994-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_994
- MEDIA

994-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_994

994-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_994

994-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

994-201 • 994-411

- FFC_994
- MEDIA

994-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_994

994-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_994
- MEDIA

994-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_994

994-220

Explanation: The Release command failed.

Failing Item:

- FFC_994

994-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_994

994-240

Explanation: The Openx command failed.

Failing Item:

- FFC_994

994-300

Explanation: The device configuration failed.

Failing Item:

- FFC_994
- SOFTWARE

994-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
- FFC_994
- SOFTWARE

994-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_994
- MEDIA

994-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_994

994-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_994
- FFC_B88
- SOFTWARE

994-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-417

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-418

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-419

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-511

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_994
- FFC_B88

994-512

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_994
- FFC_B88

994-513

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_994
- FFC_B88

994-514

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_994
- FFC_B88

994-515

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_994
- FFC_B88

994-516

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_994
- FFC_B88

994-517

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_994
- FFC_B88

994-518

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_994
- FFC_B88

994-519

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_994
- FFC_B88

994-520

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_994
- FFC_B88

994-521

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_994
- FFC_B88

994-522

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_994
- FFC_B88

994-523

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_994
 - FFC_B88
-

994-611

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-612

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-613

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-614

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-615

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-616

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-617

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-618

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-619

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-620

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-621

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-622

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-623

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_994
- FFC_B88
- SOFTWARE

994-711

Explanation: A device timeout error occurred.

Failing Item:

- FFC_994
- FFC_B88
- SOFTWARE

994-712

Explanation: A device timeout error occurred.

Failing Item:

- FFC_994
- FFC_B88
- SOFTWARE

994-713

Explanation: A device timeout error occurred.

Failing Item:

- FFC_994
- FFC_B88
- SOFTWARE

994-714

Explanation: A device timeout error occurred.

Failing Item:

- FFC_994
- FFC_B88
- SOFTWARE

994-715

Explanation: A device timeout error occurred.

Failing Item:

- FFC_994
- FFC_B88
- SOFTWARE

994-716

Explanation: A device timeout error occurred.

Failing Item:

- FFC_994
- FFC_B88
- SOFTWARE

994-717

Explanation: A device timeout error occurred.

Failing Item:

- FFC_994
- FFC_B88
- SOFTWARE

994-718

Explanation: A device timeout error occurred.

Failing Item:

- FFC_994
- FFC_B88
- SOFTWARE

994-719

Explanation: A device timeout error occurred.

Failing Item:

- FFC_994
- FFC_B88
- SOFTWARE

994-720

Explanation: A device timeout error occurred.

Failing Item:

- FFC_994
- FFC_B88
- SOFTWARE

994-721

Explanation: A device timeout error occurred.

Failing Item:

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-722

Explanation: A device timeout error occurred.

Failing Item:

- FFC_994
 - FFC_B88
 - SOFTWARE
-

994-723

Explanation: A device timeout error occurred.

Failing Item:

- FFC_994
 - FFC_B88
 - SOFTWARE
-

995-110

Explanation: The Reserve command failed.

Failing Item:

- FFC_995
-

995-120

Explanation: The Inquiry command failed.

Failing Item:

- FFC_995
-

995-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_995
 - MEDIA
-

995-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_995
-

995-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_995
 - MEDIA
-

995-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_995
-

995-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_995
-

995-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_995
 - MEDIA
-

995-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_995
-

995-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_995
- MEDIA

995-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_995

995-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_995
- MEDIA

995-16L

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_995

995-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_995
- FFC_B88
- MEDIA

995-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_995
- FFC_B88

995-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_995
- MEDIA

995-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_995

995-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_995
- MEDIA

995-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_995

995-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_995

995-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_995
- MEDIA

995-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_995

995-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_995
- MEDIA

995-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_995

995-220

Explanation: The Release command failed.

Failing Item:

- FFC_995

995-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_995

995-240

Explanation: The Openx command failed.

Failing Item:

- FFC_995

995-300

Explanation: The device configuration failed.

Failing Item:

- FFC_995
- SOFTWARE

995-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
- FFC_995
- SOFTWARE

995-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the

instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_995
- MEDIA

995-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_995

995-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-417

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-418

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-419

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_995
 - FFC_B88
 - SOFTWARE
-

995-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_995
 - FFC_B88
 - SOFTWARE
-

995-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_995
 - FFC_B88
 - SOFTWARE
-

995-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_995
 - FFC_B88
 - SOFTWARE
-

995-511

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_995
 - FFC_B88
-

995-512

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_995
 - FFC_B88
-

995-513

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_995
 - FFC_B88
-

995-514

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_995
 - FFC_B88
-

995-515

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_995
 - FFC_B88
-

995-516

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_995
 - FFC_B88
-

995-517

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_995
 - FFC_B88
-

995-518

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_995
 - FFC_B88
-

995-519

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_995
 - FFC_B88
-

995-520

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

995-521 • 995-619

- FFC_995
- FFC_B88

995-521

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_995
- FFC_B88

995-522

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_995
- FFC_B88

995-523

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_995
- FFC_B88

995-611

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-612

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-613

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-614

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-615

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-616

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-617

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-618

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-619

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_995
 - FFC_B88
 - SOFTWARE
-

995-620

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_995
 - FFC_B88
 - SOFTWARE
-

995-621

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_995
 - FFC_B88
 - SOFTWARE
-

995-622

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_995
 - FFC_B88
 - SOFTWARE
-

995-623

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_995
 - FFC_B88
 - SOFTWARE
-

995-711

Explanation: A device timeout error occurred.

Failing Item:

- FFC_995
 - FFC_B88
 - SOFTWARE
-

995-712

Explanation: A device timeout error occurred.

Failing Item:

- FFC_995
 - FFC_B88
 - SOFTWARE
-

995-713

Explanation: A device timeout error occurred.

Failing Item:

- FFC_995
 - FFC_B88
 - SOFTWARE
-

995-714

Explanation: A device timeout error occurred.

Failing Item:

- FFC_995
 - FFC_B88
 - SOFTWARE
-

995-715

Explanation: A device timeout error occurred.

Failing Item:

- FFC_995
 - FFC_B88
 - SOFTWARE
-

995-716

Explanation: A device timeout error occurred.

Failing Item:

- FFC_995
 - FFC_B88
 - SOFTWARE
-

995-717

Explanation: A device timeout error occurred.

Failing Item:

- FFC_995
 - FFC_B88
 - SOFTWARE
-

995-718

Explanation: A device timeout error occurred.

Failing Item:

- FFC_995
 - FFC_B88
 - SOFTWARE
-

995-719

Explanation: A device timeout error occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-720

Explanation: A device timeout error occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-721

Explanation: A device timeout error occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-722

Explanation: A device timeout error occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

995-723

Explanation: A device timeout error occurred.

Failing Item:

- FFC_995
- FFC_B88
- SOFTWARE

998-110

Explanation: The Reserve command failed.

Failing Item:

- FFC_998

998-120

Explanation: The Inquiry command failed.

Failing Item:

- FFC_998

998-130

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_998
- MEDIA

998-131

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_998

998-135

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_998
- MEDIA

998-136

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_998

998-140

Explanation: The Mode Select command failed.

Failing Item:

- FFC_998

998-150

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_998
 - MEDIA
-

998-151

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_998
-

998-160

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_998
 - MEDIA
-

998-168

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_998
-

998-169

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC

failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_998
 - MEDIA
-

998-16L

Explanation: The Send Diagnostic command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_998
-

998-170

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_998
 - FFC_B88
 - MEDIA
-

998-171

Explanation: The Read, Write and Compare test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_998
 - FFC_B88
-

998-180

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_998
- MEDIA

998-181

Explanation: The Load command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_998

998-185

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_998
- MEDIA

998-186

Explanation: The Unload command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_998

998-190

Explanation: The Mode Select command failed.

Failing Item:

- FFC_998

998-200

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_998
- MEDIA

998-201

Explanation: The Test Unit Ready command failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_998

998-210

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_998
- MEDIA

998-211

Explanation: The Write Protect test failed.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
- FFC_998

998-220

Explanation: The Release command failed.

Failing Item:

- FFC_998

998-230

Explanation: The Request Sense command failed.

Failing Item:

- FFC_998

998-240

Explanation: The Openx command failed.

Failing Item:

- FFC_995
-

998-300

Explanation: The device configuration failed.

Failing Item:

- FFC_995
 - SOFTWARE
-

998-310

Explanation: SCSI adapter configuration failed.

Failing Item:

- FFC_B88
 - FFC_995
 - SOFTWARE
-

998-320

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- FFC_998
 - MEDIA
-

998-321

Explanation: Error log analysis indicates a failure.

Response: Refer to the instructions for the MEDIA failing item. If the problem persists after following the instructions for the MEDIA failing item, use the FFC failing item and MAP0210 : General Problem Resolution.

Failing Item:

- MEDIA
 - FFC_998
-

998-411

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-412

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-413

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-414

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-415

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-416

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-417

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-418

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_998
- FFC_B88
- SOFTWARE

998-419

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_998
- FFC_B88
- SOFTWARE

998-420

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_998
- FFC_B88
- SOFTWARE

998-421

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_998
- FFC_B88
- SOFTWARE

998-422

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_998
- FFC_B88
- SOFTWARE

998-423

Explanation: A reservation conflict occurred.

Failing Item:

- FFC_998
- FFC_B88
- SOFTWARE

998-511

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_998
- FFC_B88

998-512

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_998
- FFC_B88

998-513

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_998
- FFC_B88

998-514

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_998
- FFC_B88

998-515

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_998
- FFC_B88

998-516

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_998
- FFC_B88

998-517

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_998
- FFC_B88

998-518

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_998
- FFC_B88

998-519

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_998
- FFC_B88

998-520

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_998
- FFC_B88

998-521

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_998
- FFC_B88

998-522

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_998
- FFC_B88

998-523

Explanation: The drive returned bad or non-extended sense data.

Failing Item:

- FFC_998
- FFC_B88

998-611

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_998
- FFC_B88
- SOFTWARE

998-612

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_998
- FFC_B88
- SOFTWARE

998-613

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_998
- FFC_B88
- SOFTWARE

998-614

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_998
- FFC_B88
- SOFTWARE

998-615

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_998
- FFC_B88
- SOFTWARE

998-616

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-617

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_998
- FFC_B88
- SOFTWARE

998-618

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_998
- FFC_B88
- SOFTWARE

998-619

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_998
- FFC_B88
- SOFTWARE

998-620

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_998
- FFC_B88
- SOFTWARE

998-621

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_998
- FFC_B88
- SOFTWARE

998-622

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_998
- FFC_B88
- SOFTWARE

998-623

Explanation: An adapter or bus I/O error occurred.

Failing Item:

- FFC_998
- FFC_B88
- SOFTWARE

998-711

Explanation: A device timeout error occurred.

Failing Item:

- FFC_998
- FFC_B88
- SOFTWARE

998-712

Explanation: A device timeout error occurred.

Failing Item:

- FFC_998
- FFC_B88
- SOFTWARE

998-713

Explanation: A device timeout error occurred.

Failing Item:

- FFC_998
- FFC_B88
- SOFTWARE

998-714

Explanation: A device timeout error occurred.

Failing Item:

- FFC_998
- FFC_B88
- SOFTWARE

998-715

Explanation: A device timeout error occurred.

Failing Item:

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-716

Explanation: A device timeout error occurred.

Failing Item:

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-717

Explanation: A device timeout error occurred.

Failing Item:

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-718

Explanation: A device timeout error occurred.

Failing Item:

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-719

Explanation: A device timeout error occurred.

Failing Item:

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-720

Explanation: A device timeout error occurred.

Failing Item:

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-721

Explanation: A device timeout error occurred.

Failing Item:

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-722

Explanation: A device timeout error occurred.

Failing Item:

- FFC_998
 - FFC_B88
 - SOFTWARE
-

998-723

Explanation: A device timeout error occurred.

Failing Item:

- FFC_998
 - FFC_B88
 - SOFTWARE
-

9CC-1XX

Explanation: I/O Error on PCI bus.

Response: Refer to the Bus SRN to FRU Reference Table in the system unit's service guide. Note: xx represents the last 2 digits of the SRN.

9CC-XXX

Explanation: I/O Bus Data, Address Parity Error, or Time-out error.

Response: Note: xxx represents the last 3 digits of the SRN. Use MAP0210 : General problem resolution.

Failing Item:

- XXX
 - FFC_2C9
-

801-XXXX

Explanation: No LED value could be determined for the missing resource.

Response: Note: To obtain the FRU substitute the last three or four digits of the SRN following the dash (-) for xxxx . (The substituted xxxx is the FRU). Use MAP0210 : General problem resolution.

Failing Item:

- FFC_E10
 - FFC_227
-

802-2592

Explanation: The DVD-ROM that was previously installed was not detected.

Failing Item:

- FFC_2592
 - FFC_199
 - FFC_E10
-

- FFC_227

802-XXXX

Explanation: The diagnostics did not detect an installed resource.

Response: Note: To obtain the FRU substitute the last three or four digits of the SRN following the dash (-) for xxxx . (The substituted xxxx is the FRU) . Use MAP0210 : General problem resolution.

Failing Item:

- FFC_E10
- FFC_227

803-XXXX

Explanation: A software error occurred while running the diagnostics which could be caused by either hardware or software.

Response: Note: This SRN can also occur if the filesystem is full, particularly in the / , /var , or /tmp directories (verify using the df command at the AIX prompt, make sure %Used is 90% or less for each file system). Run standalone diagnostics. If you get a different SRN, use it in place of the original SRN. If you get the same SRN, use the last three or four digits of the 803- xxx(x) as the FRU and use general problem resolution. If you get no error from the standalone diagnostics, you may have a problem with the software, contact your support center. Note: xxxx corresponds to the last three or four digits of the SRN. If your 803- xxx(x) SRN is not listed, substitute the last three or four digits of the SRN after the dash (-) for xxx(x) , then proceed to the FRU list using the substituted digits as your FRU.

832-XXXX

Explanation: I/O bridge/device internal error

Response: Note: xxxx represents the last 3 or 4 digits of the SRN after the dash (-). Use MAP0210 : General problem resolution.

833-XXXX

Explanation: PCI device address parity error, PCI device data parity error, or PCI device abort error. The diagnostics screen indicates the actual error.

Response: Note: xxxx represents the last 3 or 4 digits of the SRN after the dash (-). Use MAP0210 : General problem resolution.

Failing Item:

- FFC_296
- FFC_2C9

950-2502

Explanation: Missing options resolution for PCI-X266 Planar 3GB SAS Adapter.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_2502
- FFC_221

950-2503

Explanation: Missing options resolution for PCI-X266 Planar 3GB SAS RAID Adapter.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_2503
- FFC_221

950-2504

Explanation: Missing options resolution for PCI Express x1 Auxiliary cache adapter.

Response: Use MAP0291 : Missing device or bus problem resolution, located in your host system service guide.

Failing Item:

- FFC_2504
- FFC_221

950-2505

Explanation: Missing options resolution for PCI-X266 Planar 3 GB SAS RAID adapter.

Response: Use MAP0291 : Missing device or bus problem resolution, located in your host system service guide.

Failing Item:

- FFC_2505
- FFC_2502

950-2512

Explanation: Missing options resolution for PCI-X DDR Quad Channel U320 SCSI RAID

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_2512
- FFC_221

950-2513

Explanation: Missing options resolution for PCI-X DDR Quad Channel U320 SCSI RAID Adapter.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_2513
 - FFC_221
-

950-2514

Explanation: Missing options resolution for PCI-X DDR Dual Channel U320 SCSI

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_2514
 - FFC_221
-

950-2515

Explanation: Missing options resolution for PCI-X266 Ext Dual-x4 3 GB SAS adapter.

Response: Use MAP0291 : Missing device or bus problem resolution, located in your host system service guide.

Failing Item:

- FFC_2515
-

950-2516

Explanation: Missing options resolution for PCI Express x8 Ext Dual-x4 3GB SAS Adapter

Response: Use MAP0291 : Missing device or bus problem resolution, located in your host system service guide.

Failing Item:

- FFC_2516
-

950-2517

Explanation: Missing options resolution for PCI-X266 Ext Dual-x4 3 GB SAS RAID adapter.

Response: Use MAP0291 : Missing device or bus problem resolution, located in your host system service guide.

Failing Item:

- FFC_2517
-

950-2518

Explanation: Missing options resolution for PCI Express x8 Ext Dual-x4 3Gb SAS Adapter

Response: Use MAP0291 : Missing device or bus problem resolution, located in your host system service guide.

Failing Item:

- FFC_2518
-

950-2519

Explanation: Missing options resolution for PCI-X266 Ext Tri-x4 3Gb SAS RAID Adapter

Response: Use MAP0291 : Missing device or bus problem resolution, located in your host system service guide.

Failing Item:

- FFC_2519
-

950-251D

Explanation: Missing options resolution for PCI-X266 Ext Tri-x4 3Gb SAS RAID Adapter

Response: Use MAP0291 : Missing device or bus problem resolution, located in your host system service guide.

Failing Item:

- FFC_251D
-

950-2522

Explanation: Missing options resolution for PCI-x Dual Channel Ultra320 SCSI Adapter.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_2522
 - FFC_221
-

950-2523

Explanation: Missing options resolution for PCI-X Dual Channel Ultra320 SCSI Adapter.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_2523
 - FFC_221
-

950-2524

Explanation: Missing options resolution for PCI-X Dual Channel Ultra320 SCSI Adapter.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_2524
-

950-2525

Explanation: Missing options resolution for PCI-X Dual Channel Ultra320 SCSI Adapter.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_2525
 - FFC_2524
-

950-2527

Explanation: Missing options resolution for PCI-X Dual Channel Ultra320 SCSI Adapter.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_2527
 - FFC_221
-

950-2528

Explanation: Missing options resolution for PCI-X Dual Channel U320 SCSI Adapter.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_2528
 - FFC_221
-

950-2529

Explanation: Missing options resolution for PCI-X Dual Channel U320 SCSI RAID Adapter.

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_2529
 - FFC_221
-

950-252B

Explanation: Missing options resolution for PCI-X DDR Dual Channel U320 SCSI

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_252B
 - FFC_221
-

950-252D

Explanation: Missing options resolution for PCI-X DDR Dual Channel U320 SCSI

Response: Use MAP0291 : Missing device or bus problem resolution.

Failing Item:

- FFC_252D
 - FFC_221
-

950-2D0B

Explanation: Missing options resolution for PCI-X266 Ext Tri-x4 3Gb SAS RAID Adapter

Response: Use MAP0291 : Missing device or bus problem resolution, located in your host system service guide.

Failing Item:

- FFC_2D0B
-

950-2D14

Explanation: Missing options resolution for PCI Express x8 Planar 3Gb SAS Adapter

Response: Use MAP0291 : Missing device or bus problem resolution, located in your host system service guide.

Failing Item:

- FFC_2D14
-

950-2D15

Explanation: Missing options resolution for PCI Express x8 Planar 3Gb SAS RAID Adapter

Response: Use MAP0291 : Missing device or bus problem resolution, located in your host system service guide.

Failing Item:

- FFC_2D15
-

950-XXXX

Explanation: The device does not respond.

Response: Use MAP0291 : Missing device or bus problem resolution. Note: xxxx corresponds to the last three or four digits of the SRN after the dash (-). If your 950- xxxx SRN is not listed, substitute the last three or four digits of the SRN for xxxx .

Failing Item:

- FFC_XXXX
 - FFC_B88
 - FFC_190
 - FFC_152
-

A00-FF0

Explanation: Error log analysis is unable to determine the error. The error log indicates the following physical FRU locations as the probable causes.

Response: Use MAP0230 : Platform error problem resolution.

A01-00X

Explanation: Error log analysis indicates an error detected by the CPU, but the failure could not be isolated.

Response: Use MAP0230 : Platform error problem resolution.

A01-01X

Explanation: CPU internal error.

Response: Use MAP0230 : Platform error problem resolution.

A01-02X

Explanation: CPU internal cache or cache controller error.

Response: Use MAP0230 : Platform error problem resolution.

A01-03X

Explanation: External cache parity or multi-bit ECC error.

Response: Use MAP0230 : Platform error problem resolution.

A01-04X

Explanation: External cache ECC single-bit error.

Response: Use MAP0230 : Platform error problem resolution.

A01-05X

Explanation: System bus time-out error.

Response: Use MAP0230 : Platform error problem resolution.

A01-06X

Explanation: Time-out error waiting for I/O.

Response: Use MAP0230 : Platform error problem resolution.

A01-07X

Explanation: System bus parity error.

Response: Use MAP0230 : Platform error problem resolution.

A01-08X

Explanation: System bus protocol/transfer error.

Response: Use MAP0230 : Platform error problem resolution.

A02-00X

Explanation: Error log analysis indicates an error detected by the memory controller, but the failure could not be isolated.

Response: Use MAP0230 : Platform error problem resolution.

A02-01X

Explanation: Uncorrectable Memory Error.

Response: Use MAP0230 : Platform error problem resolution.

A02-02X

Explanation: ECC correctable error.

Response: Use MAP0230 : Platform error problem resolution.

A02-03X

Explanation: Correctable error threshold exceeded.

Response: Use MAP0230 : Platform error problem resolution.

A02-04X

Explanation: Memory Control subsystem internal error.

A02-05X • A03-04X

Response: Use MAP0230 : Platform error problem resolution.

A02-05X

Explanation: Memory Address Error (invalid address or access attempt).

Response: Use MAP0230 : Platform error problem resolution.

A02-06X

Explanation: Memory Data error (Bad data going to memory).

Response: Use MAP0230 : Platform error problem resolution.

A02-07X

Explanation: Memory bus/switch internal error.

Response: Use MAP0230 : Platform error problem resolution.

A02-08X

Explanation: Memory time-out error.

Response: Use MAP0230 : Platform error problem resolution.

A02-09X

Explanation: System bus parity error.

Response: Use MAP0230 : Platform error problem resolution.

A02-10X

Explanation: System bus time-out error.

Response: Use MAP0230 : Platform error problem resolution.

A02-11X

Explanation: System bus protocol/transfer error.

Response: Use MAP0230 : Platform error problem resolution.

A02-12X

Explanation: I/O Host Bridge time-out error.

Response: Use MAP0230 : Platform error problem resolution.

A02-13X

Explanation: I/O Host Bridge address/data parity error.

Response: Use MAP0230 : Platform error problem resolution.

A02-15X

Explanation: System support function error.

Response: Use MAP0230 : Platform error problem resolution.

A02-16X

Explanation: System bus internal hardware/switch error.

Response: Use MAP0230 : Platform error problem resolution.

A03-00X

Explanation: Error log analysis indicates an error detected by the I/O device, but the failure could not be isolated.

Response: Use MAP0230 : Platform error problem resolution.

A03-01X

Explanation: I/O Bus Address parity error.

Response: Use MAP0230 : Platform error problem resolution.

A03-02X

Explanation: I/O Bus Data parity error.

Response: Use MAP0230 : Platform error problem resolution.

A03-03X

Explanation: I/O bridge/device time-out, access or other error.

Response: Use MAP0230 : Platform error problem resolution.

A03-04X

Explanation: I/O bridge/device internal error.

Response: Use MAP0230 : Platform error problem resolution.

A03-05X

Explanation: I/O Error on non-PCI bus.

Response: Use MAP0230 : Platform error problem resolution.

A03-06X

Explanation: Mezzanine bus address parity error.

Response: Use MAP0230 : Platform error problem resolution.

A03-07X

Explanation: System bus address parity error.

Response: Use MAP0230 : Platform error problem resolution.

A03-08X

Explanation: Mezzanine bus data parity error.

Response: Use MAP0230 : Platform error problem resolution.

A03-09X

Explanation: System bus data parity error.

Response: Use MAP0230 : Platform error problem resolution.

A03-10X

Explanation: Mezzanine bus time-out, transfer or protocol error.

Response: Use MAP0230 : Platform error problem resolution.

A03-11X

Explanation: System bus time-out error.

Response: Use MAP0230 : Platform error problem resolution.

A03-12X

Explanation: Error on System bus.

Response: Use MAP0230 : Platform error problem resolution.

A03-13X

Explanation: I/O Expansion bus parity error.

Response: Use MAP0230 : Platform error problem resolution.

A03-14X

Explanation: I/O Expansion bus time-out error.

Response: Use MAP0230 : Platform error problem resolution.

A03-15X

Explanation: I/O Expansion bus connection failure.

Response: Use MAP0230 : Platform error problem resolution.

A03-16X

Explanation: I/O Expansion unit not in an operating state.

Response: Use MAP0230 : Platform error problem resolution.

A05-00X

Explanation: Error log analysis indicates an environmental and power warning, but the failure could not be isolated.

Response: Use MAP0230 : Platform error problem resolution.

A05-01X

Explanation: Sensor indicates a fan has failed.

Response: Use MAP0230 : Platform error problem resolution.

A05-02X

Explanation: System shutdown due to a fan failure.

Response: Use MAP0230 : Platform error problem resolution.

A05-03X

Explanation: Sensor indicates a voltage outside normal range.

Response: Use Power problem isolation for your system.

A05-04X

Explanation: System shutdown due to voltage outside normal range.

Response: Use Power problem isolation for your system.

A05-05X

Explanation: Sensor indicates an abnormally high internal temperature.

Response: Verify that:

1. The room ambient temperature is within the system operating environment.
2. There is unrestricted air flow around the system.
3. All system covers are closed.
4. There are no fan failures.

If none of these problems exist, then proceed with MAP0230 : Platform error problem resolution.

A05-06X

Explanation: System shutdown due to abnormally high internal temperature.

Response: Verify that:

1. The room ambient temperature is within the system operating environment.
2. There is unrestricted air flow around the system.
3. All system covers are closed.
4. There are no fan failures.

If none of these problems exist, then proceed with MAP0230 : Platform error problem resolution.

A05-07X

Explanation: Sensor indicates a power supply has failed.

Response: Use MAP0230 : Platform error problem resolution.

A05-08X

Explanation: System shutdown due to power supply failure.

Response: Use MAP0230 : Platform error problem resolution.

A05-09X

Explanation: Sensor detected a FRU that has failed.

Response: Use MAP0230 : Platform error problem resolution.

A05-10X

Explanation: System shutdown due to FRU that has failed.

Response: Use MAP0230 : Platform error problem resolution.

A05-14X

Explanation: System shutdown due to power fault with an unspecified cause.

Response: Use MAP0230 : Platform error problem resolution.

A05-16X

Explanation: System shutdown due to internal power supply failure.

Response: Use MAP0230 : Platform error problem resolution.

A05-19X

Explanation: System shutdown due to Fan failure.

Response: Use MAP0230 : Platform error problem resolution.

A05-21X

Explanation: System shutdown due to over temperature condition.

Response: Verify the following:

- The room ambient temperature is within the system operating environment.
- There is unrestricted air flow around the system.
- All system covers are closed.

If all conditions are met, then use MAP0230 : Platform error problem resolution.

A05-22X

Explanation: System shutdown due to over temperature and fan failure.

Response: Use MAP0230 : Platform error problem resolution.

A05-24X

Explanation: Power fault specifically due to internal battery failure.

Response: Use MAP0230 : Platform error problem resolution.

A0D-00X

Explanation: Error log analysis indicates an error detected by the service processor, but the failure could not be isolated.

Response: Use MAP0230 : Platform error problem resolution.

A0D-01X

Explanation: Description: Time-out communication response from service processor.

Response: Use MAP0230 : Platform error problem resolution. Note: Ensure that the system IPLROS and service processor are at the latest firmware level before removing any parts from the system.

A0D-02X

Explanation: I/O (I2C) general bus error.

Response: Use MAP0230 : Platform error problem resolution. Note: If you are servicing a 9076/Nxx system, go to the service processor Error Log (SVP).

A0D-03X

Explanation: Secondary I/O (I2C) general bus error.

Response: Use MAP0230 : Platform error problem resolution.

A0D-04X

Explanation: Internal service processor memory error.

Response: Use MAP0230 : Platform error problem resolution.

A0D-05X

Explanation: Service processor error accessing special registers.

Response: Use MAP0230 : Platform error problem resolution.

A0D-06X

Explanation: Service processor reports unknown communication error.

Response: Use MAP0230 : Platform error problem resolution.

A0D-07X

Explanation: Internal service processor firmware error or incorrect version.

Response: Use MAP0230 : Platform error problem resolution.

A0D-08X

Explanation: Other internal service processor hardware error.

Response: Use MAP0230 : Platform error problem resolution.

A0D-09X

Explanation: Service processor error accessing vital product data EEPROM.

Response: Use MAP0230 : Platform error problem resolution.

A0D-10X

Explanation: Service processor error accessing operator panel.

Response: Use MAP0230 : Platform error problem resolution.

A0D-11X

Explanation: Service processor error accessing power controller.

Response: Use MAP0230 : Platform error problem resolution.

A0D-12X

Explanation: Service processor error accessing fan sensor.

Response: Use MAP0230 : Platform error problem resolution.

A0D-13X

Explanation: Service processor error accessing thermal sensor.

Response: Use MAP0230 : Platform error problem resolution. Note: If you are servicing a 9076/Nxx system, go to the service processor Error Log (SVP).

A0D-14X

Explanation: Service processor error accessing voltage sensor.

Response: Use MAP0230 : Platform error problem resolution. Note: If you are servicing a 9076/Nxx system, go to the service processor Error Log (SVP).

A0D-17X

Explanation: Service processor error accessing serial port.

Response: Use MAP0230 : Platform error problem resolution.

A0D-18X

Explanation: Service processor detected NVRAM error.

A0D-19X • A0D-39X

Response: Use MAP0230 : Platform error problem resolution.

A0D-19X

Explanation: Service processor error accessing real time clock/time-of-day clock.

Response: Use MAP0230 : Platform error problem resolution.

A0D-20X

Explanation: Service processor error accessing scan controller/hardware.

Response: Use MAP0230 : Platform error problem resolution.

A0D-21X

Explanation: Service processor detected error with time-of-day clock backup battery.

Response: Use MAP0230 : Platform error problem resolution.

A0D-23X

Explanation: Loss of heart beat from service processor.

Response: Use MAP0230 : Platform error problem resolution.

A0D-24X

Explanation: Service processor detected a surveillance time-out.

Response: Use MAP0230 : Platform error problem resolution.

A0D-25X

Explanation: Power control network general connection failure.

Response: Use MAP0230 : Platform error problem resolution.

A0D-26X

Explanation: Power control network node failure.

Response: Use MAP0230 : Platform error problem resolution.

A0D-29X

Explanation: Service processor error accessing power control network.

Response: Use MAP0230 : Platform error problem resolution.

A0D-30X

Explanation: Non-supported hardware.

Response: Use MAP0230 : Platform error problem resolution.

A0D-31X

Explanation: Error detected while handling an attention/interrupt from the system hardware.

Response: Use MAP0230 : Platform error problem resolution.

A0D-33X

Explanation: Array of Logic Built in Self Test Error.

Response: Use MAP0230 : Platform error problem resolution.

A0D-34X

Explanation: Wire Test Error.

Response: Use MAP0230 : Platform error problem resolution.

A0D-35X

Explanation: Mainstore or Cache IPL Diagnostic Error.

Response: Use MAP0230 : Platform error problem resolution.

A0D-36X

Explanation: Other IPL Diagnostic Error.

Response: Use MAP0230 : Platform error problem resolution.

A0D-37X

Explanation: Clock or PLL Error.

Response: Use MAP0230 : Platform error problem resolution.

A0D-38X

Explanation: Hardware Scan or Initialization Error.

Response: Use MAP0230 : Platform error problem resolution.

A0D-39X

Explanation: Chip ID Verification Error.

Response: Use MAP0230 : Platform error problem resolution.

A0D-40X

Explanation: FRU Presence/Detect Error (Mis-Plugged).

Response: Use MAP0230 : Platform error problem resolution.

A10-100

Explanation: The resource is unavailable due to an error. System is operating in degraded mode.

Response: Use MAP0230 : Platform error problem resolution.

A10-200

Explanation: The resource was marked failed by the platform. The system is operating in degraded mode.

Response: Use MAP0230 : Platform error problem resolution.

A10-210

Explanation: The processor has been deconfigured. The system is operating in degraded mode.

Response: Use MAP0230 : Platform error problem resolution.

A11-00X

Explanation: A non-critical error has been detected. Error log analysis indicates an error detected by the CPU, but the failure could not be isolated.

Response: Use MAP0230 : Platform error problem resolution.

A11-01X

Explanation: A non-critical error has been detected, a CPU internal error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A11-02X

Explanation: A non-critical error has been detected, a CPU internal cache or cache controller error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A11-03X

Explanation: A non-critical error has been detected, an external cache parity or multi-bit ECC error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A11-04X

Explanation: A non-critical error has been detected, an external cache ECC single-bit error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A11-05X

Explanation: A non-critical error has been detected, a system bus time-out error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A11-06X

Explanation: A non-critical error has been detected, a time-out error waiting for an I/O device.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A11-07X

Explanation: A non-critical error has been detected, a system bus parity error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A11-08X

Explanation: A non-critical error has been detected, a system bus protocol/transfer error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A11-50X

Explanation: Recoverable errors on resource indicate a trend toward an unrecoverable error. However, the resource could not be deconfigured and is still in use. The system is operating with the potential for an unrecoverable error.

Response: If repair is not immediately available, reboot and the resource will be deconfigured. Then operations can continue in a degraded mode. To repair use MAP0230 : Platform error problem resolution.

A11-510

Explanation: Resource has been deconfigured and is no longer in use due to a trend toward an unrecoverable error.

Response: The system is operating in a degraded mode. Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A11-520

Explanation: Recoverable errors on resource indicate a trend toward an unrecoverable error. However, the resource could not be deconfigured and is still in use. The system is operating with the potential for an unrecoverable error.

Response: Try removing the processes from the failing processor and retry the deconfiguration; use the `ha_star -C` command. An alternative is reboot, and the processor will be deconfigured. Then the system can continue in a degraded mode. To repair Use MAP0230 : Platform error problem resolution.

A11-530

Explanation: Recoverable errors on resource indicate a trend toward an unrecoverable error. However, the resource could not be deconfigured and is still in use. The system is operating with the potential for an unrecoverable error. Run-time processor deconfiguration can be enabled to deconfigure the processor.

Response: To enable run-time processor deconfiguration, use the `chdev -a cpuguard=enable -l sys0` command. Then to retry the deconfiguration, use the `ha_star -C` command. An alternative is reboot, and the processor will be deconfigured. Then the system can continue in a degraded mode. To repair Use MAP0230 : Platform error problem resolution.

A11-540

Explanation: Recoverable errors on resource indicate a trend toward an unrecoverable error. However, the resource could not be deconfigured and is still in use. The system is operating with the potential for an unrecoverable error.

Response: If repair is not immediately available, reboot and the resource will be deconfigured. Then operations can continue in a degraded mode. To repair use MAP0230 : Platform error problem resolution.

A11-550

Explanation: Recoverable errors on resource indicate a trend toward an unrecoverable error. However, the resource could not be deconfigured and is still in use. The system is operating with the potential for an unrecoverable error.

Response: If repair is not immediately available, reboot and the resource will be deconfigured. Then operations can continue in a degraded mode. To repair use MAP0230 : Platform error problem resolution.

A11-560

Explanation: Recoverable errors on a resource indicate a potential for unrecoverable errors. The resource cannot be deconfigured and is still in use. The problem may be corrected by array bit steering.

Response: Use MAP0235: System array self-repair problem resolution.

A11-570

Explanation: A processor has been deconfigured due to a trend toward an unrecoverable error. The system is operating in a degraded mode. The problem may be corrected by array bit steering.

Response: Use MAP0235: System array self-repair problem resolution.

A11-580

Explanation: Recoverable errors on a processor indicate a potential for an unrecoverable error. The resource cannot be deconfigured and is still in use. The problem may be corrected by array bit steering.

Response: Use MAP0235: System array self-repair problem resolution.

A12-00X

Explanation: A non-critical error has been detected. Error log analysis indicates an error detected by the memory controller, but the failure could not be isolated.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A12-01X

Explanation: A non-critical error has been detected, an uncorrectable memory error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A12-02X

Explanation: A non-critical error has been detected, an ECC correctable error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A12-03X

Explanation: A non-critical error has been detected, a correctable error threshold exceeded.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A12-04X

Explanation: A non-critical error has been detected, a memory control subsystem internal error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A12-05X

Explanation: A non-critical error has been detected, a memory address error (invalid address or access attempt).

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A12-06X

Explanation: A non-critical error has been detected, a memory data error (bad data going to memory).

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A12-07X

Explanation: A non-critical error has been detected, a memory bus/switch internal error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A12-08X

Explanation: A non-critical error has been detected, a memory time-out error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A12-09X

Explanation: A non-critical error has been detected, a system bus parity error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A12-10X

Explanation: A non-critical error has been detected, a system bus time-out error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A12-11X

Explanation: A non-critical error has been detected, a system bus protocol/transfer error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A12-12X

Explanation: A non-critical error has been detected, an I/O host bridge time-out error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A12-13X

Explanation: A non-critical error has been detected, a I/O host bridge address/data parity error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A12-15X

Explanation: A non-critical error has been detected, a system support function error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A12-16X

Explanation: A non-critical error has been detected, a system bus internal hardware/switch error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A12-50X

Explanation: Recoverable errors on resource indicate a trend toward an unrecoverable error. However, the resource could not be deconfigured and is still in use. The system is operating with the potential for an unrecoverable error.

Response: If repair is not immediately available, reboot and the resource will be deconfigured. Then operations can continue in a degraded mode. Use MAP0230 : Platform error problem resolution.

A13-00X

Explanation: A non-critical error has been detected, a error log analysis indicates an error detected by the I/O device, but the failure could not be isolated.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A13-01X

Explanation: A non-critical error has been detected, an I/O bus address parity error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A13-02X • A13-50X

A13-02X

Explanation: A non-critical error has been detected, an I/O bus data parity error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A13-03X

Explanation: A non-critical error has been detected, an I/O bus time-out, access or other error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A13-04X

Explanation: A non-critical error has been detected, an I/O bridge/device internal error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A13-05X

Explanation: A non-critical error has been detected, an I/O error on non-PCI bus.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A13-06X

Explanation: A non-critical error has been detected, a mezzanine bus address parity error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A13-07X

Explanation: A non-critical error has been detected, a system bus address parity error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A13-08X

Explanation: A non-critical error has been detected, a mezzanine bus data parity error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A13-09X

Explanation: A non-critical error has been detected, a system bus data parity error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A13-10X

Explanation: A non-critical error has been detected, a mezzanine bus time-out error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A13-11X

Explanation: A non-critical error has been detected, a system bus time-out error

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A13-12X

Explanation: A non-critical error has been detected, an error on system bus.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A13-13X

Explanation: A non-critical error has been detected, an I/O expansion bus parity error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A13-14X

Explanation: A non-critical error has been detected, an I/O expansion bus time-out error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A13-15X

Explanation: A non-critical error has been detected, an I/O expansion bus connection failure.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A13-16X

Explanation: A non-critical error has been detected, an I/O expansion unit not in an operating state.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A13-50X

Explanation: Recoverable errors on resource indicate a trend toward an unrecoverable error. However, the resource could not be deconfigured and is still in use. The system is operating with the potential for an unrecoverable error.

Response: If repair is not immediately available, reboot and the resource will be deconfigured. Then operations can continue in a degraded mode. To repair use MAP0230 : Platform error problem resolution.

A15-01X

Explanation: Sensor indicates a fan is turning too slowly.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A15-03X

Explanation: Description: Sensor indicates a voltage outside normal range.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A15-05X

Explanation: Sensor indicates an abnormally high internal temperature.

Response: Verify that:

1. The room ambient temperature is within the system operating environment.
2. There is unrestricted air flow around the system.
3. All system covers are closed.
4. There are no fan failures.

If none of these problems exist, then proceed with MAP0230 : Platform error problem resolution.

A15-07X

Explanation: Sensor indicates a power supply has failed.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A15-09X

Explanation: Sensor indicates a FRU has failed.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A15-11X

Explanation: Sensor detected a redundant fan failure.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A15-12X

Explanation: Sensor detected redundant power supply failure.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A15-13X

Explanation: Sensor detected a redundant FRU that has failed.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A15-14X

Explanation: Power fault due to unspecified cause.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A15-16X

Explanation: Internal power supply failure.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A15-17X

Explanation: Internal redundant power supply failure.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A15-19X

Explanation: Fan failure.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A15-20X

Explanation: Non-critical cooling problem, loss of redundant fan.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A15-21X

Explanation: Over temperature condition.

Response: Verify the following:

- The room ambient temperature is within the system operating environment.
- There is unrestricted air flow around the system.
- All system covers are closed.

A15-22X • A1D-09X

If all conditions are met, then use MAP0230 : Platform error problem resolution.

A15-22X

Explanation: Fan failure and Over temperature condition.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A15-23X

Explanation: Non-critical power problem, loss of redundant power supply.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A15-24X

Explanation: Power Fault specifically due to internal battery failure.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A15-50X

Explanation: Recoverable errors on resource indicate a trend toward an unrecoverable error. However, the resource could not be deconfigured and is still in use. The system is operating with the potential for an unrecoverable error.

Response: If repair is not immediately available, reboot and the resource will be deconfigured. Then operations can continue in a degraded mode. To repair use MAP0230 : Platform error problem resolution.

A1D-00X

Explanation: A non-critical error has been detected. Error log analysis indicates an error detected by the service processor, but the failure could not be isolated.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-01X

Explanation: A non-critical error has been detected. Time Out communication response from service processor

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution. Note: Ensure that the system IPLROS and service processor are at the latest firmware level before removing any parts from the system.

A1D-02X

Explanation: A non-critical error has been detected, an I/O (I2C) general bus error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-03X

Explanation: A non-critical error has been detected, a secondary I/O (I2C) general bus error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-04X

Explanation: A non-critical error has been detected, an internal service processor memory error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-05X

Explanation: A non-critical error has been detected, a service processor error accessing special registers.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-06X

Explanation: A non-critical error has been detected, a service processor reports unknown communication error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-07X

Explanation: A non-critical error has been detected. Internal service processor firmware error or incorrect version.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-08X

Explanation: A non-critical error has been detected, an other internal service processor hardware error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-09X

Explanation: A non-critical error has been detected, a service processor error accessing vital product data EEPROM.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-10X

Explanation: A non-critical error has been detected, a service processor error accessing operator panel.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-11X

Explanation: A non-critical error has been detected, a service processor error accessing power controller.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-12X

Explanation: A non-critical error has been detected, a service processor error accessing fan sensor.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-13X

Explanation: A non-critical error has been detected, a service processor error accessing a thermal sensor.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-14X

Explanation: A non-critical error has been detected, a service processor error accessing voltage sensor.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-17X

Explanation: A non-critical error has been detected, a service processor error accessing serial port.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-18X

Explanation: A non-critical error has been detected, a service processor detected NVRAM error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-19X

Explanation: A non-critical error has been detected, a service processor error accessing real time clock/time-of-day clock.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-20X

Explanation: A non-critical error has been detected: Service processor error accessing scan controller/hardware.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-21X

Explanation: A non-critical error has been detected, a service processor detected error with time-of-day clock backup battery.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-23X

Explanation: A non-critical error has been detected: Loss of heart beat from service processor.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-24X

Explanation: A non-critical error has been detected, a service processor detected a surveillance time-out.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-25X

Explanation: A non-critical error has been detected, a power control network general connection failure.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-26X

Explanation: A non-critical error has been detected, a power control network node failure.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-29X

Explanation: A non-critical error has been detected, a service process error accessing power control network.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-30X

Explanation: A non-critical error has been detected: Non-supported hardware.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-31X

Explanation: A non-critical error has been detected: Error detected while handling an attention/interrupt from the system hardware.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-33X

Explanation: A non-critical error has been detected: Array of Logic Built in Self Test Error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-34X

Explanation: A non-critical error has been detected: Wire Test Error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-35X

Explanation: A non-critical error has been detected: Mainstore or Cache IPL Diagnostic Error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-36X

Explanation: A non-critical error has been detected: Other IPL Diagnostic Error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-37X

Explanation: A non-critical error has been detected: Clock or PLL Error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-38X

Explanation: A non-critical error has been detected: Hardware Scan or Initialization Error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-39X

Explanation: A non-critical error has been detected: Chip ID Verification Error.

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-40X

Explanation: A non-critical error has been detected: Presence/Detect Error (Mis-Plugged).

Response: Schedule deferred maintenance. Use MAP0230 : Platform error problem resolution.

A1D-50X

Explanation: Recoverable errors on resource indicate a trend toward an unrecoverable error. However, the resource could not be deconfigured and is still in use. The system is operating with the potential for an unrecoverable error.

Response: If repair is not immediately available, reboot and the resource will be deconfigured. Then operations can continue in a degraded mode. To repair use MAP0230 : Platform error problem resolution.

A23-001

Explanation: Multipath I/O Problem Resolution.

Response: Use MAP0285 : Multipath I/O (MPIO) problem resolution.

A24-000

Explanation: Spurious interrupts on shared interrupt level have exceeded threshold.

Response: Use the part numbers reported by diagnostics and use MAP0210 : General problem resolution.

Failing Item:

- USE_DIAGNOSTIC_PART_NUMBER
 - FFC_227
-

A24-XXX

Explanation: Spurious interrupts have exceeded threshold.

Failing Item:

- XXX
- FFC_227

A25-001

Explanation: Platform error, switch network interface extended error data is available.

Response: Refer to the management console. Use the system reference codes in the serviceable event view for this partition.

A22-XXXX

Explanation: Defective Multipath I/O Device.

Response: Note: To obtain the FFC, substitute the last 3 or 4 digits after the dash (-) for xxxx (The substituted xxxx is the FFC).

D0000

Explanation: The using system cannot configure the disk drive module.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive.

D0100

Explanation: Unable to clear a disk drive module reservation.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive.

D0101

Explanation: The disk drive module has been reserved since the diagnostics started.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive.

D0200

Explanation: The disk drive module timed out while the diagnostics were running.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive.

D0300

Explanation: The disk drive module failed the diagnostic test.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive.

D0400

Explanation: The disk drive module is Not Ready while the diagnostics are running.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive.

D0450

Explanation: The Format operation that was started on this disk drive module has not finished.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive.

D0460

Explanation: A Format operation was degraded.

Response: Refer to the SRN table in the Service Guide for the unit containing the disk drive.

D4000

Explanation: The diagnostics cannot configure the SSA adapter.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

D4100

Explanation: The diagnostics cannot open the SSA adapter.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

D4300

Explanation: The diagnostics have detected an SSA adapter POST failure.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

D44XX

Explanation: The diagnostics detected that the SSA adapter has corrupted microcode, but cannot download a new version of the microcode.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.
Note: In this SRN, an x represents a digit 0 through F.

D6PAA

Explanation: A high-speed SSA link is running at low speed.

Response: Refer to the SRN table in the User's Guide and Maintenance Information for the SSA adapter.

DFFFF

DFFFF

Explanation: A command or parameter that was sent or received is not valid.

Response: Note: The description and action for this SRN are valid only if you ran the diagnostics on the SSA attachment. Refer to the SRN table in the Service Guide for the unit containing the disk drive and to the User's Guide and Maintenance Information for the SSA adapter.

Notices

This information was developed for products and services offered in the U.S.A.

The manufacturer may not offer the products, services, or features discussed in this document in other countries. Consult the manufacturer's representative for information on the products and services currently available in your area. Any reference to the manufacturer's product, program, or service is not intended to state or imply that only that product, program, or service may be used. Any functionally equivalent product, program, or service that does not infringe any intellectual property right of the manufacturer may be used instead. However, it is the user's responsibility to evaluate and verify the operation of any product, program, or service.

The manufacturer may have patents or pending patent applications covering subject matter described in this document. The furnishing of this document does not grant you any license to these patents. You can send license inquiries, in writing, to the manufacturer.

The following paragraph does not apply to the United Kingdom or any other country where such provisions are inconsistent with local law: THIS PUBLICATION IS PROVIDED "AS IS" WITHOUT WARRANTY OF ANY KIND, EITHER EXPRESS OR IMPLIED, INCLUDING, BUT NOT LIMITED TO, THE IMPLIED WARRANTIES OF NON-INFRINGEMENT, MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. Some states do not allow disclaimer of express or implied warranties in certain transactions, therefore, this statement may not apply to you.

This information could include technical inaccuracies or typographical errors. Changes are periodically made to the information herein; these changes will be incorporated in new editions of the publication. The manufacturer may make improvements and/or changes in the product(s) and/or the program(s) described in this publication at any time without notice.

Any references in this information to websites not owned by the manufacturer are provided for convenience only and do not in any manner serve as an endorsement of those websites. The materials at those websites are not part of the materials for this product and use of those websites is at your own risk.

The manufacturer may use or distribute any of the information you supply in any way it believes appropriate without incurring any obligation to you.

Any performance data contained herein was determined in a controlled environment. Therefore, the results obtained in other operating environments may vary significantly. Some measurements may have been made on development-level systems and there is no guarantee that these measurements will be the same on generally available systems. Furthermore, some measurements may have been estimated through extrapolation. Actual results may vary. Users of this document should verify the applicable data for their specific environment.

Information concerning products not produced by this manufacturer was obtained from the suppliers of those products, their published announcements or other publicly available sources. This manufacturer has not tested those products and cannot confirm the accuracy of performance, compatibility or any other claims related to products not produced by this manufacturer. Questions on the capabilities of products not produced by this manufacturer should be addressed to the suppliers of those products.

All statements regarding the manufacturer's future direction or intent are subject to change or withdrawal without notice, and represent goals and objectives only.

The manufacturer's prices shown are the manufacturer's suggested retail prices, are current and are subject to change without notice. Dealer prices may vary.

This information is for planning purposes only. The information herein is subject to change before the products described become available.

This information contains examples of data and reports used in daily business operations. To illustrate them as completely as possible, the examples include the names of individuals, companies, brands, and products. All of these names are fictitious and any similarity to the names and addresses used by an actual business enterprise is entirely coincidental.

If you are viewing this information in softcopy, the photographs and color illustrations may not appear.

The drawings and specifications contained herein shall not be reproduced in whole or in part without the written permission of the manufacturer.

The manufacturer has prepared this information for use with the specific machines indicated. The manufacturer makes no representations that it is suitable for any other purpose.

The manufacturer's computer systems contain mechanisms designed to reduce the possibility of undetected data corruption or loss. This risk, however, cannot be eliminated. Users who experience unplanned outages, system failures, power fluctuations or outages, or component failures must verify the accuracy of operations performed and data saved or transmitted by the system at or near the time of the outage or failure. In addition, users must establish procedures to ensure that there is independent data verification before relying on such data in sensitive or critical operations. Users should periodically check the manufacturer's support websites for updated information and fixes applicable to the system and related software.

Homologation statement

This product may not be certified in your country for connection by any means whatsoever to interfaces of public telecommunications networks. Further certification may be required by law prior to making any such connection. Contact an IBM representative or reseller for any questions.

Trademarks

IBM, the IBM logo, and ibm.com are trademarks or registered trademarks of International Business Machines Corp., registered in many jurisdictions worldwide. Other product and service names might be trademarks of IBM or other companies. A current list of IBM trademarks is available on the web at www.ibm.com/legal/copytrade.shtml.

INFINIBAND, InfiniBand Trade Association, and the INFINIBAND design marks are trademarks and/or service marks of the INFINIBAND Trade Association.

Linux is a registered trademark of Linus Torvalds in the United States, other countries, or both.

Java and all Java-based trademarks and logos are trademarks or registered trademarks of Oracle and/or its affiliates.

UNIX is a registered trademark of The Open Group in the United States and other countries.

Electronic emission notices

When attaching a monitor to the equipment, you must use the designated monitor cable and any interference suppression devices supplied with the monitor.

Class A Notices

The following Class A statements apply to the IBM servers that contain the POWER7[®] processor and its features unless designated as electromagnetic compatibility (EMC) Class B in the feature information.

Federal Communications Commission (FCC) statement

Note: This equipment has been tested and found to comply with the limits for a Class A digital device, pursuant to Part 15 of the FCC Rules. These limits are designed to provide reasonable protection against harmful interference when the equipment is operated in a commercial environment. This equipment generates, uses, and can radiate radio frequency energy and, if not installed and used in accordance with the instruction manual, may cause harmful interference to radio communications. Operation of this equipment in a residential area is likely to cause harmful interference, in which case the user will be required to correct the interference at his own expense.

Properly shielded and grounded cables and connectors must be used in order to meet FCC emission limits. IBM is not responsible for any radio or television interference caused by using other than recommended cables and connectors or by unauthorized changes or modifications to this equipment. Unauthorized changes or modifications could void the user's authority to operate the equipment.

This device complies with Part 15 of the FCC rules. Operation is subject to the following two conditions: (1) this device may not cause harmful interference, and (2) this device must accept any interference received, including interference that may cause undesired operation.

Industry Canada Compliance Statement

This Class A digital apparatus complies with Canadian ICES-003.

Avis de conformité à la réglementation d'Industrie Canada

Cet appareil numérique de la classe A est conforme à la norme NMB-003 du Canada.

European Community Compliance Statement

This product is in conformity with the protection requirements of EU Council Directive 2004/108/EC on the approximation of the laws of the Member States relating to electromagnetic compatibility. IBM cannot accept responsibility for any failure to satisfy the protection requirements resulting from a non-recommended modification of the product, including the fitting of non-IBM option cards.

This product has been tested and found to comply with the limits for Class A Information Technology Equipment according to European Standard EN 55022. The limits for Class A equipment were derived for commercial and industrial environments to provide reasonable protection against interference with licensed communication equipment.

European Community contact:
IBM Deutschland GmbH
Technical Regulations, Department M372
IBM-Allee 1, 71139 Ehningen, Germany
Tele: +49 7032 15 2941
email: lugi@de.ibm.com

Warning: This is a Class A product. In a domestic environment, this product may cause radio interference, in which case the user may be required to take adequate measures.

VCCI Statement - Japan

この装置は、クラスA 情報技術装置です。この装置を家庭環境で使用すると電波妨害を引き起こすことがあります。この場合には使用者が適切な対策を講ずるよう要求されることがあります。

VCCI-A

The following is a summary of the VCCI Japanese statement in the box above:

This is a Class A product based on the standard of the VCCI Council. If this equipment is used in a domestic environment, radio interference may occur, in which case, the user may be required to take corrective actions.

Japanese Electronics and Information Technology Industries Association (JEITA) Confirmed Harmonics Guideline (products less than or equal to 20 A per phase)

高調波ガイドライン適合品

Japanese Electronics and Information Technology Industries Association (JEITA) Confirmed Harmonics Guideline with Modifications (products greater than 20 A per phase)

高調波ガイドライン準用品

Electromagnetic Interference (EMI) Statement - People's Republic of China

声 明

此为 A 级产品, 在生活环境中, 该产品可能会造成无线电干扰。在这种情况下, 可能需要用户对其干扰采取切实可行的措施。

Declaration: This is a Class A product. In a domestic environment this product may cause radio interference in which case the user may need to perform practical action.

Electromagnetic Interference (EMI) Statement - Taiwan

警告使用者：
這是甲類的資訊產品，在居住的環境中使用時，可能會造成射頻干擾，在這種情況下，使用者會被要求採取某些適當的對策。

The following is a summary of the EMI Taiwan statement above.

Warning: This is a Class A product. In a domestic environment this product may cause radio interference in which case the user will be required to take adequate measures.

IBM Taiwan Contact Information:

台灣IBM 產品服務聯絡方式：
台灣國際商業機器股份有限公司
台北市松仁路7號3樓
電話：0800-016-888

Electromagnetic Interference (EMI) Statement - Korea

이 기기는 업무용(A급)으로 전자파적합기기로서 판매자 또는 사용자는 이 점을 주의하시기 바라며, 가정외의 지역에서 사용하는 것을 목적으로 합니다.

Germany Compliance Statement

Deutschsprachiger EU Hinweis: Hinweis für Geräte der Klasse A EU-Richtlinie zur Elektromagnetischen Verträglichkeit

Dieses Produkt entspricht den Schutzanforderungen der EU-Richtlinie 2004/108/EG zur Angleichung der Rechtsvorschriften über die elektromagnetische Verträglichkeit in den EU-Mitgliedsstaaten und hält die Grenzwerte der EN 55022 Klasse A ein.

Um dieses sicherzustellen, sind die Geräte wie in den Handbüchern beschrieben zu installieren und zu betreiben. Des Weiteren dürfen auch nur von der IBM empfohlene Kabel angeschlossen werden. IBM übernimmt keine Verantwortung für die Einhaltung der Schutzanforderungen, wenn das Produkt ohne Zustimmung von IBM verändert bzw. wenn Erweiterungskomponenten von Fremdherstellern ohne Empfehlung von IBM gesteckt/eingebaut werden.

EN 55022 Klasse A Geräte müssen mit folgendem Warnhinweis versehen werden:
"Warnung: Dieses ist eine Einrichtung der Klasse A. Diese Einrichtung kann im Wohnbereich Funk-Störungen verursachen; in diesem Fall kann vom Betreiber verlangt werden, angemessene Maßnahmen zu ergreifen und dafür aufzukommen."

Deutschland: Einhaltung des Gesetzes über die elektromagnetische Verträglichkeit von Geräten

Dieses Produkt entspricht dem "Gesetz über die elektromagnetische Verträglichkeit von Geräten (EMVG)". Dies ist die Umsetzung der EU-Richtlinie 2004/108/EG in der Bundesrepublik Deutschland.

Zulassungsbescheinigung laut dem Deutschen Gesetz über die elektromagnetische Verträglichkeit von Geräten (EMVG) (bzw. der EMC EG Richtlinie 2004/108/EG) für Geräte der Klasse A

Dieses Gerät ist berechtigt, in Übereinstimmung mit dem Deutschen EMVG das EG-Konformitätszeichen - CE - zu führen.

Verantwortlich für die Einhaltung der EMV Vorschriften ist der Hersteller:
International Business Machines Corp.
New Orchard Road
Armonk, New York 10504
Tel: 914-499-1900

Der verantwortliche Ansprechpartner des Herstellers in der EU ist:
IBM Deutschland GmbH
Technical Regulations, Abteilung M372
IBM-Allee 1, 71139 Ehningen, Germany
Tel: +49 7032 15 2941
email: lugi@de.ibm.com

Generelle Informationen:

Das Gerät erfüllt die Schutzanforderungen nach EN 55024 und EN 55022 Klasse A.

Electromagnetic Interference (EMI) Statement - Russia

ВНИМАНИЕ! Настоящее изделие относится к классу А.
В жилых помещениях оно может создавать радиопомехи, для снижения которых необходимы дополнительные меры

Class B Notices

The following Class B statements apply to features designated as electromagnetic compatibility (EMC) Class B in the feature installation information.

Federal Communications Commission (FCC) statement

This equipment has been tested and found to comply with the limits for a Class B digital device, pursuant to Part 15 of the FCC Rules. These limits are designed to provide reasonable protection against harmful interference in a residential installation.

This equipment generates, uses, and can radiate radio frequency energy and, if not installed and used in accordance with the instructions, may cause harmful interference to radio communications. However, there is no guarantee that interference will not occur in a particular installation.

If this equipment does cause harmful interference to radio or television reception, which can be determined by turning the equipment off and on, the user is encouraged to try to correct the interference by one or more of the following measures:

- Reorient or relocate the receiving antenna.
- Increase the separation between the equipment and receiver.
- Connect the equipment into an outlet on a circuit different from that to which the receiver is connected.
- Consult an IBM-authorized dealer or service representative for help.

Properly shielded and grounded cables and connectors must be used in order to meet FCC emission limits. Proper cables and connectors are available from IBM-authorized dealers. IBM is not responsible for any radio or television interference caused by unauthorized changes or modifications to this equipment. Unauthorized changes or modifications could void the user's authority to operate this equipment.

This device complies with Part 15 of the FCC rules. Operation is subject to the following two conditions: (1) this device may not cause harmful interference, and (2) this device must accept any interference received, including interference that may cause undesired operation.

Industry Canada Compliance Statement

This Class B digital apparatus complies with Canadian ICES-003.

Avis de conformité à la réglementation d'Industrie Canada

Cet appareil numérique de la classe B est conforme à la norme NMB-003 du Canada.

European Community Compliance Statement

This product is in conformity with the protection requirements of EU Council Directive 2004/108/EC on the approximation of the laws of the Member States relating to electromagnetic compatibility. IBM cannot accept responsibility for any failure to satisfy the protection requirements resulting from a non-recommended modification of the product, including the fitting of non-IBM option cards.

This product has been tested and found to comply with the limits for Class B Information Technology Equipment according to European Standard EN 55022. The limits for Class B equipment were derived for typical residential environments to provide reasonable protection against interference with licensed communication equipment.

European Community contact:
IBM Deutschland GmbH
Technical Regulations, Department M372
IBM-Allee 1, 71139 Ehningen, Germany
Tele: +49 7032 15 2941
email: lugi@de.ibm.com

VCCI Statement - Japan

この装置は、クラスB情報技術装置です。この装置は、家庭環境で使用することを目的としていますが、この装置がラジオやテレビジョン受信機に近接して使用されると、受信障害を引き起こすことがあります。

取扱説明書に従って正しい取り扱いをして下さい。 VCCI-B

Japanese Electronics and Information Technology Industries Association (JEITA) Confirmed Harmonics Guideline (products less than or equal to 20 A per phase)

高調波ガイドライン適合品

Japanese Electronics and Information Technology Industries Association (JEITA) Confirmed Harmonics Guideline with Modifications (products greater than 20 A per phase)

高調波ガイドライン準用品

IBM Taiwan Contact Information

台灣IBM 產品服務聯絡方式：
台灣國際商業機器股份有限公司
台北市松仁路7號3樓
電話：0800-016-888

Electromagnetic Interference (EMI) Statement - Korea

이 기기는 가정용(B급)으로 전자과적합기기로
서 주로 가정에서 사용하는 것을 목적으로 하
며, 모든 지역에서 사용할 수 있습니다.

Germany Compliance Statement

Deutschsprachiger EU Hinweis: Hinweis für Geräte der Klasse B EU-Richtlinie zur
Elektromagnetischen Verträglichkeit

Dieses Produkt entspricht den Schutzanforderungen der EU-Richtlinie 2004/108/EG zur Angleichung der Rechtsvorschriften über die elektromagnetische Verträglichkeit in den EU-Mitgliedsstaaten und hält die Grenzwerte der EN 55022 Klasse B ein.

Um dieses sicherzustellen, sind die Geräte wie in den Handbüchern beschrieben zu installieren und zu betreiben. Des Weiteren dürfen auch nur von der IBM empfohlene Kabel angeschlossen werden. IBM übernimmt keine Verantwortung für die Einhaltung der Schutzanforderungen, wenn das Produkt ohne Zustimmung von IBM verändert bzw. wenn Erweiterungskomponenten von Fremdherstellern ohne Empfehlung von IBM gesteckt/eingebaut werden.

Deutschland: Einhaltung des Gesetzes über die elektromagnetische Verträglichkeit von Geräten

Dieses Produkt entspricht dem "Gesetz über die elektromagnetische Verträglichkeit von Geräten (EMVG)". Dies ist die Umsetzung der EU-Richtlinie 2004/108/EG in der Bundesrepublik Deutschland.

Zulassungsbescheinigung laut dem Deutschen Gesetz über die elektromagnetische Verträglichkeit von Geräten (EMVG) (bzw. der EMC EG Richtlinie 2004/108/EG) für Geräte der Klasse B

Dieses Gerät ist berechtigt, in Übereinstimmung mit dem Deutschen EMVG das EG-Konformitätszeichen - CE - zu führen.

Verantwortlich für die Einhaltung der EMV Vorschriften ist der Hersteller:
International Business Machines Corp.
New Orchard Road
Armonk, New York 10504
Tel: 914-499-1900

Der verantwortliche Ansprechpartner des Herstellers in der EU ist:
IBM Deutschland GmbH
Technical Regulations, Abteilung M372
IBM-Allee 1, 71139 Ehningen, Germany
Tel: +49 7032 15 2941
email: lugi@de.ibm.com

Generelle Informationen:

Das Gerät erfüllt die Schutzanforderungen nach EN 55024 und EN 55022 Klasse B.

Terms and conditions

Permissions for the use of these publications are granted subject to the following terms and conditions.

Applicability: These terms and conditions are in addition to any terms of use for the IBM website.

Personal Use: You may reproduce these publications for your personal, noncommercial use provided that all proprietary notices are preserved. You may not distribute, display or make derivative works of these publications, or any portion thereof, without the express consent of IBM.

Commercial Use: You may reproduce, distribute and display these publications solely within your enterprise provided that all proprietary notices are preserved. You may not make derivative works of these publications, or reproduce, distribute or display these publications or any portion thereof outside your enterprise, without the express consent of IBM.

Rights: Except as expressly granted in this permission, no other permissions, licenses or rights are granted, either express or implied, to the Publications or any information, data, software or other intellectual property contained therein.

IBM reserves the right to withdraw the permissions granted herein whenever, in its discretion, the use of the publications is detrimental to its interest or, as determined by IBM, the above instructions are not being properly followed.

You may not download, export or re-export this information except in full compliance with all applicable laws and regulations, including all United States export laws and regulations.

IBM MAKES NO GUARANTEE ABOUT THE CONTENT OF THESE PUBLICATIONS. THE PUBLICATIONS ARE PROVIDED "AS-IS" AND WITHOUT WARRANTY OF ANY KIND, EITHER EXPRESSED OR IMPLIED, INCLUDING BUT NOT LIMITED TO IMPLIED WARRANTIES OF MERCHANTABILITY, NON-INFRINGEMENT, AND FITNESS FOR A PARTICULAR PURPOSE.



Printed in USA